

2023 ODAV Pavement Evaluation Program Lenhardt Airpark

Hubbard, Oregon

December 29, 2023

Prepared for

State of Oregon Department of Aviation
3040 25th Street SE
Salem, OR 97303-1125

Prepared by



16520 SW Upper Boones Ferry Road, Suite 100
Tigard, OR 97224-7661
(503) 641-3478 | www.gri.com

TABLE OF CONTENTS

1	OVERVIEW.....	1
2	PAVEMENT INVENTORY	1
3	PAVEMENT CONDITION INSPECTION RESULTS.....	5
	3.1 Introduction.....	5
	3.2 Pavement Condition Index Survey Results	5
4	FUTURE PAVEMENT CONDITION ANALYSIS.....	8
	4.1 Introduction.....	8
	4.2 Future Condition Analysis	8
	4.3 Functional Remaining Life.....	8
5	MAINTENANCE AND REHABILITATION PROJECT RECOMMENDATIONS	10
	5.1 Introduction.....	10
	5.2 Recommended Localized Maintenance.....	10
	5.3 Surface Treatment, Rehabilitation, and Reconstruction Plan.....	10
6	LIMITATIONS.....	12

TABLES

Table 3-1:	ASTM PCI Rating Scale.....	5
Table 5-1:	Localized Maintenance Quantities.....	10
Table 5-2:	Surface Treatment, Rehabilitation, and Reconstruction Quantities.....	10

FIGURES

Figure 2.1:	Lenhardt Airpark Location Map
Figure 2.2:	Lenhardt Airpark Pavement Area by Surface Type
Figure 2.3:	Lenhardt Airpark Pavement Area by Branch Use
Figure 2.4:	Lenhardt Airpark Pavement Inventory
Figure 3.1:	Lenhardt Airpark 2023 PCI Survey Results
Figure 3.2:	Lenhardt Airpark Pavement Condition Rating by Percent of Area
Figure 4.1:	Lenhardt Airpark Future Pavement Condition
Figure 5.2:	Lenhardt Airpark 5-Year Pavement Management Plan

APPENDICES

Appendix A:	Pavement Inventory Report and Maps
Appendix B:	Pavement Condition Index Survey Results
Appendix C:	Future Pavement Condition Analysis
Appendix D:	Unit Cost Data and Maintenance and Rehabilitation Plan
Appendix E:	Reinspection Report
Appendix F:	Work History Report

1 OVERVIEW

GRI assisted with updating the Oregon Department of Aviation (ODAV) airport pavement management system and developing a five-year plan comprised of maintenance, surface treatment, rehabilitation, and reconstruction projects for the Lenhardt Airpark in Hubbard, Oregon. This project was implemented as part of the ODAV and Federal Aviation Administration (FAA) *Oregon Continuous Aviation System Plan*. The information provided in this report ensures compliance with FAA Grant Assurance Number 11, which outlines that an airport shall have an effective airport pavement maintenance-management program in place to receive federal financial assistance for the construction, reconstruction, or repair of airport pavements.

GRI conducted surveys of the airside pavement at Lenhardt Airpark in 2023 in accordance with the procedures of Advisory Circular 150/5380-7B and ASTM International (ASTM) D5340. We uploaded the survey data into the PAVER database and used the software to provide a rapid calculation of the pavement condition index (PCI) rating. The PCI is a numerical indicator that defines the functional condition of the pavement based on visual inspection. The scale ranges from zero to 100, where zero represents a pavement in the worst possible condition with no remaining functional life and 100 represents a pavement in the best possible condition with no defects.

2 PAVEMENT INVENTORY

Lenhardt Airpark is located in Hubbard, Oregon, and is owned and operated by the Lenhardt family. The airport consists of a single runway and multiple aprons that serve a variety of general aviation aircraft. The general location of the airport is shown below on the Lenhardt Airpark Location Map, Figure 2.1.



Figure 2.1: LENHARDT AIRPARK LOCATION MAP

The airside pavements at the Lenhardt Airpark are comprised of asphalt concrete (AC). The airport pavements, delineated by surface type and branch use, are shown on the Lenhardt Airpark Percent of Pavement Area by Surface Type, Figure 2.2, and on the Lenhardt Pavement Area by Branch Use, Figure 2.3. The pavement inventory, including work history for each pavement section, is displayed spatially on the Lenhardt Airpark Pavement Inventory, Figure 2.4. The pavement facilities summarized by branch and section are listed in Tables 1A and 2A, respectively, in Appendix A. The sample unit layout for each section is shown on Figure 1A in Appendix A. We used the sampling rates outlined in Table 3A of Appendix A in our survey. The pavement inventory, including work history for individual airport pavement sections, is provided in the work history report, Table 1F.

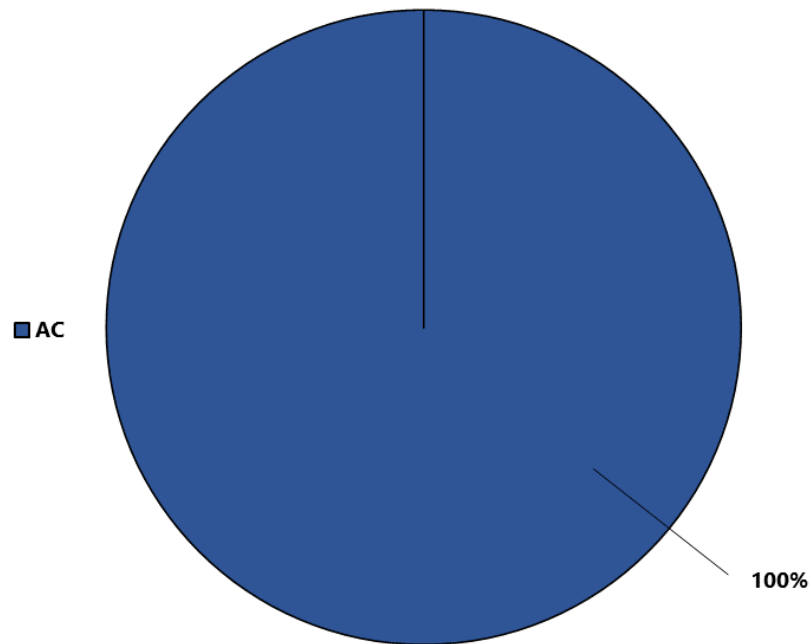


Figure 2.2: LENHARDT AIRPARK PERCENT OF PAVEMENT AREA BY SURFACE TYPE



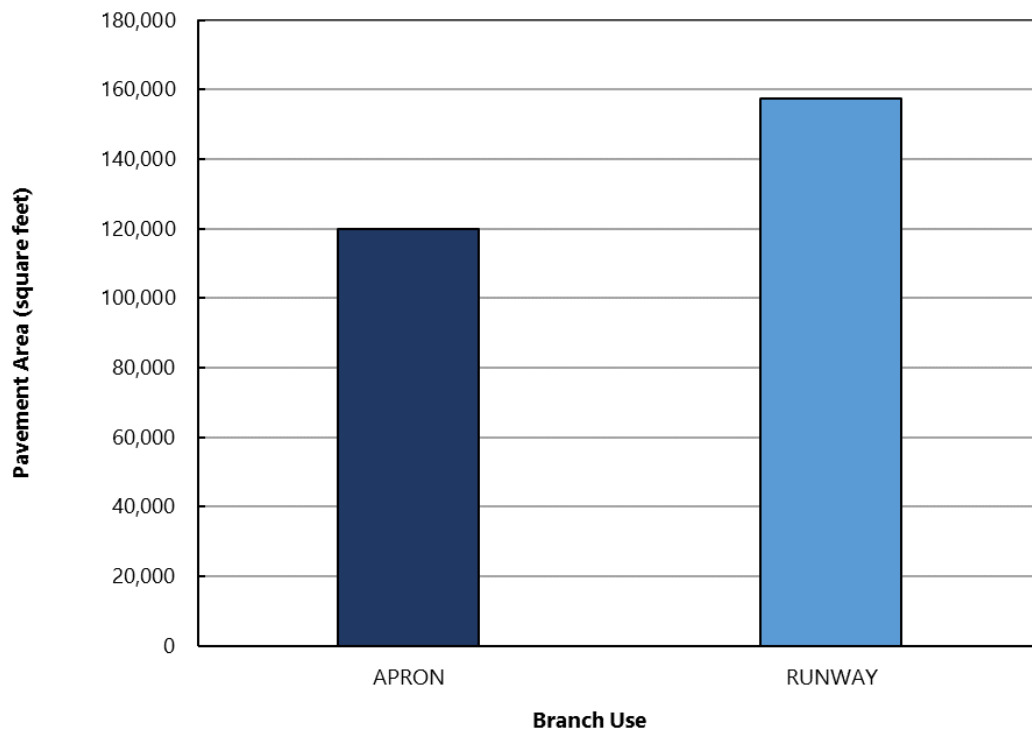


Figure 2.3: LENHARDT AIRPARK PAVEMENT AREA BY BRANCH USE

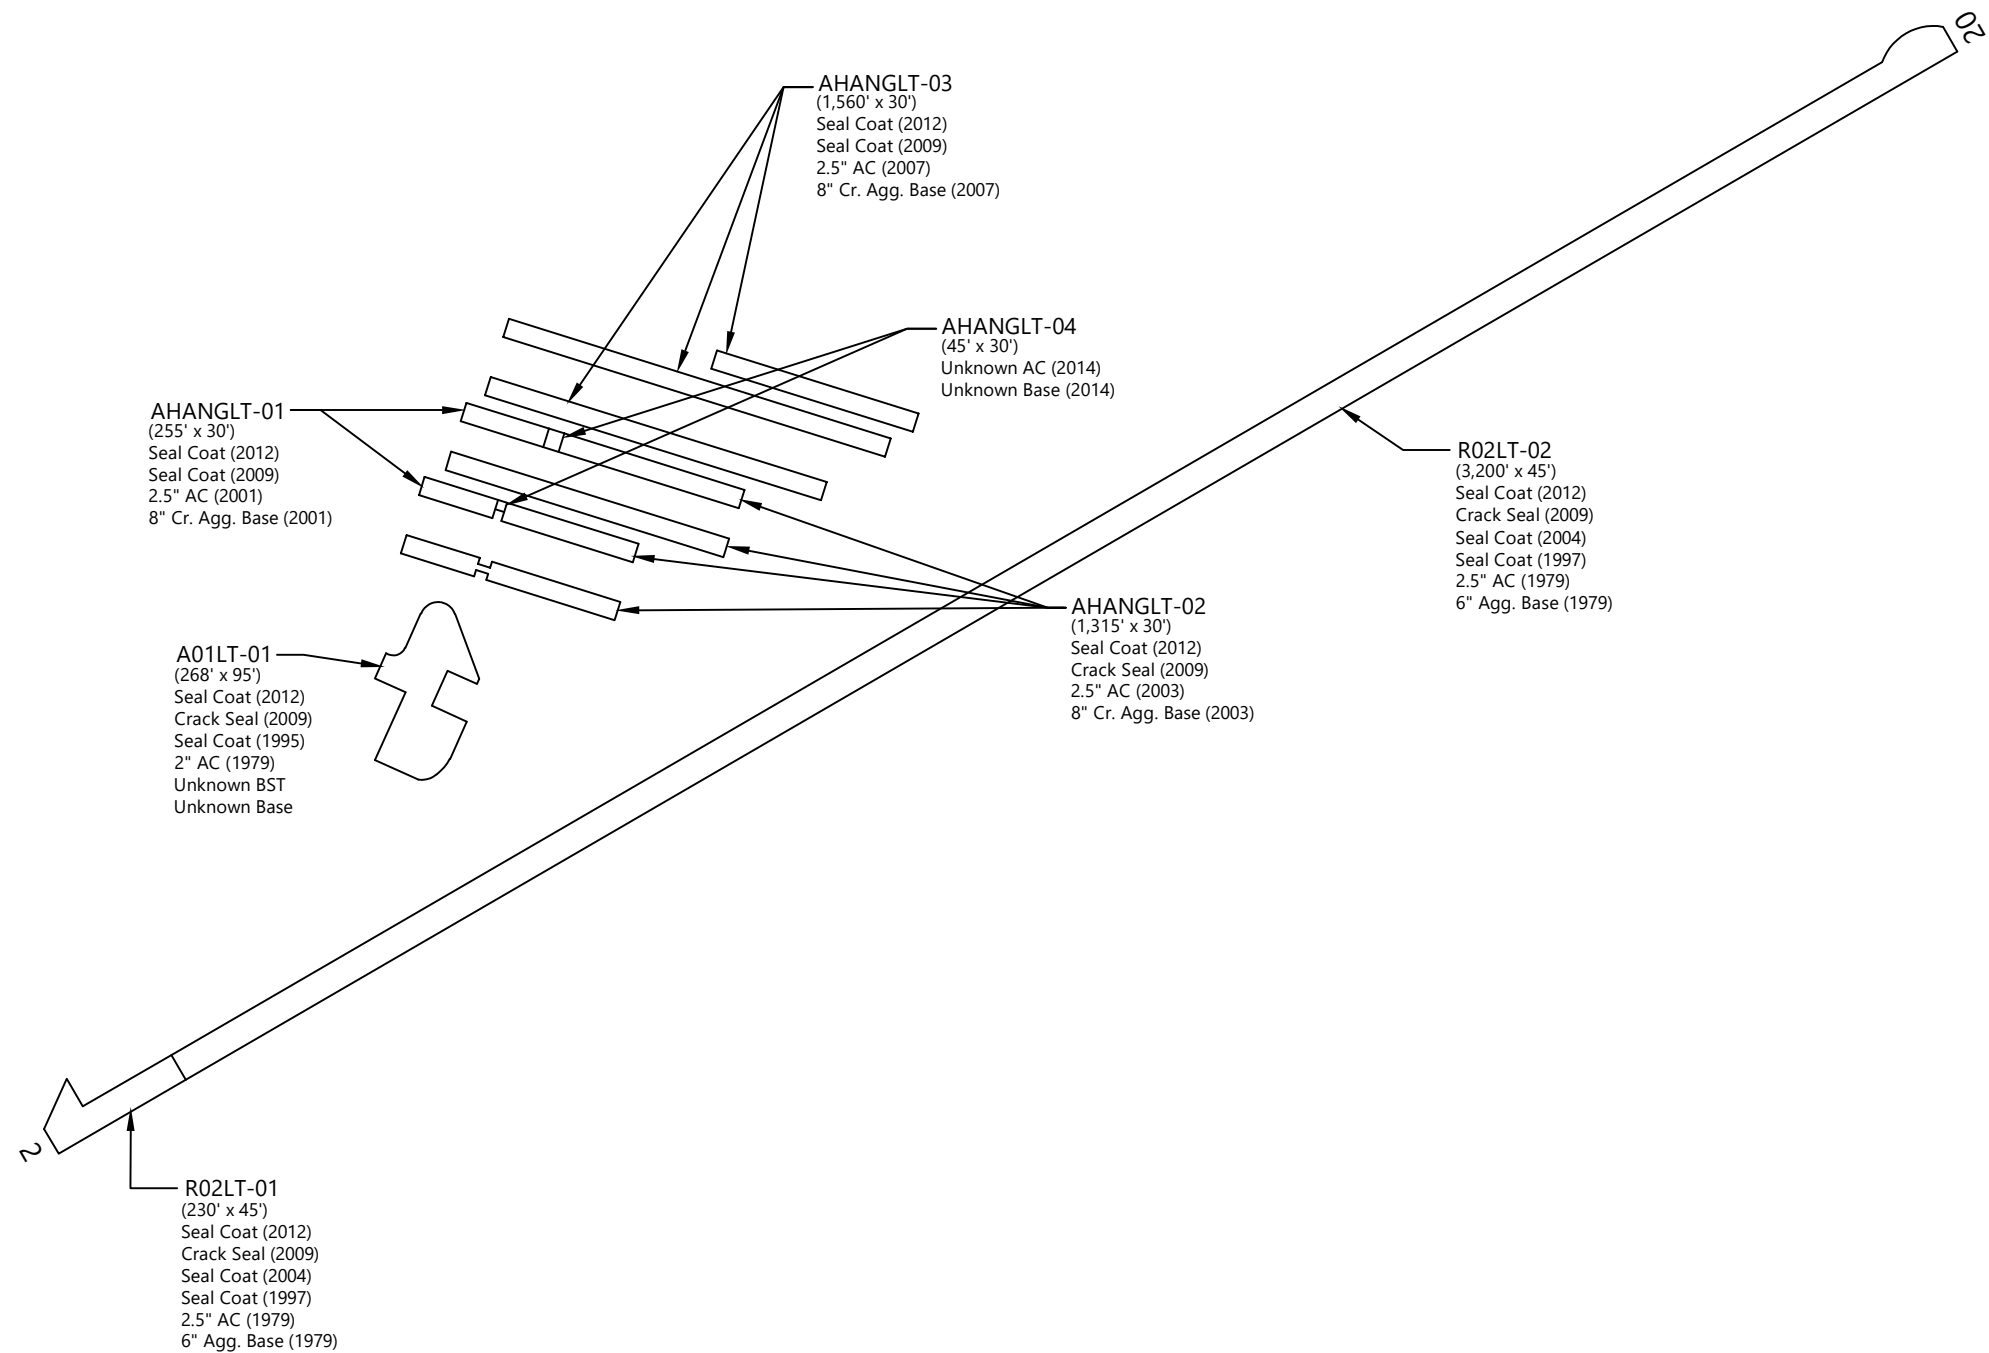

ABBREVIATIONS: AC = ASPHALT CONCRETE; Cr. = CRUSHED; Agg. = AGGREGATE; BST = BITUMINOUS SURFACE TREATMENT

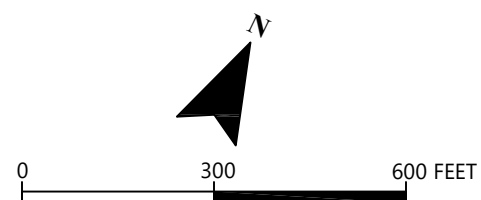

3 PAVEMENT CONDITION INSPECTION RESULTS

3.1 Introduction

GRI conducted a visual PCI survey of the airside pavements at Lenhardt Airpark in July 2023. The 2023 survey work was performed on sections last inspected in 2018 in order to update the Lenhardt Airpark inspection data. GRI performed the 2023 PCI survey in accordance with the methods described in FAA Advisory Circular 150/5380-6C and ASTM D5340 and further discussed in Appendix B of this report.


The PCI is based on the type, severity, and quantity of each distress found in an inspected sample unit. Further discussion of distress types for flexible is provided in Appendix B and summarized in Table 1B in Appendix B. The results of the PCI survey are displayed using a seven-category rating scale in accordance with ASTM D5340. Details of the ASTM PCI rating scale are provided in Table 3-1 below.

Table 3-1: ASTM PCI RATING SCALE

PCI Color Legend	PCI Range	PCI Rating and Definition
	86 – 100	GOOD: Pavement has minor or no distresses and should require only routine maintenance.
	71 – 85	SATISFACTORY: Pavement has scattered low-severity distresses that should require only routine maintenance.
	56 – 70	FAIR: Pavement has a combination of generally low- and medium-severity distresses. Maintenance and repair needs may range from routine to major.
	41 – 55	POOR: Pavement has low-, medium-, and high-severity distresses that probably cause some operational problems. M&R needs will be major.
	26 – 40	VERY POOR: Pavement has predominantly medium- and high-severity distresses that cause considerable maintenance and operational problems. M&R needs will be major.
	11 – 25	SERIOUS: Pavement has mainly high-severity distresses that may affect operational safety; immediate repairs are needed.
	0 – 10	FAILED: Pavement deterioration has progressed to the point that safe aircraft operations are no longer possible; complete reconstruction is required.


3.2 Pavement Condition Index Survey Results

The area-weighted average PCI for all airport pavements at Lenhardt Airpark is approximately 71. The section PCIs ranged from a low of 52 to a high of 82. The primary distresses observed during the inspection were weathering, alligator cracking, longitudinal and transverse cracking, block cracking, and patching on AC-surfaced pavements. Section PCIs following our pavement survey are displayed below spatially on the Lenhardt Airpark 2023 PCI Survey Results, Figure 3.1.

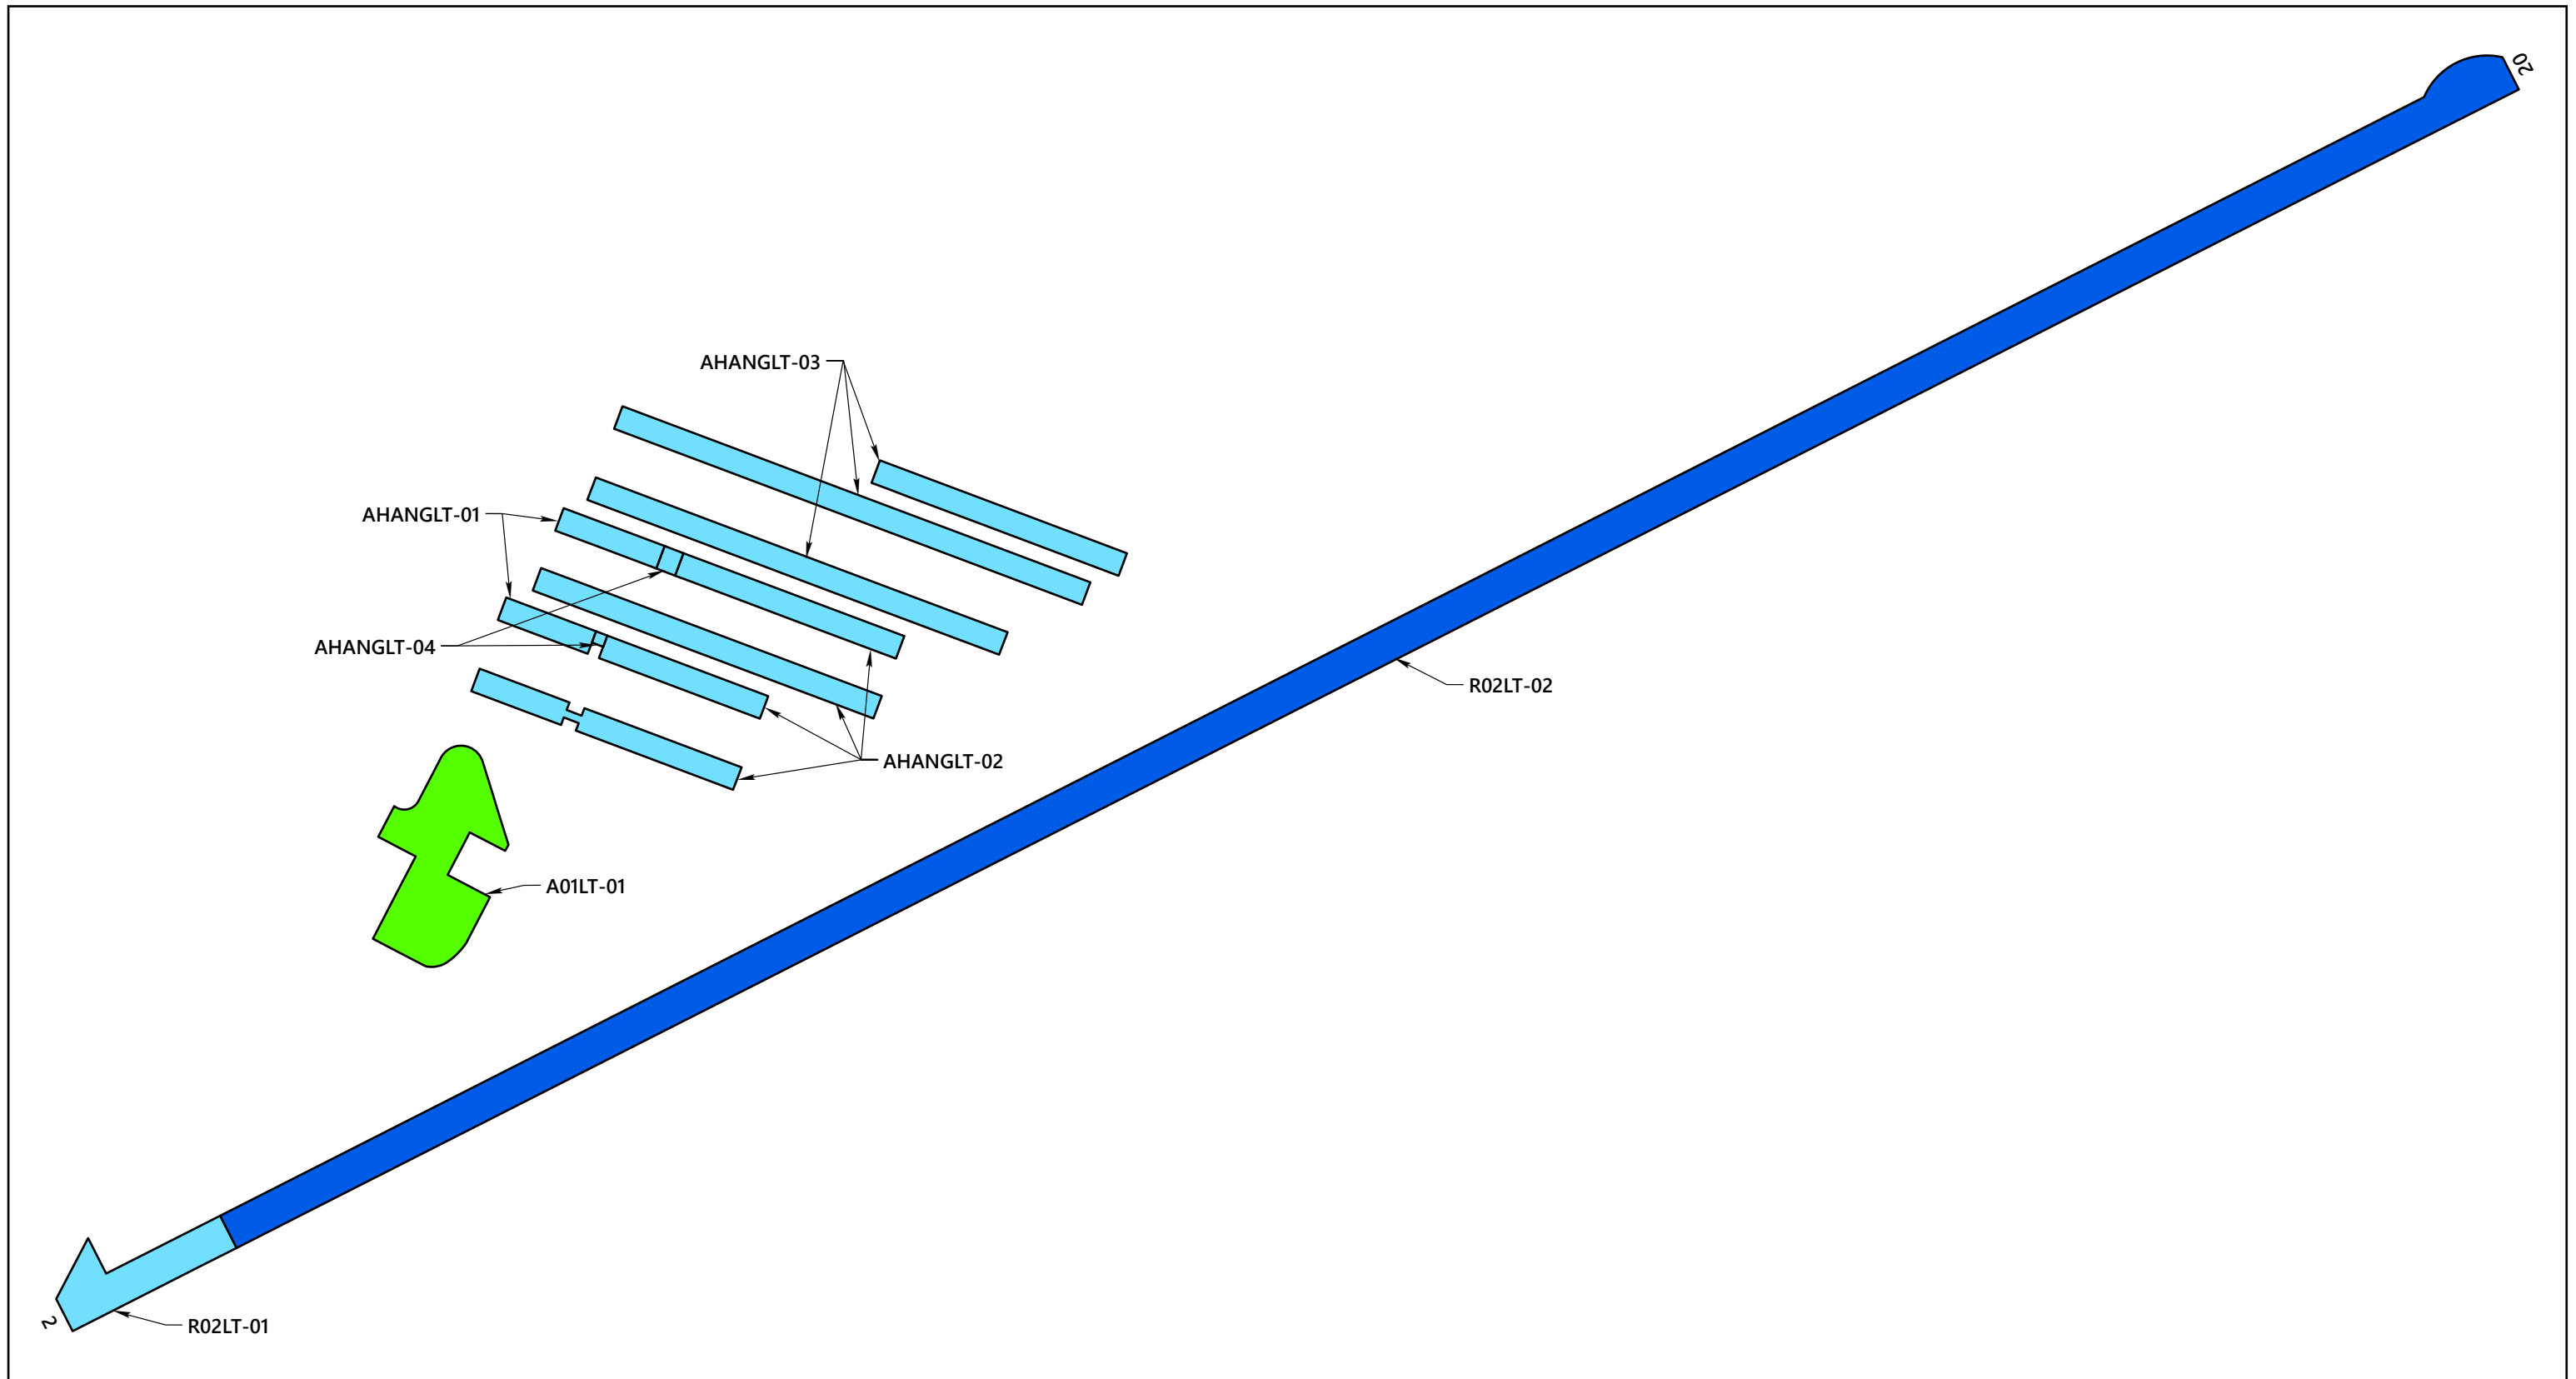

SECTION PCI

- (86 - 100) GOOD
- (71 - 85) SATISFACTORY
- (56 - 70) FAIR
- (41 - 55) POOR
- (26 - 40) VERY POOR
- (11 - 25) SERIOUS
- (0 - 10) FAILED

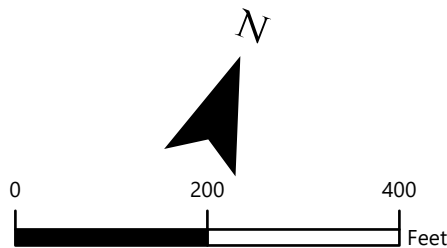

The condition distribution of the network by percent of total pavement area is provided on the Lenhardt Airpark Pavement Condition Rating by Percent of Area, Figure 3.2. A summary of the pavement condition results by branch and section is included in Tables 2B and 3B of Appendix B, respectively. A comparison between the previous inspection and the 2023 inspection is provided in Table 4B in Appendix B. The re-inspection report that includes inspection details for individual sample units is provided in Table 1E in Appendix E.

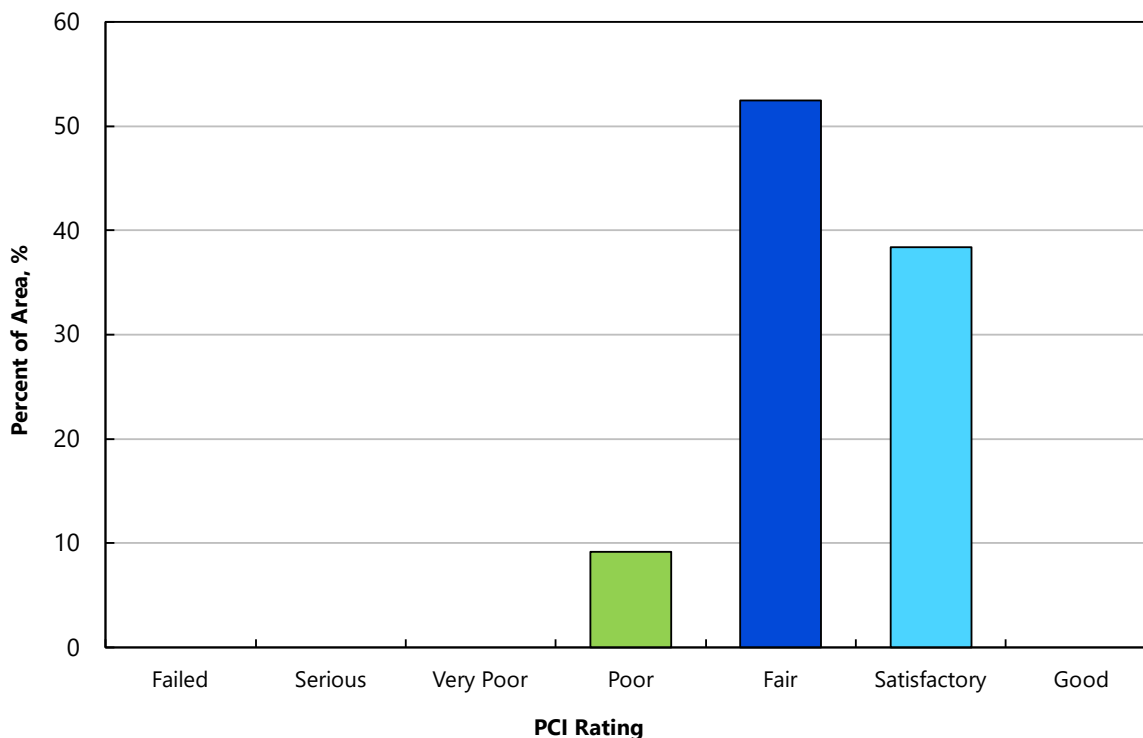


Figure 3.2: LENHARDT AIRPARK PAVEMENT CONDITION RATING BY PERCENT OF AREA

4 FUTURE PAVEMENT CONDITION ANALYSIS

4.1 Introduction

In addition to assessing the current condition of a pavement, it is very important from a planning standpoint to be able to predict with reasonable accuracy the future condition. Additional details regarding our future pavement condition analysis, including pavement condition prediction models, are provided in Appendix C. PCI performance curves developed for Lenhardt Airpark are displayed on Figures 1C and 2C in Appendix C.

4.2 Future Condition Analysis



Using the condition prediction models discussed above, the projected condition of each pavement section was determined for 5- and 10-year periods. Based on this analysis, we project the PCI to decrease from a current value of 71 to a value of 61 in 2028 and 45 in 2033 if no maintenance or rehabilitation work is performed. The projected pavement condition in 5 years and 10 years for each pavement section at Lenhardt Airpark is displayed spatially on the Lenhardt Airpark Future Pavement Condition, Figure 4.1, and listed in Table 1C in Appendix C, along with the past and present PCI values for the pavement network.

4.3 Functional Remaining Life

Functional remaining life is the practical amount of time a pavement is in service before requiring rehabilitation, as estimated solely based on visual condition. This is not to be confused with structural remaining life, which requires analysis of the structural capacity of a pavement and typically a field exploration and testing program that includes core explorations and falling weight deflectometer (FWD) deflection tests.



We calculated two forms of functional remaining life based on the current visual condition surveys of the pavement at Lenhardt Airpark. The first type of functional remaining life is the time until rehabilitation, such as an overlay, is needed. The critical PCI, further discussed in Section C.3 of Appendix C, is the threshold used for this type of functional remaining-life analysis. The second type of functional remaining life is the time until the pavement is no longer operational due to high foreign object debris (FOD) potential and increased safety concerns for trafficking aircraft. A PCI of 40 was set as the trigger point for the end of the pavement's functional service life with regard to FOD potential.

The two types of functional remaining life for each section at Lenhardt Airpark are summarized in Table 2C in Appendix C.

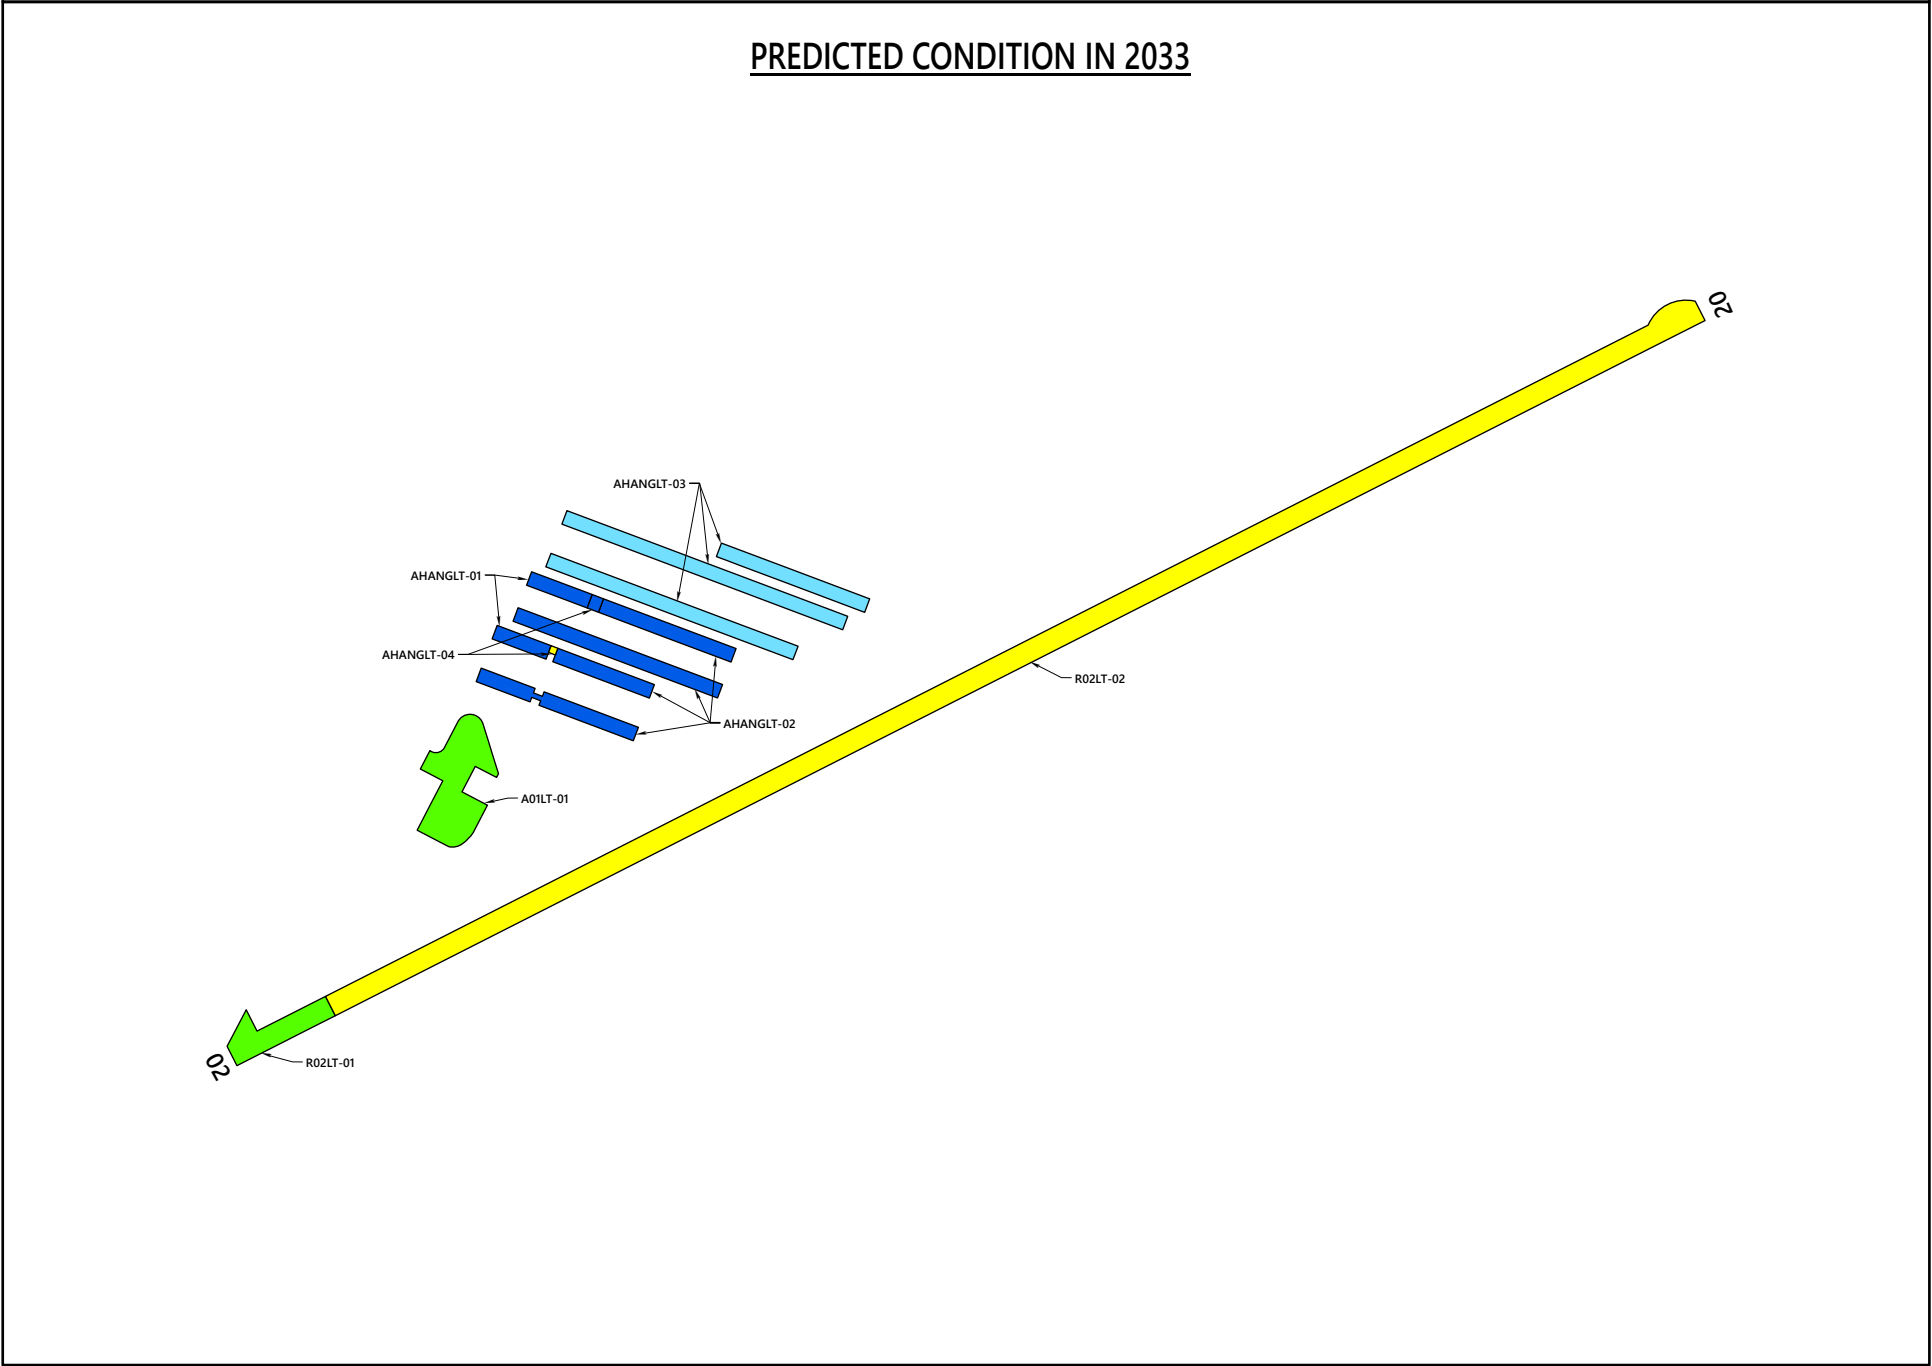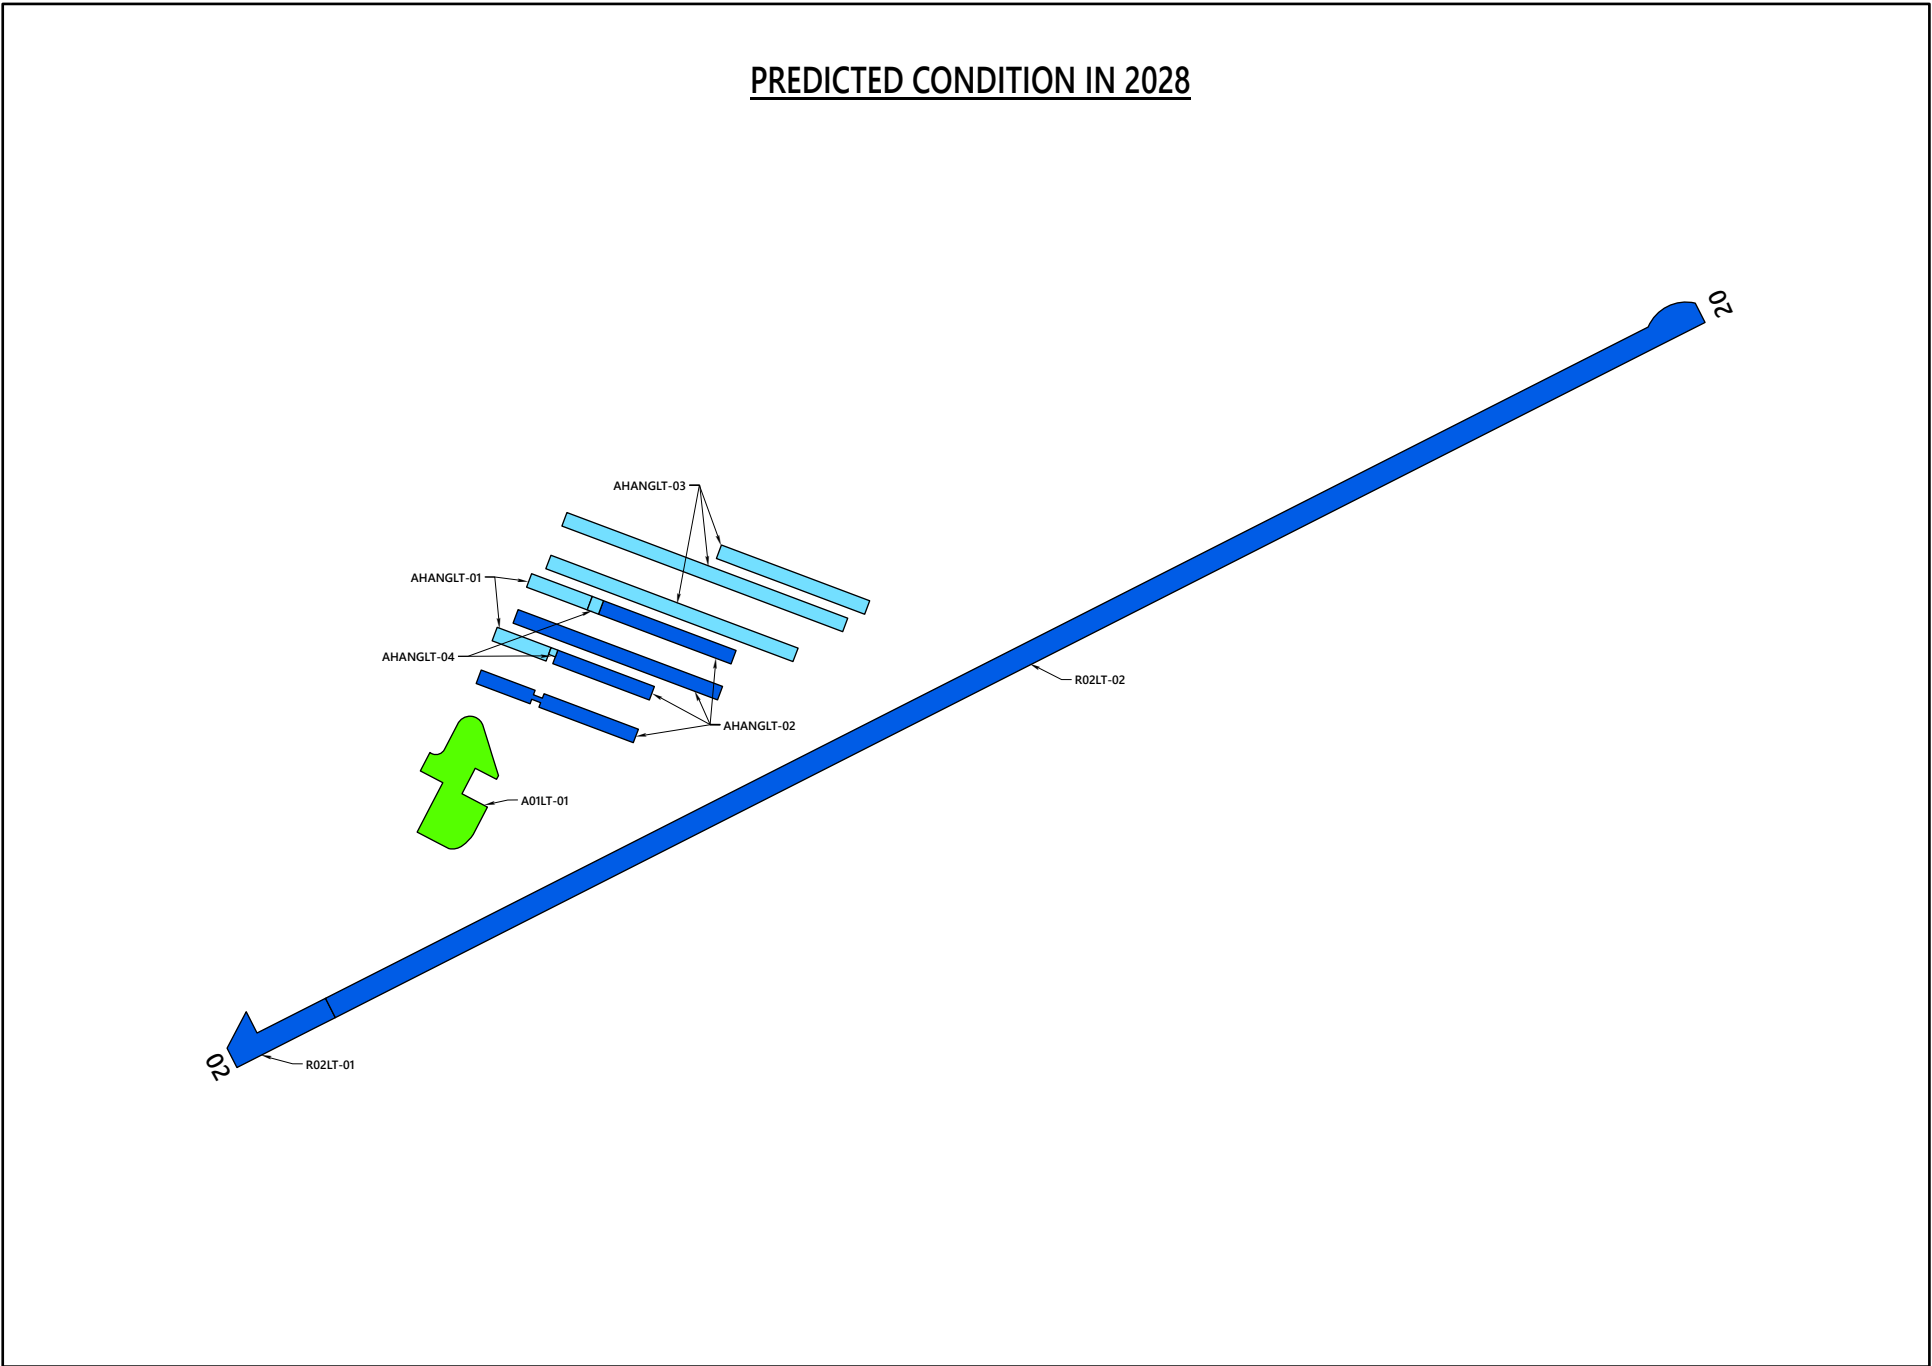

SECTION PCI

 - (86 - 100) GOOD
- (71 - 85) SATISFACTORY
- (56 - 70) FAIR
- (41 - 55) POOR
- (26 - 40) VERY POOR
- (11 - 25) SERIOUS
- (0 - 10) FAILED

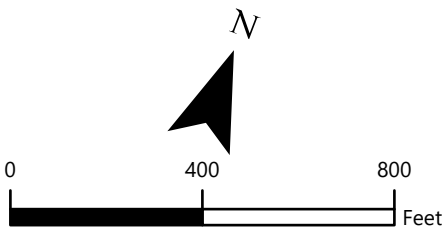

**FUTURE PAVEMENT CONDITION
LENHARDT AIRPARK**

5 MAINTENANCE AND REHABILITATION PROJECT RECOMMENDATIONS

5.1 Introduction

We evaluated M&R needs, as determined from the PAVER analysis results, in order to develop localized maintenance, surface treatment, rehabilitation, and reconstruction needs. Details of our M&R work priority and unit costs for work activities are provided in Tables 1D and 2D, respectively, in Appendix D.

5.2 Recommended Localized Maintenance

Localized maintenance refers to activities such as crack sealing and patching, which should be performed annually in order to properly maintain aging pavements. Using the PAVER Localized Distress Maintenance Analysis tool, we developed a list of recommended localized maintenance. This list is shown in Table 3D in Appendix D and is independent of the surface treatments, rehabilitation, and reconstruction projects associated with the five-year surface treatment and rehabilitation work plan. A summary of total localized maintenance quantities is provided in Table 5-1 below.

Table 5-1: LOCALIZED MAINTENANCE QUANTITIES


Localized Maintenance Operation	Quantity
Asphalt Concrete Crack Sealing	26,189 linear feet
Asphalt Concrete Full-Depth Patching	287 square feet

5.3 Surface Treatment, Rehabilitation, and Reconstruction Plan

To develop the five-year work plan, we first ran the eliminate backlog scenario with the PAVER M&R Work Planning Module in order to generate a list, organized by year, of surface treatment, rehabilitation, and reconstruction projects. We then reviewed the project list and refined it into practical construction projects for each year. A summary of surface treatment, rehabilitation, and reconstruction quantities is provided in Table 5-2 below, and maps of the project locations by year are shown on the Lenhardt Airpark 5-Year Pavement Management Plan, Figure 5.1. The complete list of recommended surface treatment, rehabilitation, and reconstruction projects is presented in Table 4D in Appendix D.

Table 5-2: SURFACE TREATMENT, REHABILITATION, AND RECONSTRUCTION QUANTITIES

Treatment Type	Quantity, square feet
Reconstruction	0
Overlay	25,495
Fog Seal	94,475
Slurry Seal	157,605

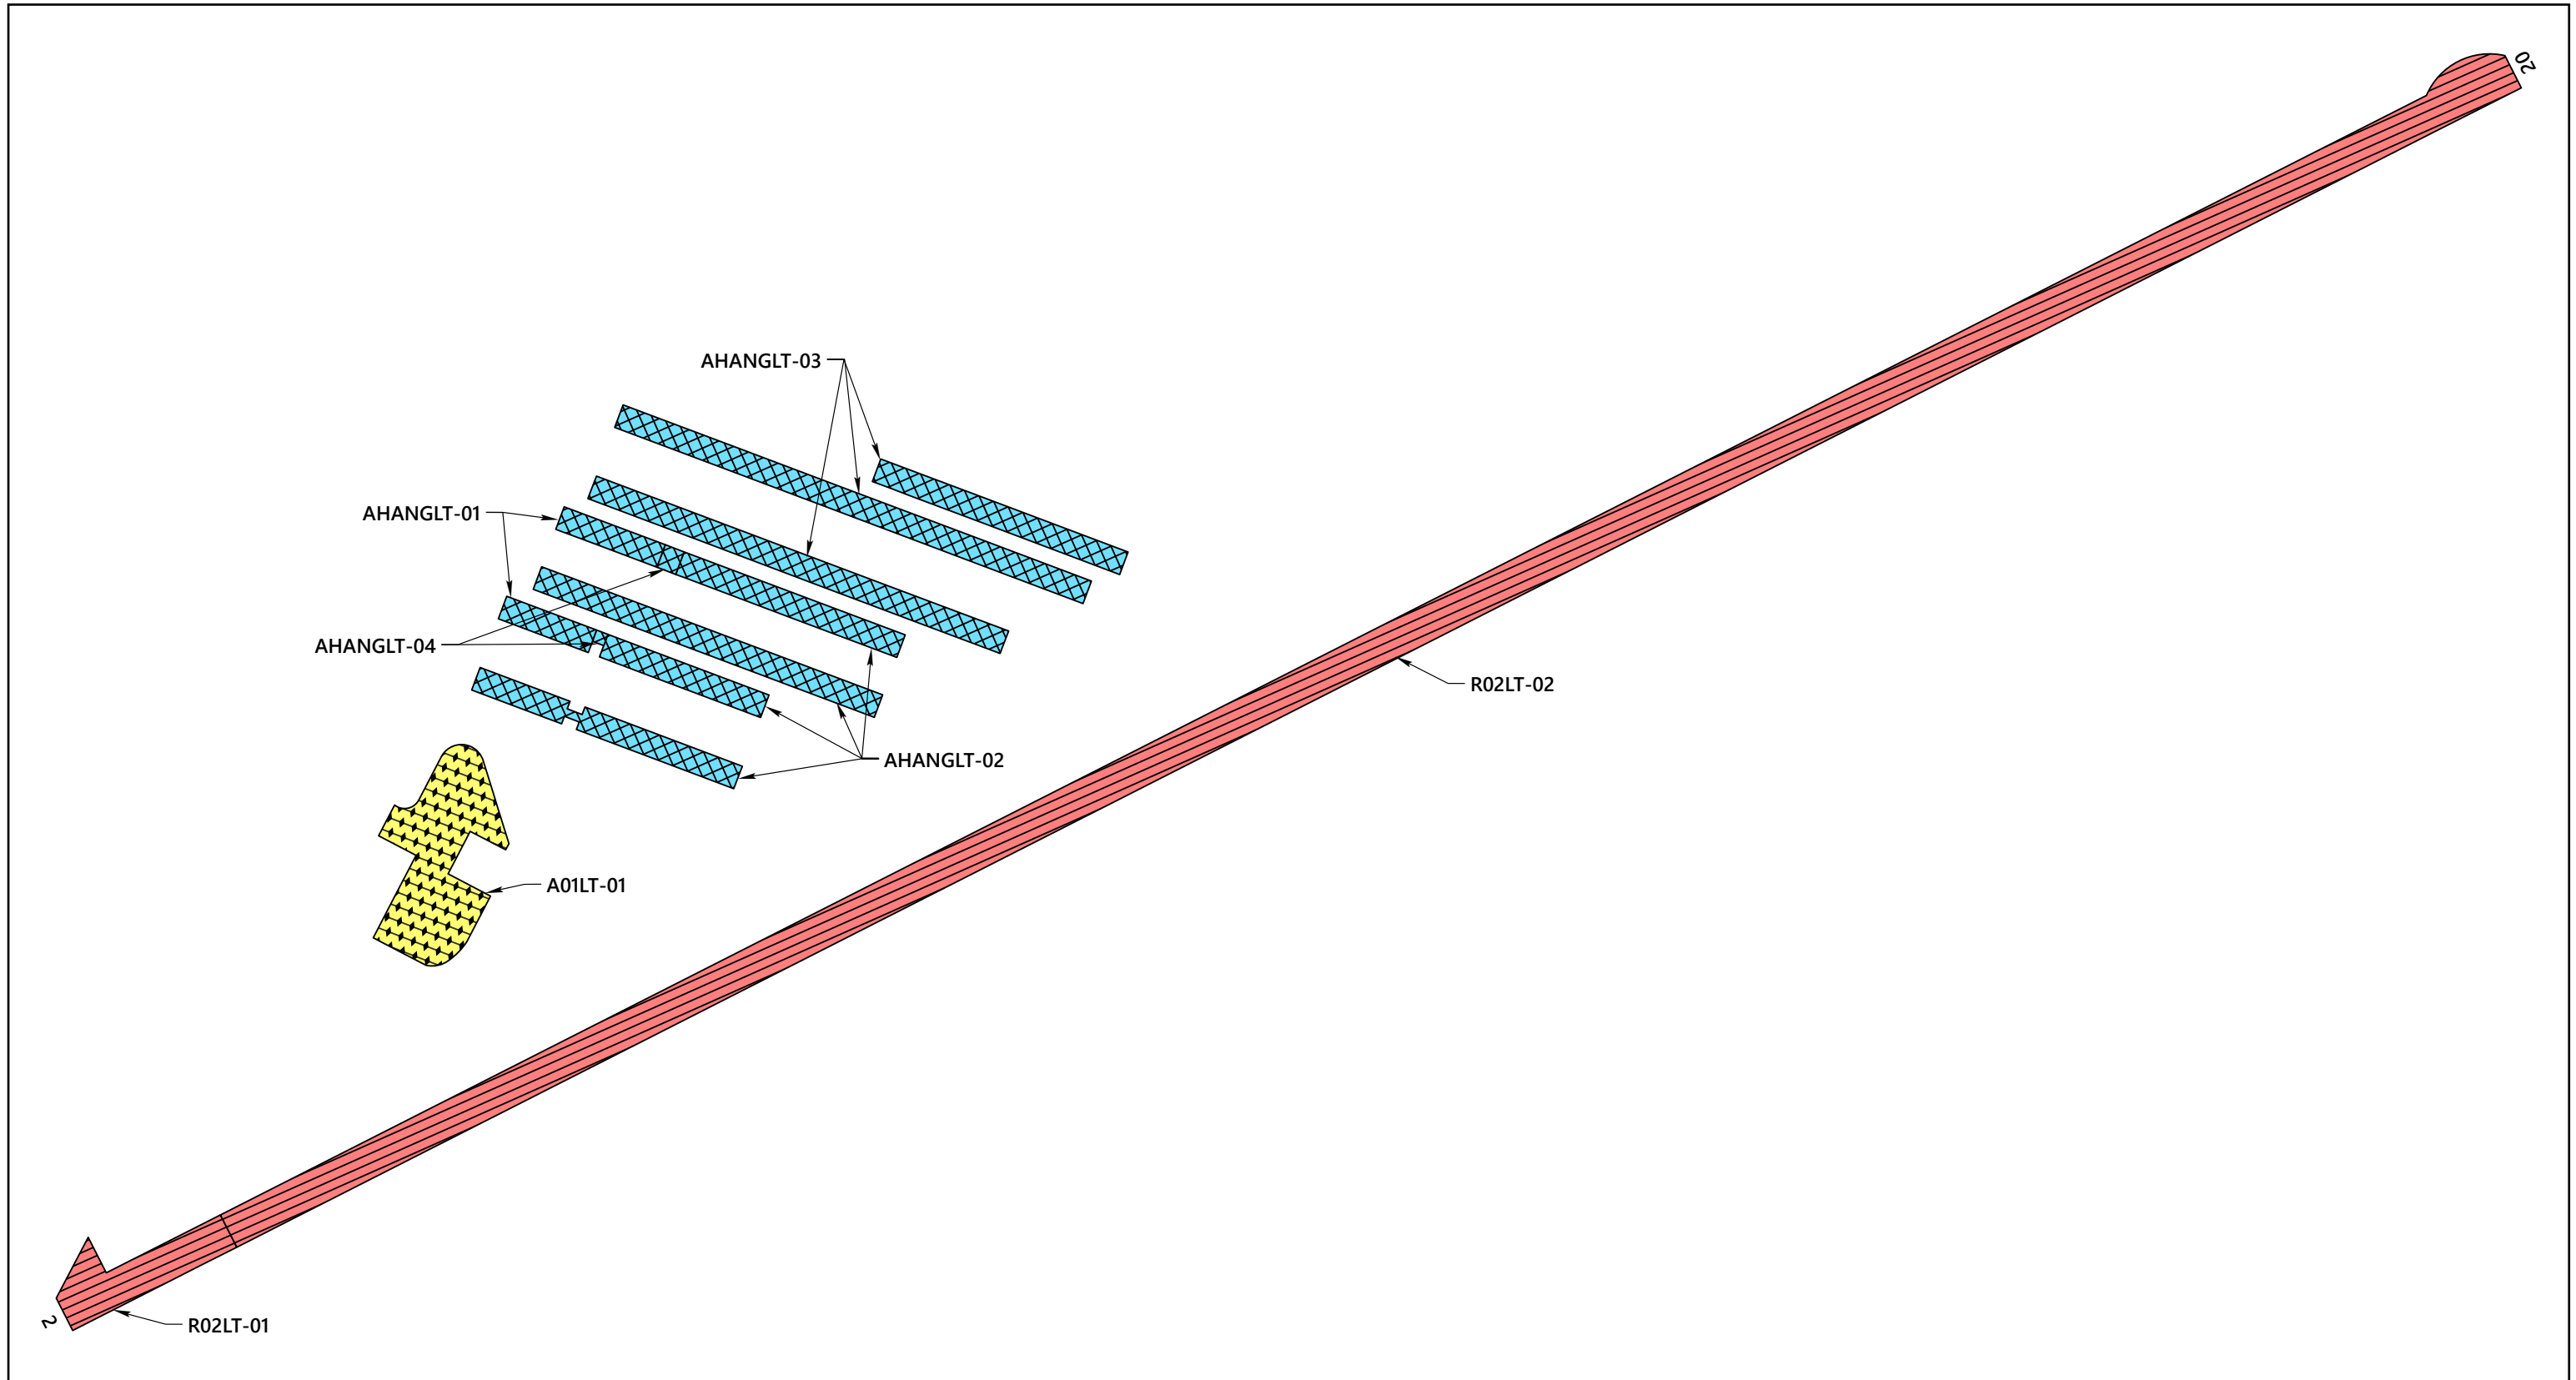


ACTION TIMING

- 2024
- 2025
- 2026
- 2027
- 2028

ACTION

- FOG SEAL
- SLURRY SEAL
- OVERLAY
- RECONSTRUCTION
- ROUTINE MAINTENANCE

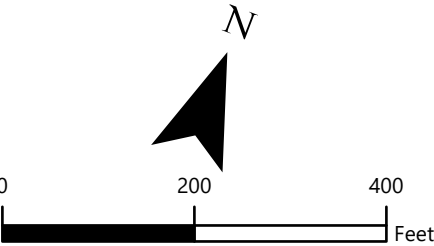

6 LIMITATIONS

This report has been prepared to assist the Oregon Department of Aviation (ODAV) with pavement-related project planning for the Lenhardt Airpark. The scope is limited to the specific pavement areas described within this report. The conclusions and recommendations provided in this report are based on information provided by ODAV, estimated costs, and an understanding of the pavement conditions based solely on visual assessment. The surface treatment, rehabilitation, and reconstruction recommendations and project selections provided in this report, as well as their corresponding cost estimates, are based on a practical grouping of projects and an estimate of the structural requirements. It is possible that recommendations based on a structural evaluation would differ materially from the recommendations given within this report. Therefore, the information included in this report should be used solely for project planning purposes, and it should be understood that rehabilitation costs may vary from the cost estimates given within this report.


Because the condition of the airport pavement network is dynamic, an effective maintenance and rehabilitation program should be reviewed and updated on a regular basis. In addition to regularly surveying and updating the pavement condition, completed construction activities should be tracked in the PAVER database. If Lenhardt Airpark would like to know more about the results presented in this report, please contact the undersigned.

Submitted for GRI,



RENEWS: 06/2025

Lindsy A. Hammond, PE
Principal


Matthew A. Haynes, PE
Project Engineer


Ana-Maria Coca, PhD
Engineering Staff

This document has been submitted electronically.

APPENDIX A

Pavement Inventory Reports and Maps

APPENDIX A

PAVEMENT INVENTORY REPORTS AND MAPS

A.1 PAVEMENT NETWORK

Lenhardt Airpark is located in Hubbard, Oregon, and is owned and operated by the Lenhardt family. The pavement network/facilities at Lenhardt Airpark serve a variety of general aviation aircraft. Lenhardt Airpark consists of a single runway and multiple aprons. The airside pavements are comprised of asphalt concrete (AC).

The current airport pavement management system (APMS) network at Lenhardt Airpark has an approximate area of 277,575 square feet of paved airside facilities. The pavement network has previously been divided (by others) into a hierarchical order of branches, sections, and sample units that facilitate inspection and maintenance planning. The pavement facilities summarized by branch and section are listed in Tables 1A and 2A, respectively. Pavement sections and the sample unit layout for each section are shown on Figure 1A in this appendix.

A.2 BRANCHES

A branch, as defined in the PAVER system, is a facility that is a readily identifiable part of the pavement system and has a distinct function. For airports, branches typically consist of individual runways, taxiways, and aprons. The current pavement network for Lenhardt Airpark contains 3 branches, tabulated in Table 1A and shown on Figure 1A.

A.3 SECTIONS AND SAMPLE UNITS

A pavement section is the smallest management unit used when considering the application and selection of maintenance and rehabilitation (M&R) repairs and treatments and is defined by Section 2.1.8 of ASTM International (ASTM) D5340 as *“a contiguous pavement area having uniform construction, maintenance, usage history, and condition.”* All sections should also have the same traffic volume and load intensity. The current pavement network included in the PAVER database for Lenhardt Airpark contains 7 sections that are managed by the Lenhardt family, which are tabulated in Table 2A and shown spatially on Figure 1A.

PAVER assigns a rank, which designates that pavement’s prioritization in receiving maintenance and repair. The highest use or priority pavements, such as runways, taxiways, and terminal aprons, are ranked *Primary*, while the surrounding aprons and shoulders are ranked *Secondary* and low-use areas are ranked *Tertiary*. The ranks for all sections are shown on Table 2A.

To facilitate the visual survey of the airport pavement, each section is further subdivided into smaller areas called sample units. Similar sizing of these units is critical, and studies have found that maintaining the size of the sample units to within 40% of the established normal distribution reduces the standard error of the average pavement condition index (PCI) values. To meet this criterion, the ASTM method recommends sample units for flexible pavements be $5,000 \pm 2,000$ square feet. The delineation of sample units for each section is displayed on Figure 1A.

A.4 SAMPLE UNIT DELINEATION

For an APMS survey, a PCI confidence level of 92% and an allowable error (e) of eight PCI points are used for all airport pavements. To determine the number of sample units that need to be inspected to achieve the required confidence level and allowable error, the following equation is used:

$$n = \frac{N \times s^2}{\left(\frac{e^2}{4}\right)(N-1) + s^2} \quad \text{(Equation 1)}$$

where:

- n = number of sample units to be inspected
- N = total number of samples in the pavement sections
- e = allowable error
- s = section standard deviation

For the 2023 Lenhardt Airpark PCI survey, Table 3A was used as a guideline in developing sampling rates for flexible pavement that reflect similar rates used for other large airport pavement networks. In general, this sampling rate distribution provides a 92% confidence level with a standard error of eight PCI points.

Sample unit locations at Lenhardt Airpark were selected using a systematic random sampling model method. This technique is implemented by first determining the number of sample units needed based on the confidence interval calculated using Equation 1. The first sample unit is randomly placed in the section, and then the remaining sample units are systematically spaced throughout the section at an equal distance apart.

Table 1A: LENHARDT AIRPARK PAVEMENT BRANCHES

Facility Designation (Branch ID)	Branch Name	Number of Sections	Approximate Area, square feet
A01LT	Apron 01 Lenhardt	1	25,495
AHANGLT	Hangar Apron Lenhardt	4	94,475
R02LT	Runway 02/20 Lenhardt	2	157,605

Table 2A: LENHARDT AIRPARK CURRENT PAVEMENT INVENTORY

BranchID	Branch Name	Branch Use	SectionID	From	To	Rank	Length, feet	Width, feet	Approximate Area, square feet	LCD	Surface Type
A01LT	Apron 01 Lenhardt	APRON	01	Airport Office & Parking	Hangars	P	268	95	25,495	8/1/1979	AC
AHANGLT	Hangar Apron Lenhardt	APRON	01	West of Runway	North of Apron	S	255	30	7,650	9/2/2001	AC
AHANGLT	Hangar Apron Lenhardt	APRON	02	West of Runway	North of Apron	S	1,315	30	39,050	9/2/2003	AC
AHANGLT	Hangar Apron Lenhardt	APRON	03	West of Runway	North of Apron	S	1,560	30	46,800	9/2/2007	AC
AHANGLT	Hangar Apron Lenhardt	APRON	04	Connector Pavement	Section 01 and 02	S	45	30	975	9/1/2014	AC
R02LT	Runway 02/20 Lenhardt	RUNWAY	01	Runway 2 End (South)	Section 02	P	230	45	12,100	8/2/1979	AC
R02LT	Runway 02/20 Lenhardt	RUNWAY	02	Section 01	Runway 20 End (North)	P	3,200	45	145,505	8/2/1979	AC

Abbreviations:

P = Primary pavement, S = Secondary pavement


LCD = Last Construction Date. The date of the last major rehabilitation (e.g. overlay)

AC = Asphalt Concrete

Table 3A: EXAMPLE SAMPLE RATES FOR AC PAVEMENTS


AC Sampling Rate	
Total Number of Sample Units, N	Sample Units to Survey, n
1	1
2-3	2
4-6	3
7-13	4
14-38	5
39+	6

Note: AC = Asphalt Concrete

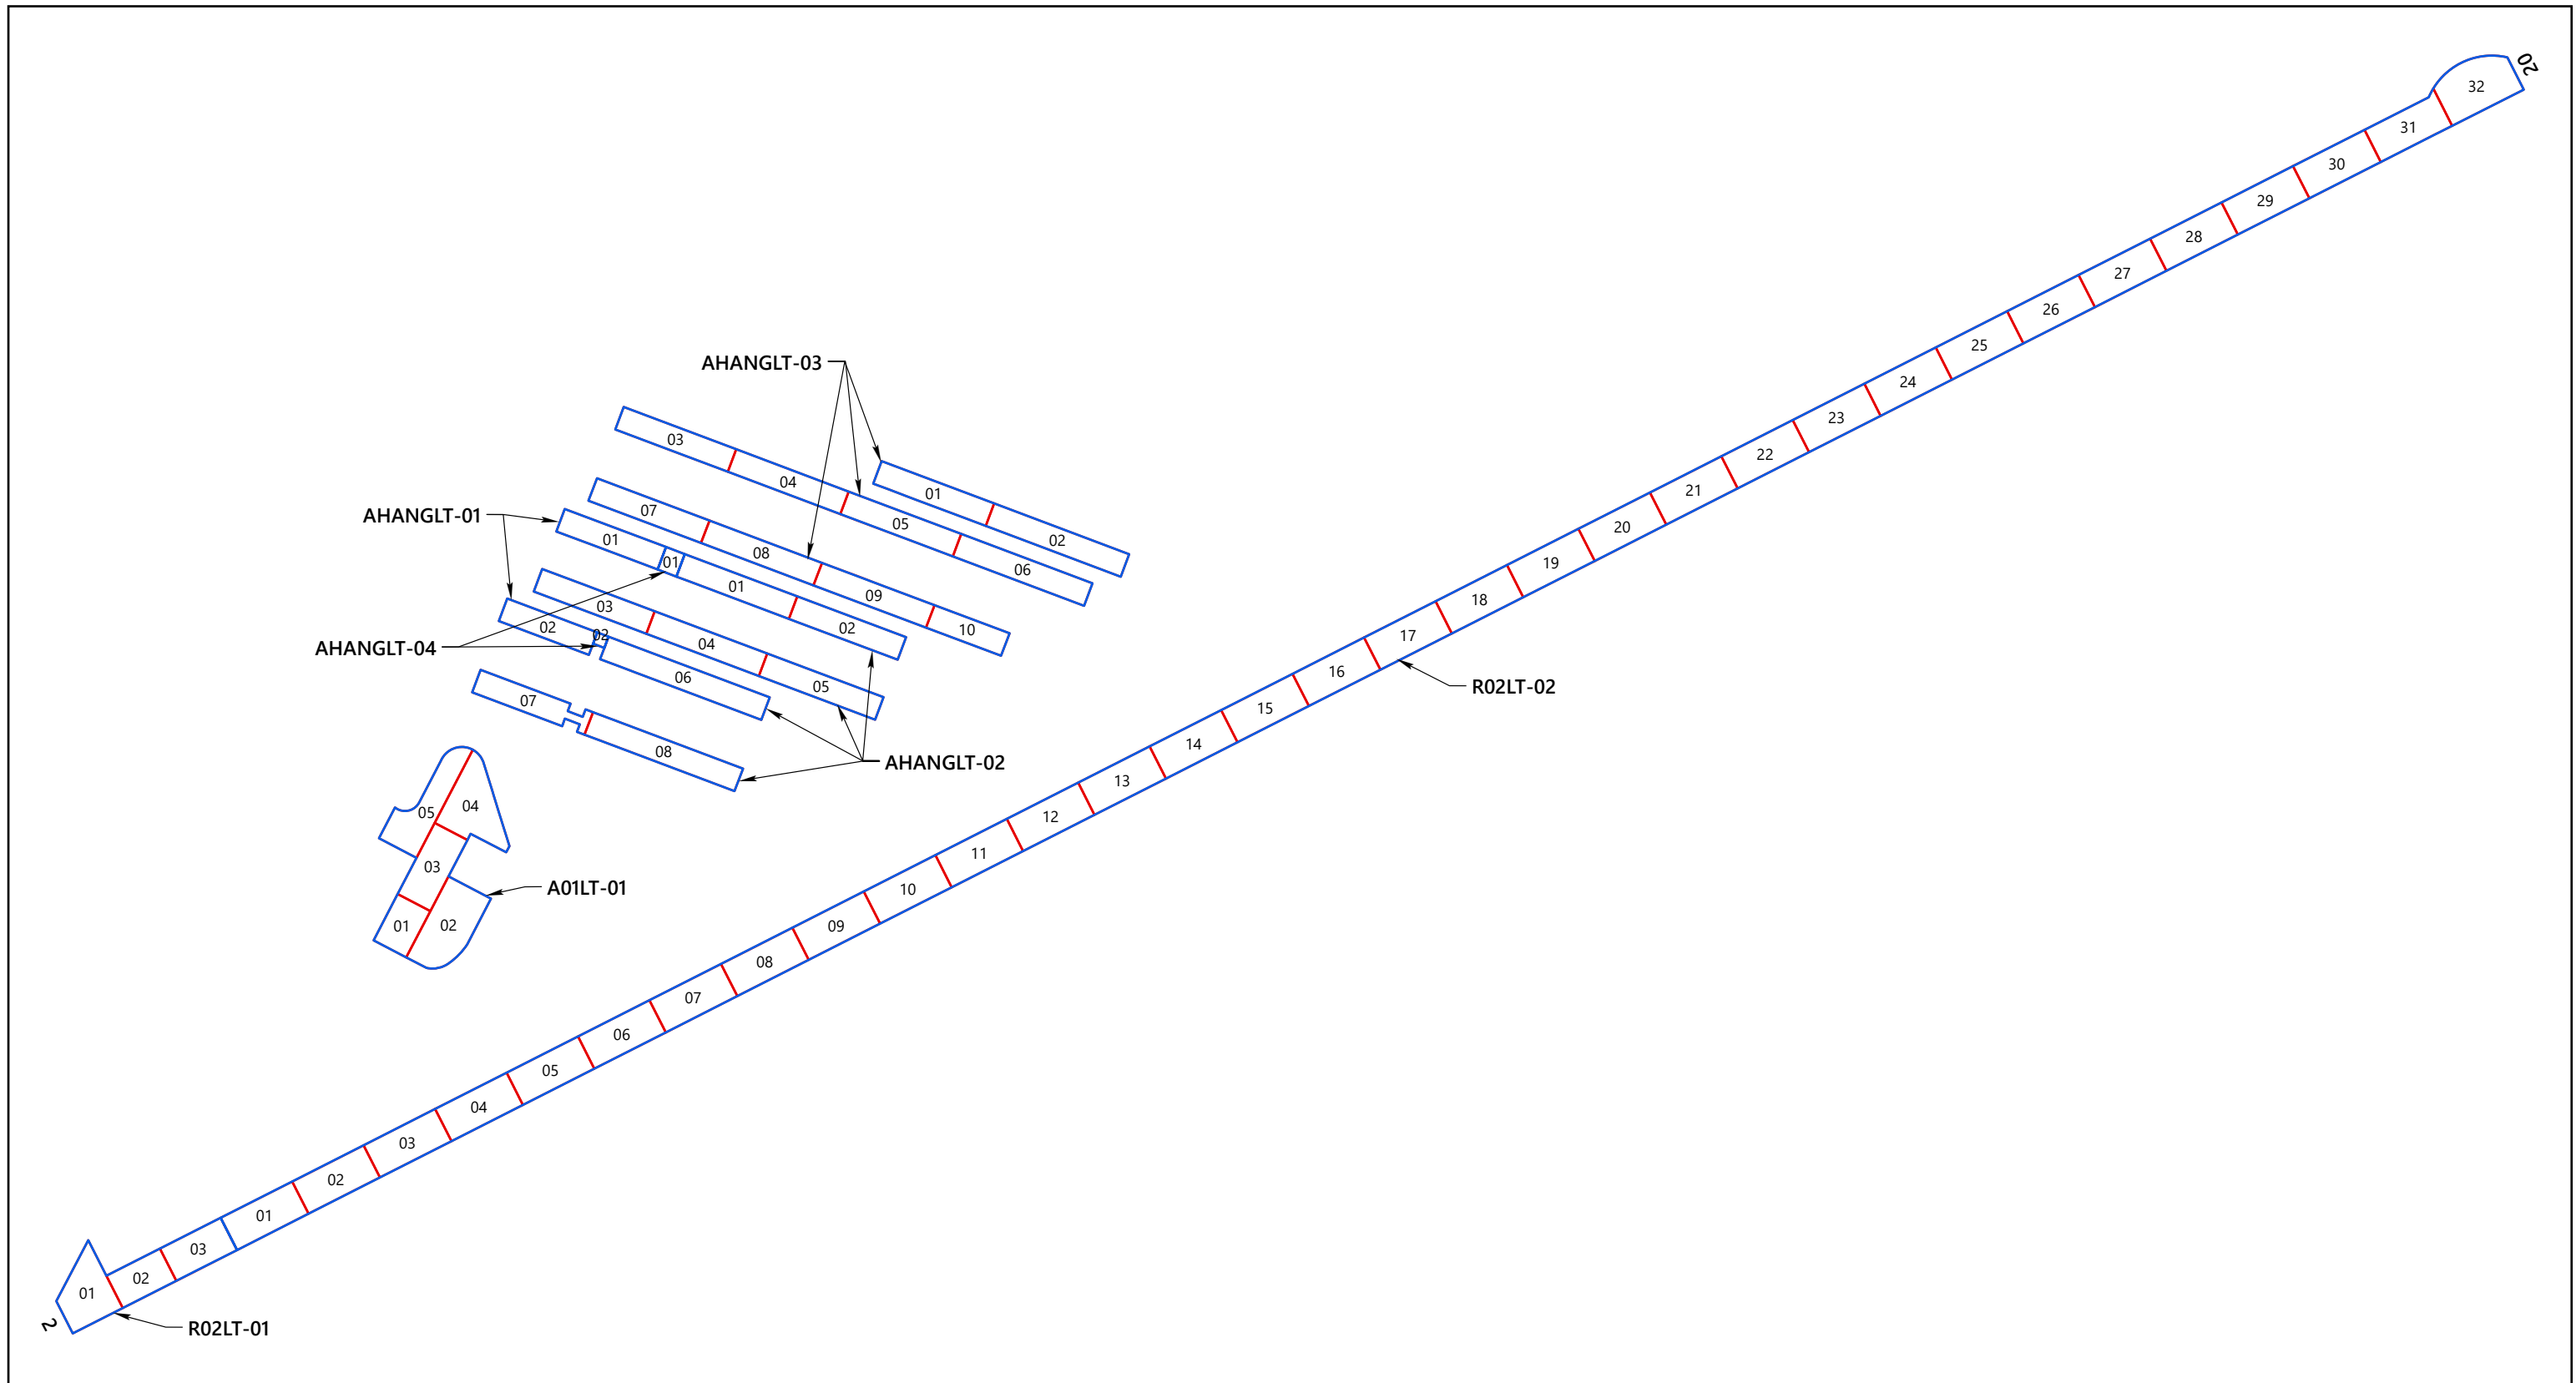

LEGEND

- SECTION
- SAMPLE UNIT

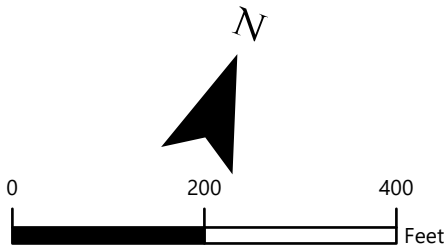

**LENHARDT AIRPARK
SAMPLE UNIT LAYOUT**

APPENDIX B

Pavement Condition Index Survey Results

APPENDIX B

PAVEMENT CONDITION INDEX SURVEY RESULTS

B.1 METHODOLOGY

As previously discussed, the PCI is a measure of the pavement's functional surface condition and provides a methodology for assessing the causes of distress and whether the distress is related to a load or climatic conditions. Although the PCI is not a direct measure of structural capacity, it provides a suggestion of the structural needs of the pavement.

The PCI is based on the type, severity, and quantity of each distress found in an inspected sample unit. The results are displayed using a seven-category rating scale in accordance with ASTM D5340. Flexible pavement (e.g., AC and AAC) distress types are presented in Table 1B. A summary of the pavement condition results by branch and section is included in Tables 2B and 3B of Appendix B, respectively.

Table 1B: PAVER DISTRESS CODES FOR FLEXIBLE PAVEMENT

Flexible Pavement		
PAVER Code	Pavement Distress	Related Cause
41	Alligator Cracking	Load
42	Bleeding	Other
43	Block Cracking	Climate/ Durability
44	Corrugation	Other
45	Depression	Other
46	Jet Blast	Other
47	Joint Reflection Cracking	Climate/ Durability
48	Longitudinal & Transverse Cracking	Climate/ Durability
49	Oil Spillage	Other
50	Patching	Climate/ Durability
51	Polished Aggregate	Other
52	Raveling	Climate/ Durability
53	Rutting	Load
54	Shoving	Other
55	Slippage Cracking	Other
56	Swelling	Other
57	Weathering	Climate/ Durability

To obtain the section PCI, we extrapolated the PCI of each selected sample unit over the entire section area. Distresses found in sample units classified as “additional”– defined as nonrepresentative instead of random- are not extrapolated over the entire section but merely added to the extrapolated quantity. The PCI rating scale presented previously in Table 3-1 of Section 3.1 is based on ASTM D5340.

Section 4.1 of ASTM D5340, governing PCI surveys, offers this caution:

“The PCI is a numerical indicator that rates the surface condition of the pavement. The PCI provides a measure of the **present condition** of the pavement based on the distress observed on the surface of the pavement, which also indicates the structural integrity and surface operational condition (localized roughness and safety). The PCI **cannot** measure structural capacity, nor does it provide a direct measurement of skid resistance or roughness. It provides an objective and rational basis for determining maintenance and repair needs and priorities. Continuous monitoring of the PCI is used to establish the rate of pavement deterioration, which permits the early identification of major rehabilitation needs. The PCI provides feedback on pavement performance for validation or improvement of current pavement design and maintenance procedures.”

Based on the limitations of the PCI method, it is imperative that engineers and planners treat the PCI as a tool that will assist them during the M&R planning process. Any major project should always be preceded by an up-to-date, detailed, 100% project-level inspection of the pavement in order to reevaluate maintenance needs prior to the project design process.

B.2 DISTRESS TYPES

Distress tends to fall into one of the following four cause categories:

- **Load-related:** Flexible pavement distresses include alligator/fatigue cracking, corrugation, depression, polished aggregate, rutting, and slippage cracking.
- **Climate- and durability-related:** Flexible pavement distresses include bleeding, block cracking, joint reflection cracking, longitudinal and transverse (L&T) cracking, swelling, and raveling/weathering.
- **Moisture- and drainage-related:** Flexible pavement distresses include alligator/fatigue cracking, depressions, potholes, and swelling.
- **Other factors:** Include oil spillage, jet blast erosion, bleeding, and patching.

As described above, distress may be the result of more than one cause. For example, depressions may be caused by incorrect compaction during construction or by subgrade softening due to environmental factors. In addition, distress may be initiated by one cause but may progress to a distress of higher severity by another cause. Therefore, engineering judgment is critical in analyzing the actual cause or causes of the distress.

B.3 PAVEMENT CONDITION INDEX SURVEY RESULTS

The evaluated Lenhardt Airpark pavement network consists of 3 branches and 7 sections. A total of 24 sample units were visually inspected in the field. Data from the inspected sample units were input into the PAVER database, and a resultant PCI for each section was computed. Additional details regarding the PCI and distress types observed for each surveyed sample unit are provided in the re-inspection report, Table 1E, in Appendix E. Based on the 2023 PCI survey, the area-weighted average PCI for the entire pavement network at Lenhardt Airpark is approximately 71, which corresponds to a PCI rating of Satisfactory.

To investigate the rate of deterioration of each pavement section, we compared the PCI results from the 2023 survey to the PCI results from the previous inspection. The variation in PCI between inspections for Lenhardt Airpark pavement sections is outlined in Table 4B in this appendix.

Table 2B: LENHARDT AIRPARK CURRENT BRANCH CONDITION REPORT

Branch ID	Number of Sections	Approximate Area, square feet	Use	Area Weighted Average Branch PCI	PCI Category
A01LT	1	25,495	APRON	52	Poor
AHANGLT	4	94,475	APRON	79	Satisfactory
R02LT	2	157,605	RUNWAY	70	Fair

Use Category	Number of Sections	Total Area, square feet	Area Weighted Average PCI
APRON	5	119,970	73
RUNWAY	2	157,605	70
ALL	7	277,575	71

Abbreviation: PCI = Pavement Condition Index

Table 3B: LENHARDT AIRPARK 2023 PAVEMENT CONDITION INDEX SURVEY RESULTS

BranchID	SectionID	Last Construction Date	Surface Type	Use	Last Inspection Date	Age at Inspection	PCI	PCI Category	PCI % Climate	PCI % Load	PCI % Other
A01LT	01	8/1/1979	AC	APRON	7/1/2023	44	52	Poor	69	31	0
AHANGLT	01	9/2/2001	AC	APRON	7/1/2023	22	80	Satisfactory	100	0	0
AHANGLT	02	9/2/2003	AC	APRON	7/1/2023	20	74	Satisfactory	99	0	1
AHANGLT	03	9/2/2007	AC	APRON	7/1/2023	16	82	Satisfactory	100	0	0
AHANGLT	04	9/1/2014	AC	APRON	7/1/2023	9	81	Satisfactory	100	0	0
R02LT	01	8/2/1979	AC	RUNWAY	7/1/2023	44	72	Satisfactory	100	0	0
R02LT	02	8/2/1979	AC	RUNWAY	7/1/2023	44	70	Fair	100	0	0

Abbreviations:

PCI = Pavement Condition Index, AC = Asphalt Concrete

Table 4B: LENHARDT AIRPARK COMPARISON OF PREVIOUS INSPECTION AND 2023 RESULTS

Branch ID	Section ID	Surface Type ¹	Approximate Area, square feet	LCD ²	2018 Survey			2023 Survey			Δ PCI/yr ⁴	Rate of Deterioration
					PCI	PCI Category	Inspection Date	PCI	PCI Category	Age ³		
A01LT	01	AC	25,495	8/1/79	64	Fair	5/10/2018	52	Poor	39	-2.33	NORMAL
AHANGLT	01	AC	7,650	9/2/01	89	Good	5/10/2018	80	Satisfactory	17	-2	NORMAL
AHANGLT	02	AC	39,050	9/2/03	83	Satisfactory	5/10/2018	74	Satisfactory	15	-1.75	NORMAL
AHANGLT	03	AC	46,800	9/2/07	93	Good	5/10/2018	82	Satisfactory	11	-2	NORMAL
AHANGLT	04	AC	975	9/1/14	99	Good	5/10/2018	81	Satisfactory	4	-3.50	NORMAL
R02LT	01	AC	12,100	8/2/79	72	Satisfactory	5/10/2018	72	Satisfactory	39	0	NONE
R02LT	02	AC	145,505	8/2/79	77	Satisfactory	5/10/2018	70	Fair	39	-1.36	NORMAL

Abbreviations:

¹ AC = Asphalt Concrete, PCI = Pavement Condition Index

² LCD = Last construction date. The date of the last major pavement rehabilitation (e.g. AC overlay)

³ Age = Pavement age in years at the time of the PCI survey in 2018

⁴ Δ PCI/yr = Change in PCI points per year between 2018 survey and 2023 survey

APPENDIX C

Future Pavement Condition Analysis

APPENDIX C

PAVEMENT CONDITION ANALYSIS

C.1 METHODOLOGY

In addition to assessing the current condition of a pavement, it is very important from a planning standpoint to be able to predict with reasonable accuracy its future condition. In a pavement management plan (PMP), this is done with the aid of a prediction model. When an APMS is initially implemented, the default models are typically used to predict the future condition of a pavement. However, after PCI surveys are completed, the historical data are then used to refine the models, so they better represent the deterioration of a particular class of pavement based on local climatic conditions, loading, material sources, construction procedures, etc. The importance of accurate prediction models is part of the reason it is essential to conduct periodic, routine surveys in order to track the rate of deterioration.

In PAVER, the pavement deterioration curves are developed based on the “family” model procedure. A pavement “family” is defined as a group of pavements with similar deterioration characteristics. The procedure for developing the prediction models is:

- 1) Define the pavement families.
- 2) Review the data.
- 3) Conduct a data-outlier analysis.
- 4) Model the data.

C.2 PREDICTION MODELS

We developed separate condition prediction models for each pavement “family” at Lenhardt Airpark. The delineation is based on branch use, surface type, section rank, and structural design life. We use two distinct models for the following “families” of pavements at Lenhardt Airpark. For each model, we reviewed the data in order to filter out any inconsistent or inaccurate data or any data that fell outside the boundary values set by PAVER. After outliers are removed and the data are checked for accuracy and reasonableness, the PAVER program calculates a best-fit curve using a polynomial-constrained, least-squares analysis procedure. This best-fit curve for each family is used in the analysis to predict the average behavior of all sections within each “family.” Our condition prediction models for each “family” are provided on Figures 1C and 2C below.

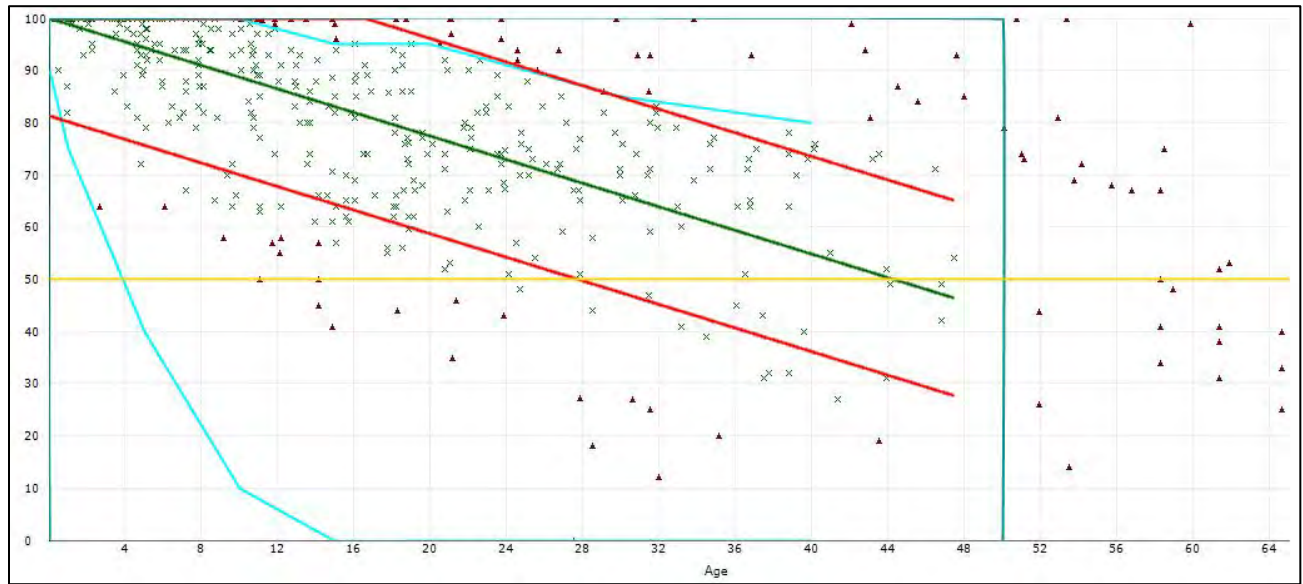


Figure 1C - CONDITION PREDICTION MODEL FOR NORTHWESTERN CATEGORY 4 AC APRONS

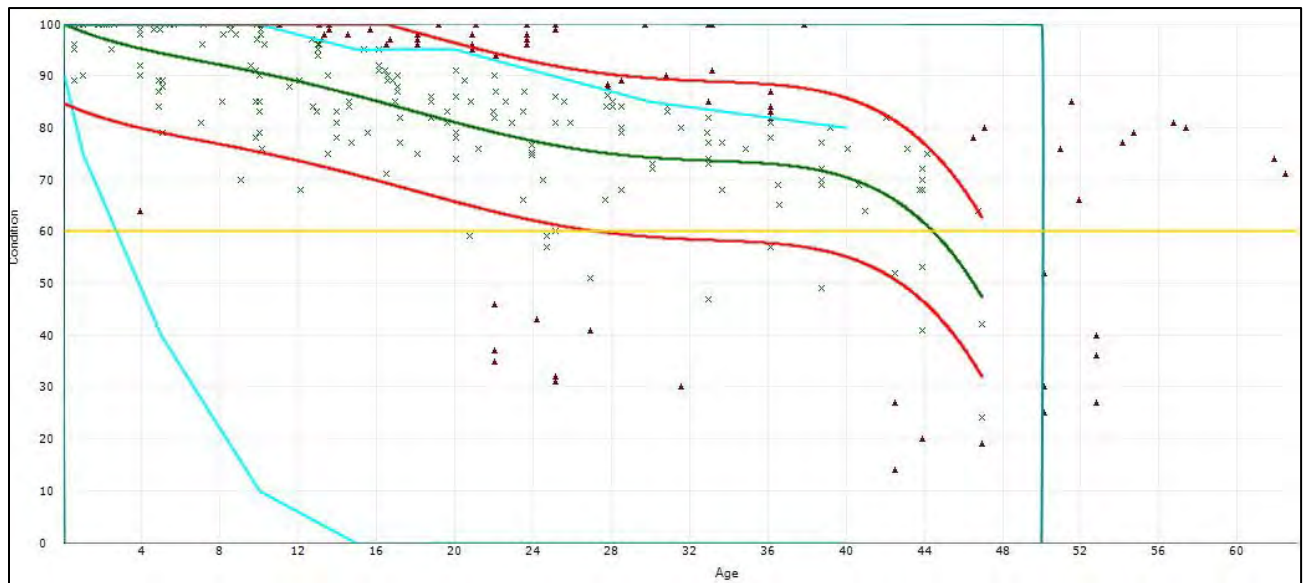


Figure 2C - CONDITION PREDICTION MODEL FOR NORTHWESTERN CATEGORY 4 AC RUNWAYS

C.3 CRITICAL PCI

Each of the condition-prediction models has an assigned critical PCI. The critical PCI is the point at which the pavement condition begins to deteriorate more quickly over time. As the condition deteriorates to a worse state, major M&R (rehabilitation/reconstruction) is triggered because the cost to apply localized M&R increases significantly. Pavement sections with PCI above the critical value are given a higher priority for funding during

budget analysis in order to prevent them from deteriorating to the point where more costly rehabilitation is necessary. We used the following critical PCI values at Lenhardt Airpark:

- Runways – 60
- Taxiways/Taxilanes – 55
- Aprons – 50

C.4 FUTURE CONDITION ANALYSIS

As previously discussed, the projected condition of each pavement section was determined for 5- and 10-year periods. The projected pavement conditions in 5 years and 10 years for each pavement section at Lenhardt Airpark, along with the conditions at the previous inspection, are listed in Table 1C.

C.5 FUNCTIONAL REMAINING LIFE

As mentioned above, functional remaining life is the practical amount of time a pavement is in service before requiring rehabilitation, as estimated based solely on visual condition. This is not to be confused with structural remaining life, which requires analysis of the structural capacity of a pavement.

We calculated two forms of functional remaining life based on the current visual condition surveys of the pavement at Lenhardt Airpark: the time until rehabilitation and the time until the pavement is no longer operational due to high foreign object debris potential and increased safety concerns for trafficking aircraft (PCI less than 40). The results of the functional life analysis are provided in Table 2C.

Table 1C: PAST, PRESENT AND FUTURE PCI

BranchID	SectionID	Past Inspection PCI	Current PCI	Predicted Future PCI	
		2018	2023	2028	2033
A01LT	01	64	52	46	41
AHANGLT	01	89	80	74	69
AHANGLT	02	83	74	68	63
AHANGLT	03	93	82	76	71
AHANGLT	04	99	81	75	70
R02LT	01	72	72	64	41
R02LT	02	77	70	56	31

Abbreviation: PCI = Pavement Condition Index

Table 2C: LENHARDT AIRPARK FUNCTIONAL REMAINING LIFE ANALYSIS

Branch ID	Section ID	Surface Type	Current PCI	Years to Major M&R	Major M&R Trigger PCI ¹	Years to End of Functional Service Life
A01LT	01	AC	52	0 - 5	50	6 - 10
AHANGLT	01	AC	80	> 20	50	> 20
AHANGLT	02	AC	74	> 20	50	> 20
AHANGLT	03	AC	82	> 20	50	> 20
AHANGLT	04	AC	81	> 20	50	> 20
R02LT	01	AC	72	6 - 10	60	6 - 10
R02LT	02	AC	70	0 - 5	60	6 - 10

Abbreviations:

PCI = Pavement Condition Index, AC = Asphalt Concrete

¹ Major M&R (Maintenance and Rehabilitation) Trigger PCI = Critical PCI

APPENDIX D

Unit Cost Data and Maintenance and Rehabilitation Plan

APPENDIX D

UNIT COST DATA AND MAINTENANCE AND REHABILITATION PLAN

D.1 ANALYSIS METHODOLOGY

We evaluated the M&R needs, as determined from the PAVER analysis results, in order to develop project recommendations for the next five years. The purpose of this analysis is to determine the M&R needs of the Lenhardt Airpark pavement network condition over time. We used PAVER v7.0.8 software to develop network-level project recommendations for the next five years.

The PAVER M&R Work Planning Module identifies when and where M&R is required and how much it will cost. M&R plans can be developed either by assuming an annual budget or by identifying specific constraints, such as a condition goal, to determine the budget required to meet the goal. The M&R work planning analysis was based on a five-year period beginning on August 1, 2024. A backlog elimination analysis scenario was selected to generate a list of surface treatment, rehabilitation, and reconstruction projects in order to optimize the allocation of capital and establish preservation-based project recommendations. The repair strategies considered for pavement sections in our analysis are as follows:

- Reconstruction – Considered for pavements with a PCI less than 40.
- Rehabilitation (AC Overlay) – Considered for pavements between 40 PCI and the critical PCI and for pavements exhibiting significant load-related distresses.
- Surface Treatment – Treatments (fog seal, slurry seal, thin AC overlay) are applied to an entire pavement section with the intent of slowing the rate of deterioration.
- Localized Maintenance – Maintenance performed on a routine basis, such as crack sealing, wide crack repair, and patching.

It should be noted that the five-year list of recommended projects only includes the highest-cost maintenance items and does not include routine localized maintenance (e.g., crack sealing) work that should also be conducted in addition to and concurrently with the five-year work plan.

D.1.1 Pavement Rank and Use Prioritization

Pavement sections are assigned a rank to establish their relative importance in the overall pavement network, which is most commonly defined by their use (e.g., Taxiway, Apron, Runway). The PAVER analysis uses the combination of the section rank and the branch use

to define the priority of each section during the M&R analysis. Table 1D displays the branch use and section rank prioritization schema we used for analysis.

Table 1D: M&R WORK PRIORITY BY BRANCH USE AND SECTION RANK

Branch Use	Section Rank		
	Primary	Secondary	Tertiary
RUNWAY	1	3	6
TAXIWAY	2	5	8
APRON	4	7	9

D.2 MAINTENANCE POLICIES AND UNIT COSTS

Distress-maintenance policies are policies that determine what type of work should be applied to a specific distress type and severity. For example, on an AC pavement, a medium-severity longitudinal/transverse crack would be repaired by crack sealing. Policies for all the distress types and severities are established by ASTM D5340.

Although our work scope does not include budget analysis, we did assign construction costs to the maintenance work so that PAVER would allocate M&R projects that were approximately equal in costs for each year of the five-year period. The anticipated cost of performing M&R is based on cost tables that relate M&R work type costs to PCI. We reviewed the unit costs from the 2018 report and updated them by reviewing the bid tabulations for recent projects within the vicinity of Lenhardt Airpark and information provided by the ODAV Pavement Maintenance Program (PMP) project team. The costs for reconstruction are based on the existing pavement sections present within each branch use at Lenhardt Airpark. The costs represent the fully-loaded costs and include aspects of the project such as administration, contingencies, mobilization, and striping. The cost tables used in the analysis are presented in Table 2D below.

Table 2D: REGION 1 UNIT COST DATA

Type of M&R	Work Type	Unit Cost	Work Unit
Major M&R	Complete Reconstruction with AC	\$17.32	Sq Ft
	Cold Mill and Overlay – 2 Inches Thick	\$7.64	Sq Ft
Surface Treatment (Global) M&R	Surface Treatment - Slurry Seal	\$0.52	Sq Ft
	Surface Treatment - Fog Seal	\$0.31	Sq Ft
Localized Preventive M&R	Crack Sealing - AC	\$3.12	Ft
	Crack Sealing - PCC	\$23.4	Ft
	Crack Sealing – Wide Cracks	\$51.48	Ft
	Joint Sealing – PCC	\$7.80	Ft
	AC Patching – Full Depth	\$78.00	Sq Ft
	PCC Patching – Full Depth	\$156.00	Sq Ft

D.3 RECOMMENDED LOCALIZED MAINTENANCE

In order to properly maintain aging pavements, localized M&R activities such as crack sealing and patching should be performed on a routine basis. A list of recommended localized maintenance activities is provided in Table 3D of this appendix.

D.4 RECOMMENDED SURFACE TREATMENT, REHABILITATION, AND RECONSTRUCTION PROJECTS

Surface treatment, rehabilitation, and reconstruction projects refer to activities such as slurry seal/fog seals, AC overlays, and reconstruction. A list of recommended projects is provided in Table 4D of this appendix.

Table 3D: LENHARDT AIRPARK NETWORK MAINTENANCE REPORT

Branch ID	Section ID	Distress	Severity	Action	Work Quantity	Unit	Unit Cost	Work Cost	Section Total
A01LT	01	Block Cracking	Low	Crack Sealing - AC	5,756	Ft	\$3.12	\$17,959	\$42,685
A01LT	01	Long. & Trans. Cracking	Low	Crack Sealing - AC	736	Ft	\$3.12	\$2,296	
A01LT	01	Alligator Cracking	Medium	Patching - AC Deep	287	SqFt	\$78.00	\$22,430	
AHANGLT	01	Long. & Trans. Cracking	Low	Crack Sealing - AC	425	Ft	\$3.12	\$1,326	\$1,326
AHANGLT	02	Long. & Trans. Cracking	Low	Crack Sealing - AC	2,891	Ft	\$3.12	\$9,020	\$9,020
AHANGLT	03	Long. & Trans. Cracking	Medium	Crack Sealing - AC	19	Ft	\$3.12	\$60	\$6,177
AHANGLT	03	Long. & Trans. Cracking	Low	Crack Sealing - AC	1,961	Ft	\$3.12	\$6,117	
AHANGLT	04	Long. & Trans. Cracking	Low	Crack Sealing - AC	45	Ft	\$3.12	\$140	
R02LT	01	Long. & Trans. Cracking	Low	Crack Sealing - AC	1,438	Ft	\$3.12	\$4,487	\$4,487
R02LT	02	Long. & Trans. Cracking	Low	Crack Sealing - AC	11,991	Ft	\$3.12	\$37,411	\$40,303
R02LT	02	Long. & Trans. Cracking	Medium	Crack Sealing - AC	927	Ft	\$3.12	\$2,892	

Abbreviations:

Long. = Longitudinal; Trans. = Transverse; AC = Asphalt Concrete; Ft = Feet; SqFt = Square Feet

Table 4D: FIVE-YEAR GLOBAL MAINTENANCE AND REHABILITATION PLAN

Action Year	Branch ID	Section ID	Branch Use	Surface Type	Current PCI	Action	Area, square feet	Unit Cost per square foot	Total Cost
2024	R02LT	01	RUNWAY	AC	72	Slurry Seal	12,100	\$0.52	\$6,292
	R02LT	02	RUNWAY	AC	70	Slurry Seal	145,505	\$0.52	\$75,662
2025	A01LT	01	APRON	AC	52	Overlay	25,495	\$7.64	\$194,782
2027	AHANGLT	01	APRON	AC	80	Fog Seal	7,650	\$0.31	\$2,371
	AHANGLT	02	APRON	AC	74	Fog Seal	39,050	\$0.31	\$12,105
	AHANGLT	03	APRON	AC	82	Fog Seal	46,800	\$0.31	\$14,508
	AHANGLT	04	APRON	AC	81	Fog Seal	975	\$0.31	\$302

Abbreviations:

PCI = Pavement Condition Index, AC = Asphalt Concrete

Cost Summary	
2024 Total Project Cost	\$81,954
2025 Total Project Cost	\$194,782
2026 Total Project Cost	\$0
2027 Total Project Cost	\$29,287
2028 Total Project Cost	\$0
Total 5-Year Project Cost	\$306,023

APPENDIX E

Reinspection Report

Re-Inspection Report

ODA_2023Survey_11-21-23

Generated Date 12/5/2023

Page 1 of 8

Network:	Lenhardt			Name:	Lenhardt Airpark					
Branch:	A01LT		Name:	Apron 01 Lenhardt		Use:	APRON	Area:	25,495 SqFt	
Section:	01	of	1	From:	Airport Office & Parking		To:	Hangars	Last Const.:	8/1/1979
Surface:	AC	Family:	2023_Region1_Cat4_Apron_AC	Zone:	7S9		Category:	F	Rank:	P
Area:	25,495 SqFt		Length:	268 Ft		Width:	95 Ft			
Slabs:	Slab Length:		Ft	Slab Width:		Ft	Joint Length:		Ft	
Shoulder:	Street Type:		Grade:		0	Lanes:		0		

Section Comments:

Work Date:	8/1/1965	Work Type:	Base Course - Aggregate	Code:	BA-AG	Is Major M&R:	False
Work Date:	8/2/1965	Work Type:	Surface Course - BST	Code:	SU-SB	Is Major M&R:	True
Work Date:	8/1/1979	Work Type:	Overlay - AC Thin	Code:	OL-AT	Is Major M&R:	True
Work Date:	8/1/1995	Work Type:	Surface Treatment - Seal Coat (Global MR)	Code:	ST-SC	Is Major M&R:	False
Work Date:	6/1/2012	Work Type:	Surace Treatment - Seal Coat	Code:	ST-SC	Is Major M&R:	False

Last Insp. Date: 7/1/2023 **TotalSamples:** 5 **Surveyed:** 3

Conditions: PCI: 52

Inspection Comments:

Sample Number:	02	Type:	R	Area:	6328.00 SqFt	PCI:	58
Sample Comments:							
43	BLOCK CR	L	2160.00	SqFt			
48	L & T CR	L	471.00	Ft			
52	RAVELING	M	480.00	SqFt			
57	WEATHERING	L	5888.00	SqFt			
Sample Number:	03	Type:	R	Area:	4565.00 SqFt	PCI:	49
Sample Comments:							
41	ALLIGATOR CR	M	21.00	SqFt			
43	BLOCK CR	L	4544.00	SqFt			
50	PATCHING	L	99.00	SqFt			
57	WEATHERING	L	4565.00	SqFt			
Sample Number:	05	Type:	R	Area:	5426.00 SqFt	PCI:	46
Sample Comments:							
41	ALLIGATOR CR	M	42.00	SqFt			
41	ALLIGATOR CR	M	80.00	SqFt			
43	BLOCK CR	L	5384.00	SqFt			
57	WEATHERING	L	5426.00	SqFt			

Network:		Lenhardt		Name:		Lenhardt Airpark																									
Branch:		AHANGLT		Name:		Hangar Apron Lenhardt		Use:		APRON		Area:		94,475 SqFt																	
Section:		04		of		4		From:		Connector Pavement		To:		Section 01 and 02		Last Const.:		9/1/2014													
Surface:		AC		Family:		2023_Region1_Cat4_Apron_AC		Zone:		7S9		Category:		F		Rank:		S													
Area:		975 SqFt		Length:		45 Ft		Width:		30 Ft																					
Slabs:				Slab Length:		Ft		Slab Width:		Ft		Joint Length:				Ft															
Shoulder:				Street Type:				Grade:		0		Lanes:		0																	
Section Comments:																															
Work Date:				9/1/2014				Work Type:				New Construction - AC				Code:				NC-AC				Is Major M&R:				True			
Last Insp. Date:				7/1/2023				TotalSamples:				2				Surveyed:				2											
Conditions:				PCI:				81																							
Inspection Comments:																															
Sample Number:				01				Type:				R				Area:				750.00 SqFt				PCI:				82			
Sample Comments:																															
48		L & T CR		L		30.00 Ft																									
57		WEATHERING		L		750.00 SqFt																									
Sample Number:				02				Type:				R				Area:				225.00 SqFt				PCI:				77			
Sample Comments:																															
48		L & T CR		L		15.00 Ft																									
57		WEATHERING		L		225.00 SqFt																									

Network:	Lenhardt		Name:	Lenhardt Airpark								
Branch:	AHANGLT		Name:	Hangar Apron Lenhardt		Use:	APRON	Area:	94,475 SqFt			
Section:	01	of 4	From:	West of Runway			To:	North of Apron		Last Const.:	9/2/2001	
Surface:	AC	Family:	2023_Region1_Cat4_Apron_AC		Zone:	7S9		Category:	F		Rank:	S
Area:	7,650 SqFt		Length:	255 Ft		Width:	30 Ft					
Slabs:	Slab Length:		Ft		Slab Width:		Ft		Joint Length:	Ft		
Shoulder:	Street Type:				Grade:	0		Lanes:	0			
Section Comments:												
Work Date:	9/1/2001		Work Type: Base Course - Crushed Rock				Code:	BA-CR		Is Major M&R:	False	
Work Date:	9/2/2001		Work Type: New Construction - AC				Code:	NC-AC		Is Major M&R:	True	
Work Date:	6/1/2012		Work Type: Surace Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False	
Last Insp. Date:	7/1/2023		TotalSamples:	2		Surveyed:	2					
Conditions:	PCI: 80											
Inspection Comments:												
Sample Number:	01	Type:	R	Area:	4050.00 SqFt		PCI:	85				
Sample Comments:												
48	L & T CR		L	114.00 Ft								
57	WEATHERING		L	4050.00 SqFt								
Sample Number:	02	Type:	R	Area:	3600.00 SqFt		PCI:	74				
Sample Comments:												
48	L & T CR		L	90.00 Ft								
48	L & T CR		L	177.00 Ft								
48	L & T CR		L	44.00 Ft								
57	WEATHERING		L	3600.00 SqFt								

Network:	Lenhardt			Name:	Lenhardt Airpark						
Branch:	AHANGLT		Name:	Hangar Apron Lenhardt		Use:	APRON	Area:	94,475 SqFt		
Section:	03	of	4	From:	West of Runway		To:	North of Apron		Last Const.:	9/2/2007
Surface:	AC	Family:	2023_Region1_Cat4_Apron_AC	Zone:	7S9		Category:	F		Rank:	S
Area:	46,800 SqFt		Length:	1,560 Ft		Width:	30 Ft				
Slabs:	Slab Length:		Ft		Slab Width:		Ft		Joint Length:	Ft	
Shoulder:	Street Type:				Grade:	0		Lanes:	0		
Section Comments:											
Work Date:	9/1/2007		Work Type: Base Course - Crushed Rock				Code:	BA-CR		Is Major M&R:	False
Work Date:	9/2/2007		Work Type: New Construction - AC				Code:	NC-AC		Is Major M&R:	True
Work Date:	6/1/2012		Work Type: Surace Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	7/1/2023		TotalSamples:	10		Surveyed:	5				
Conditions:	PCI:	82									
Inspection Comments:											
Sample Number:	02	Type:	R	Area:	5400.00 SqFt		PCI:	86			
Sample Comments:											
48	L & T CR	L	72.00 Ft								
48	L & T CR	L	61.00 Ft								
57	WEATHERING	L	5400.00 SqFt								
Sample Number:	03	Type:	R	Area:	4500.00 SqFt		PCI:	80			
Sample Comments:											
48	L & T CR	L	21.00 Ft								
48	L & T CR	L	86.00 Ft								
48	L & T CR	L	105.00 Ft								
48	L & T CR	L	28.00 Ft								
57	WEATHERING	L	4500.00 SqFt								
Sample Number:	05	Type:	R	Area:	4500.00 SqFt		PCI:	82			
Sample Comments:											
48	L & T CR	L	105.00 Ft								
48	L & T CR	L	90.00 Ft								
57	WEATHERING	L	4500.00 SqFt								
Sample Number:	08	Type:	R	Area:	4500.00 SqFt		PCI:	68			
Sample Comments:											
48	L & T CR	L	176.00 Ft								
48	L & T CR	L	225.00 Ft								
48	L & T CR	M	10.00 Ft								
57	WEATHERING	L	4500.00 SqFt								
Sample Number:	10	Type:	R	Area:	5400.00 SqFt		PCI:	89			
Sample Comments:											
48	L & T CR	L	11.00 Ft								
48	L & T CR	L	38.00 Ft								
57	WEATHERING	L	5400.00 SqFt								

Network:		Lenhardt		Name:		Lenhardt Airpark						
Branch:	AHANGLT		Name:	Hangar Apron Lenhardt		Use:	APRON	Area:	94,475 SqFt			
Section:	02 of 4		From:	West of Runway		To:	North of Apron		Last Const.:	9/2/2003		
Surface:	AC		Family:	2023_Region1_Cat4_Apron_AC		Zone:	7S9		Category:	F	Rank:	S
Area:	39,050 SqFt		Length:	1,315 Ft		Width:	30 Ft					
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft		
Shoulder:			Street Type:			Grade:	0		Lanes:	0		
Section Comments:												
Work Date:	9/1/2003		Work Type:	Base Course - Crushed Rock				Code:	BA-CR		Is Major M&R:	False
Work Date:	9/2/2003		Work Type:	New Construction - AC				Code:	NC-AC		Is Major M&R:	True
Work Date:	6/1/2012		Work Type:	Surace Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	7/1/2023		TotalSamples:	8		Surveyed:	4					
Conditions:	PCI: 74											
Inspection Comments:												
Sample Number:	01		Type:	R		Area:	4500.00 SqFt		PCI:	76		
Sample Comments:												
48	L & T CR		L	160.00 Ft								
48	L & T CR		L	164.00 Ft								
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	04		Type:	R		Area:	4500.00 SqFt		PCI:	71		
Sample Comments:												
45	DEPRESSION		L	6.00 SqFt								
48	L & T CR		L	295.00 Ft								
48	L & T CR		L	170.00 Ft								
57	WEATHERING		L	4500.00 SqFt								
Sample Number:	06		Type:	R		Area:	6450.00 SqFt		PCI:	71		
Sample Comments:												
48	L & T CR		L	148.00 Ft								
48	L & T CR		L	240.00 Ft								
48	L & T CR		L	90.00 Ft								
57	WEATHERING		L	5950.00 SqFt								
57	WEATHERING		M	500.00 SqFt								
Sample Number:	08		Type:	R		Area:	6000.00 SqFt		PCI:	79		
Sample Comments:												
48	L & T CR		L	50.00 Ft								
48	L & T CR		L	117.00 Ft								
48	L & T CR		L	92.00 Ft								
48	L & T CR		L	62.00 Ft								
57	WEATHERING		L	6000.00 SqFt								

Network:	Lenhardt		Name:	Lenhardt Airpark							
Branch:	R02LT		Name:	Runway 02/20 Lenhardt		Use:	RUNWAY	Area:	157,605 SqFt		
Section:	01	of	2	From:	Runway 2 End (South)		To:	Section 02		Last Const.:	8/2/1979
Surface:	AC	Family:	2023_Region1_Cat4_Run way_AC	Zone:	7S9		Category:	F		Rank:	P
Area:	12,100 SqFt		Length:	230 Ft		Width:	45 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	8/1/1979		Work Type: Base Course - Aggregate				Code:	BA-AG		Is Major M&R:	False
Work Date:	8/2/1979		Work Type: New Construction - AC				Code:	NC-AC		Is Major M&R:	True
Work Date:	8/1/1997		Work Type: Surface Treatment - Seal Coat (Global MR)				Code:	ST-SC		Is Major M&R:	False
Work Date:	6/1/2004		Work Type: Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Work Date:	9/1/2012		Work Type: Surace Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	7/1/2023		TotalSamples:	3		Surveyed:	2				
Conditions:	PCI: 72										
Inspection Comments:											
Sample Number:	01	Type:	R	Area:	4900.00 SqFt		PCI:	67			
Sample Comments:											
48	L & T CR	L	145.00 Ft								
48	L & T CR	L	238.00 Ft								
48	L & T CR	L	318.00 Ft								
57	WEATHERING	L	4900.00 SqFt								
Sample Number:	03	Type:	R	Area:	3825.00 SqFt		PCI:	78			
Sample Comments:											
48	L & T CR	L	110.00 Ft								
48	L & T CR	L	129.00 Ft								
48	L & T CR	L	44.00 Ft								
48	L & T CR	L	53.00 Ft								

Network:	Lenhardt			Name:	Lenhardt Airpark						
Branch:	R02LT		Name:	Runway 02/20 Lenhardt		Use:	RUNWAY		Area:	157,605 SqFt	
Section:	02 of 2		From:	Section 01			To:	Runway 20 End (North)		Last Const.:	8/2/1979
Surface:	AC		Family:	2023_Region1_Cat4_Runway_AC		Zone:	7S9		Category:	F	
Area:	145,505 SqFt		Length:	3,200 Ft		Width:	45 Ft				
Slabs:			Slab Length:	Ft		Slab Width:	Ft		Joint Length:	Ft	
Shoulder:			Street Type:			Grade:	0		Lanes:	0	
Section Comments:											
Work Date:	8/1/1979		Work Type: Base Course - Aggregate				Code:	BA-AG		Is Major M&R:	False
Work Date:	8/2/1979		Work Type: New Construction - AC				Code:	NC-AC		Is Major M&R:	True
Work Date:	8/1/1997		Work Type: Surface Treatment - Seal Coat (Global MR)				Code:	ST-SC		Is Major M&R:	False
Work Date:	6/1/2004		Work Type: Surface Treatment - Seal Coat				Code:	ST-SC		Is Major M&R:	False
Last Insp. Date:	7/1/2023		TotalSamples:	32		Surveyed:	6				
Conditions:	PCI: 70										
Inspection Comments:											
Sample Number:	01		Type:	R		Area:	4500.00 SqFt		PCI:	67	
Sample Comments:											
48	L & T CR		L	23.00 Ft							
48	L & T CR		L	212.00 Ft							
48	L & T CR		L	200.00 Ft							
48	L & T CR		L	196.00 Ft							
57	WEATHERING		L	4500.00 SqFt							
Sample Number:	07		Type:	R		Area:	4500.00 SqFt		PCI:	74	
Sample Comments:											
48	L & T CR		L	48.00 Ft							
48	L & T CR		L	43.00 Ft							
48	L & T CR		L	55.00 Ft							
48	L & T CR		L	242.00 Ft							
57	WEATHERING		L	4500.00 SqFt							
Sample Number:	13		Type:	R		Area:	4500.00 SqFt		PCI:	72	
Sample Comments:											
48	L & T CR		L	227.00 Ft							
48	L & T CR		L	28.00 Ft							
48	L & T CR		L	46.00 Ft							
48	L & T CR		M	32.00 Ft							
57	WEATHERING		L	4500.00 SqFt							
Sample Number:	19		Type:	R		Area:	4500.00 SqFt		PCI:	68	
Sample Comments:											
48	L & T CR		L	60.00 Ft							
48	L & T CR		L	228.00 Ft							
48	L & T CR		L	133.00 Ft							
48	L & T CR		M	20.00 Ft							
57	WEATHERING		L	4500.00 SqFt							
Sample Number:	23		Type:	R		Area:	4500.00 SqFt		PCI:	69	
Sample Comments:											
48	L & T CR		L	300.00 Ft							
48	L & T CR		L	84.00 Ft							
48	L & T CR		M	24.00 Ft							
57	WEATHERING		L	4500.00 SqFt							
Sample Number:	28		Type:	R		Area:	4500.00 SqFt		PCI:	74	
Sample Comments:											
48	L & T CR		L	100.00 Ft							
48	L & T CR		M	96.00 Ft							

APPENDIX F

Work History Report

12/12/2023

Work History Report

Page 1 of 3

Pavement Database: ODA_2023Survey_MASTER DB-12-11-2023_4pm

Network: Lenhardt Airpark		Branch: A01LT		Apron 01 Lenhardt		Section: 01	Surface: AC
L.C.D. 8/1/1979	Use: APRON	Rank: P	Length: 268.00 (Ft)	Width: 95.00 (Ft)	True Area: 25495 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
6/1/2012	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	Unknown Depth & X-Section	
8/1/1995	ST-SC	Surface Treatment - Seal Coat (Global MR)	0.00	0.10	<input type="checkbox"/>		
8/1/1979	OL-AT	Overlay - AC Thin	0.00	2.00	<input checked="" type="checkbox"/>		
8/2/1965	SU-SB	Surface Course - BST	0.00	1.00	<input checked="" type="checkbox"/>		
8/1/1965	BA-AG	Base Course - Aggregate	0.00	0.00	<input type="checkbox"/>		

Network: Lenhardt Airpark		Branch: AHANGLT		Hangar Apron Len		Section: 01	Surface: AC
L.C.D. 9/2/2001	Use: APRON	Rank: S	Length: 255.00 (Ft)	Width: 30.00 (Ft)	True Area: 7650 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
6/1/2012	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	Assumed date	
9/2/2001	NC-AC	New Construction - AC	0.00	2.50	<input checked="" type="checkbox"/>		
9/1/2001	BA-CR	Base Course - Crushed Rock	0.00	8.00	<input type="checkbox"/>		

Network: Lenhardt Airpark		Branch: AHANGLT		Hangar Apron Len		Section: 02	Surface: AC
L.C.D. 9/2/2003	Use: APRON	Rank: S	Length: 1,315.00 (Ft)	Width: 30.00 (Ft)	True Area: 39050 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
6/1/2012	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	Assumed date	
9/2/2003	NC-AC	New Construction - AC	0.00	2.50	<input checked="" type="checkbox"/>		
9/1/2003	BA-CR	Base Course - Crushed Rock	0.00	8.00	<input type="checkbox"/>		

Network: Lenhardt Airpark		Branch: AHANGLT		Hangar Apron Len		Section: 03	Surface: AC
L.C.D. 9/2/2007	Use: APRON	Rank: S	Length: 1,560.00 (Ft)	Width: 30.00 (Ft)	True Area: 46800 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
6/1/2012	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>	Assumed date	
9/2/2007	NC-AC	New Construction - AC	0.00	2.50	<input checked="" type="checkbox"/>		
9/1/2007	BA-CR	Base Course - Crushed Rock	0.00	8.00	<input type="checkbox"/>		

Network: Lenhardt Airpark		Branch: AHANGLT		Hangar Apron Len		Section: 04	Surface: AC
L.C.D. 9/1/2014	Use: APRON	Rank: S	Length: 45.00 (Ft)	Width: 30.00 (Ft)	True Area: 975 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
9/1/2014	NC-AC	New Construction - AC	0.00	0.00	<input checked="" type="checkbox"/>	Unknown LCD and thickness	

12/12/2023

Work History Report

Page 2 of 3

Pavement Database: ODA_2023Survey_MASTER DB-12-11-2023_4pm

Network: Lenhardt Airpark		Branch: R02LT		Runway 02/20 Len		Section: 01	Surface: AC
L.C.D. 8/2/1979	Use: RUNWAY	Rank: P	Length: 230.00 (Ft)	Width: 45.00 (Ft)	True Area: 12100 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
9/1/2012	ST-SC	Surface Treatment - Seal Coat	0.00	0.00	<input type="checkbox"/>		
6/1/2004	ST-SC	Surface Treatment - Seal Coat	0.00	0.10	<input type="checkbox"/>		
8/1/1997	ST-SC	Surface Treatment - Seal Coat (Global MR)	0.00	0.10	<input type="checkbox"/>		
8/2/1979	NC-AC	New Construction - AC	0.00	2.50	<input checked="" type="checkbox"/>		
8/1/1979	BA-AG	Base Course - Aggregate	0.00	6.00	<input type="checkbox"/>		

Network: Lenhardt Airpark		Branch: R02LT		Runway 02/20 Len		Section: 02	Surface: AC
L.C.D. 8/2/1979	Use: RUNWAY	Rank: P	Length: 3,200.00 (Ft)	Width: 45.00 (Ft)	True Area: 145505 (SqFt)		
Work Date	Work Code	Work Description	Cost	Thickness (in)	Major M&R	Comments	
6/1/2004	ST-SC	Surface Treatment - Seal Coat	0.00	0.10	<input type="checkbox"/>		
8/1/1997	ST-SC	Surface Treatment - Seal Coat (Global MR)	0.00	0.10	<input type="checkbox"/>		
8/2/1979	NC-AC	New Construction - AC	0.00	2.50	<input checked="" type="checkbox"/>		
8/1/1979	BA-AG	Base Course - Aggregate	0.00	6.00	<input type="checkbox"/>		

Summary:

Work Description	Section Count	Area Total (SqFt)	Thickness Avg (in)	Thickness STD (in)
Base Course - Aggregate	3	183,100.00	4.00	2.83
Base Course - Crushed Rock	3	93,500.00	8.00	0.00
New Construction - AC	6	252,080.00	2.08	0.93
Overlay - AC Thin	1	25,495.00	2.00	0.00
Surface Treatment - Seal Coat	5	131,095.00	0.00	0.00
Surface Course - BST	1	25,495.00	1.00	0.00
Surface Treatment - Seal Coat	2	157,605.00	0.10	0.00
Surface Treatment - Seal Coat (Global MR)	3	183,100.00	0.10	0.00