

Instructions: Prepare and submit the "Initial Report" on the first Wednesday after a well is spudded or workover operations are started. Daily work prior to spudding should be summarized on the form giving inclusive dates only.

 
District Western	County, parish or borough Columbia	State OR
Field Mist	Lease or Unit Columbia County	Well no. 21-35-65
Auth. or W.O. no. API #009-00230	Title Perforate & Return to Production	

Section 35, Township 6 North, Range 5 West (Property Code M830016CE)

Operator ARCO OIL AND GAS COMPANY	ARCO W.I. 100%	
Spudded or W.O. begun Workover	Date 10/25/90	hour Producer

Date and depth as of 8:00 a.m.	Complete record for each day reported
10/25/90 (1) TD: 2745'	5-1/2" @ 3037' SHUT DOWN F/NIGHT MIRU TAYLOR. TAKE ON LEASE WATER. ACCEPT RIG @ 1700 HRS. SITP 500 PSI. RU & PUMP 13 BBLs LEASE WATER CUSHION DN TBG. SI WELL. WILL PERF 10/26.
10/26/90 (2) TD: 1691'	5-1/2" @ 1691' WELL SHUT IN, TOPS RU ATLAS. RIH W/9' 1-11/16" STRIP GUN & CCL. TAG FLUID @ 816'. TAG BMT @ 1589'. PUT GUN ON DEPTH, PERF 1527-1536', 4 SPF. POOH, ALL SHOTS FIRED. RUN CHOKE/BLOWDOWN LINE. OPEN WELL, FLOWED GAS/WATER MIST, FTP 100 PSI 45 MIN. SI WELL. RR 1130.

The above is correct

Signature 	Date 1/17/91	Title District Drilling Engineer
--	------------------------	--

For form preparation and distribution, see Procedures Manual, Section 10, Drilling, Pages 86 and 87.

Number all daily well history forms consecutively as they are prepared for each well.	Page no. 1 of 1
---	---------------------------