

STATE OF OREGON

DEPARTMENT OF GEOLOGY AND MINERAL INDUSTRIES

800 NE Oregon St. #28

Portland, OR. 97232

HISTORY OF OIL OR GAS WELL

(In compliance with rules and regulations pursuant to ORS 520)

Enerfin Resources Northwest

P.O. Box 1358

Clatskanie, OR. 97016-3358

Phone (503) 755-2010

Fax (503) 755-2030

"C.C."

#44-21-65

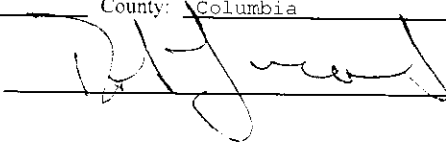
(Company or Operator)

(Lease)

(Well No.)

Sec. 21, T 6N, R 5W Surveyed Coordinates (if directional, BHL & SHL): 271.72' North and 472.19' West  
from the Southeast corner of Sec. 21

Wildcat: NA (or) Field Name: Mist Gas Field County: Columbia

Signature:  - Rob Lucas

Date: September 21, 1998 Position: Consultant

Date

- June 30, 1998      MIRU Taylor workover rig. Remove tree. Unseat packer. Install 7-1/16" 5M BOPE. Install working platform and rig up tongs. Secure rig and close well in for night (CWIFN).
- July 1, 1998      Open well. Function test BOPE (witnessed and approved by Dennis Olmstead-DOGAMI). Pull out of hole measuring tubing. Lay down packer, and make up 4-3/4" bit, 5-1/2" casing scraper, and test sub. Run in hole to 2,000' (fill). Wash out fill to 2,025'. Circulate clean. Drop test ball and pressure test tubing to 1000 PSI-OK. Reverse circulate out test ball. Pull out of hole. Lay down test sub, scraper, and bit, and make up exchange Baker model "A-3" Lockset packer with mule shoe on bottom. Run in hole with 54 joints of 2-3/8" 4.7# J-55 EUE tubing. Rig down floor and remove BOPE. Set packer at 1,712' (tail at 1,719') with 8K compression and land tubing on sliding hangar. Secure rig and CWIFN.
- July 2, 1998      Open well. Pressure test packer to 500 PSI-OK. Install tree. Re-pressure test packer to 500 PSI-OK (witnessed and approved by Dennis Olmstead-DOGAMI). Rig up Cogco Wireline Service (CWS) and run RA tracer survey for mechanical integrity test (witnessed and approved by Dennis Olmstead-DOGAMI/DEQ), rig down CWS. Rig down equipment and release rig at 4:00 PM.