

STATE OF OREGON

DEPARTMENT OF GEOLOGY AND MINERAL INDUSTRIES

800 NE Oregon St. #28

Portland, OR. 97232

HISTORY OF OIL OR GAS WELL

(In compliance with rules and regulations pursuant to ORS 520)

Enerfin Resources Northwest

P.O. Box 1358

Clatskanie, OR. 97016-3358

Phone (503) 755-2010

Fax (503) 755-2030

"L. F. "

#32-20-65 R-RD

(Company or Operator)

(Lease)

(Well No.)

Sec. 20 . T 6N , R 5W Surveyed Coordinates (if directional, BHL & SHL): 1,561' South and 1,334' West from the
Northeast corner of Sec. 20

Wildcat: NA (or) Field Name: Mist Gas Field County: Columbia

Signature:  - Rob Lucas

Date: September 21, 1998 Position: Consultant

Date

July 3, 1998 MIRU Taylor workover Rig #1. Nipple down tree flanges as needed for reconfiguration to 1.660" tubing. Secure rig and CWIFN.

July 7, 1998 Install 3-1/8" 3M X 3-1/8" 3M tubing hangar flange and 3-1/8" 3M X 4" MPT flange. Install 4" BOPE. Unload 87 joints of 1-1/4" tubing. Function test BOPE (witnessed and approved by Dennis Olmstead-DOGAMI). Measure, pick up and drift, and run in hole with 80 joints (2,581.58' including hangar) of 1.660" (1-1/4") 2.4# J-55 EUE 10 rnd tubing. Land tubing on hangar with tail at 2,588' KB. Secure rig and CWIFN.

July 8, 1998 Open well (70 SITP/470 SICP). Bleed pressure off well. Remove BOPE and 3-1/8" 3M X 4" MPT flange. Install 3-1/8" 3M X 2" FPT flange. configure valves, and reconnect well to separator. Open well and flow to tank to unload fluid. Shut well in (430 SITP/470 SICP). Pressure pipeline and start compressor. Return well to sales line at ~ 110 MCFD rate with 130 FTP/235 CP. Rig down equipment and move off location.