

Instructions: Prepare and submit the "Initial Report" on the first Wednesday after a well is spudded or workover operations are started. Daily work prior to spudding should be summarized on the form giving inclusive dates only.

District <b>Western</b>	County, parish or borough <b>Columbia</b>	State <b>OR</b>
Field <b>Mist</b>	Lease or Unit <b>Longview Fibre</b>	Well no. <b>23-36-65</b>
Auth. or W.O. no. <b>API #009-00132</b>	Title <b>Plug &amp; Abandon</b>	

 
**Section 36, Township 6 North, Range 5 West (Property Code M830016F3)**

Operator <b>ARCO OIL AND GAS COMPANY</b>	ARCO W.I. <b>100%</b>
Spudded or W.O. begun <b>Workover</b>	Prior status of a W.O. <b>Shut-In</b>
Date <b>11/3/90</b>	Hour

Date and depth as of 8:00 a.m. Complete record for each day reported

<p>11/03/90 ( 1 ) TD: 1879'</p>	<p>5-1/2" @ 1214' PREP T/P&amp;A, SNFN MIRU. <b>ACCEPT RIG 1230 HRS.</b> SITP/SICP 325 PSI. KILL WELL W/23 BBLs LEASE WATER. CIRC RTNS FOR 1/2 HR. WELL DEAD. SET BPSV, ND TREE, NU BOPE, PULL BPSV. RIH W/TBG, TOOK WT AFTER RUNNING IN 4 JTS, 2000LBS. CONT RIH. TBG STOPPED @1165'. PU &amp; LD 1 JT RU &amp; CBU. CIRC OUT CMT FROM PLUG REPORTED IN PROGNOSIS. CIRC CLEAN. RIH UP HALLIB PUMP 141 SX 'G'+3% CACL IN 2 STAGES FROM 1140'-SURF. CIP 1630 HRS. RD HALLIB, WASH OUT BOPE. CLOSE BLIND RAMS, SECURE WELL F/NIGHT. DAN WERMIEL W/DOGAMI WAIVED WITNESS OF P&amp;A. WELD PLATE ON STUB.</p>
<p>11/04/90 ( 2 ) TD: 1879'</p>	<p>5-1/2" @ 1214' <b>RELEASED RIG, P&amp;A FINISHED</b> ND BOPE CLEAN MUD PIT. RIG <b>RELEASED 0830 HRS.</b></p>

The above is correct

Signature 	Date <b>11/7/91</b>	Title <b>District Drilling Engineer</b>
--	------------------------	--

For form preparation and distribution, see Procedures Manual, Section 10, Drilling, Pages 56 and 57.