

Oregon

DEPARTMENT OF
AVIATION

Pavement
Evaluation/
Maintenance
Management Program
2012




Pavement
Consultants Inc.

McMinnville Municipal
Airport

Oregon Department of Aviation

**2012 Pavement Evaluation / Maintenance
Management Program**

**Final Report – Individual Airports
Functional Category 2, Central Climatic Zone**

Prepared for:

State of Oregon
Department of Aviation
3040 25th Street SE
Salem, Oregon 97303-1125

Prepared by:

Pavement Consultants Inc.
7530 Roosevelt Way N.E.
Seattle, Washington 98115-4221

October 2012

Table of Contents

Introduction	1
Pavement Inventory.....	3
Records Review.....	3
Network Definition	3
Branch and Section Names	4
Network Identifiers.....	5
Network Identification.....	5
Zone	5
Functional Category.....	5
Funding Group	5
Ownership.....	5
Climatic Region	6
Branch or Section Identifiers	6
Branch Use	6
Pavement Rank.....	6
Surface Type.....	6
Structural and Construction History Data.....	6
Field Verification	7
Inspection Schedule	8
Detailed Inspection	8
Methodology.....	8
Pavement Condition Index Calculation.....	10
Monthly Drive-By Inspection	10
Record Keeping and Data Retrieval	12
Pavement Condition Prediction.....	13
Typical Maintenance Requirements.....	18
Appendix: Your Airport Report	

Table of Contents (continued)

List of Figures

1.	Monthly Drive-By Inspection Form.....	11
2.	Performance Curve for Category 2 AC Runways – Central Oregon.....	13
3.	Performance Curve for Category 2 AAC Runways – Central Oregon	14
4.	Performance Curve for Category 2 AC Taxiways – Central Oregon	14
5.	Performance Curve for Category 2 AAC Taxiways – Central Oregon	15
6.	Performance Curve for Category 2 PCC Taxiways – Central Oregon.....	15
7.	Performance Curve for Category 2 AC Aprons – Central Oregon.....	16
8.	Performance Curve for Category 2 AAC Aprons – Central Oregon	16
9.	Performance Curve for Category 2 PCC Aprons – Central Oregon.....	17
10.	Performance Curve for Category 2 ST Aprons – Central Oregon	17

List of Tables

1.	Pavement Condition Index Distress Types and Related Causes	9
2.	Selection of Number of Sample Units to Inspect.....	10
3.	Micro PAVER Reports.....	12
4.	Unit Costs for the Various Work Plan Activities	18

Introduction

The Oregon Department of Aviation has been collecting pavement condition information at eligible airports since the mid 1980s. In January 1995 the Federal Aviation Administration (FAA) mandated that any airport sponsor receiving and/or requesting federal funds for pavement improvement projects must have implemented a pavement maintenance management program. Through the Department's system planning efforts, the airports included in the Department's Pavement Evaluation / Maintenance Management Program have been complying with the intent of the law since the mid 1980s, well ahead of the FAA mandate. The information collected during this study ensures that your airport continues to comply with the Federal mandate. The developed pavement maintenance management program, as it relates to an individual airport, is described in this report.

The Oregon Department of Aviation routinely provides information to airport owners and operators throughout the State that assists them in maintaining and operating their airports. The State addresses many issues as part of their planning process, one of which is to provide to each individual airport, on a three-year cycle, a report on pavement condition. Through the statewide study, pavement maintenance management programs for all eligible airports in the state are efficiently and economically completed through the Department of Aviation's Pavement Evaluation / Maintenance Management Program.

Each airport owner or operator makes frequent decisions about the timing and type of maintenance and repair activities that should be completed on their pavements to maintain acceptable surface condition and adequate load-carrying capacity. The pavement maintenance management program described in this document, and supplemented by the information contained in the attached report prepared specifically for your airport, will assist you in making necessary decisions about pavement maintenance and rehabilitation projects at your airport, and will ensure compliance with the Federal mandate.

To develop a pavement maintenance management program for each eligible airport, the Department of Aviation elected to conduct pavement evaluations (visual inspections), and to implement the Micro PAVER pavement maintenance management software. These activities were completed as part of the Department's Continuous Aviation System Plan efforts. Micro PAVER uses the evaluation results to efficiently identify pavements requiring maintenance and rehabilitation, and to establish project priorities. The software can also be used to assess overall pavement network condition, prepare and forecast the budgets required to maintain the network at an acceptable condition level, and identify required maintenance and rehabilitation activities.

The federally mandated pavement maintenance management program identifies five major requirements:

- **Pavement inventory**
- **Inspection schedule (detailed and monthly)**
- **Record keeping**
- **Information retrieval**
- **Program funding**

The approach taken to meet these program requirements for your airport is described in this report.

Pavement Inventory

The FAA-mandated Pavement Inventory requirement specifies that information about each piece of pavement at an airport be compiled. This information is to include, at a minimum: pavement location, pavement dimensions, pavement surface type, and last construction date. The process used to develop this information is discussed under “Records Review”.

Additionally, information is collected about the pavements at an airport so its pavement network can be defined. After the pavement network is defined, pavement inspections can be completed and a pavement maintenance management program can be developed. The methodology for defining the pavement network follows the Records Review discussion.

Records Review

The first step in meeting FAA’s pavement maintenance management program requirement is to develop a maintenance and construction history for all pavements at an airport. For the past 27 years the Oregon Department of Aviation has, for its eligible airports, been conducting pavement evaluations to determine existing condition. In 1991 Pavement Consultants Inc. began assisting the Department in their efforts to compile and update that information. The information collected was used to develop a pavement maintenance management program for each eligible airport as described in this report, and your attached individual airport report.

Previous State-sponsored projects identified pavement layout, pavement construction history and pavement condition at each eligible airport. During this inspection cycle these documents were reviewed, and follow-up inquiries on pavement construction history were directed to the Oregon Department of Aviation, the FAA, consultants and airport sponsors. Based on this review, pavement boundaries were identified at your airport and were placed on an AutoCAD-generated base map (see Figure 1 in your attached airport report). ***The established base map fulfills the FAA "Pavement Inventory" requirement for locating pavements, identifying their dimensions, and identifying pavement type and age.***

Network Definition

Once the pavement history at an airport has been compiled, individual pavement features can be identified, a process called network definition. These pavement features are defined on the basis of: primary use, construction history, and traffic pattern. Each airport is divided into features according to the guidelines contained in the current edition of ASTM International-Standard D5340, *Standard Test Method for Airport Condition Index Surveys*. The pavement features used in this project are defined as follows.

Network: Each eligible airport constitutes a separate pavement network.

Branch: A branch is any identifiable part of a pavement network that has a distinct function. Airfield pavements such as individual runways, taxiways and aprons are each considered to be a separate branch.

Section: A section is a subdivision of a branch and has consistent characteristics throughout its length or area. These characteristics include: pavement layer material type and thickness, construction history, traffic, and pavement condition. A section is the basic management unit of a pavement network, and is that portion of a branch over which a maintenance and rehabilitation project is likely to be completed.

Sample Unit: A sample unit is an arbitrarily defined portion of a pavement section that is used when performing detailed pavement inspections. It is the smallest subdivision in a pavement network. For flexible airport pavements such as asphalt concrete or surface treatment, sample units are about 5,000 square feet in area. For rigid (portland cement concrete) airport pavements, sample units typically include approximately 20 contiguous pavement slabs.

Beginning 27 years ago, branches, sections and sample units were established for each eligible airport in the Oregon system. During this project, these divisions were reviewed and modified as required, based on changed conditions (new pavements, demolished pavements), or completion of any pavement-related maintenance and rehabilitation projects.

Branch and Section Names

Each pavement feature is assigned a name that allows it to be uniquely identified in the statewide airport system. Each branch name consists of a series of characters. The first character indicates the branch type: "R" for Runway, "T" for Taxiway, "A" for Apron and "H" for Helipad. The last two characters in the branch name identify the airport to which the branch belongs and were taken from the airport name. All branches for your airport carry this airport-specific two-letter identifier. The individual runway, taxiway or apron referenced is identified by characters located between the branch type ("R", "T", "A" or "H") and your two-letter airport identifier. To the extent possible, these identifying characters were chosen to reflect the facility names you use. If the facility does not have a name it was assigned a number. In the case of runways, numbers are used that are the lower of the two runway numbers corresponding to compass bearing.

Located after a hyphen following the branch name are two- or three alpha-numeric characters. These characters identify the section within the branch. An example illustrating the naming convention is:

R16AB-01

which is the name for Runway 16/34, Albany Municipal Airport, Section 01.

The branches, sections and sample units identified for your airport are shown on Figure 2 in your attached individual airport report.

Network Identifiers

Several designators are used to describe information about a particular airport included in the State System Plan. These designators include: network identification, zone, functional category, funding group, ownership and climatic region.

Network Identification

Each airport in the statewide system is assigned a unique network identifier (name). This name is typically the name of the city in which the airport is located. The network identification name for your airport can be found in the appendices attached to your airport report. This network identification name is assigned so that an individual airport or a group of airports contained in the statewide database can be selected for evaluation. The statewide database contains information for all eligible airports in the State.

Zone

Zones are used to allow individual airports within the statewide database to be separately selected for analysis. The FAA airport designator is used as the zone designator.

Functional Category

Each airport is assigned a functional category based on its classification within the State System Plan. Each airport is assigned a functional category of either 1, 2, 3, 4 or 5 in accordance with the criteria set forth in the System Plan. These categories correspond to the following airport types: commercial service, business or high activity general aviation, regional general aviation, community general aviation, and low activity general aviation, respectively. The category assigned to your airport is listed in the appendices attached to your airport report. This category assignment allows groups of airports in different functional categories to be separately evaluated.

Funding Group

Airports in the State are categorized as either NPIAS or non-NPIAS. NPIAS designated airports are eligible for project funding under the FAA's Airport Improvement Program (AIP). Being designated as NPIAS or non-NPIAS in the database allows the Department to evaluate funding alternatives for the State airport system.

Ownership

Airport ownership is designated as Public, State or Private. This designation allows the Department to evaluate funding allocations based on eligibility for State and/or Federal funding.

Climatic Region

Each airport in the statewide system is assigned to one of three climatic regions - eastern, central or coastal. Because climatic conditions can impact pavement performances, assigning airports to a climatic region allows pavement performance to be more accurately modeled resulting in more accurate pavement condition forecasts.

Branch or Section Identifiers

Several designators are used to describe a branch or section's function, importance or construction. These characteristics are: branch use, pavement rank, and surface type.

Branch Use

Branch use identifies the primary use of each distinct pavement area. For each airport pavement included in this study, a branch use of "Runway", "Taxiway", "Apron" or "Helipad" is assigned, as appropriate.

Pavement Rank

Pavement rank refers to the relative importance assigned to multiple facilities having the same branch use. Each pavement section is assigned a rank of primary ("P"), secondary ("S") or tertiary ("T") as appropriate. As an example, an airport with two runways might rank the more heavily used runway as primary and the lesser-used runway as secondary. The pavement rank assigned to each pavement section at your airport can be found in the appendices attached to your individual airport report.

Surface Type

Each pavement section is assigned a surface type designator based on the type of surface material present. Throughout the State seven (7) surface types were encountered: asphalt overlay over asphalt concrete (AAC), asphalt concrete (AC), asphalt concrete over cement treated base (ACT), asphalt overlay over portland cement concrete (APC), asphalt concrete over pozzolanic base (APZ), portland cement concrete (PCC), and surface treatment (ST). The surface type assigned to each pavement section at your airport is provided in the report appended to this document. ***Surface type identification fulfills one of FAA's "Pavement Inventory" requirements.***

Structural and Construction History Data

Available construction records for each airport were obtained from the Oregon Department of Aviation, Federal Aviation Administration, or consultants. These records were reviewed to establish a last construction date for each pavement section. Additional information was requested from individual airport sponsors to update or clarify this information, as necessary. The last construction date and known construction history for each pavement section can be found on Figure 1 in your individual airport report. The last construction date is also identified in the reports found in the attached appendixes. For those pavement sections where information was

not available, a last construction date was assigned based on pavement condition. ***Last construction date identification fulfills the final FAA "Pavement Inventory" requirement.***

Field Verification

Information obtained through the records review and discussions with airport sponsors, Department of Aviation staff, FAA personnel and consultant staff was field-verified to ensure that each facility is accurately mapped and properly subdivided into branches and sections. Modifications to the maps, and/or branch and section divisions, were made as necessary wherever discrepancies in airport geometry, paving materials, or construction history were found during the visual inspections.

Inspection Schedule

The FAA's Pavement Maintenance Management Program guidelines require all airports seeking or receiving federal funds for pavement-related projects to complete both detailed and drive-by inspections. The guidelines require that detailed inspections be performed yearly, unless the inspections are conducted in accordance with the Pavement Condition Index methodology set forth in ASTM D5340, at which point detailed inspections are required once every three years. ***The Pavement Condition Index methodology is used to inspect Oregon's airports. Each airport is inspected on a three-year cycle thus complying with the FAA detailed inspection requirement.***

The drive-by inspections required by the FAA are to be completed monthly. These inspections are cursory inspections that are performed to detect any unexpected changes in pavement condition.

A description of the detailed inspection methodology, as well as an approach to completing the monthly drive-by inspections, is provided below.

Detailed Inspection

Methodology

Pavement Condition Index (PCI) surveys were performed in late summer / early fall 2012 for all airports included in this year's project. The surveys were performed using the Pavement Condition Index (PCI) methodology developed by the U.S. Army Corps of Engineers, and outlined in the current edition of ASTM D-5340, *Standard Test Method for Airport Condition Index Surveys*. This document defines distress types, severity levels, and methods for measuring and recording distresses.

The PCI procedure was developed to collect data that would provide engineers and managers with a numerical value indicating overall pavement condition, and that would reflect both pavement structural integrity and surface operational condition. The procedure was designed to be highly repeatable and was found to be well-correlated with the judgment of experienced pavement engineers.

A PCI survey is performed by measuring the amount and severity of certain defined distresses (defects) observed in a sample unit. Table 1 lists both the asphalt concrete and portland cement concrete pavement distress types considered in the PCI method, and also identifies their most common cause (load, climate/durability, other) as assigned by the Micro PAVER software. Load-related distresses are apparent where the pavement has been over-stressed by traffic loads applied to its surface. Climate/durability-related distresses arise due to exposure to the environment. Other-related distresses are caused by actions not related to load or climate such as fuel spills or construction deficiencies.

Table 1. Pavement Condition Index Distress Types and Related Causes.

Asphalt Concrete		Portland Cement Concrete	
Pavement Distress	Related Cause	Pavement Distress	Related Cause
Alligator Cracking	Load	Blow-Up	Climate/Durability
Bleeding	Other	Corner Break	Load
Block Cracking	Climate/Durability	Cracks: Longitudinal, Transverse, and Diagonal	Load
Corrugation	Other	Durability ("D") Crack	Climate/Durability
Depression	Other	Joint Seal Damage	Climate/Durability
Jet Blast Erosion	Other	Patching, Small	Other
Joint Reflection Cracking	Climate/Durability	Patching, Large and Utility Cuts	Other
Longitudinal and Transverse Cracking	Climate/Durability	Popouts	Other
Oil Spillage	Other	Pumping	Other
Patching and Utility Cut Patching	Climate/Durability	Scaling, Map Cracking, Crazeing	Other
Polished Aggregate	Other	Settlement or Faulting	Other
Raveling	Climate/Durability	Shattered Slab / Intersecting Cracks	Load
Rutting	Load	Shrinkage Cracks	Other
Shoving	Other	Spalling (Longitudinal and Transverse Joint)	Other
Slippage Cracking	Other	Spalling (Corner)	Other
Swell	Other	Alkali Silica Reaction (ASR)	Other
Weathering	Climate/Durability		

To obtain a statistically reliable PCI for a given pavement section it is not necessary to inspect all sample units in that section. A pre-determined number of randomly chosen sample units are selected for inspection based on the total number of sample units in the section. The sampling rates used during this study are shown in Table 2. The sampling rates contained in Table 2 result in data that are reliable at a 92 percent confidence level.

Table 2. Selection of Number of Sample Units to Inspect.

Flexible Pavement		Rigid Pavement	
N	n	N	n
1	1	1	1
2 - 3	2	2	2
4 - 6	3	3 - 4	3
7 - 13	4	5 - 6	4
14 - 38	5	7 - 8	5
39 +	6	9 - 11	6
		12 - 14	7
		15 - 19	8
		20 - 27	9
		28 - 38	10
		39 - 58	11
		59 - 104	12
		105 - 313	13
		314 +	14

Where: N = Total number of sample units in a pavement section
n = Number of sample units to be surveyed

Pavement Condition Index Calculation

To calculate a PCI for a given sample unit, each distress type observed is assigned a deduct value based on its density (frequency of occurrence) in that sample area, and its severity. All deducts are summed and subsequently adjusted (corrected) for the number of different distresses found. This corrected deduct value is subtracted from 100, the PCI for a "perfect" pavement, to arrive at a PCI for that particular sample unit. The PCI for a pavement section is the area-weighted average PCI value of all sample units evaluated in that section. Pavement Condition Ratings (PCRs) are associated with ranges of PCI values.

The color-coded Figure 3 in your attached individual airport report shows the PCRs and their associated PCI ranges, as well as the pavement condition at your airport in summer/fall 2012.

Monthly Drive-By Inspection

As part of the FAA-mandated pavement maintenance management program, a monthly drive-by inspection is required. This inspection is intended to identify abrupt changes in condition occurring since the last monthly inspection, and to record any maintenance activities completed during the previous month. This inspection can easily be accomplished by driving your airport and noting any changes or maintenance performed on the form provided in Figure 1. Each drive-by inspection must note the date the inspection was completed, and record any maintenance performed since the last inspection. These records must be kept on-file for five years.

Record Keeping and Data Retrieval

The FAA pavement maintenance management program requires that compiled records be kept for five years. To facilitate record keeping and data retrieval at the State level, the Micro PAVER pavement maintenance management software was implemented. Micro PAVER provides the Oregon Department of Aviation with a method for storing data and generating reports.

Micro PAVER was developed by the U.S. Army Construction Engineering Research Laboratory (USA-CERL). The program uses the guidelines contained in the current edition of ASTM D5340 as its basis. The current version, Version 6.5.2, is a Windows-based program that can store pavement condition information, as well as construction and maintenance history information. Using the data stored in the Micro PAVER database the user has many capabilities, including: evaluating current condition, predicting future condition, determining maintenance and rehabilitation needs, scheduling future inspections, and preparing budget estimates.

The statewide database containing the information for all evaluated airports was updated during this project. Information for each individual airport can easily be extracted from the statewide database. The database allows required records to be stored indefinitely, thus meeting the FAA requirement that records be maintained for a five-year period. Additionally, the software allows data to be retrieved quickly and efficiently.

After data were entered into the State's Micro PAVER database for each inspected airport, the software was used to analyze the stored data and to generate useful reports. The reports described in Table 3 were generated for your airport and are provided as appendices to your individual airport report.

Table 3. Micro PAVER Reports.

Report Name	Report Description
Branch Condition	Lists information about each branch, including: network identification, branch identification, name, use, number of sections, total branch area and the average and area-weighted average PCI for the entire branch.
Section Condition	Provides information about each section, including: branch identification and section number, last construction date, surface type, use, rank, section area, last inspection date, age of pavement at last inspection and the PCI at the last inspection.
Network Maintenance	Applies the stored distress maintenance policy to the pavement network and identifies the type and cost of routine maintenance required across the entire network. Information in this report is listed by section.
Re-Inspection	Summarizes the distress data collected during the most recent inspection and provides the PCI for each sample unit inspected, as well as summary information about the section.

Pavement Condition Prediction

To allow future pavement condition to be predicted, data collected throughout the State were used to generate "performance curves". The curves were developed based on surface type, use, airport functional category and climatic region. These curves (models) are used to predict future pavement condition by assuming the behavior of an individual pavement section is similar to the behavior of the pavement sections used to generate the "performance curve". Figures 2 through 10 show the "performance curves" used to model pavements in your airport's functional category and climatic region.

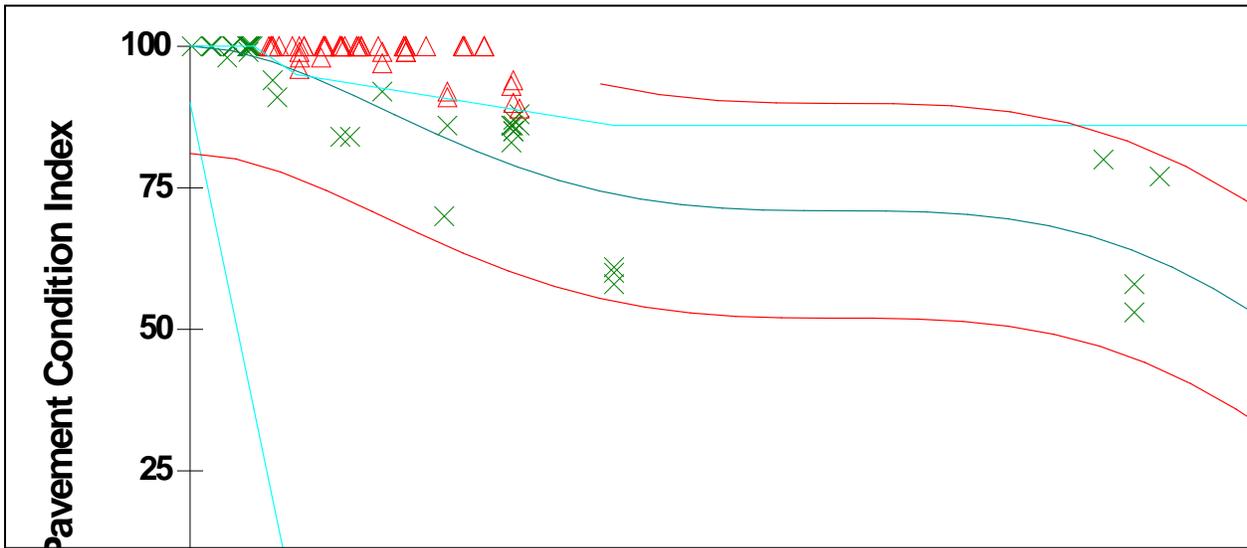


Figure 2. Performance Curve for Category 2 AC Runways – Central Oregon.

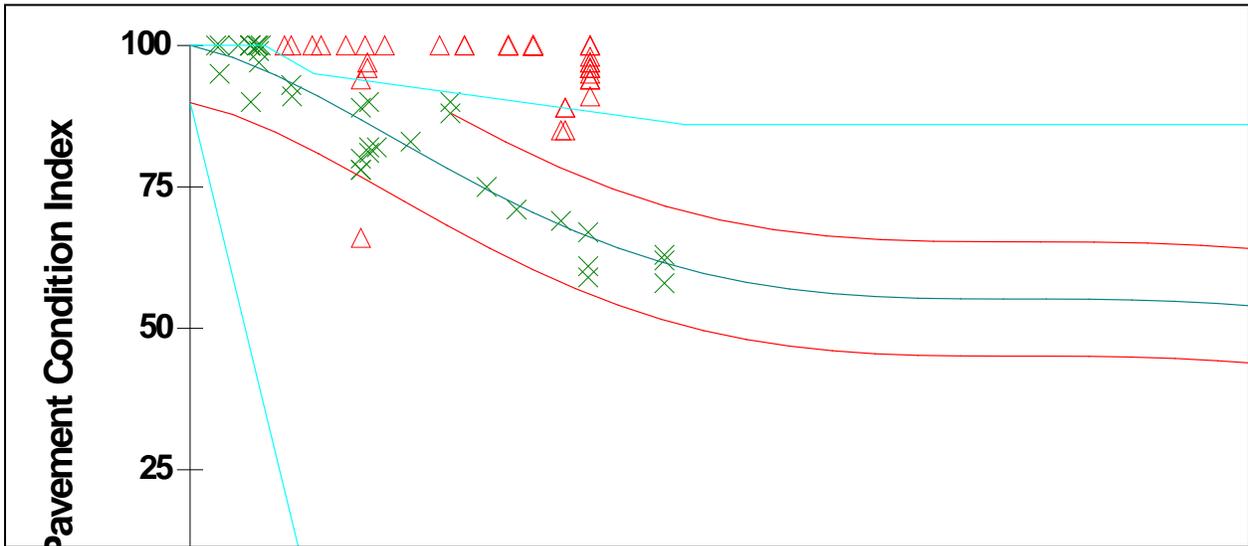


Figure 3. Performance Curve for Category 2 AAC Runways – Central Oregon.

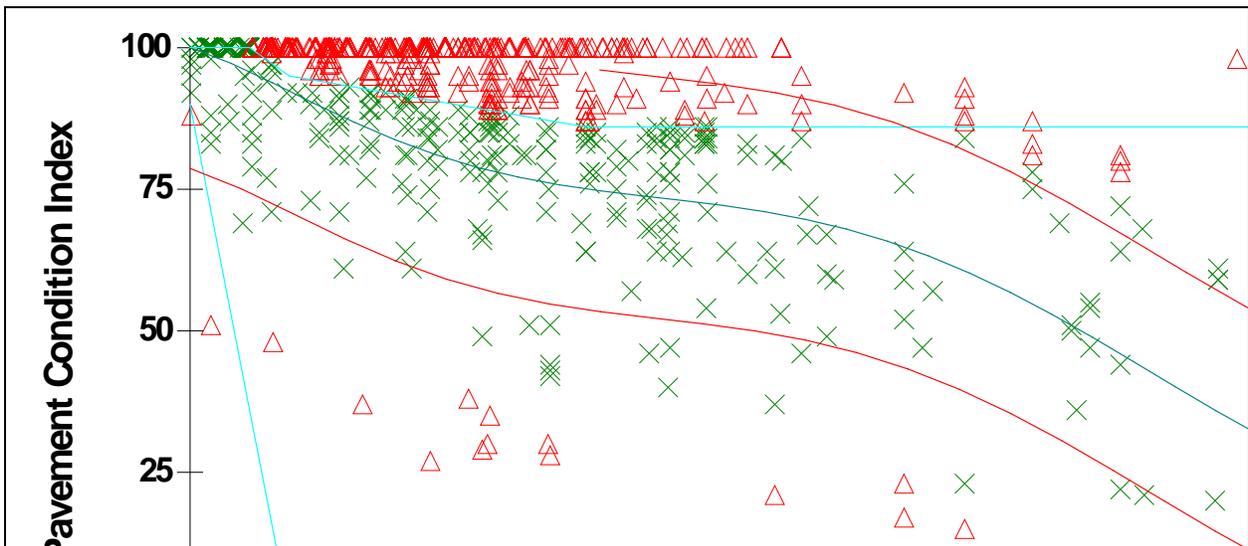


Figure 4. Performance Curve for Category 2 AC Taxiways – Central Oregon.

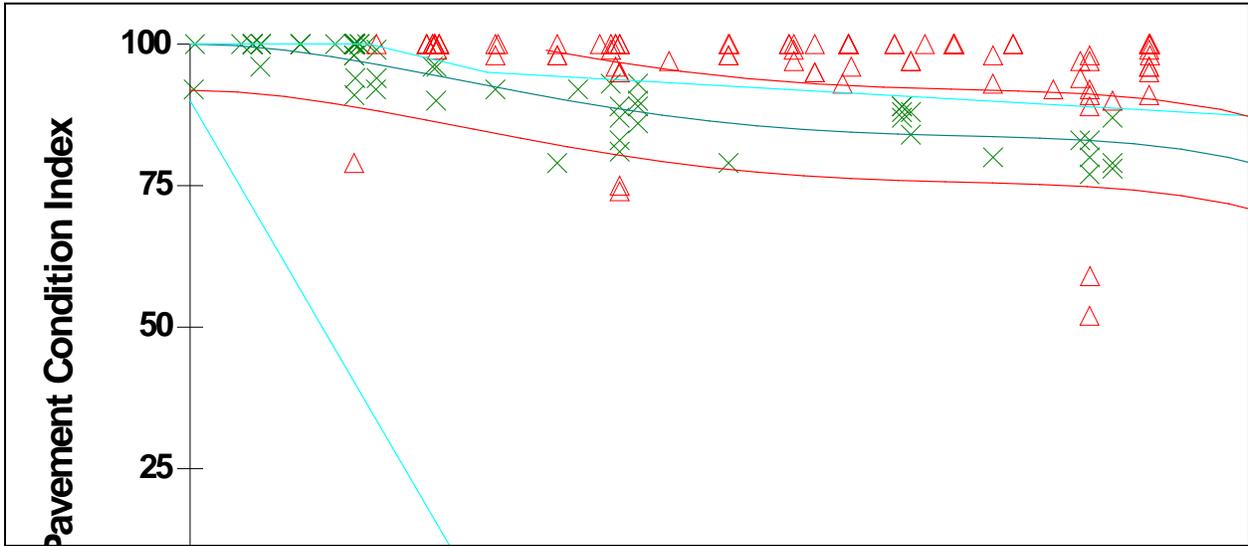


Figure 5. Performance Curve for Category 2 AAC Taxiways – Central Oregon.

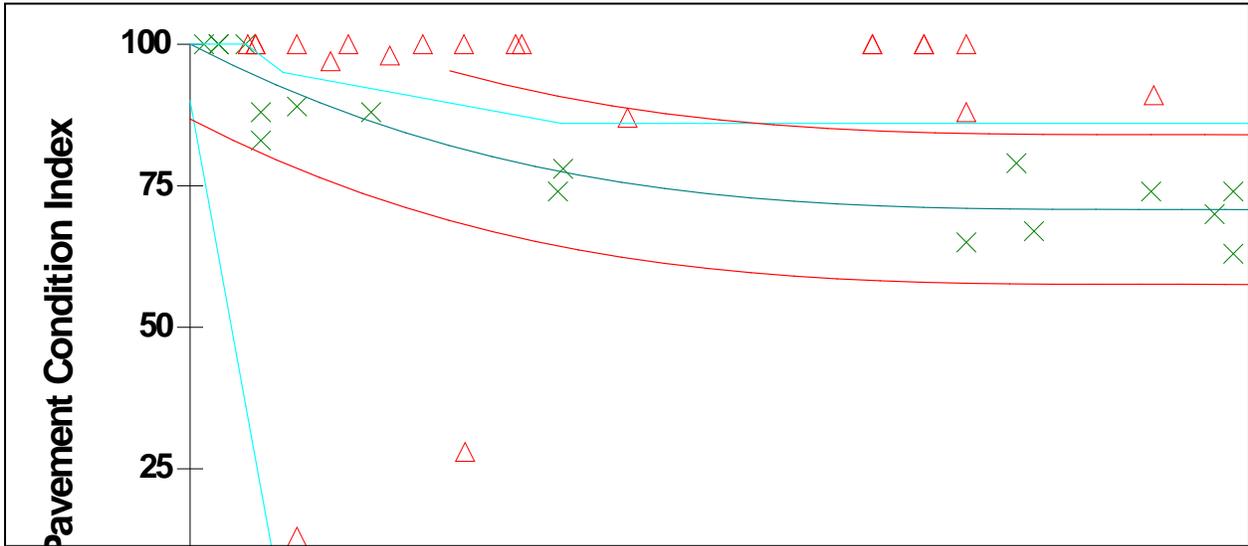


Figure 6. Performance Curve for Category 2 PCC Taxiways – Central Oregon.

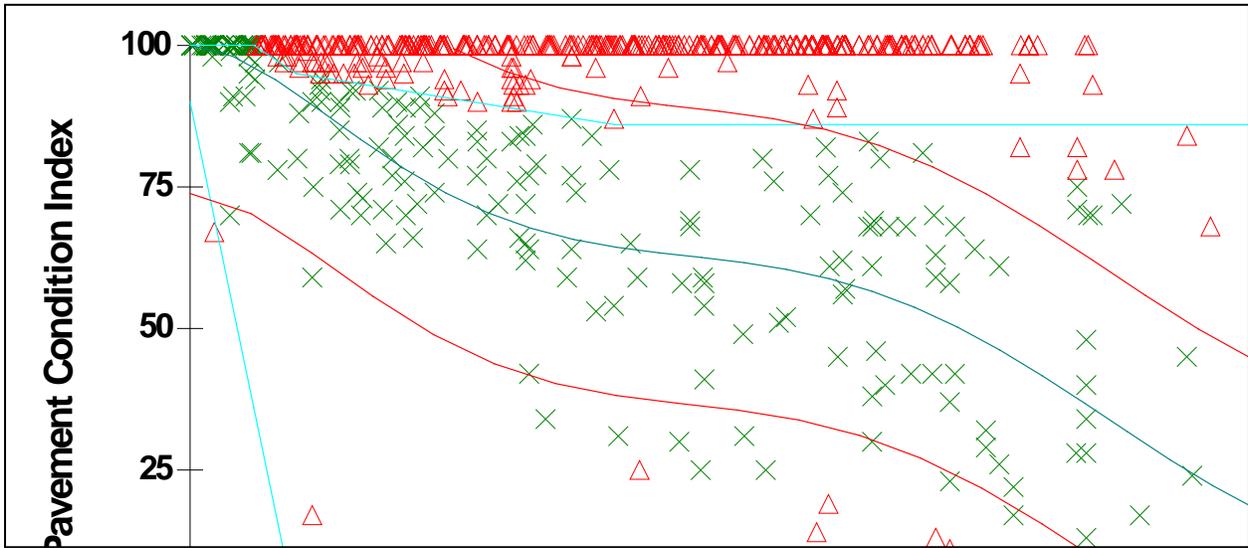


Figure 7. Performance Curve for Category 2 AC Aprons – Central Oregon.

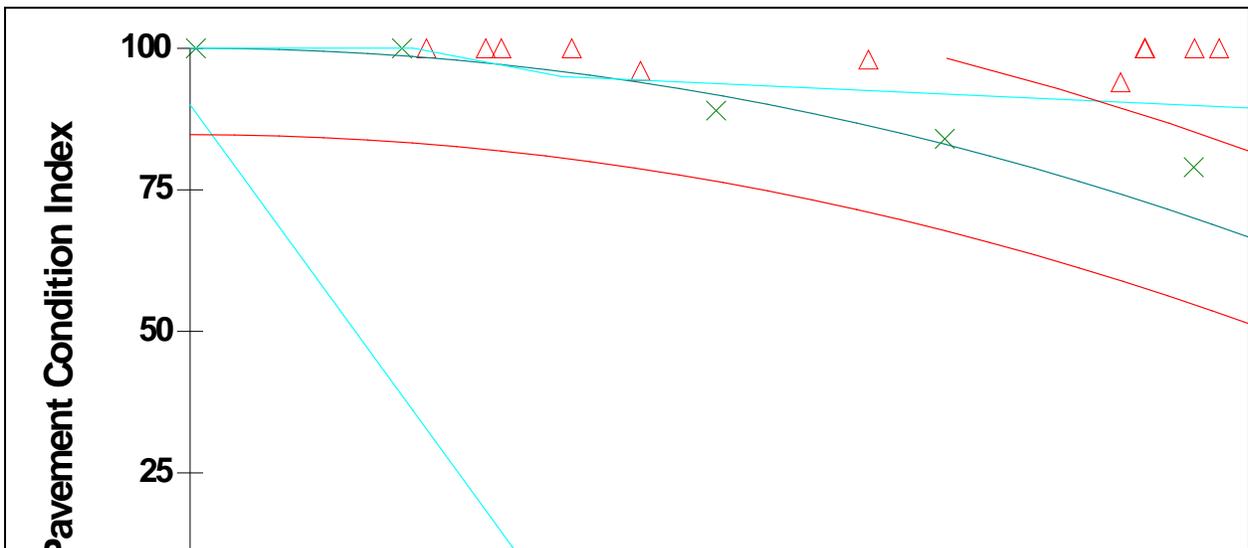


Figure 8. Performance Curve for Category 2 AAC Aprons – Central Oregon.

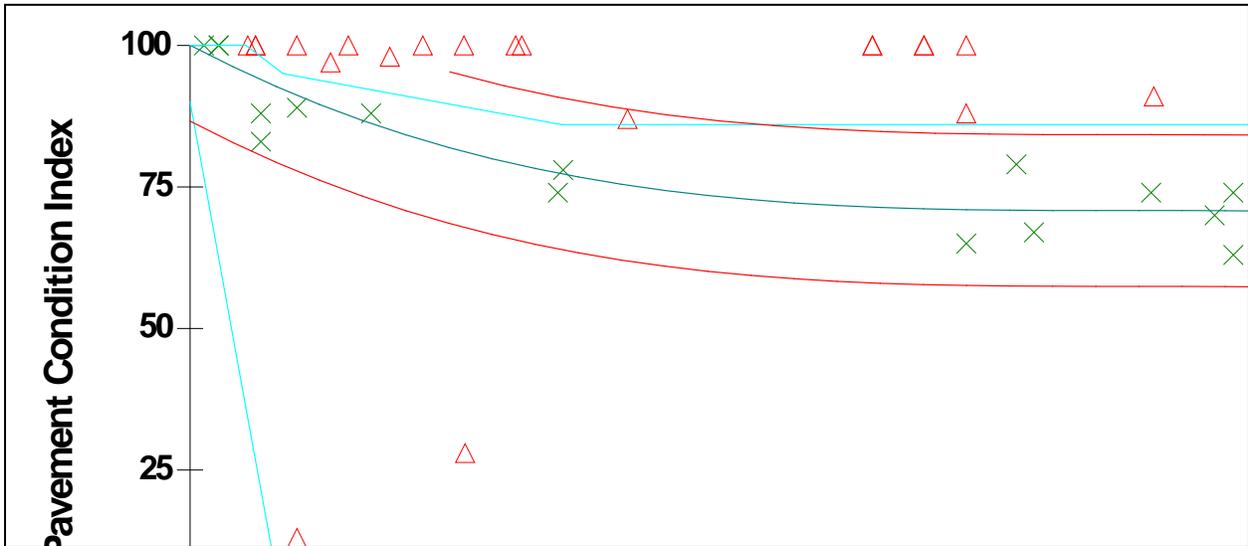


Figure 9. Performance Curve for Category 2 PCC Aprons – Central Oregon.

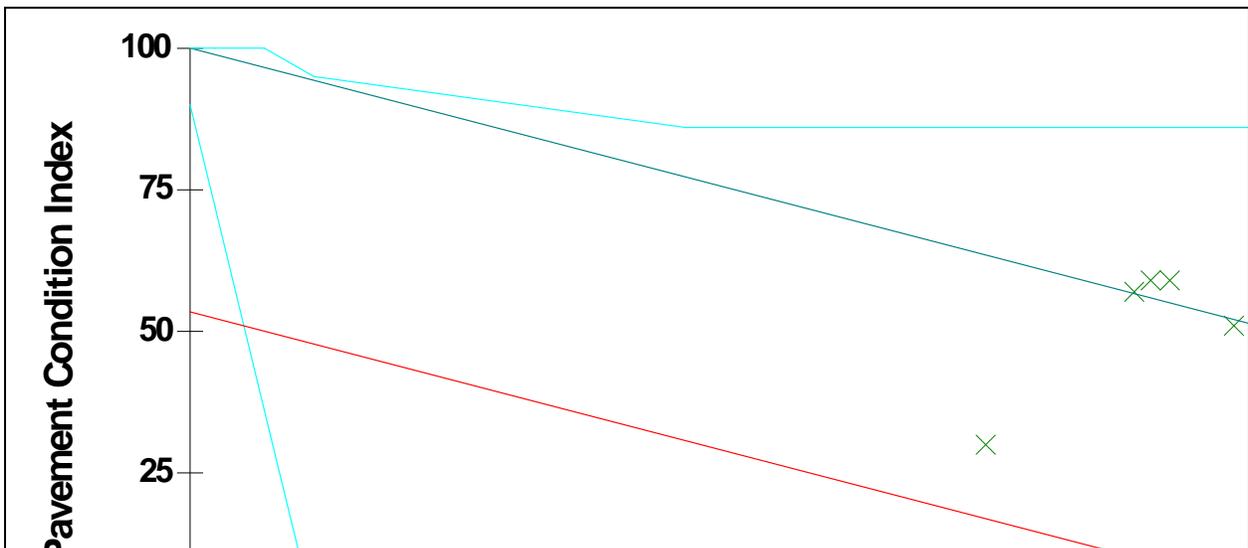


Figure 10. Performance Curve for Category 2 ST Aprons – Central Oregon.

Typical Maintenance Requirements

The Micro PAVER-generated M&R Plan Report was used to identify when pavement maintenance and rehabilitation projects are required for a given pavement section, and what repair type is most appropriate. The repair strategies evaluated were:

- Reconstruction (pavements with Pavement Condition Indices less than 40).
- Overlay flexible pavements (runways with Pavement Condition Indices between 40 and 65, taxiways between 40 and 60, aprons between 40 and 55, and pavements exhibiting significant load-related distress with PCIs above the critical PCI).
- Global maintenance (fog seal, slurry seal or thin (2 inch) overlay) applied on a user-specified interval (6 years for a fog seal, 6 years for a slurry seal, and 10 years for an overlay). The global maintenance type recommended is based on the distress types observed in the section during the visual inspections.
- Routine maintenance, such as crack sealing and patching.

The M&R Plan Report was generated for a 5-year period beginning in June 2013. Included in the work plan are estimated costs for each recommended project. The costs are estimated by applying a unit cost for the recommended activity to the square foot area of the pavement section. The unit costs include adjustments for engineering and administration, mobilization, restriping and contingency. The unit costs used to develop the work plan activity cost are shown in Table 4. The recommended work plan for your airport is provided in your attached individual airport report.

Table 4. Unit Costs for the Various Work Plan Activities.

Activity	Unit	Unit Cost
Fog Seal	SF	\$0.12
Slurry Seal	SF	\$0.23
2" Asphalt Concrete Overlay	SF	\$2.50
Reconstruction	SF	\$7.12 - \$10.36
Reseal PCC Joints w/ Hot Pour Sealant	LF	\$2.00

Your Airport Report

McMINNVILLE MUNICIPAL AIRPORT

This report describes how your Pavement Maintenance Management Program (PMMP) was developed. Your Program was developed as part of the Oregon Continuous Aviation System Plan sponsored in part by the Oregon Department of Aviation and the Federal Aviation Administration (FAA). The information and data contained in this report ensures you are in compliance with the requirements of FAA Grant Assurance Number 11 which states that any airport requesting federal funds for pavement improvement projects must have implemented a pavement maintenance management program.

DATA COLLECTION


To determine how your pavements were constructed and their age, a records review was conducted. Figure MM-1 shows the records review results. This figure identifies pavement boundaries, dimensions, pavement layer types, thicknesses and dates of construction. The most recent construction date for each pavement can also be found in the Section Condition Report in Appendix 2. Figure MM-1 and the information contained in Appendices 1, 2 and 4 ensure that your airport complies with the “pavement inventory” requirement of FAA’s PMMP guidelines.

The pavements at your airport were divided into branches, sections and sample units in accordance with the methodology outlined in the current edition of ASTM D5430, *Standard Test Method for Airport Condition Index Surveys*. The branches, sections and sample units established at your airport are shown in Figure MM-2. A Branch Condition Report showing all branches, their associated areas, and their area-weighted average condition is provided in Appendix 1. Additionally, the Appendix 2 Section Condition Report provides information used to define each branch and section in the Micro PAVER database.

Using the branch, section and sample unit divisions established, a visual condition survey was conducted at McMinnville Municipal Airport in July 2012. During the inspection, pavement defects were identified and measured in accordance with the methodology outlined in ASTM D5430. This inspection ensures your airport complies with the “detailed inspection” requirement of FAA’s PMMP guidelines. After collection, the data were entered into the Micro PAVER software for analysis. These data are reproduced in the Re-Inspection Report attached as Appendix 4.


The Micro PAVER database updated during this project ensures your airport complies with the “record keeping and information retrieval” requirements of FAA’s PMMP guidelines.

Figure MM-1A. Airport Layout, Dimensions and Pavement Cross-Sections – Runways and Taxiways.
McMinnville Municipal Airport

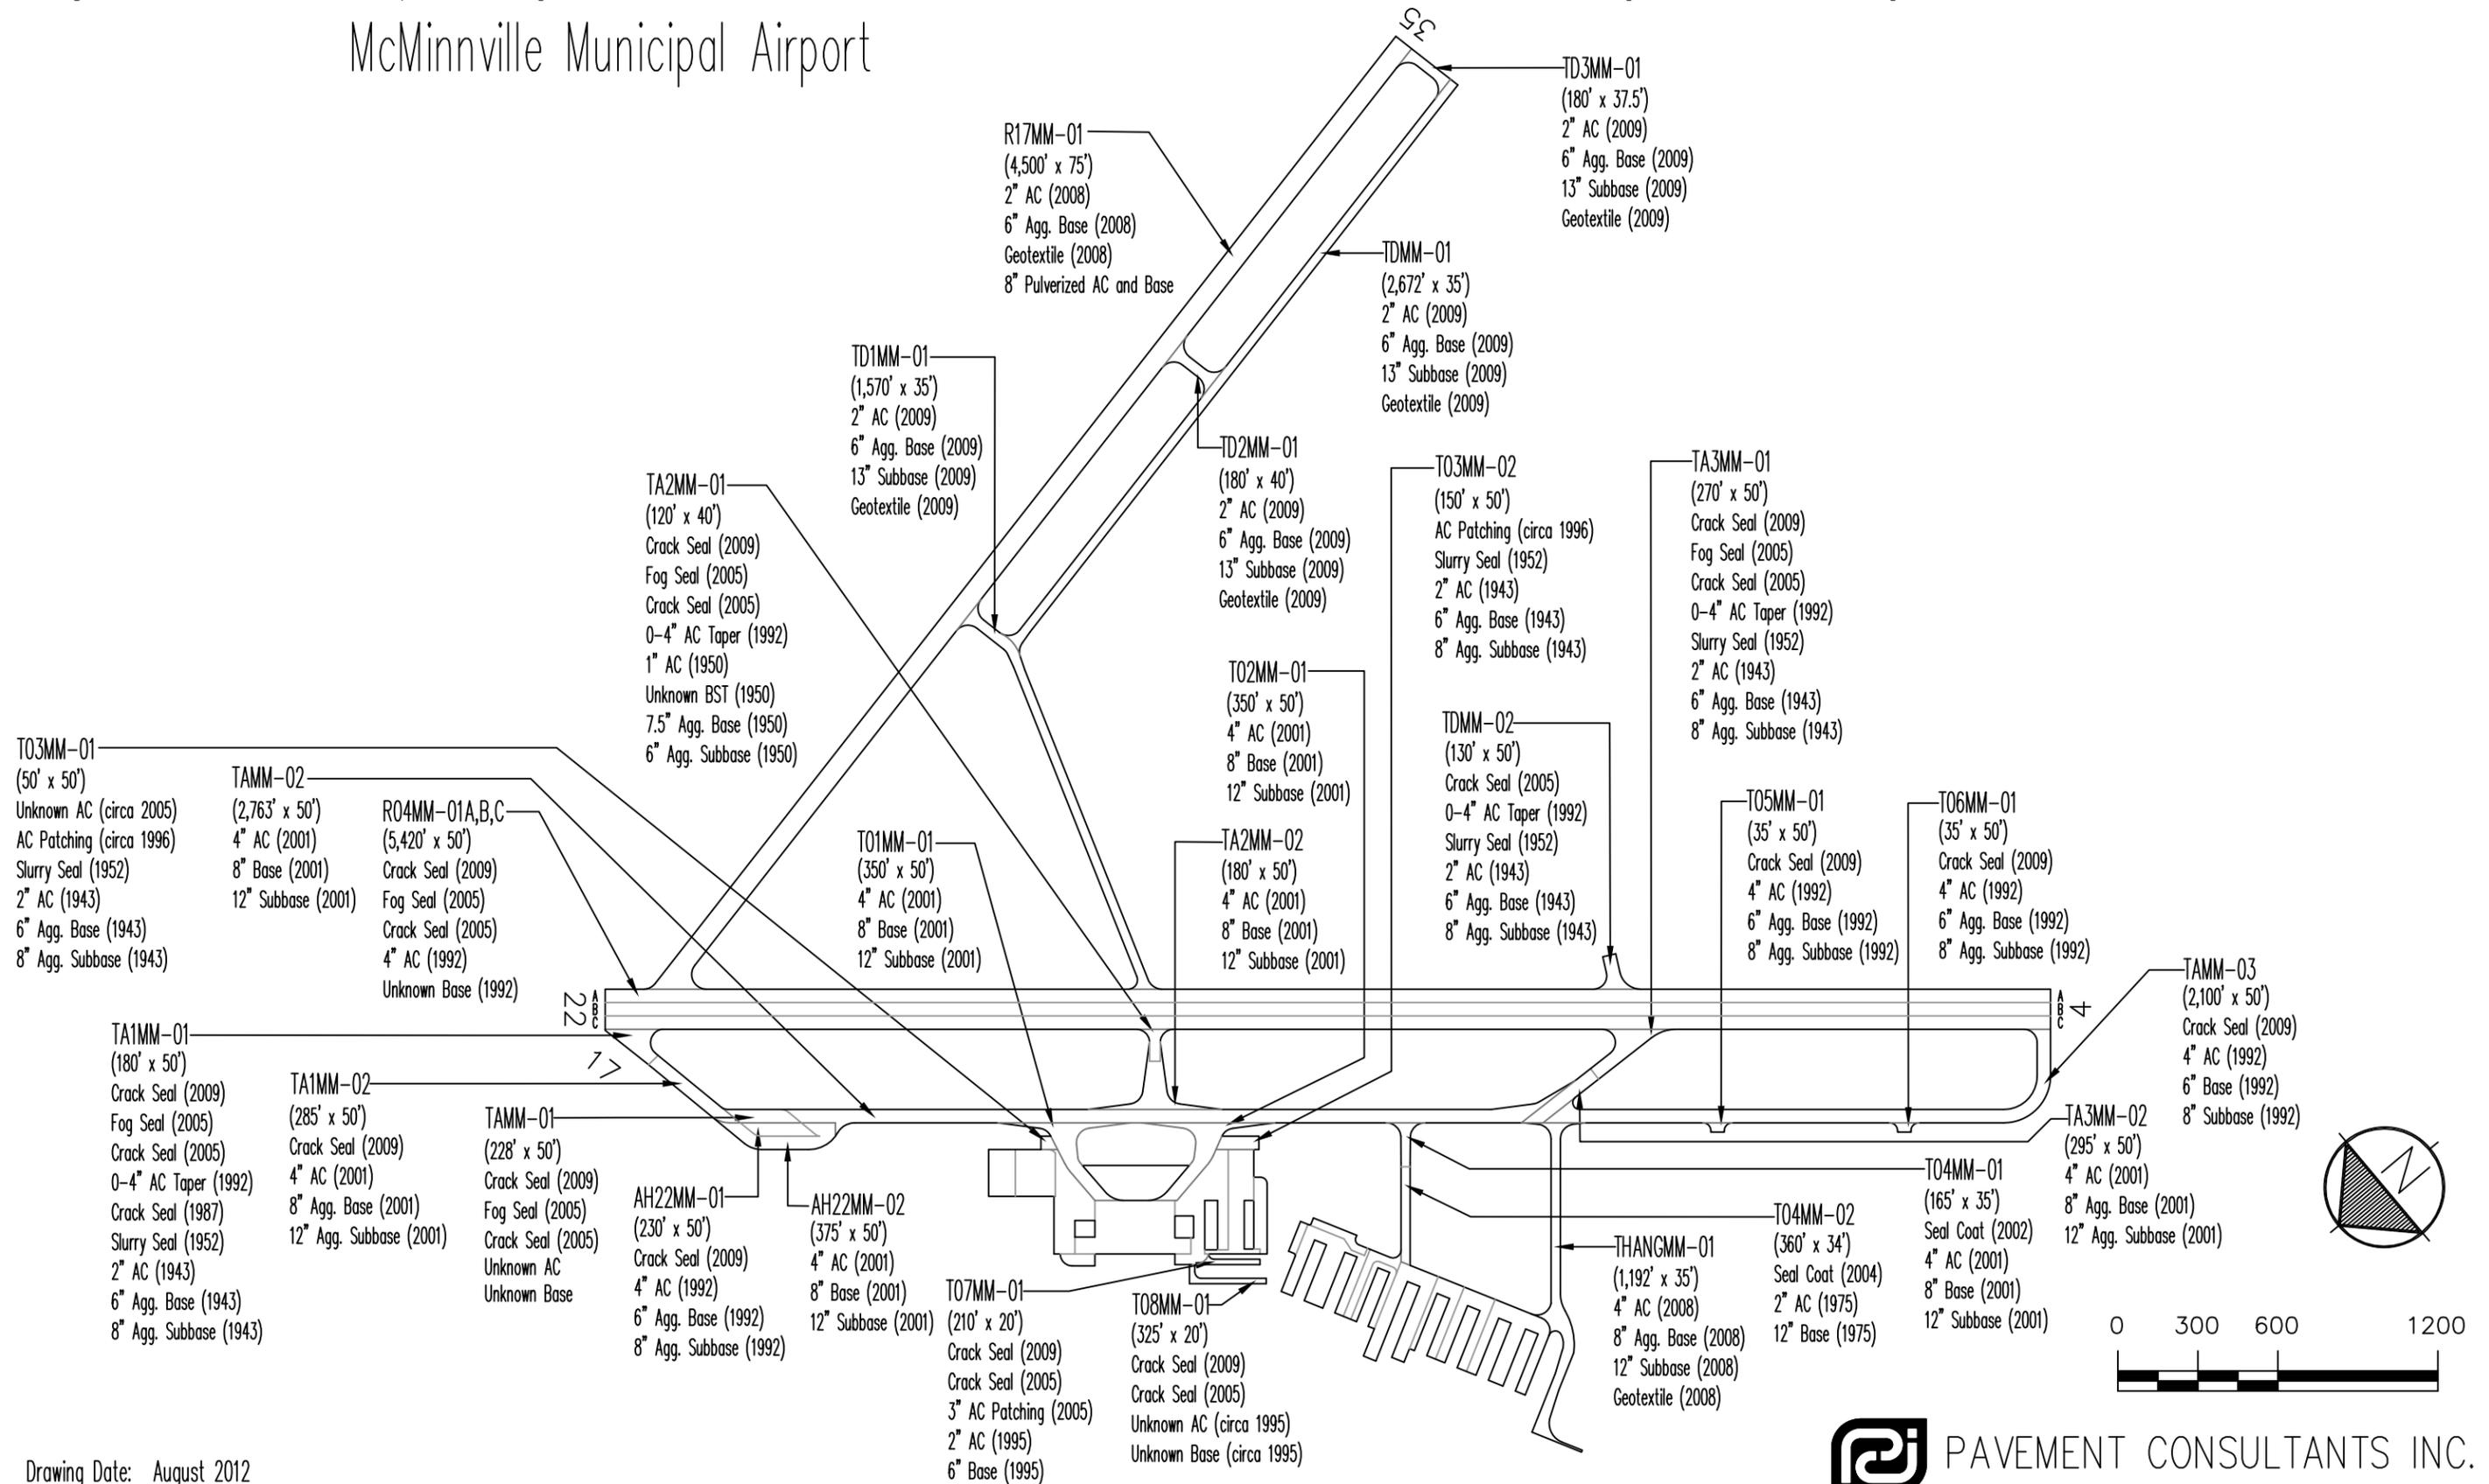


Drawing Date: August 2012

Figure MM-1B. Airport Layout, Dimensions and Pavement Cross-Sections – Aprons and Hangar Areas.
McMinnville Municipal Airport

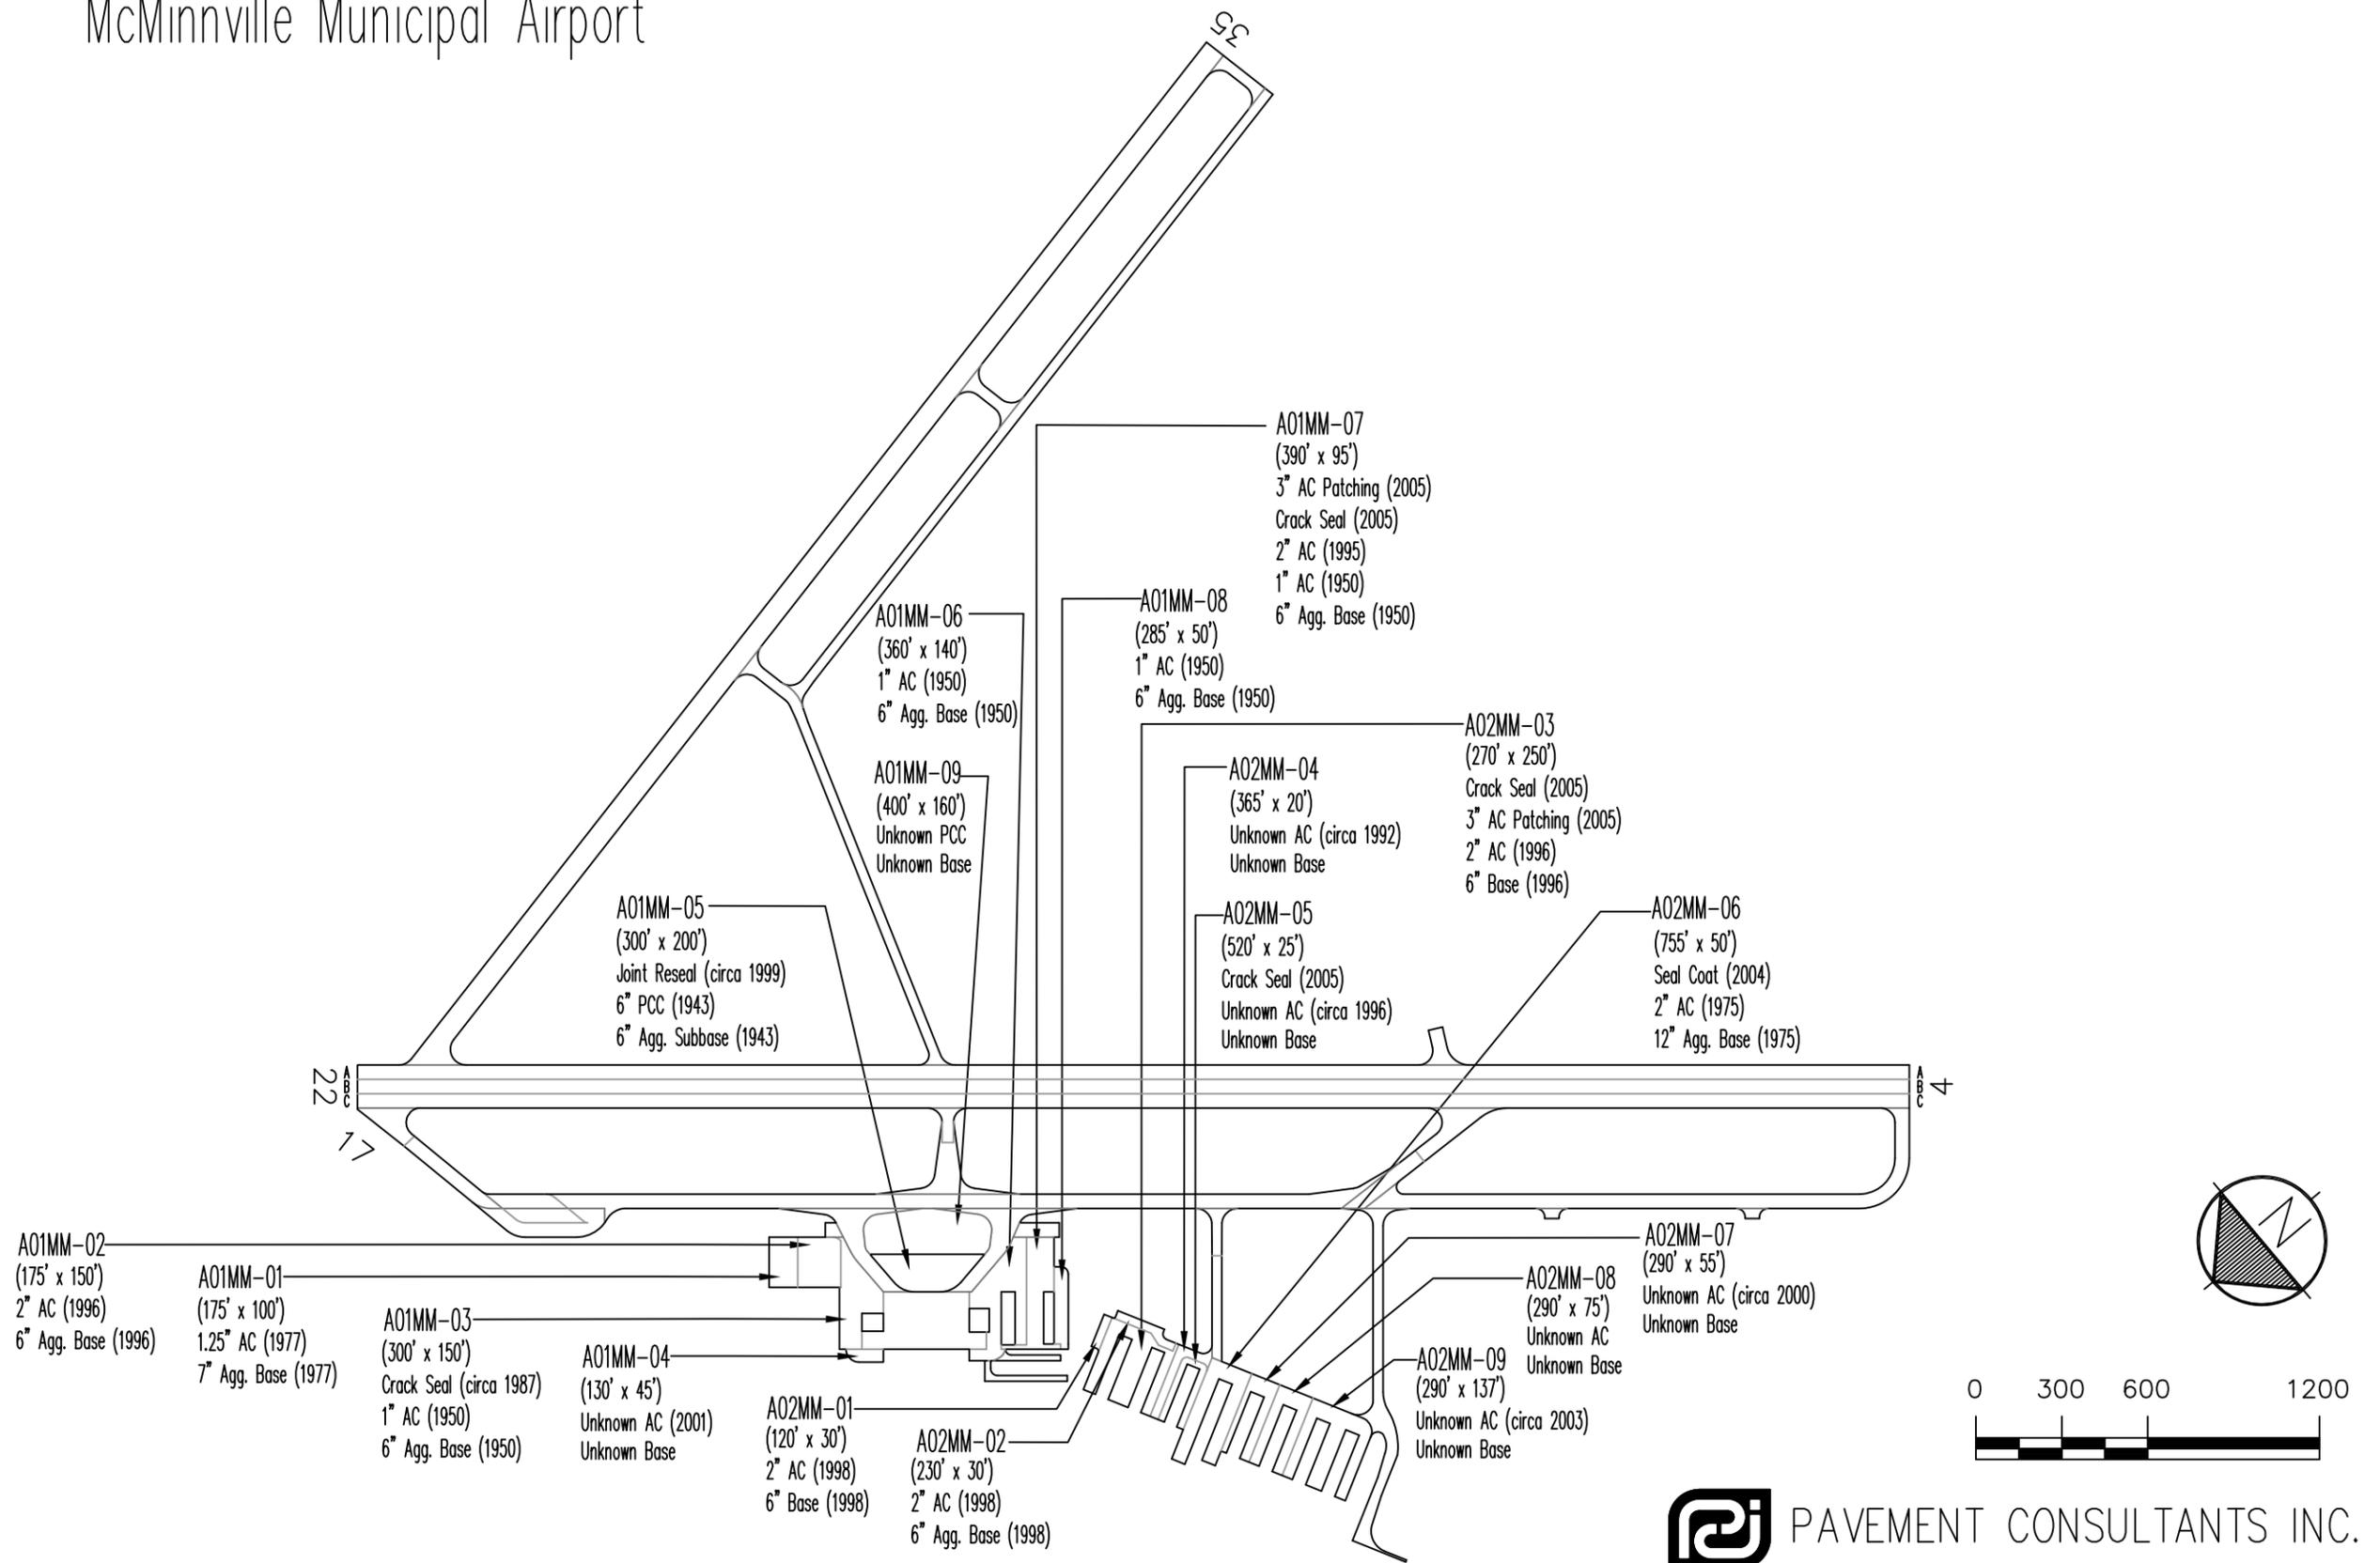

Drawing Date: August 2012

Figure MM-2. Pavement Branch, Section and Sample Unit Layout.
McMinnville Municipal Airport

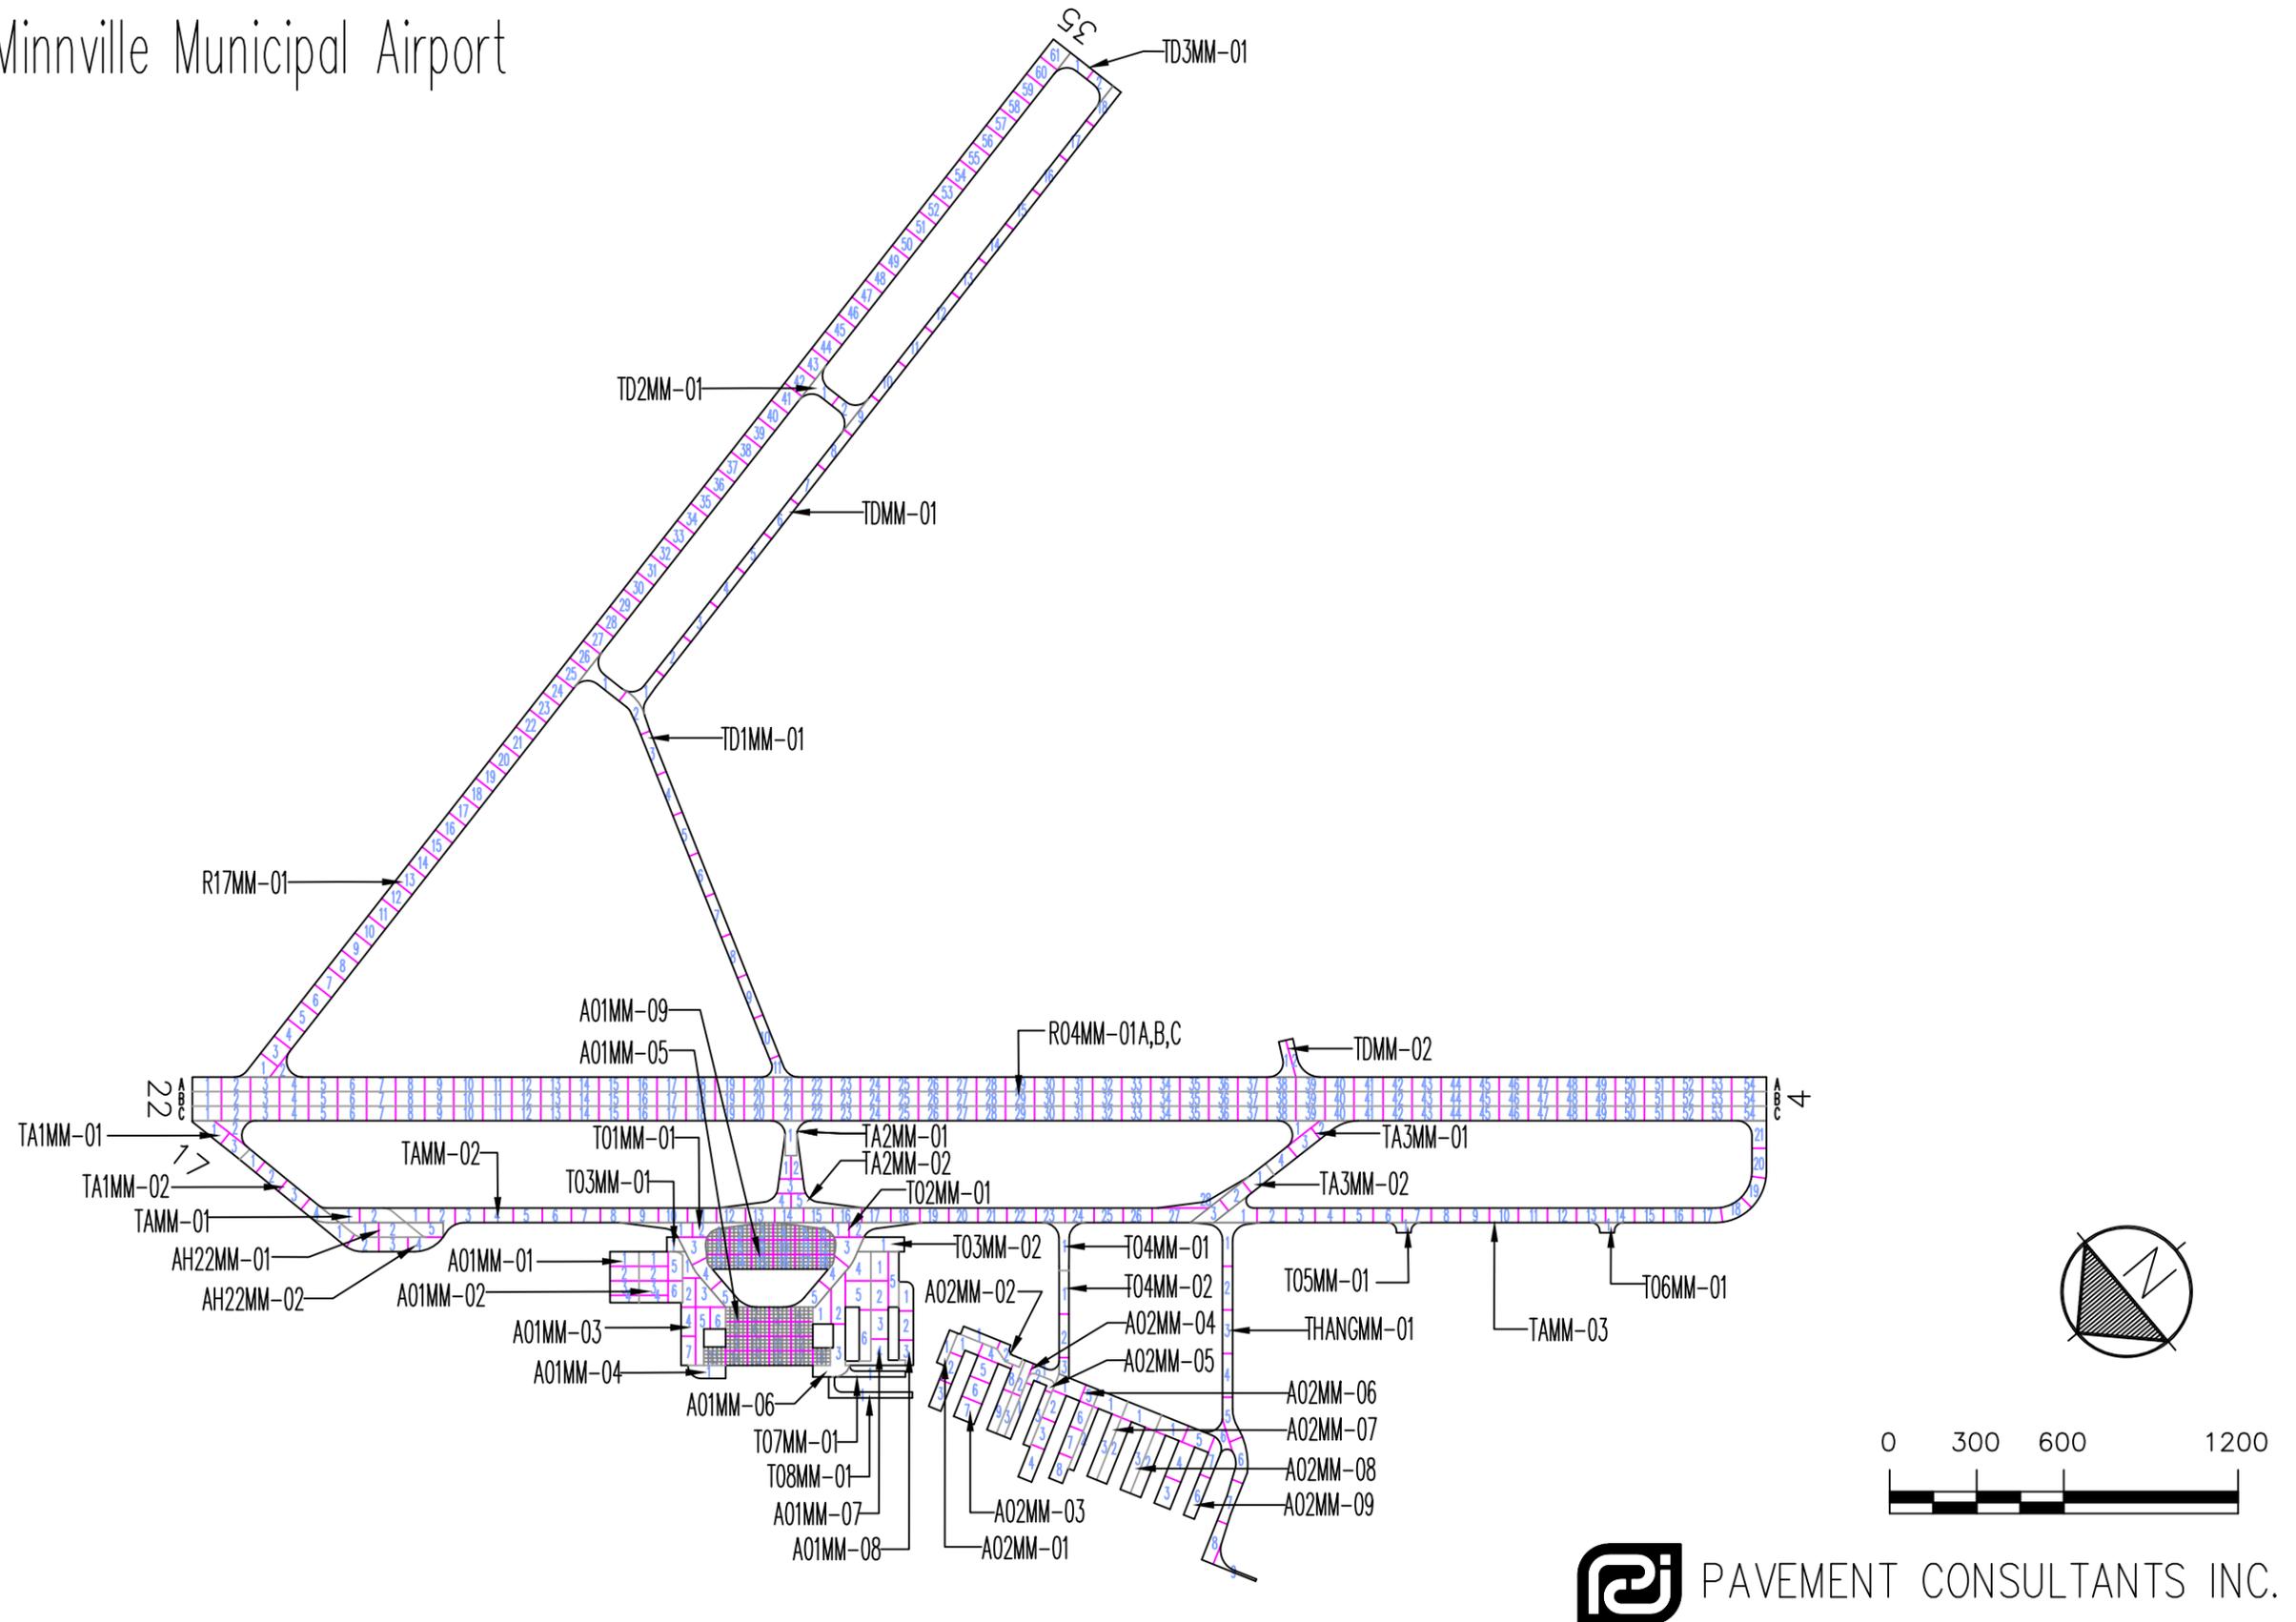

RESULTS

Using the data collected during the visual inspection, the Micro PAVER software was used to calculate an area-weighted average Pavement Condition Index (PCI) for each pavement section inspected using the sample units evaluated. Using each section's PCI, a Pavement Condition Rating (PCR) was assigned. The PCIs measured during this inspection are shown in Table 1. The table also contains PCIs from past inspections as well as projected PCIs for 2017 and 2022. The projections were based on pavement deterioration models developed by Micro PAVER using the inspection data from other pavements in the same airport category as your airport, located in the same climatic region, and with the same surface type and use.

The ASTM Standard which governs the methodology for conducting the visual inspections was modified in 2010 and could result in changes to the Pavement Condition Index for the current inspection relative to that from the previous inspections. So a slight increase in the PCI value over the PCI values from previous inspections is possible, even if no work has been completed on the pavement.

The Branch Condition Report in Appendix 1 summarizes current pavement condition by branch while the Section Condition Report in Appendix 2 lists pavement condition by section. The current PCR is shown graphically in Figure MM-3.

Table 1. Past, Present and Future Pavement Condition Indices.

Branch	Section	Inspections			Forecast	
		2004	2008	2012	2017	2022
A01MM	01	25	45	42	30	18
A01MM	02	97	74	42	30	18
A01MM	03	11	7	24	15	10
A01MM	04	100	97	97	84	73
A01MM	05	78	92	92	86	81
A01MM	06	0	10	25	15	11
A01MM	07	98	94	47	21	0
A01MM	08	3	0	25	15	11
A01MM	09	-	100	97	90	84
A02MM	01	95	80	80	70	65
A02MM	02	92	77	70	65	62
A02MM	03	96	88	77	68	64
A02MM	04	91	93	87	75	67
A02MM	05	73	84	64	62	58
A02MM	06	93	80	64	62	58
A02MM	07	100	92	94	81	70
A02MM	08	100	97	89	76	68
A02MM	09	100	100	98	86	74
AH22MM	01	100	84	54	44	32


Table 1. Past, Present and Future Pavement Condition Indices.

Branch	Section	Inspections			Forecast	
		2004	2008	2012	2017	2022
AH22MM	02	100	100	91	78	69
R04MM	01A	91	89	61	50	35
R04MM	01B	86	86	58	46	31
R04MM	01C	92	88	60	49	34
R17MM	01	17	16	94	85	78
T01MM	01	100	100	81	76	74
T02MM	01	100	98	94	86	79
T03MM	01	0	100	100	93	85
T03MM	02	16	5	37	28	21
T04MM	01	100	100	100	92	84
T04MM	02	64	59	47	37	27
T05MM	01	87	81	87	80	76
T06MM	01	92	87	94	86	79
T07MM	01	83	79	81	76	74
T08MM	01	92	86	96	88	81
TA1MM	01	97	78	64	47	30
TA1MM	02	100	98	86	80	76
TA2MM	01	84	79	82	66	49
TA2MM	02	100	100	97	89	81
TA3MM	01	97	87	64	47	30
TA3MM	02	100	100	91	83	78
TAMM	01	99	78	64	56	46
TAMM	02	100	100	90	82	77
TAMM	03	97	89	83	78	75
TD1MM	01	-	-	100	92	84
TD2MM	01	-	-	100	92	84
TD3MM	01	-	-	100	92	84
TDMM	01	-	-	100	92	84
TDMM	02	88	90	64	56	46
THANGMM	01	-	-	100	92	84

Section PCIs at McMinnville Municipal Airport range from a low of 24 (a PCR of “Serious”) to a high of 100 (a PCR of “Good”). The area-weighted average PCI for all airport pavements is 75, corresponding to an overall PCR of “Satisfactory”. Figure MM-4 shows how much pavement area is associated with each Pavement Condition Rating category and also shows pavement condition distribution from the inspections conducted in 2004 and 2008.


The primary distresses observed in the asphalt pavements during the inspection were: longitudinal and transverse cracking, block cracking, raveling, depressions, patching, alligator cracking and an isolated occurrence of rutting. The distresses observed in the concrete

Figure MM-3. Pavement Condition in July 2012.
McMinnville Municipal Airport

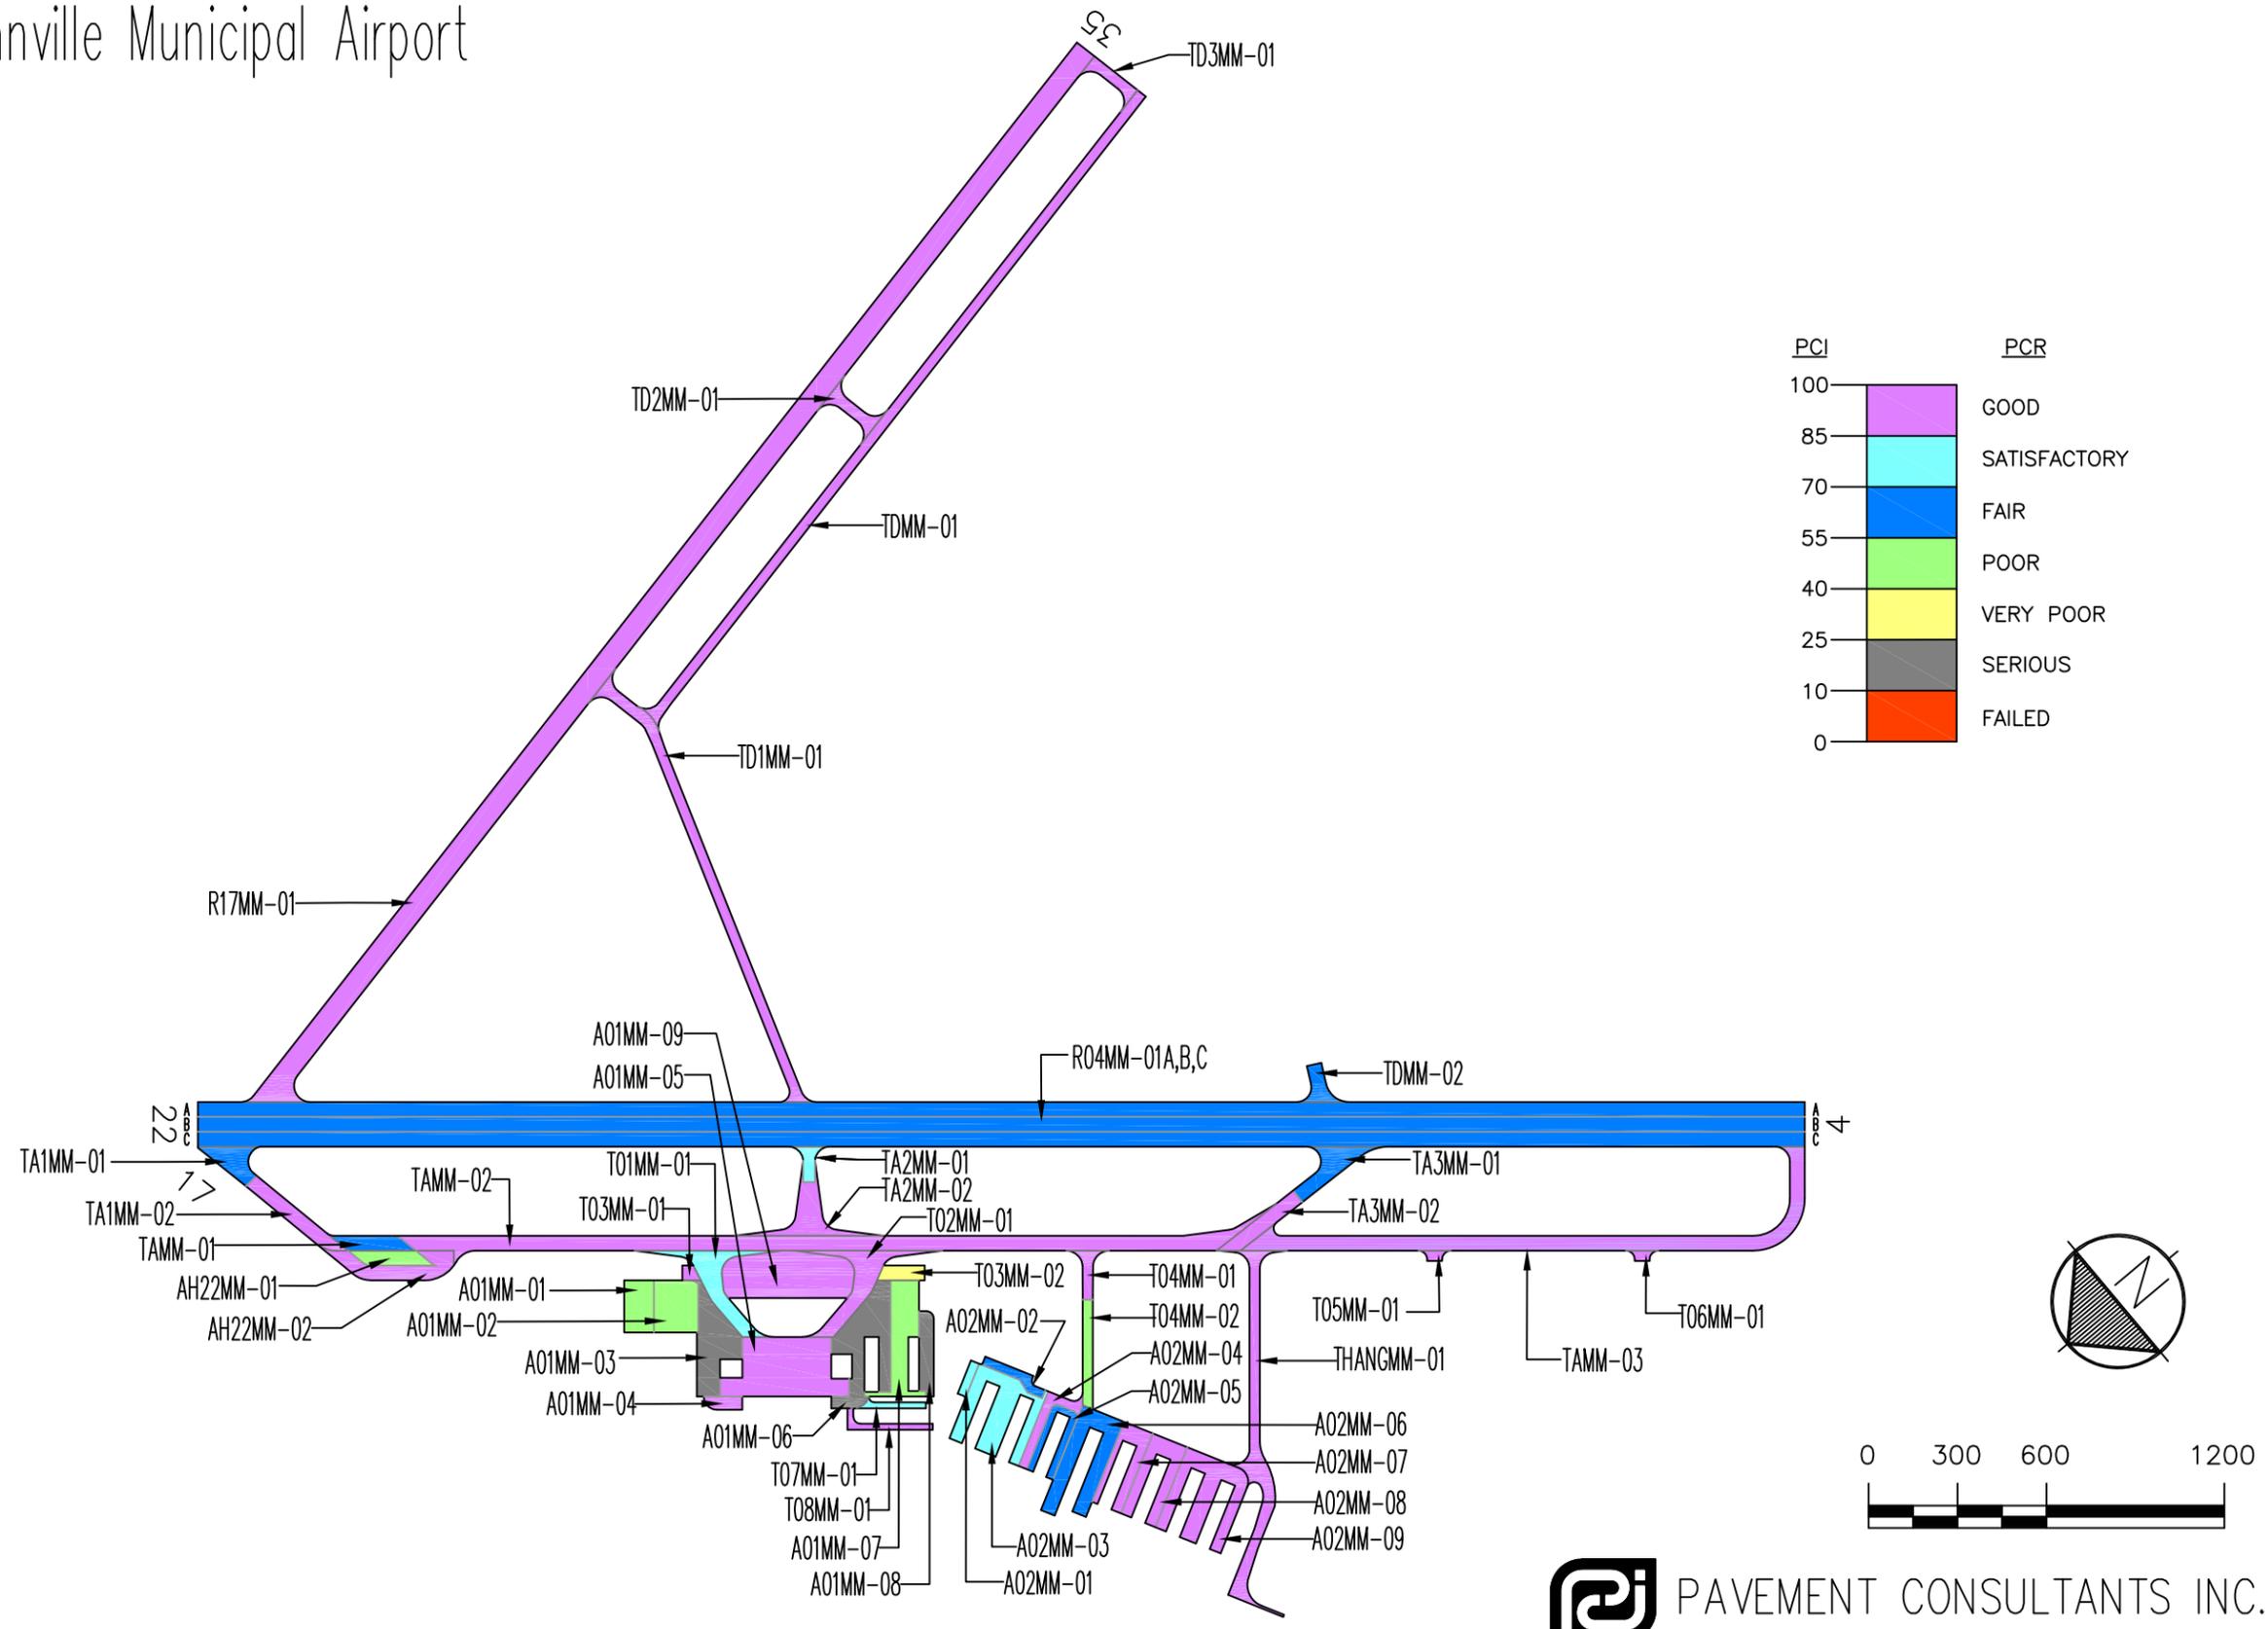

Drawing Date: August 2012

**Figure MM-4. Pavement Condition Distribution
McMinnville Municipal Airport**

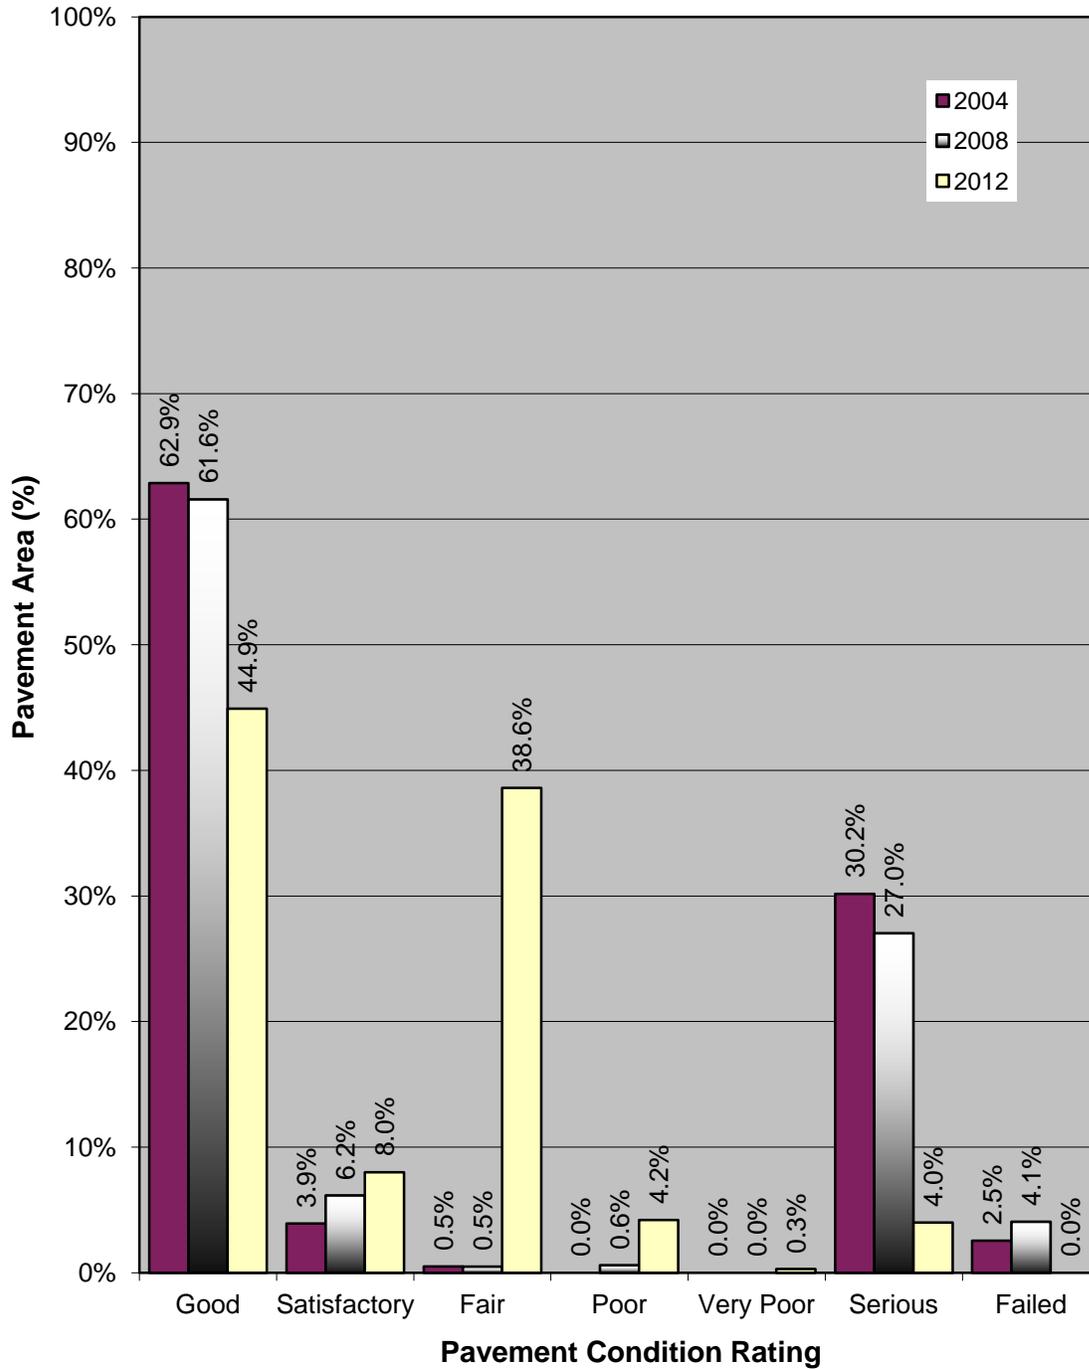

pavement were: linear cracking, joint seal damage, small patch, corner spall, shattered slab and corner break.

A graphical representation of the projected PCIs listed in Table 1 is shown in Figure MM-5.

RECOMMENDATIONS

Data collected during the visual condition survey were used by the Micro PAVER software to generate the Network Maintenance Report contained in Appendix 3. This report identifies, for each pavement section, the recommended localized maintenance activities (i.e.-crack sealing, patching) that should be completed to repair the defects observed during the visual inspection. The repair quantities identified in the report were extrapolated to cover the entire pavement section, based on the distresses measured in the inspected sample units. If the repair activities identified are completed, the pavement deterioration rate will be slowed.


The recommended localized maintenance activities to be applied are selected by the Micro PAVER software based on a Distress Maintenance Policy established for the Oregon airport system. The report results indicate that, over your entire airport, the following quantities of localized maintenance are needed:

- 302,058 linear feet of asphalt concrete crack sealing
- 685 square feet of asphalt concrete deep patching


The Micro PAVER software can also identify and schedule recommended global (applied over an entire section) maintenance activities such as fog seals, slurry seals and other surface treatments, as well as major rehabilitation activities such as asphalt concrete overlays and complete reconstruction. Micro PAVER schedules global maintenance on a user-defined interval. To schedule major rehabilitation Micro PAVER uses pavement deterioration models developed during this project. These models are used to estimate future pavement condition and to schedule rehabilitation based on a trigger PCI.

During this project a 5-year program outlining recommended global maintenance and rehabilitation was developed. The program begins in the year 2013 to allow time for project development. These recommendations are presented in Table 2, which identifies the pavement section requiring rehabilitation, the year the action should be completed, the type of action, and an associated cost. This information is also presented graphically in Figure MM-6.

Predicted Condition in 2017.

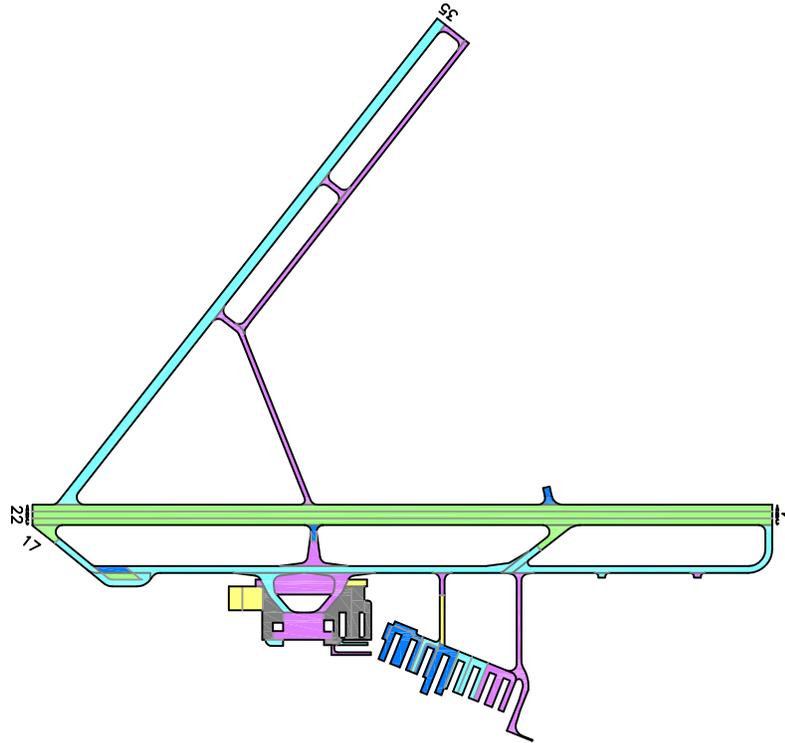

Predicted Condition in 2022.

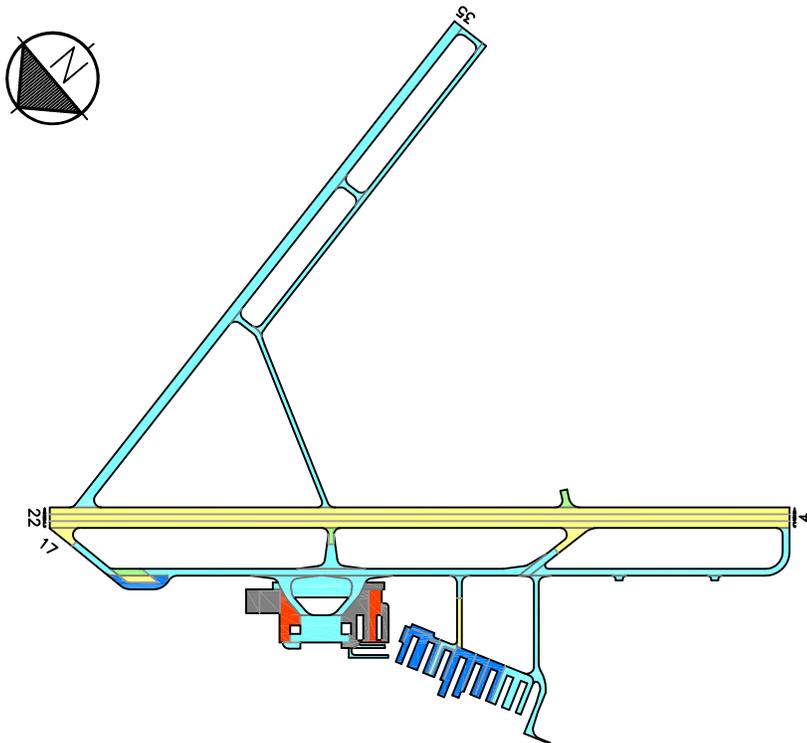

Drawing Date: August 2012

 PAVEMENT CONSULTANTS INC.

Figure MM-5. Future Pavement Condition.

Table 2. Five-Year Global Maintenance and Rehabilitation Plan.


Year	Branch	Section	Action	Area (sf)	Unit Cost (\$/sf)	Total Cost (\$)
2013	A01MM	01	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	17,500	\$10.36	\$181,300
2013	A01MM	02	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	26,153	\$10.36	\$270,945
2013	A01MM	03	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	35,038	\$10.36	\$362,994
2013	A01MM	04	Slurry Seal	5,415	\$0.23	\$1,245
2013	A01MM	06	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	46,407	\$10.36	\$480,777
2013	A01MM	07	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	32,672	\$10.36	\$338,482
2013	A01MM	08	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	13,802	\$10.36	\$142,989
2013	A02MM	01	Slurry Seal	3,621	\$0.23	\$833
2013	A02MM	02	Slurry Seal	7,475	\$0.23	\$1,719
2013	A02MM	03	Slurry Seal	44,039	\$0.23	\$10,129
2013	A02MM	04	Slurry Seal	11,573	\$0.23	\$2,662
2013	A02MM	05	Slurry Seal	12,429	\$0.23	\$2,859
2013	A02MM	06	Slurry Seal	39,250	\$0.23	\$9,028
2013	A02MM	07	Slurry Seal	18,950	\$0.23	\$4,359
2013	A02MM	08	Slurry Seal	24,750	\$0.23	\$5,693
2013	A02MM	09	Slurry Seal	45,334	\$0.23	\$10,427
2013	AH22MM	01	Slurry Seal	11,420	\$0.23	\$2,627
2013	AH22MM	02	Slurry Seal	24,568	\$0.23	\$5,651
2013	R04MM	01A	2" AC Overlay	271,000	\$2.50	\$677,500
2013	R04MM	01B	2" AC Overlay	271,000	\$2.50	\$677,500
2013	R04MM	01C	2" AC Overlay	271,000	\$2.50	\$677,500
2013	T01MM	01	Slurry Seal	27,631	\$0.23	\$6,355
2013	T02MM	01	Slurry Seal	28,271	\$0.23	\$6,502
2013	T03MM	01	Slurry Seal	2,500	\$0.23	\$575
2013	T03MM	02	Reconstruct with 4" AC, 8" Aggregate Base, 12" Aggregate Subbase	7,500	\$10.36	\$77,700

Table 2. Five-Year Global Maintenance and Rehabilitation Plan.

Year	Branch	Section	Action	Area (sf)	Unit Cost (\$/sf)	Total Cost (\$)
2013	T04MM	01	Slurry Seal	7,024	\$0.23	\$1,616
2013	T04MM	02	2" AC Overlay	12,308	\$2.50	\$30,770
2013	T05MM	01	Slurry Seal	2,136	\$0.23	\$491
2013	T06MM	01	Slurry Seal	2,136	\$0.23	\$491
2013	T07MM	01	Slurry Seal	4,472	\$0.23	\$1,029
2013	T08MM	01	Slurry Seal	6,935	\$0.23	\$1,595
2013	TA1MM	01	Slurry Seal	13,451	\$0.23	\$3,094
2013	TA1MM	02	Slurry Seal	18,353	\$0.23	\$4,221
2013	TA2MM	01	Slurry Seal	5,873	\$0.23	\$1,351
2013	TA2MM	02	Slurry Seal	21,735	\$0.23	\$4,999
2013	TA3MM	01	Slurry Seal	18,008	\$0.23	\$4,142
2013	TA3MM	02	Slurry Seal	14,828	\$0.23	\$3,410
2013	TAMM	01	Slurry Seal	11,436	\$0.23	\$2,630
2013	TAMM	02	Slurry Seal	143,160	\$0.23	\$32,927
2013	TAMM	03	Slurry Seal	106,963	\$0.23	\$24,601
2013	TDMM	02	Slurry Seal	8,186	\$0.23	\$1,883
2013 Total						\$4,077,598
2014	R17MM	01	Slurry Seal	340,435	\$0.23	\$78,300
2014	THANGMM	01	Slurry Seal	52,865	\$0.23	\$12,159
2014 Total						\$90,459
2015	TD1MM	01	Fog Seal	58,737	\$0.12	\$7,048
2015	TD2MM	01	Fog Seal	9,997	\$0.12	\$1,200
2015	TD3MM	01	Fog Seal	8,236	\$0.12	\$988
2015	TDMM	01	Fog Seal	94,389	\$0.12	\$11,327
2015 Total						\$20,563
TOTAL						\$4,188,620

If the global maintenance and/or rehabilitation activities recommended in Table 2 are not completed, the localized maintenance activities identified in the Network Maintenance Report (Appendix 3) for that section should be done. Additionally, for those sections not listed in Table 2 as requiring global maintenance or rehabilitation, the localized maintenance activities outlined in the Network Maintenance Report should be completed. By completing the localized maintenance activities, pavement condition is improved, life is extended, deterioration is slowed and the length of time until major repair or rehabilitation is required is increased.

Figure MM-6. Five-Year Pavement Management Plan.
McMinnville Municipal Airport

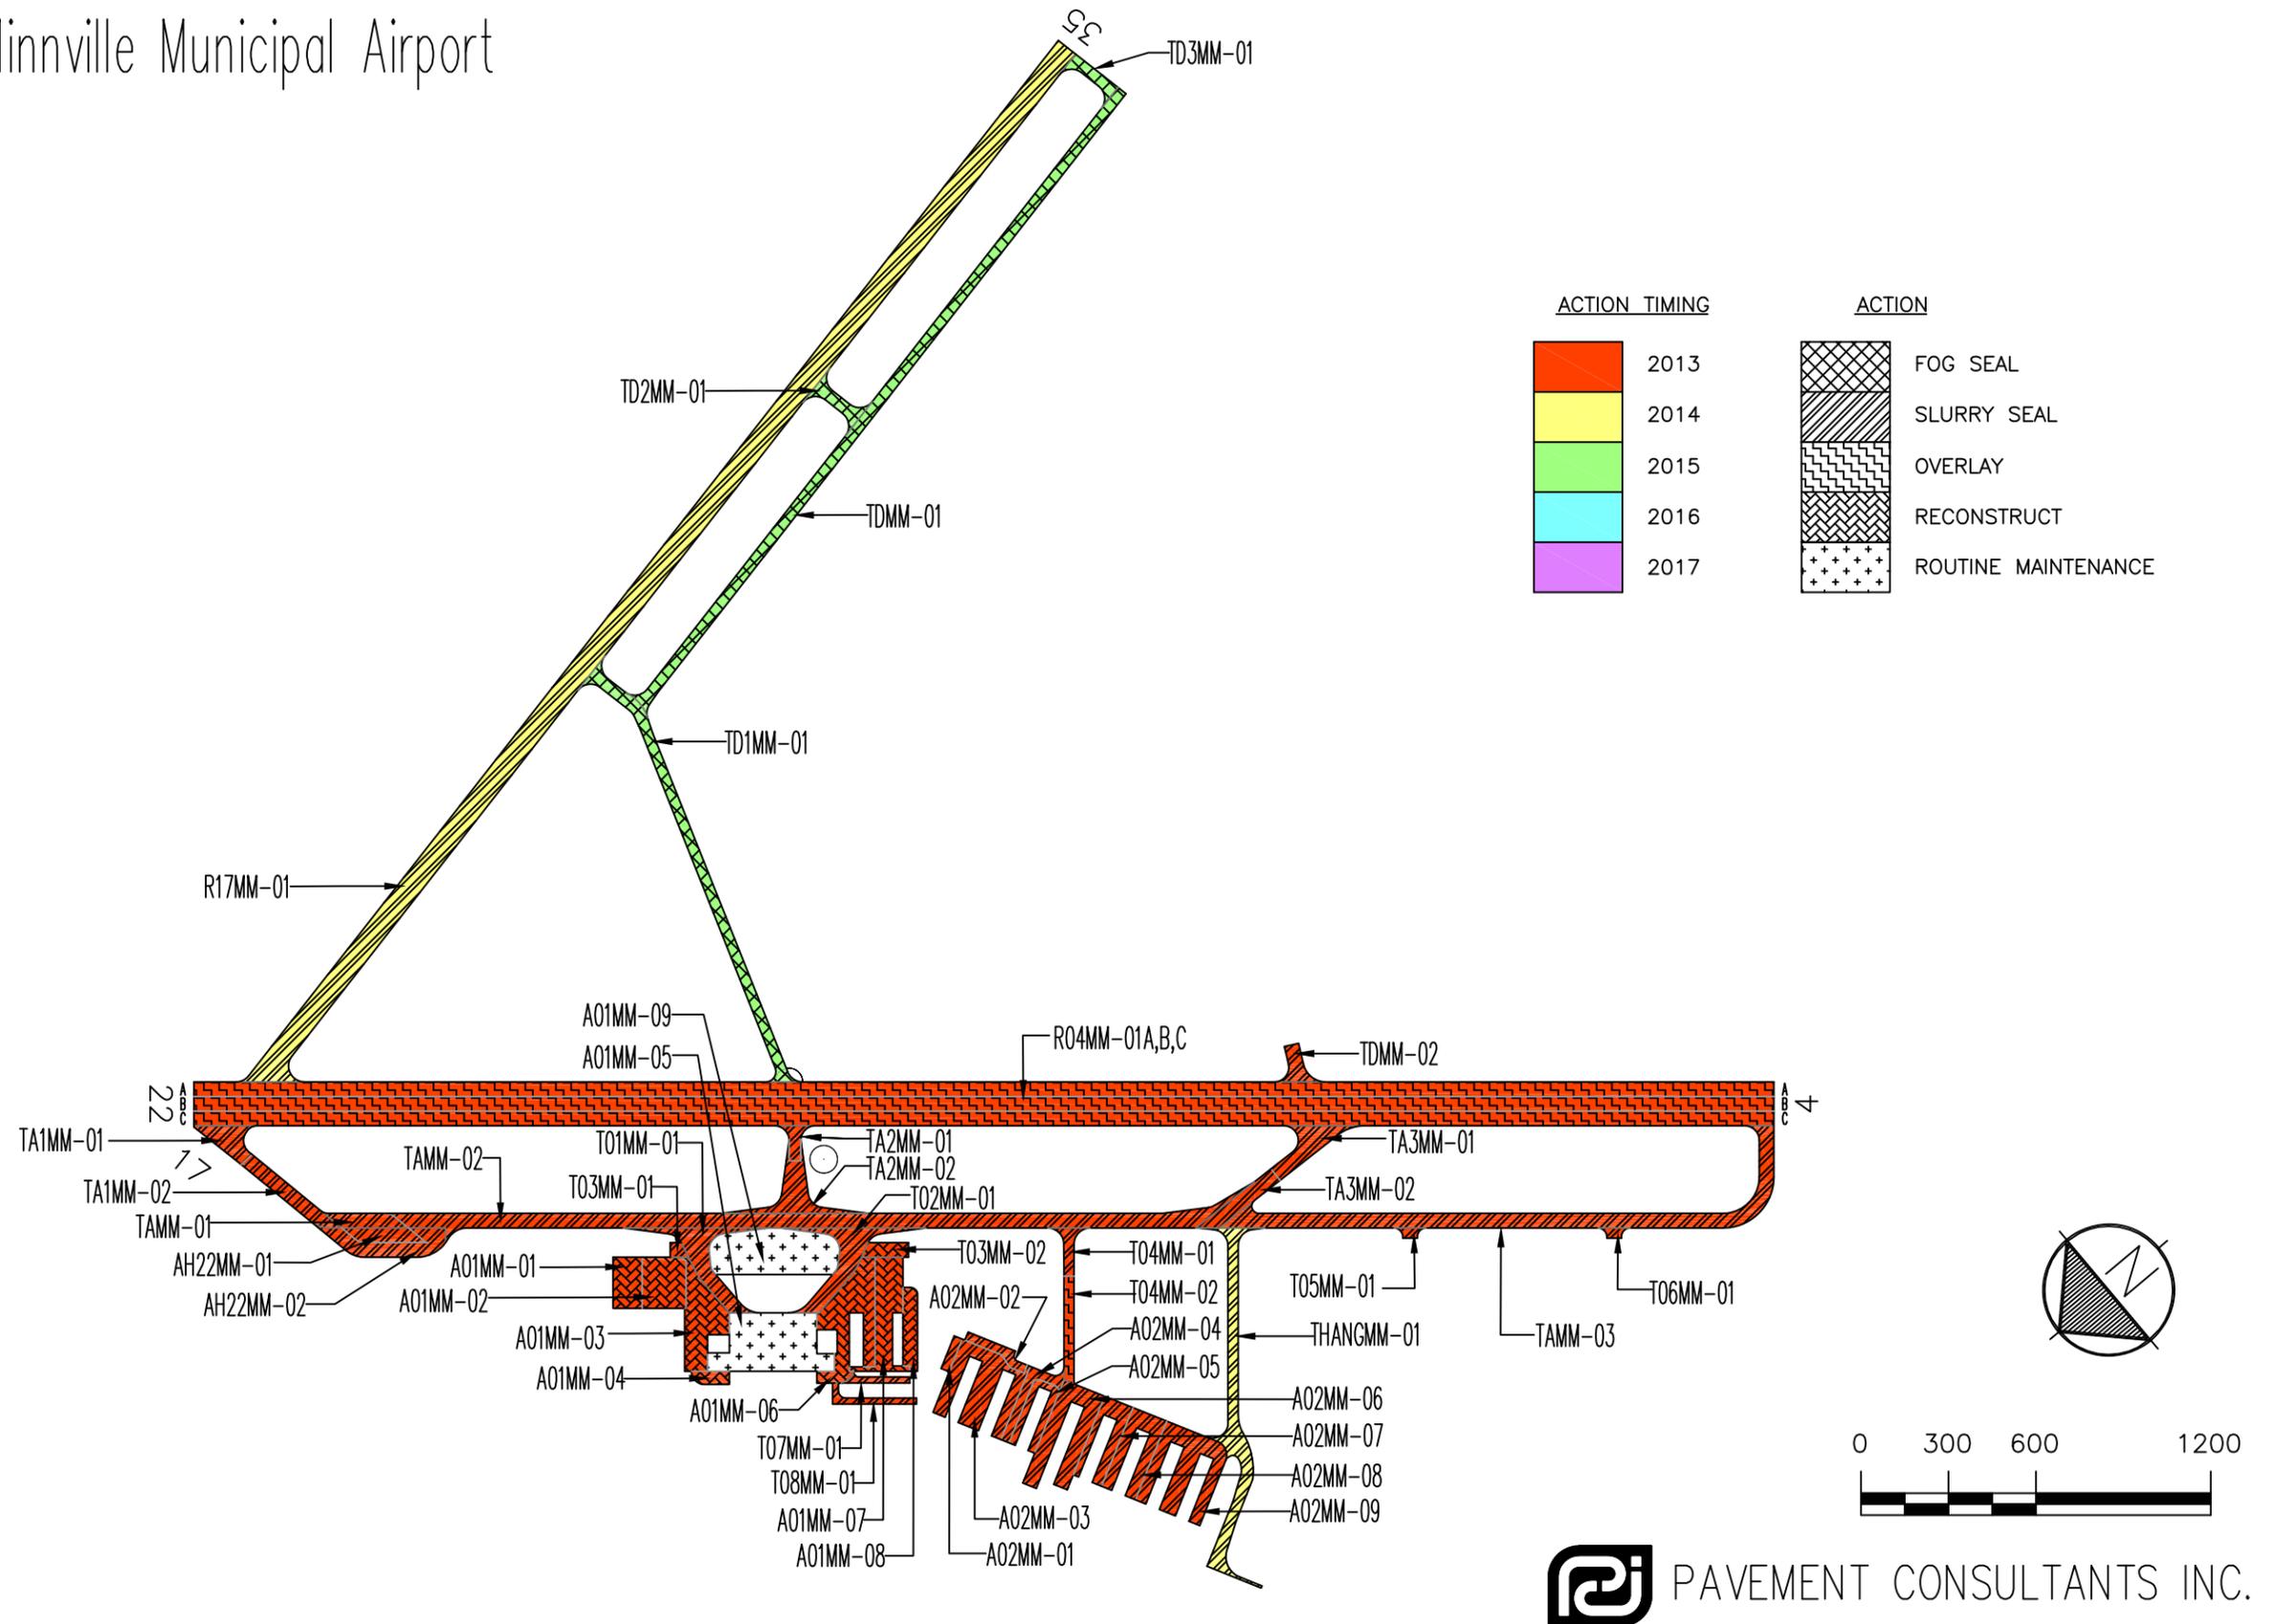

INSPECTION SCHEDULE

To comply with the inspection schedule requirement of FAA Grant Assurance Number 11, a detailed visual inspection should be conducted every 3 years using the methodology described in ASTM D5430. The next scheduled detailed visual inspection should take place in 2015.

In addition, the FAA requires that a drive-by inspection be conducted monthly to detect unforeseen changes in pavement condition. The results of each drive-by inspection should be recorded and kept in a file. At a minimum, the date of the inspection and an indication of any maintenance performed since the last drive-by inspection should be recorded.

Appendix 1

Branch Condition Report

Date: 8 /20/2012

Branch Condition Report

1 of 3

Pavement Database: ODOT2012 NetworkID: McMinnville

Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	PCI Standard Deviation	Weighted Average PCI
A01MM (Apron 01 McMinnville)	9	2,515.00	121.11	309,377.01	APRON	54.56	29.92	60.58
A02MM (Apron 02 McMinnville)	9	3,130.00	74.67	207,421.00	APRON	80.33	11.88	81.69
AH22MM (Hold Apron 22 McMinnville)	2	605.00	50.00	35,988.00	APRON	72.50	18.50	79.26
R04MM (Runway 04/22 McMinnville)	3	16,260.00	50.00	813,000.00	RUNWAY	59.67	1.25	59.67
R17MM (Runway 17/35 McMinnville)	1	4,500.00	75.00	340,435.00	RUNWAY	94.00	0.00	94.00
T01MM (Taxiway 01 McMinnville)	1	350.00	50.00	27,631.00	TAXIWAY	81.00	0.00	81.00
T02MM (Taxiway 02 McMinnville)	1	350.00	50.00	28,271.00	TAXIWAY	94.00	0.00	94.00
T03MM (Taxiway 03 McMinnville)	2	200.00	50.00	10,000.00	TAXIWAY	68.50	31.50	52.75
T04MM (Taxiway 04 McMinnville)	2	525.00	34.50	19,332.00	TAXIWAY	73.50	26.50	66.26
T05MM (Taxiway 05 McMinnville)	1	35.00	50.00	2,136.00	TAXIWAY	87.00	0.00	87.00
T06MM (Taxiway 06 McMinnville)	1	35.00	50.00	2,136.00	TAXIWAY	94.00	0.00	94.00
T07MM (Taxiway 07 McMinnville)	1	210.00	20.00	4,472.00	TAXIWAY	81.00	0.00	81.00
T08MM (Taxiway 08 McMinnville)	1	325.00	20.00	6,935.00	TAXIWAY	96.00	0.00	96.00
TA1MM (Taxiway A1 McMinnville)	2	465.00	50.00	31,804.00	TAXIWAY	75.00	11.00	76.70
TA2MM (Taxiway A2 McMinnville)	2	300.00	45.00	27,608.00	TAXIWAY	89.50	7.50	93.81
TA3MM (Taxiway A3 McMinnville)	2	565.00	50.00	32,836.00	TAXIWAY	77.50	13.50	76.19

Date: 8 /20/2012

Branch Condition Report

2 of 3

Pavement Database: ODOT2012 NetworkID: McMinnvill

Branch ID	Number of Sections	Sum Section Length (Ft)	Avg Section Width (Ft)	True Area (SqFt)	Use	Average PCI	PCI Standard Deviation	Weighted Average PCI
TAMM (Taxiway A McMinnville)	3	5,091.00	50.00	261,559.00	TAXIWAY	79.00	10.98	86.00
TD1MM (Taxiway D1 McMinnville)	1	1,570.00	35.00	58,737.00	TAXIWAY	100.00	0.00	100.00
TD2MM (Taxiway D2 McMinnville)	1	180.00	40.00	9,997.00	TAXIWAY	100.00	0.00	100.00
TD3MM (Taxiway D3 McMinnville)	1	180.00	37.50	8,236.00	TAXIWAY	100.00	0.00	100.00
TDMM (Taxiway D McMinnville)	2	2,802.00	42.50	102,575.00	TAXIWAY	82.00	18.00	97.13
THANGMM (Hangar Taxiway McMinnville)	1	1,192.00	35.00	52,865.00	TAXIWAY	100.00	0.00	100.00

Use Category	Number of Sections	Total Area (SqFt)	Arithmetic Average PCI	Average PCI STD.	Weighted Average PCI
APRON	20	552,786.01	67.95	25.54	69.72
RUNWAY	4	1,153,435.00	68.25	14.91	69.80
TAXIWAY	25	687,130.00	84.08	17.44	88.91
All	49	2,393,351.01	76.20	22.46	75.27

Appendix 2
Section Condition Report

Date: 8 /20/2012

Section Condition Report

1 of 3

Pavement Database: ODOT2012 NetworkID: McMinnville

Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspection	PCI
A01MM (Apron 01 McMinnville)	01	08/02/1977	AC	APRON	S	0	17,500.00	07/25/2012	35	42.00
A01MM (Apron 01 McMinnville)	02	08/02/1996	AC	APRON	S	0	26,153.00	07/25/2012	16	42.00
A01MM (Apron 01 McMinnville)	03	08/02/1950	AC	APRON	S	0	35,038.00	07/25/2012	62	24.00
A01MM (Apron 01 McMinnville)	04	08/01/2001	AC	APRON	S	0	5,415.00	07/25/2012	11	97.00
A01MM (Apron 01 McMinnville)	05	08/02/1943	PCC	APRON	P	0	68,330.00	07/25/2012	69	92.00
A01MM (Apron 01 McMinnville)	06	08/02/1950	AC	APRON	S	0	46,407.00	07/25/2012	62	25.00
A01MM (Apron 01 McMinnville)	07	08/01/1995	AAC	APRON	S	0	32,672.00	07/25/2012	17	47.00
A01MM (Apron 01 McMinnville)	08	08/02/1950	AC	APRON	S	0	13,802.00	07/25/2012	62	25.00
A01MM (Apron 01 McMinnville)	09	01/01/2005	PCC	APRON	P	0	64,060.00	07/25/2012	7	97.00
A02MM (Apron 02 McMinnville)	01	08/02/1998	AC	APRON	S	0	3,621.00	07/25/2012	14	80.00
A02MM (Apron 02 McMinnville)	02	08/02/1998	AC	APRON	S	0	7,475.00	07/25/2012	14	70.00
A02MM (Apron 02 McMinnville)	03	08/02/1996	AC	APRON	S	0	44,039.00	07/25/2012	16	77.00
A02MM (Apron 02 McMinnville)	04	08/02/1992	AC	APRON	S	0	11,573.00	07/25/2012	20	87.00
A02MM (Apron 02 McMinnville)	05	08/02/1996	AC	APRON	S	0	12,429.00	07/25/2012	16	64.00
A02MM (Apron 02 McMinnville)	06	08/02/1975	AC	APRON	S	0	39,250.00	07/25/2012	37	64.00
A02MM (Apron 02 McMinnville)	07	08/01/2000	AC	APRON	S	0	18,950.00	07/25/2012	12	94.00
A02MM (Apron 02 McMinnville)	08	09/20/2001	AC	APRON	S	0	24,750.00	07/25/2012	11	89.00
A02MM (Apron 02 McMinnville)	09	09/20/2003	AC	APRON	S	0	45,334.00	07/25/2012	9	98.00
AH22MM (Hold Apron 22 McMinnville)	01	08/03/1992	AC	APRON	P	0	11,420.00	07/25/2012	20	54.00
AH22MM (Hold Apron 22 McMinnville)	02	09/22/2001	AC	APRON	P	0	24,568.00	07/25/2012	11	91.00
R04MM (Runway 04/22 McMinnville)	01A	08/02/1992	AC	RUNWAY	P	0	271,000.00	07/25/2012	20	61.00
R04MM (Runway 04/22 McMinnville)	01B	08/02/1992	AC	RUNWAY	P	0	271,000.00	07/25/2012	20	58.00
R04MM (Runway 04/22 McMinnville)	01C	08/02/1992	AC	RUNWAY	P	0	271,000.00	07/25/2012	20	60.00
R17MM (Runway 17/35 McMinnville)	01	09/04/2008	AC	RUNWAY	P	0	340,435.00	07/25/2012	4	94.00
T01MM (Taxiway 01 McMinnville)	01	09/22/2001	AC	TAXIWAY	P	0	27,631.00	07/25/2012	11	81.00
T02MM (Taxiway 02 McMinnville)	01	09/22/2001	AC	TAXIWAY	P	0	28,271.00	07/25/2012	11	94.00

Date: 8 /20/2012

Section Condition Report

2 of 3

Pavement Database: ODOT2012 NetworkID: McMinnville

Branch ID	Section ID	Last Const. Date	Surface	Use	Rank	Lanes	True Area (SqFt)	Last Inspection Date	Age At Inspection	PCI
T03MM (Taxiway 03 McMinnville)	01	09/01/2005	AAC	TAXIWAY	S	0	2,500.00	07/25/2012	7	100.00
T03MM (Taxiway 03 McMinnville)	02	08/03/1943	AC	TAXIWAY	S	0	7,500.00	07/25/2012	69	37.00
T04MM (Taxiway 04 McMinnville)	01	09/22/2001	AC	TAXIWAY	S	0	7,024.00	07/25/2012	11	100.00
T04MM (Taxiway 04 McMinnville)	02	08/02/1975	AC	TAXIWAY	S	0	12,308.00	07/25/2012	37	47.00
T05MM (Taxiway 05 McMinnville)	01	08/03/1992	AC	TAXIWAY	S	0	2,136.00	07/25/2012	20	87.00
T06MM (Taxiway 06 McMinnville)	01	08/03/1992	AC	TAXIWAY	S	0	2,136.00	07/25/2012	20	94.00
T07MM (Taxiway 07 McMinnville)	01	08/02/1995	AC	TAXIWAY	S	0	4,472.00	07/25/2012	17	81.00
T08MM (Taxiway 08 McMinnville)	01	08/02/1995	AC	TAXIWAY	S	0	6,935.00	07/25/2012	17	96.00
TA1MM (Taxiway A1 McMinnville)	01	08/01/1992	AAC	TAXIWAY	P	0	13,451.00	07/25/2012	20	64.00
TA1MM (Taxiway A1 McMinnville)	02	09/22/2001	AC	TAXIWAY	P	0	18,353.00	07/25/2012	11	86.00
TA2MM (Taxiway A2 McMinnville)	01	08/01/1992	AAC	TAXIWAY	P	0	5,873.00	07/25/2012	20	82.00
TA2MM (Taxiway A2 McMinnville)	02	09/22/2001	AC	TAXIWAY	P	0	21,735.00	07/25/2012	11	97.00
TA3MM (Taxiway A3 McMinnville)	01	08/01/1992	AAC	TAXIWAY	P	0	18,008.00	07/25/2012	20	64.00
TA3MM (Taxiway A3 McMinnville)	02	09/22/2001	AC	TAXIWAY	P	0	14,828.00	07/25/2012	11	91.00
TAMM (Taxiway A McMinnville)	01	08/01/1992	AC	TAXIWAY	P	0	11,436.00	07/25/2012	20	64.00
TAMM (Taxiway A McMinnville)	02	09/22/2001	AC	TAXIWAY	P	0	143,160.00	07/25/2012	11	90.00
TAMM (Taxiway A McMinnville)	03	08/03/1992	AC	TAXIWAY	P	0	106,963.00	07/25/2012	20	83.00
TD1MM (Taxiway D1 McMinnville)	01	09/04/2009	AC	TAXIWAY	P	0	58,737.00	07/25/2012	3	100.00
TD2MM (Taxiway D2 McMinnville)	01	09/04/2009	AC	TAXIWAY	P	0	9,997.00	07/25/2012	3	100.00
TD3MM (Taxiway D3 McMinnville)	01	09/04/2009	AC	TAXIWAY	P	0	8,236.00	07/25/2012	3	100.00
TDMM (Taxiway D McMinnville)	01	09/04/2009	AC	TAXIWAY	P	0	94,389.00	07/25/2012	3	100.00
TDMM (Taxiway D McMinnville)	02	08/01/1992	AC	TAXIWAY	P	0	8,186.00	07/25/2012	20	64.00
THANGMM (Hangar Taxiway McMinnville)	01	09/04/2008	AC	TAXIWAY	S	0	52,865.00	07/25/2012	4	100.00

Age Category	Average Age At Inspection	Total Area (SqFt)	Number of Sections	Arithmetic Average PCI	PCI Standard Deviation	Weighted Average PCI
03-05	3.33	564,659.00	6	99.00	2.45	96.38
06-10	7.67	111,894.00	3	98.33	1.53	97.47
11-15	11.54	345,781.00	13	89.23	8.28	89.87
16-20	18.89	1,130,882.00	19	69.95	15.61	62.78
31-35	35.00	17,500.00	1	42.00	0.00	42.00
36-40	37.00	51,558.00	2	55.50	12.02	59.94
over 40	64.80	171,077.00	5	40.60	29.23	52.08
All	20.10	2,393,351.01	49	76.20	22.69	75.27

Appendix 3
Network Maintenance Report

**Network Maintenance Report
McMinnville Municipal Airport**

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Unit	Unit Cost	Work Cost	Total Cost
McMinnvill	A01MM	1	BLOCK CR	M	Crack Sealing - AC	5,334	Ft	\$0.75	\$4,000.45	\$4,000.45
McMinnvill	A01MM	2	BLOCK CR	M	Crack Sealing - AC	7,971	Ft	\$0.75	\$5,978.50	\$5,978.50
McMinnvill	A01MM	3	BLOCK CR	M	Crack Sealing - AC	10,680	Ft	\$0.75	\$8,009.59	\$8,009.59
McMinnvill	A01MM	6	BLOCK CR	M	Crack Sealing - AC	14,145	Ft	\$0.75	\$10,608.51	\$10,608.51
McMinnvill	A01MM	7	BLOCK CR	M	Crack Sealing - AC	9,958	Ft	\$0.75	\$7,468.73	\$7,468.73
McMinnvill	A01MM	8	BLOCK CR	M	Crack Sealing - AC	4,207	Ft	\$0.75	\$3,155.10	\$36,065.78
McMinnvill	A02MM	1	L & T CR	M	Crack Sealing - AC	66	Ft	\$0.75	\$49.50	\$49.50
McMinnvill	A02MM	2	L & T CR	M	Crack Sealing - AC	113	Ft	\$0.75	\$84.75	\$2,012.88
McMinnvill	A02MM	2	ALLIGATOR CR	M	Patching - AC Deep	129	SqFt	\$15.00	\$1,928.13	
McMinnvill	A02MM	3	L & T CR	M	Crack Sealing - AC	857	Ft	\$0.75	\$642.92	\$10,921.07
McMinnvill	A02MM	3	ALLIGATOR CR	M	Patching - AC Deep	685	SqFt	\$15.00	\$10,278.15	
McMinnvill	A02MM	4	L & T CR	M	Crack Sealing - AC	150	Ft	\$0.75	\$112.51	\$112.51
McMinnvill	A02MM	5	BLOCK CR	L	Crack Sealing - AC	3,788	Ft	\$0.75	\$2,841.23	\$2,841.23
McMinnvill	A02MM	6	BLOCK CR	L	Crack Sealing - AC	11,963	Ft	\$0.75	\$8,972.44	\$8,972.44
McMinnvill	A02MM	7	L & T CR	L	Crack Sealing - AC	76	Ft	\$0.75	\$57.00	\$57.00
McMinnvill	A02MM	8	L & T CR	M	Crack Sealing - AC	133	Ft	\$0.75	\$99.75	\$186.00
McMinnvill	A02MM	8	L & T CR	L	Crack Sealing - AC	115	Ft	\$0.75	\$86.25	
McMinnvill	A02MM	9	L & T CR	L	Crack Sealing - AC	105	Ft	\$0.75	\$78.97	\$78.97
McMinnvill	AH22MM	1	BLOCK CR	M	Crack Sealing - AC	1,347	Ft	\$0.75	\$1,010.26	\$2,610.58
McMinnvill	AH22MM	1	BLOCK CR	L	Crack Sealing - AC	2,134	Ft	\$0.75	\$1,600.32	
McMinnvill	AH22MM	2	L & T CR	L	Crack Sealing - AC	648	Ft	\$0.75	\$485.84	\$485.84
McMinnvill	R04MM	01A	BLOCK CR	L	Crack Sealing - AC	26,645	Ft	\$0.75	\$19,983.82	\$45,343.87
McMinnvill	R04MM	01A	BLOCK CR	M	Crack Sealing - AC	26,645	Ft	\$0.75	\$19,983.82	
McMinnvill	R04MM	01A	L & T CR	M	Crack Sealing - AC	3,235	Ft	\$0.75	\$2,425.86	
McMinnvill	R04MM	01A	L & T CR	L	Crack Sealing - AC	3,934	Ft	\$0.75	\$2,950.37	
McMinnvill	R04MM	01B	BLOCK CR	M	Crack Sealing - AC	34,639	Ft	\$0.75	\$25,978.97	\$25,978.97
McMinnvill	R04MM	01B	BLOCK CR	L	Crack Sealing - AC	18,652	Ft	\$0.75	\$13,988.68	
McMinnvill	R04MM	01B	L & T CR	M	Crack Sealing - AC	2,666	Ft	\$0.75	\$1,999.69	
McMinnvill	R04MM	01B	L & T CR	L	Crack Sealing - AC	5,420	Ft	\$0.75	\$4,064.95	
McMinnvill	R04MM	01C	BLOCK CR	M	Crack Sealing - AC	34,639	Ft	\$0.75	\$25,978.97	\$25,978.97

**Network Maintenance Report
McMinnville Municipal Airport**

Network	Branch	Section	Distress	Severity	Action	Maint. Quantity	Unit	Unit Cost	Work Cost	Total Cost
McMinnvill	R04MM	01C	BLOCK CR	L	Crack Sealing - AC	31,975	Ft	\$0.75	\$23,980.59	
McMinnvill	R04MM	01C	L & T CR	L	Crack Sealing - AC	1,748	Ft	\$0.75	\$1,311.27	
McMinnvill	R17MM	1	L & T CR	L	Crack Sealing - AC	5,356	Ft	\$0.75	\$4,017.08	\$4,017.08
McMinnvill	T01MM	1	L & T CR	M	Crack Sealing - AC	764	Ft	\$0.75	\$573.16	\$573.16
McMinnvill	T02MM	1	L & T CR	L	Crack Sealing - AC	453	Ft	\$0.75	\$339.96	\$339.96
McMinnvill	T03MM	2	BLOCK CR	M	Crack Sealing - AC	2,286	Ft	\$0.75	\$1,714.48	\$1,714.48
McMinnvill	T04MM	2	BLOCK CR	M	Crack Sealing - AC	3,752	Ft	\$0.75	\$2,813.57	\$2,813.57
McMinnvill	T05MM	1	L & T CR	L	Crack Sealing - AC	50	Ft	\$0.75	\$37.50	\$40.50
McMinnvill	T05MM	1	L & T CR	M	Crack Sealing - AC	4	Ft	\$0.75	\$3.00	
McMinnvill	T06MM	1	L & T CR	M	Crack Sealing - AC	6	Ft	\$0.75	\$4.50	\$4.50
McMinnvill	T07MM	1	L & T CR	M	Crack Sealing - AC	80	Ft	\$0.75	\$60.00	\$60.00
McMinnvill	T08MM	1	L & T CR	L	Crack Sealing - AC	52	Ft	\$0.75	\$39.00	\$39.00
McMinnvill	TA1MM	1	BLOCK CR	L	Crack Sealing - AC	4,100	Ft	\$0.75	\$3,074.86	\$3,074.86
McMinnvill	TA1MM	2	L & T CR	L	Crack Sealing - AC	874	Ft	\$0.75	\$655.26	\$655.26
McMinnvill	TA2MM	1	L & T CR	L	Crack Sealing - AC	250	Ft	\$0.75	\$187.50	\$249.00
McMinnvill	TA2MM	1	L & T CR	M	Crack Sealing - AC	82	Ft	\$0.75	\$61.50	
McMinnvill	TA2MM	2	L & T CR	L	Crack Sealing - AC	139	Ft	\$0.75	\$104.25	\$104.25
McMinnvill	TA3MM	1	BLOCK CR	L	Crack Sealing - AC	5,489	Ft	\$0.75	\$4,116.58	\$4,116.58
McMinnvill	TA3MM	2	L & T CR	L	Crack Sealing - AC	398	Ft	\$0.75	\$298.50	\$298.50
McMinnvill	TAMM	1	BLOCK CR	L	Crack Sealing - AC	3,486	Ft	\$0.75	\$2,614.24	\$2,614.24
McMinnvill	TAMM	2	L & T CR	L	Crack Sealing - AC	3,402	Ft	\$0.75	\$2,551.08	\$2,551.08
McMinnvill	TAMM	3	L & T CR	M	Crack Sealing - AC	947	Ft	\$0.75	\$710.29	\$3,414.18
McMinnvill	TAMM	3	L & T CR	L	Crack Sealing - AC	3,605	Ft	\$0.75	\$2,703.89	
McMinnvill	TDMM	2	BLOCK CR	L	Crack Sealing - AC	2,495	Ft	\$0.75	\$1,871.30	\$1,871.30
									TOTAL	\$238,747.39

Appendix 4
Re-Inspection Report

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 01 of 9 From: Taxiway 03 To: Section 02 Last Const.: 08/02/1977

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 17,500.00SqFt Length: 175.00Ft Width: 100.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 4 Surveyed: 3

Conditions: PCI : 42

Sample Number: 01 Type: R Area: 5,000.00SqFt PCI = 42
43 BLOCK CRACKING M 5,000.00 SqFt
52 RAVELING L 5,000.00 SqFt

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 42
43 BLOCK CRACKING M 5,000.00 SqFt
52 RAVELING L 5,000.00 SqFt

Sample Number: 03 Type: R Area: 5,000.00SqFt PCI = 42
43 BLOCK CRACKING M 5,000.00 SqFt
52 RAVELING L 5,000.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 02 of 9 From: Section 01 To: Section 03 Last Const.: 08/02/1996

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 26,153.00SqFt Length: 175.00Ft Width: 150.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 6 Surveyed: 3

Conditions: PCI: 42

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 42
43 BLOCK CRACKING M 5,000.00 SqFt
52 RAVELING L 5,000.00 SqFt

Sample Number: 05 Type: R Area: 4,897.00SqFt PCI = 42
43 BLOCK CRACKING M 4,897.00 SqFt
52 RAVELING L 4,897.00 SqFt

Sample Number: 06 Type: R Area: 3,756.00SqFt PCI = 42
43 BLOCK CRACKING M 3,756.00 SqFt
52 RAVELING L 3,756.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 03 of 9 From: Taxiway 01 To: FBO Hangar Last Const.: 08/02/1950

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 35,038.00SqFt Length: 300.00Ft Width: 150.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 7 Surveyed: 4

Conditions: PCI : 24

Sample Number: 01 Type: R Area: 3,076.00SqFt PCI = 25
43 BLOCK CRACKING M 3,076.00 SqFt
52 RAVELING M 3,076.00 SqFt

Sample Number: 02 Type: R Area: 4,578.00SqFt PCI = 22
43 BLOCK CRACKING M 4,578.00 SqFt
45 DEPRESSION L 4,578.00 SqFt

Sample Number: 04 Type: R Area: 5,000.00SqFt PCI = 25
43 BLOCK CRACKING M 5,000.00 SqFt
52 RAVELING M 5,000.00 SqFt

Sample Number: 07 Type: R Area: 5,000.00SqFt PCI = 25
43 BLOCK CRACKING M 5,000.00 SqFt
52 RAVELING M 5,000.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 04 of 9 From: Section 03 To: Fence Last Const.: 08/01/2001

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 5,415.00SqFt Length: 130.00Ft Width: 45.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI : 97

Sample Number: 01 Type: R Area: 5,415.00SqFt PCI = 97

45 DEPRESSION L 26.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 05 of 9 From: Taxiway 01, 02 To: Airport Office Last Const.: 08/02/1943
Surface: PCC Family: OR-Cat2-PCC-Central-AP-2012 Zone: KMMV Category: F Rank: P
Area: 68,330.00SqFt Length: 300.00Ft Width: 200.00Ft
Slabs: 364 Slab Width: 12.50Ft Slab Length: 15.00Ft Joint Length: 8,300.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 18 Surveyed: 8

Conditions: PCI: 92

Sample Number: 01 Type: R Area: 20.00Slabs PCI = 98
65 JOINT SEAL DAMAGE L 20.00 Slabs

Sample Number: 02 Type: R Area: 20.00Slabs PCI = 97
66 SMALL PATCH L 1.00 Slabs
65 JOINT SEAL DAMAGE L 20.00 Slabs

Sample Number: 03 Type: R Area: 20.00Slabs PCI = 97
65 JOINT SEAL DAMAGE L 20.00 Slabs
66 SMALL PATCH L 1.00 Slabs

Sample Number: 04 Type: R Area: 20.00Slabs PCI = 98
65 JOINT SEAL DAMAGE L 20.00 Slabs

Sample Number: 08 Type: R Area: 20.00Slabs PCI = 96
75 CORNER SPALLING L 1.00 Slabs
65 JOINT SEAL DAMAGE L 20.00 Slabs

Sample Number: 10 Type: R Area: 20.00Slabs PCI = 98
65 JOINT SEAL DAMAGE L 20.00 Slabs

Sample Number: 12 Type: R Area: 20.00Slabs PCI = 92
63 LINEAR CRACKING L 1.00 Slabs
66 SMALL PATCH L 1.00 Slabs
65 JOINT SEAL DAMAGE L 20.00 Slabs

Sample Number: 18 Type: R Area: 20.00Slabs PCI = 58
72 SHATTERED SLAB L 4.00 Slabs
63 LINEAR CRACKING L 6.00 Slabs
62 CORNER BREAK L 2.00 Slabs
65 JOINT SEAL DAMAGE L 20.00 Slabs

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 06 of 9 From: Taxiway 02 To: Hangars Last Const.: 08/02/1950

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 46,407.00SqFt Length: 360.00Ft Width: 140.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 6 Surveyed: 3

Conditions: PCI : 25

Sample Number: 02 Type: R Area: 7,393.00SqFt PCI = 25
43 BLOCK CRACKING M 7,393.00 SqFt
52 RAVELING M 7,393.00 SqFt

Sample Number: 04 Type: R Area: 7,142.00SqFt PCI = 25
43 BLOCK CRACKING M 7,142.00 SqFt
52 RAVELING M 7,142.00 SqFt

Sample Number: 06 Type: R Area: 7,021.00SqFt PCI = 25
43 BLOCK CRACKING M 7,021.00 SqFt
52 RAVELING M 7,021.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 07 of 9 From: Section 06 To: Hangars, Section 08 Last Const.: 08/01/1995

Surface: AAC Family: OR-Cat2-AAC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 32,672.00SqFt Length: 390.00Ft Width: 95.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 5 Surveyed: 3

Conditions: PCI: 47

Sample Number: 01 Type: R Area: 6,000.00SqFt PCI = 47
43 BLOCK CRACKING M 6,000.00 SqFt

Sample Number: 02 Type: R Area: 6,000.00SqFt PCI = 47
43 BLOCK CRACKING M 6,000.00 SqFt

Sample Number: 04 Type: R Area: 7,813.00SqFt PCI = 47
43 BLOCK CRACKING M 7,813.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 08 of 9 From: Section 07 To: Hangars Last Const.: 08/02/1950

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 13,802.00SqFt Length: 285.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 2

Conditions: PCI : 25

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 25

43 BLOCK CRACKING M 5,000.00 SqFt

52 RAVELING M 5,000.00 SqFt

Sample Number: 03 Type: R Area: 3,936.00SqFt PCI = 25

43 BLOCK CRACKING M 3,936.00 SqFt

52 RAVELING M 3,936.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A01MM Name: Apron 01 McMinnville Use: APRON Area: 309,377.01SqFt

Section: 09 of 9 From: Taxiway 01 To: Taxiway 02 Last Const.: 01/01/2005
Surface: PCC Family: OR-Cat2-PCC-Central-AP-2012 Zone: Category: Rank: P
Area: 64,060.00SqFt Length: 400.00Ft Width: 160.00Ft
Slabs: 342 Slab Width: 12.50Ft Slab Length: 15.00Ft Joint Length: 8,826.67Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 18 Surveyed: 8

Conditions: PCI: 97

Sample Number: 02 Type: R Area: 20.00Slabs PCI = 100
<NO DISTRESSES>

Sample Number: 05 Type: R Area: 20.00Slabs PCI = 100
<NO DISTRESSES>

Sample Number: 09 Type: R Area: 20.00Slabs PCI = 100
<NO DISTRESSES>

Sample Number: 10 Type: R Area: 20.00Slabs PCI = 100
<NO DISTRESSES>

Sample Number: 14 Type: R Area: 20.00Slabs PCI = 100
<NO DISTRESSES>

Sample Number: 15 Type: R Area: 20.00Slabs PCI = 86
63 LINEAR CRACKING L 4.00 Slabs

Sample Number: 16 Type: R Area: 20.00Slabs PCI = 100
<NO DISTRESSES>

Sample Number: 17 Type: R Area: 20.00Slabs PCI = 86
63 LINEAR CRACKING L 4.00 Slabs

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 01 of 9 From: Section 03 To: Hangar Last Const.: 08/02/1998

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 3,621.00SqFt Length: 120.00Ft Width: 30.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI : 80

Sample Number: 01 Type: R Area: 3,621.00SqFt PCI = 80

45 DEPRESSION L 58.00 SqFt

48 LONGITUDINAL/TRANSVERSE CRACKING M 66.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 02 of 9 From: Section 03 To: Hangar Last Const.: 08/02/1998

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 7,475.00SqFt Length: 230.00Ft Width: 30.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 2 Surveyed: 2

Conditions: PCI : 70

Sample Number: 01 Type: R Area: 4,088.00SqFt PCI = 63

41 ALLIGATOR CRACKING M 87.00 SqFt

Sample Number: 02 Type: R Area: 3,387.00SqFt PCI = 79

48 LONGITUDINAL/TRANSVERSE CRACKING M 113.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 03 of 9 From: Section 04 To: Hangars Last Const.: 08/02/1996

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 44,039.00SqFt Length: 270.00Ft Width: 250.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 9 Surveyed: 4

Conditions: PCI: 77

Sample Number: 04 Type: R Area: 4,100.00SqFt PCI = 45

41 ALLIGATOR CRACKING M 250.00 SqFt

48 LONGITUDINAL/TRANSVERSE CRACKING M 115.00 Ft

Sample Number: 05 Type: R Area: 5,625.00SqFt PCI = 87

48 LONGITUDINAL/TRANSVERSE CRACKING M 80.00 Ft

Sample Number: 06 Type: R Area: 5,625.00SqFt PCI = 86

48 LONGITUDINAL/TRANSVERSE CRACKING M 96.00 Ft

Sample Number: 08 Type: R Area: 3,504.00SqFt PCI = 84

48 LONGITUDINAL/TRANSVERSE CRACKING M 76.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 04 of 9 From: Section 06 To: Section 05 Last Const.: 08/02/1992

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 11,573.00SqFt Length: 365.00Ft Width: 20.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 2

Conditions: PCI : 87

Sample Number: 02 Type: R Area: 3,600.00SqFt PCI = 88

48 LONGITUDINAL/TRANSVERSE CRACKING M 40.00 Ft

Sample Number: 03 Type: R Area: 4,500.00SqFt PCI = 87

48 LONGITUDINAL/TRANSVERSE CRACKING M 65.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 05 of 9 From: Section 04 To: Hangars Last Const.: 08/02/1996

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 12,429.00SqFt Length: 520.00Ft Width: 25.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 2

Conditions: PCI: 64

Sample Number: 02 Type: R Area: 2,829.00SqFt PCI = 64
43 BLOCK CRACKING L 2,829.00 SqFt

Sample Number: 03 Type: R Area: 5,000.00SqFt PCI = 64
43 BLOCK CRACKING L 5,000.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 06 of 9 From: Taxiway 04 To: Hangars Last Const.: 08/02/1975

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 39,250.00SqFt Length: 755.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 8 Surveyed: 4

Conditions: PCI: 64

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 64
43 BLOCK CRACKING L 5,000.00 SqFt

Sample Number: 03 Type: R Area: 5,000.00SqFt PCI = 64
43 BLOCK CRACKING L 5,000.00 SqFt

Sample Number: 05 Type: R Area: 3,000.00SqFt PCI = 64
43 BLOCK CRACKING L 3,000.00 SqFt

Sample Number: 06 Type: R Area: 5,000.00SqFt PCI = 64
43 BLOCK CRACKING L 5,000.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 07 of 9 From: Section 06 To: Hangars Last Const.: 08/01/2000

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 18,950.00SqFt Length: 290.00Ft Width: 55.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 3

Conditions: PCI : 94

Sample Number: 01 Type: R Area: 6,300.00SqFt PCI = 88

45 DEPRESSION L 80.00 SqFt

48 LONGITUDINAL/TRANSVERSE CRACKING L 30.00 Ft

Sample Number: 02 Type: R Area: 4,600.00SqFt PCI = 96

48 LONGITUDINAL/TRANSVERSE CRACKING L 30.00 Ft

Sample Number: 03 Type: R Area: 8,050.00SqFt PCI = 97

48 LONGITUDINAL/TRANSVERSE CRACKING L 16.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 08 of 9 From: Section 07 To: Section 09 Last Const.: 09/20/2001

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 24,750.00SqFt Length: 290.00Ft Width: 75.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 3

Conditions: PCI: 89

Sample Number: 01 Type: R Area: 7,500.00SqFt PCI = 96

48 LONGITUDINAL/TRANSVERSE CRACKING L 40.00 Ft

Sample Number: 02 Type: R Area: 8,625.00SqFt PCI = 86

48 LONGITUDINAL/TRANSVERSE CRACKING L 30.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 77.00 Ft

Sample Number: 03 Type: R Area: 8,625.00SqFt PCI = 87

48 LONGITUDINAL/TRANSVERSE CRACKING L 45.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 56.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: A02MM Name: Apron 02 McMinnville Use: APRON Area: 207,421.00SqFt

Section: 09 of 9 From: Section 08 To: Hangars Last Const.: 09/20/2003

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: S

Area: 45,334.00SqFt Length: 290.00Ft Width: 137.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 7 Surveyed: 4

Conditions: PCI: 98

Sample Number: 01 Type: R Area: 6,000.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 03 Type: R Area: 5,910.00SqFt PCI = 96
48 LONGITUDINAL/TRANSVERSE CRACKING L 30.00 Ft

Sample Number: 05 Type: R Area: 5,842.00SqFt PCI = 96
48 LONGITUDINAL/TRANSVERSE CRACKING L 23.00 Ft

Sample Number: 07 Type: R Area: 5,067.00SqFt PCI = 100
<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: AH22MM Name: Hold Apron 22 McMinnville Use: APRON Area: 35,988.00SqFt

Section: 01 of 2 From: Taxiway A To: Section 02 Last Const.: 08/03/1992

Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: P

Area: 11,420.00SqFt Length: 230.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 2 Surveyed: 2

Conditions: PCI : 54

Sample Number: 01 Type: R Area: 5,178.00SqFt PCI = 54

43 BLOCK CRACKING L 3,000.00 SqFt

43 BLOCK CRACKING M 2,178.00 SqFt

Sample Number: 02 Type: R Area: 6,241.00SqFt PCI = 55

43 BLOCK CRACKING L 4,000.00 SqFt

43 BLOCK CRACKING M 2,241.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: AH22MM Name: Hold Apron 22 McMinnville Use: APRON Area: 35,988.00SqFt

Section: 02 of 2 From: Taxiway A1 To: Taxiway A Last Const.: 09/22/2001
Surface: AC Family: OR-Cat2-AC-Central-AP-2012 Zone: KMMV Category: F Rank: P
Area: 24,568.00SqFt Length: 375.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 5 Surveyed: 3

Conditions: PCI : 91

Sample Number: 01 Type: R Area: 5,118.00SqFt PCI = 92
48 LONGITUDINAL/TRANSVERSE CRACKING L 120.00 Ft

Sample Number: 03 Type: R Area: 5,000.00SqFt PCI = 90
48 LONGITUDINAL/TRANSVERSE CRACKING L 142.00 Ft

Sample Number: 04 Type: R Area: 4,597.00SqFt PCI = 91
48 LONGITUDINAL/TRANSVERSE CRACKING L 126.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: R04MM Name: Runway 04/22 McMinnville Use: RUNWAY Area: 813,000.00SqFt

Section: 01A of 3 From: Runway 22 End (East) To: Runway 04 End (West) Last Const.: 08/02/1992

Surface: AC Family: OR-Cat2-AC-Central-RW-2012 Zone: KMMV Category: F Rank: P

Area: 271,000.00SqFt Length: 5,420.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 54 Surveyed: 6

Conditions: PCI : 61

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 69

48 LONGITUDINAL/TRANSVERSE CRACKING L 150.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 250.00 Ft

Sample Number: 10 Type: R Area: 5,000.00SqFt PCI = 54

43 BLOCK CRACKING L 3,000.00 SqFt

43 BLOCK CRACKING M 2,000.00 SqFt

Sample Number: 21 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 32 Type: R Area: 5,000.00SqFt PCI = 51

43 BLOCK CRACKING L 2,000.00 SqFt

43 BLOCK CRACKING M 3,000.00 SqFt

Sample Number: 40 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 54 Type: R Area: 6,000.00SqFt PCI = 79

48 LONGITUDINAL/TRANSVERSE CRACKING L 300.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 120.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: R04MM Name: Runway 04/22 McMinnville Use: RUNWAY Area: 813,000.00SqFt

Section: 01B of 3 From: Runway 22 End (East) To: Runway 04 End (West) Last Const.: 08/02/1992

Surface: AC Family: OR-Cat2-AC-Central-RW-2012 Zone: KMMV Category: F Rank: P

Area: 271,000.00SqFt Length: 5,420.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 54 Surveyed: 6

Conditions: PCI : 58

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 68

48 LONGITUDINAL/TRANSVERSE CRACKING L 120.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 280.00 Ft

Sample Number: 10 Type: R Area: 5,000.00SqFt PCI = 51

43 BLOCK CRACKING L 2,000.00 SqFt

43 BLOCK CRACKING M 3,000.00 SqFt

Sample Number: 21 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 32 Type: R Area: 5,000.00SqFt PCI = 47

43 BLOCK CRACKING M 5,000.00 SqFt

Sample Number: 40 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 54 Type: R Area: 6,000.00SqFt PCI = 74

48 LONGITUDINAL/TRANSVERSE CRACKING L 500.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 25.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: R04MM Name: Runway 04/22 McMinnville Use: RUNWAY Area: 813,000.00SqFt

Section: 01C of 3 From: Runway 22 End (East) To: Runway 04 End (West) Last Const.: 08/02/1992

Surface: AC Family: OR-Cat2-AC-Central-RW-2012 Zone: KMMV Category: F Rank: P

Area: 271,000.00SqFt Length: 5,420.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 54 Surveyed: 6

Conditions: PCI : 60

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 10 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 21 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 32 Type: R Area: 5,000.00SqFt PCI = 51

43 BLOCK CRACKING L 2,000.00 SqFt

43 BLOCK CRACKING M 3,000.00 SqFt

Sample Number: 40 Type: R Area: 5,000.00SqFt PCI = 53

43 BLOCK CRACKING L 2,500.00 SqFt

43 BLOCK CRACKING M 2,500.00 SqFt

Sample Number: 54 Type: R Area: 6,000.00SqFt PCI = 89

48 LONGITUDINAL/TRANSVERSE CRACKING L 200.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: R17MM Name: Runway 17/35 McMinnville Use: RUNWAY Area: 340,435.00SqFt

Section: 01 of 1 From: Runway 04/22 To: Runway 35 End (South) Last Const.: 09/04/2008

Surface: AC Family: OR-Cat2-AC-Central-RW-2012 Zone: KMMV Category: F Rank: P

Area: 340,435.00SqFt Length: 4,500.00Ft Width: 75.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 46 Surveyed: 6

Conditions: PCI: 94

Sample Number: 03 Type: R Area: 5,625.00SqFt PCI = 98
48 LONGITUDINAL/TRANSVERSE CRACKING L 6.00 Ft

Sample Number: 14 Type: R Area: 5,625.00SqFt PCI = 91
48 LONGITUDINAL/TRANSVERSE CRACKING L 150.00 Ft

Sample Number: 26 Type: R Area: 5,625.00SqFt PCI = 91
48 LONGITUDINAL/TRANSVERSE CRACKING L 150.00 Ft

Sample Number: 43 Type: R Area: 5,625.00SqFt PCI = 94
48 LONGITUDINAL/TRANSVERSE CRACKING L 75.00 Ft

Sample Number: 54 Type: R Area: 5,625.00SqFt PCI = 94
48 LONGITUDINAL/TRANSVERSE CRACKING L 75.00 Ft

Sample Number: 60 Type: R Area: 5,625.00SqFt PCI = 94
48 LONGITUDINAL/TRANSVERSE CRACKING L 75.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T01MM Name: Taxiway 01 McMinnville Use: TAXIWAY Area: 27,631.00SqFt

Section: 01 of 1 From: Taxiway A To: Apron 01 Last Const.: 09/22/2001

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P

Area: 27,631.00SqFt Length: 350.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 5 Surveyed: 3

Conditions: PCI: 81

Sample Number: 01 Type: R Area: 5,403.00SqFt PCI = 83
48 LONGITUDINAL/TRANSVERSE CRACKING M 124.00 Ft

Sample Number: 02 Type: R Area: 5,374.00SqFt PCI = 82
48 LONGITUDINAL/TRANSVERSE CRACKING M 142.00 Ft

Sample Number: 03 Type: R Area: 6,433.00SqFt PCI = 80
48 LONGITUDINAL/TRANSVERSE CRACKING M 210.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T02MM Name: Taxiway 02 McMinnville Use: TAXIWAY Area: 28,271.00SqFt

Section: 01 of 1 From: Taxiway A To: Apron 01 Last Const.: 09/22/2001

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P

Area: 28,271.00SqFt Length: 350.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 5 Surveyed: 3

Conditions: PCI: 94

Sample Number: 03 Type: R Area: 6,944.00SqFt PCI = 95
48 LONGITUDINAL/TRANSVERSE CRACKING L 82.00 Ft

Sample Number: 04 Type: R Area: 5,194.00SqFt PCI = 93
48 LONGITUDINAL/TRANSVERSE CRACKING L 104.00 Ft

Sample Number: 05 Type: R Area: 5,263.00SqFt PCI = 93
48 LONGITUDINAL/TRANSVERSE CRACKING L 93.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T03MM Name: Taxiway 03 McMinnville Use: TAXIWAY Area: 10,000.00SqFt

Section: 01 of 2 From: Apron 01 To: Taxiway 01 Last Const.: 09/01/2005

Surface: AAC Family: OR-Cat2-AAC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 2,500.00SqFt Length: 50.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Sample Number: 01 Type: R Area: 2,500.00SqFt PCI = 100

<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T03MM Name: Taxiway 03 McMinnville Use: TAXIWAY Area: 10,000.00SqFt

Section: 02 of 2 From: Apron 01 To: Taxiway 02 Last Const.: 08/03/1943

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 7,500.00SqFt Length: 150.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI : 37

Sample Number: 01 Type: R Area: 7,500.00SqFt PCI = 37

43 BLOCK CRACKING M 7,500.00 SqFt

52 RAVELING L 7,500.00 SqFt

50 PATCHING L 400.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T04MM Name: Taxiway 04 McMinnville Use: TAXIWAY Area: 19,332.00SqFt

Section: 01 of 2 From: Taxiway A To: Section 02 Last Const.: 09/22/2001

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 7,024.00SqFt Length: 165.00Ft Width: 35.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI: 100

Sample Number: 01 Type: R Area: 7,024.00SqFt PCI = 100

<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T04MM Name: Taxiway 04 McMinnville Use: TAXIWAY Area: 19,332.00SqFt

Section: 02 of 2 From: Apron 02 To: Section 01 Last Const.: 08/02/1975

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 12,308.00SqFt Length: 360.00Ft Width: 34.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 2

Conditions: PCI: 47

Sample Number: 01 Type: R Area: 5,091.00SqFt PCI = 47
43 BLOCK CRACKING M 5,091.00 SqFt

Sample Number: 02 Type: R Area: 5,080.00SqFt PCI = 47
43 BLOCK CRACKING M 5,080.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T05MM Name: Taxiway 05 McMinnville Use: TAXIWAY Area: 2,136.00SqFt

Section: 01 of 1 From: Taxiway A To: Future Expansion Last Const.: 08/03/1992

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 2,136.00SqFt Length: 35.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI: 87

Sample Number: 01 Type: R Area: 2,136.00SqFt PCI = 87

48 LONGITUDINAL/TRANSVERSE CRACKING L 50.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 4.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T06MM Name: Taxiway 06 McMinnville Use: TAXIWAY Area: 2,136.00SqFt

Section: 01 of 1 From: Taxiway A To: Future Expansion Last Const.: 08/03/1992

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 2,136.00SqFt Length: 35.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI: 94

Sample Number: 01 Type: R Area: 2,136.00SqFt PCI = 94

48 LONGITUDINAL/TRANSVERSE CRACKING M 6.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T07MM Name: Taxiway 07 McMinnville Use: TAXIWAY Area: 4,472.00SqFt

Section: 01 of 1 From: Apron 01 To: Hangars Last Const.: 08/02/1995

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 4,472.00SqFt Length: 210.00Ft Width: 20.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI : 81

Sample Number: 01 Type: R Area: 4,472.00SqFt PCI = 81

48 LONGITUDINAL/TRANSVERSE CRACKING M 80.00 Ft

50 PATCHING L 60.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: T08MM Name: Taxiway 08 McMinnville Use: TAXIWAY Area: 6,935.00SqFt

Section: 01 of 1 From: Apron To: Hangars Last Const.: 08/02/1995

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: S

Area: 6,935.00SqFt Length: 325.00Ft Width: 20.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI : 96

Sample Number: 01 Type: R Area: 6,935.00SqFt PCI = 96

48 LONGITUDINAL/TRANSVERSE CRACKING L 52.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TA1MM Name: Taxiway A1 McMinnville Use: TAXIWAY Area: 31,804.00SqFt

Section: 01 of 2 From: Runway 22 End (East) To: Section 02 Last Const.: 08/01/1992
Surface: AAC Family: OR-Cat2-AAC-Central-TW-2012 Zone: KMMV Category: F Rank: P
Area: 13,451.00SqFt Length: 180.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 2

Conditions: PCI: 64

Sample Number: 01 Type: R Area: 4,899.00SqFt PCI = 64
43 BLOCK CRACKING L 4,899.00 SqFt

Sample Number: 03 Type: R Area: 4,328.00SqFt PCI = 64
43 BLOCK CRACKING L 4,328.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TA1MM Name: Taxiway A1 McMinnville Use: TAXIWAY Area: 31,804.00SqFt

Section: 02 of 2 From: Section 01 To: Taxiway A Last Const.: 09/22/2001
Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P
Area: 18,353.00SqFt Length: 285.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 4 Surveyed: 3

Conditions: PCI: 86

Sample Number: 01 Type: R Area: 3,486.00SqFt PCI = 85
48 LONGITUDINAL/TRANSVERSE CRACKING L 176.00 Ft

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 86
48 LONGITUDINAL/TRANSVERSE CRACKING L 228.00 Ft

Sample Number: 03 Type: R Area: 5,000.00SqFt PCI = 86
48 LONGITUDINAL/TRANSVERSE CRACKING L 238.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TA2MM Name: Taxiway A2 McMinnville Use: TAXIWAY Area: 27,608.00SqFt

Section: 01 of 2 From: Runway 04/22 Midfield To: Section 02 Last Const.: 08/01/1992
Surface: AAC Family: OR-Cat2-AAC-Central-TW-2012 Zone: KMMV Category: F Rank: P
Area: 5,873.00SqFt Length: 120.00Ft Width: 40.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 1 Surveyed: 1

Conditions: PCI : 82

Sample Number: 01	Type: R	Area: 5,873.00SqFt	PCI = 82
48 LONGITUDINAL/TRANSVERSE CRACKING	L	250.00 Ft	
48 LONGITUDINAL/TRANSVERSE CRACKING	M	82.00 Ft	

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TA2MM Name: Taxiway A2 McMinnville Use: TAXIWAY Area: 27,608.00SqFt

Section: 02 of 2 From: Section 01 To: Taxiway A Last Const.: 09/22/2001
Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P
Area: 21,735.00SqFt Length: 180.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 5 Surveyed: 5

Conditions: PCI : 97

Sample Number: 01 Type: R Area: 3,215.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 02 Type: R Area: 3,215.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 03 Type: R Area: 4,479.00SqFt PCI = 96
48 LONGITUDINAL/TRANSVERSE CRACKING L 31.00 Ft

Sample Number: 04 Type: R Area: 5,413.00SqFt PCI = 95
48 LONGITUDINAL/TRANSVERSE CRACKING L 46.00 Ft

Sample Number: 05 Type: R Area: 5,413.00SqFt PCI = 95
48 LONGITUDINAL/TRANSVERSE CRACKING L 62.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TA3MM Name: Taxiway A3 McMinnville Use: TAXIWAY Area: 32,836.00SqFt

Section: 01 of 2 From: Runway 04/22 To: Section 02 Last Const.: 08/01/1992
Surface: AAC Family: OR-Cat2-AAC-Central-TW-2012 Zone: KMMV Category: F Rank: P
Area: 18,008.00SqFt Length: 270.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 4 Surveyed: 3

Conditions: PCI: 64

Sample Number: 01 Type: R Area: 5,000.00SqFt PCI = 64
43 BLOCK CRACKING L 5,000.00 SqFt

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 64
43 BLOCK CRACKING L 5,000.00 SqFt

Sample Number: 03 Type: R Area: 3,854.00SqFt PCI = 64
43 BLOCK CRACKING L 3,854.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TA3MM Name: Taxiway A3 McMinnville Use: TAXIWAY Area: 32,836.00SqFt

Section: 02 of 2 From: Taxiway A To: Section 01 Last Const.: 09/22/2001

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P

Area: 14,828.00SqFt Length: 295.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 3 Surveyed: 3

Conditions: PCI: 91

Sample Number: 01 Type: R Area: 5,000.00SqFt PCI = 87
48 LONGITUDINAL/TRANSVERSE CRACKING L 200.00 Ft

Sample Number: 02 Type: R Area: 5,000.00SqFt PCI = 92
48 LONGITUDINAL/TRANSVERSE CRACKING L 110.00 Ft

Sample Number: 03 Type: R Area: 4,828.00SqFt PCI = 93
48 LONGITUDINAL/TRANSVERSE CRACKING L 88.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TAMM Name: Taxiway A McMinnville Use: TAXIWAY Area: 261,559.00SqFt

Section: 01 of 3 From: Taxiway A1 To: Section 02 Last Const.: 08/01/1992
Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P
Area: 11,436.00SqFt Length: 228.00Ft Width: 50.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 2 Surveyed: 2

Conditions: PCI: 64

Sample Number: 01 Type: R Area: 5,023.00SqFt PCI = 64
43 BLOCK CRACKING L 5,023.00 SqFt

Sample Number: 02 Type: R Area: 6,414.00SqFt PCI = 64
43 BLOCK CRACKING L 6,414.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TAMM Name: Taxiway A McMinnville Use: TAXIWAY Area: 261,559.00SqFt

Section: 02 of 3 From: Taxiway A3 To: Section 01 Last Const.: 09/22/2001

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P

Area: 143,160.00SqFt Length: 2,763.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 28 Surveyed: 5

Conditions: PCI: 90

Sample Number: 10 Type: R Area: 5,000.00SqFt PCI = 91

48 LONGITUDINAL/TRANSVERSE CRACKING L 122.00 Ft

Sample Number: 12 Type: R Area: 5,000.00SqFt PCI = 84

48 LONGITUDINAL/TRANSVERSE CRACKING L 86.00 Ft

53 RUTTING L 15.00 SqFt

Sample Number: 16 Type: R Area: 5,000.00SqFt PCI = 87

48 LONGITUDINAL/TRANSVERSE CRACKING L 212.00 Ft

Sample Number: 20 Type: R Area: 5,000.00SqFt PCI = 89

48 LONGITUDINAL/TRANSVERSE CRACKING L 160.00 Ft

Sample Number: 24 Type: R Area: 5,000.00SqFt PCI = 96

48 LONGITUDINAL/TRANSVERSE CRACKING L 14.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TAMM Name: Taxiway A McMinnville Use: TAXIWAY Area: 261,559.00SqFt

Section: 03 of 3 From: Taxiway A3 To: Runway 04 End (West) Last Const.: 08/03/1992

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KMMV Category: F Rank: P

Area: 106,963.00SqFt Length: 2,100.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 21 Surveyed: 5

Conditions: PCI : 83

Sample Number: 01 Type: R Area: 6,880.00SqFt PCI = 82

48 LONGITUDINAL/TRANSVERSE CRACKING L 300.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 38.00 Ft

Sample Number: 03 Type: R Area: 5,000.00SqFt PCI = 87

48 LONGITUDINAL/TRANSVERSE CRACKING L 220.00 Ft

Sample Number: 14 Type: R Area: 5,000.00SqFt PCI = 88

48 LONGITUDINAL/TRANSVERSE CRACKING L 188.00 Ft

Sample Number: 15 Type: R Area: 5,000.00SqFt PCI = 79

48 LONGITUDINAL/TRANSVERSE CRACKING L 112.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 100.00 Ft

Sample Number: 16 Type: R Area: 5,000.00SqFt PCI = 79

48 LONGITUDINAL/TRANSVERSE CRACKING L 86.00 Ft

48 LONGITUDINAL/TRANSVERSE CRACKING M 100.00 Ft

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TD1MM Name: Taxiway D1 McMinnville Use: TAXIWAY Area: 58,737.00SqFt

Section: 01 of 1 From: Runway 17/35 To: Runway 04/22 Last Const.: 09/04/2009
Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: Category: Rank: P
Area: 58,737.00SqFt Length: 1,570.00Ft Width: 35.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 11 Surveyed: 4

Conditions: PCI: 100

Sample Number: 01 Type: R Area: 7,318.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 04 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 07 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 10 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TD2MM Name: Taxiway D2 McMinnville Use: TAXIWAY Area: 9,997.00SqFt

Section: 01 of 1 From: Runway 17/35 To: Taxiway D Last Const.: 09/04/2009

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: Category: Rank: P

Area: 9,997.00SqFt Length: 180.00Ft Width: 40.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 2 Surveyed: 2

Conditions: PCI: 100

Sample Number: 01 Type: R Area: 5,298.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 02 Type: R Area: 4,698.00SqFt PCI = 100
<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TD3MM Name: Taxiway D3 McMinnville Use: TAXIWAY Area: 8,236.00SqFt

Section: 01 of 1 From: Runway 17/35, 35 End To: Taxiway D Last Const.: 09/04/2009

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: Category: Rank: P

Area: 8,236.00SqFt Length: 180.00Ft Width: 37.50Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 2 Surveyed: 2

Conditions: PCI: 100

Sample Number: 01 Type: R Area: 4,399.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 02 Type: R Area: 3,837.00SqFt PCI = 100
<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TDMM Name: Taxiway D McMinnville Use: TAXIWAY Area: 102,575.00SqFt

Section: 01 of 2 From: Taxiway D1 To: Taxiway D3 Last Const.: 09/04/2009

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: Category: Rank: P

Area: 94,389.00SqFt Length: 2,672.00Ft Width: 35.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 18 Surveyed: 5

Conditions: PCI: 100

Sample Number: 02 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 05 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 09 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 13 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 17 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: TDMM Name: Taxiway D McMinnville Use: TAXIWAY Area: 102,575.00SqFt

Section: 02 of 2 From: Runway 04/22 To: - Last Const.: 08/01/1992

Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: KSPB Category: E Rank: P

Area: 8,186.00SqFt Length: 130.00Ft Width: 50.00Ft

Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 2 Surveyed: 2

Conditions: PCI: 64

Sample Number: 01 Type: R Area: 4,430.00SqFt PCI = 64
43 BLOCK CRACKING L 4,430.00 SqFt

Sample Number: 02 Type: R Area: 3,756.00SqFt PCI = 64
43 BLOCK CRACKING L 3,756.00 SqFt

Re-inspection Report

ODOT2012

Report Generated Date: August 20, 2012

Network: McMinnvill Name: McMinnville Municipal

Branch: THANGMM Name: Hangar Taxiway McMinnvill Use: TAXIWAY Area: 52,865.00SqFt

Section: 01 of 1 From: Taxiway A To: Apron 02 Last Const.: 09/04/2008
Surface: AC Family: OR-Cat2-AC-Central-TW-2012 Zone: Category: Rank: S
Area: 52,865.00SqFt Length: 1,192.00Ft Width: 35.00Ft
Shoulder: Street Type: Grade: 0.00 Lanes: 0

Last Insp. Date: 07/25/2012 Total Samples: 10 Surveyed: 4

Conditions: PCI: 100

Sample Number: 02 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 04 Type: R Area: 5,250.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 05 Type: R Area: 5,848.00SqFt PCI = 100
<NO DISTRESSES>

Sample Number: 07 Type: R Area: 5,450.00SqFt PCI = 100
<NO DISTRESSES>