

Evergreen Elementary School

Redmond SD 2J

Desc_sch07A

Building Type School	County Deschutes	
Street 437 S 9th St		
City Redmond	State OR	Zip 97756
Latitude 44.27306	Longitude 121.17805	
Tracking Code RVS in 2006	Inspection Date 6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	URM	3.4	-1.5	-0.5	-0.4	0	-0.4	0	0	0.6
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Evergreen Elementary School

Final RVS Score

Final Type	Final Score
URM	0.6

FEMA-154 Collapse Potential

High (>10%)

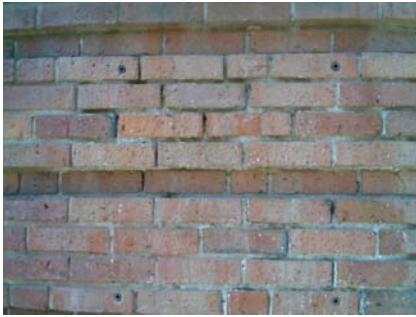


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Evergreen Elementary School

Desc_sch07A

Enrollment 593	Year Built (Field Verified) 1921	Year Built (Alt. Source) 1921	Est. Decade Built 1920
Total Area (square ft) 64340	Number of Stories 2	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners: T shaped None None		Vertical Irregularities Steps in Elevation View: Single Change None None	
Falling Hazards Parapets: Unreinforced Around Entire Building Other: Ornamental Hazard Over Exit Unreinforced Chimneys		Poor Conditions None None None	
 E Primary Structural Type headers forming an english bond		 SE Falling Hazard cornice ,parapet	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Evergreen Elementary School

Redmond SD 2J

Desc_sch07B

Building Type	County	
School	Deschutes	
Street		
437 S 9th St		
City	State	Zip
Redmond	OR	97756
Latitude	Longitude	
44.2729	121.17882	
Tracking Code	Inspection Date	
RVS in 2006	6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	0	0	0	-0.8	0	0	0.8
Secondary	RM1	3.6	-2	0	0	0	-0.8	0	0	0.8
Tertiary		0	0	0	0	0	0	0	0	0

Evergreen Elementary School

Final RVS Score

Final Type	Final Score
C2	0.8

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Evergreen Elementary School

Desc_sch07B

Enrollment 593	Year Built (Field Verified) 1921	Year Built (Alt. Source) 1921	Est. Decade Built 1950
Total Area (square ft) 64340	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities Steps in Elevation View: 2 to 3 Changes None None	
Falling Hazards None None None		Poor Conditions None None None	
 SW General Site Irregularities			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Evergreen Elementary School

Redmond SD 2J

Desc_sch07C

Building Type School	County Deschutes	
Street 437 S 9th St		
City Redmond	State OR	Zip 97756
Latitude 44.2729	Longitude 121.17914	
Tracking Code RVS in 2006	Inspection Date 6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	0	0	0	-0.8	0	0	0.8
Secondary	RM1	3.6	-2	0	0	0	-0.8	0	0	0.8
Tertiary		0	0	0	0	0	0	0	0	0

Evergreen Elementary School

Final RVS Score

Final Type	Final Score
C2	0.8

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Evergreen Elementary School

Desc_sch07C

Enrollment 593	Year Built (Field Verified) 1921	Year Built (Alt. Source) 1921	Est. Decade Built 1950
Total Area (square ft) 64340	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities Steps in Elevation View: Single Change None None	
Falling Hazards None None None		Poor Conditions None None None	

Evergreen Elementary School

Redmond SD 2J

Desc_sch07D

Building Type School	County Deschutes	
Street 437 S 9th St		
City Redmond	State OR	Zip 97756
Latitude 44.27333	Longitude 121.179	
Tracking Code RVS in 2006	Inspection Date 6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	0	-0.5	0	0	-0.8	0	0	2.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Evergreen Elementary School

Final RVS Score

Final Type	Final Score
RM1	2.3

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Evergreen Elementary School

Desc_sch07D

Enrollment 593	Year Built (Field Verified) 1921	Year Built (Alt. Source) 1921	Est. Decade Built 1960
Total Area (square ft) 64340	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners: L Shaped None None		Vertical Irregularities Steps in Elevation View: Single Change None None	
Falling Hazards None None None		Poor Conditions None None None	