

Whipple Fine Arts

Umpqua CC

Doug_coc08A

Building Type		County	
Community_College		Douglas	
Street			
1140 Umpqua College Rd			
City	State	Zip	
Roseburg	OR	97470	
Latitude		Longitude	
43.29033		123.33503	
Tracking Code		Inspection Date	
RVS in 2006		8/25/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	-2	-0.5	0	-2.4	0	0	0	-1.1
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Whipple Fine Arts

Final RVS Score

Final Type

Final Score

W2

-1.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1979	1979	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
		No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Building On Hill or Sloped Site
Non-Parallel System	Internal Discontinuous Diaphragm (large internal opening)
Out of Plane Lateral-Force-Resistance Elements	Steps in Elevation View: Very Irregular Changes

Falling Hazards	Poor Conditions
None	None
None	None
None	None



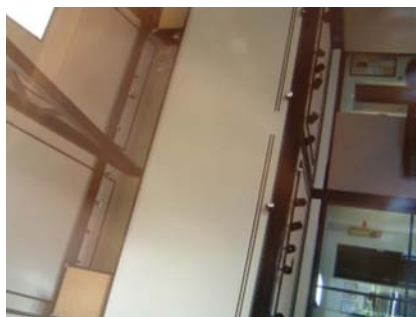
S Vertical Irregularity Tertiary



SW Vertical Irregularity Primary



W Vertical Irregularity Tertiary

NE Plan Irregularity Primary
non-parallel system as well

SW Vertical Irregularity Secondary



SE Plan Irregularity Tertiary