

South Gilliam County RFPD

Gill_fir04A

South Gilliam County RFPD

Building Type	County	
Fire - RFPD	Gilliam	
Street		
200 N. Main		
City	State	Zip
Condon	OR	97823
Latitude	Longitude	
45.23828	120.18451	
Tracking Code	Inspection Date	
RVS in 2006	8/29/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	URM	3.4	0	-0.5	-0.4	0	-0.4	0	0	2.1
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

South Gilliam County RFPD

Final RVS Score

Final Type	Final Score
URM	2.1

FEMA-154 Collapse Potential

Low (<1%)

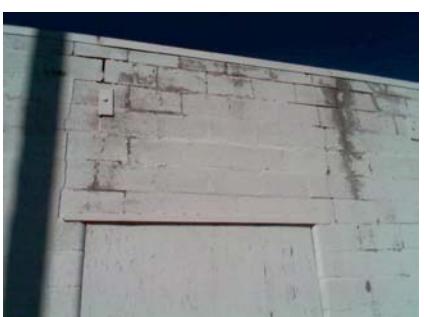


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

South Gilliam County RFPD

Gill_fir04A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1930
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
2736	1	No	No
Plan Irregularities		Vertical Irregularities	
Torsion: Eccentric Stiffness		None	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Parapets: Unreinforced Around Entire Building		Cracks	
None		Poor Masonry	
None		None	
			
N	Building Name	W	Plan Irregularity Primary
			
S	Primary Structural Type	S	Poor Condition
			
S	Elevation View	S	Elevation View
			
E	Poor Condition	E	Poor Condition



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries