

# Mountain View Hospital - Madras

Jeff\_hos01A

NFP - Mountain View

Building Type Hospital	County Jefferson	
Street 470 NE A St		
City Madras	State OR	Zip 97741
Latitude 44.63792	Longitude 121.12146	
Tracking Code RVS in 2006	Inspection Date 7/29/2006	



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Secondary	C2	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Tertiary	S3	3.8	0	-0.5	0	0	-0.6	0	0	2.7

Mountain View Hospital - Madras

## Final RVS Score

Final Type	Final Score
RM1	0.3

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Mountain View Hospital - Madras

Jeff\_hos01A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1967	1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners:Other (Adjacent Build/Entity)		Steps in Elevation View: Very Irregular Changes (Adjacent Building/Ent)	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
SE Elevation View		NE Elevation View	
		N Other	
1197 additon to jeff_ho01a including a remodel of a large portion of it.			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Mountain View Hospital - Madras

NFP - Mountain View

Jeff\_hos01B

Building Type Hospital	County Jefferson	
Street 470 NE A St		
City Madras	State OR	Zip 97741
Latitude 44.63785	Longitude 121.12067	
Tracking Code RVS in 2006	Inspection Date 7/29/2006	



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Secondary	C2	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Tertiary	S2	3.6	-2	-0.5	0	0	-0.8	0	0	0.3

Mountain View Hospital - Madras

## Final RVS Score

Final Type	Final Score
RM1	0.3

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Mountain View Hospital - Madras

Jeff\_hos01B


Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1967	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners:Other (Adjacent Build/Entity)		Steps in Elevation View: 2 to 3 Changes (Adjacent Building/Entity)	
Reentrant Corners: Other		None	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
S	Elevation View	NW	Elevation View

# Mountain View Hospital - Madras

NFP - Mountain View

Jeff\_hos01C

Building Type Hospital	County Jefferson	
Street 470 NE A St		
City Madras	State OR	Zip 97741
Latitude 44.63779	Longitude 121.12038	
Tracking Code RVS in 2006	Inspection Date 7/29/2006	

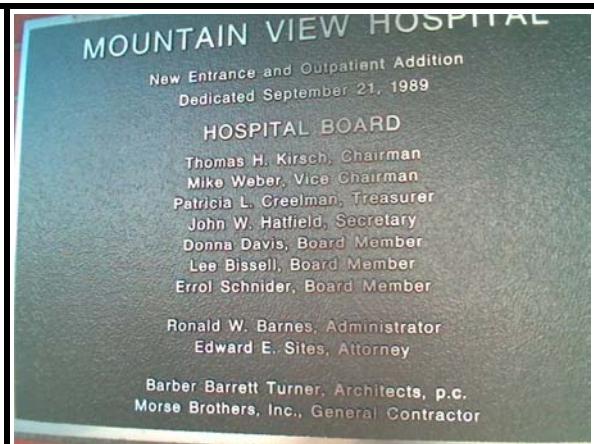

Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Secondary	C2	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Tertiary	S2	3.6	-2	-0.5	0	0	-0.8	0	0	0.3

Mountain View Hospital - Madras

## Final RVS Score

Final Type	Final Score
RM1	0.3

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Mountain View Hospital - Madras

Jeff\_hos01C

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1989	1967	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners:Other (Adjacent Build/Entity)		Steps in Elevation View: Single Change (Adjacent Building/Entity)	
Reentrant Corners: Other		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Ornamental Hazard Over Exit		None	
None		None	
None		None	
			
SE General Site		SE Falling Hazard	