

Riverside - K Building

Jose_coc06A

Rogue CC

| | | |
|------------------------------------|------------------------------|--------------|
| Building Type Community_College | County Josephine | |
| Street 3345 Redwood Hwy | | |
| City Grants Pass | State OR | Zip 97527 |
| Latitude 42.41169 | Longitude 123.39248 | |
| Tracking Code RVS in 2006 | Inspection Date 8/30/2006 | |



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

| | Type | Basic Score | Vert Irreg | Plan Irreg | Pre-Code | Post-Bench | Soil C | Soil D | Soil E | RVS Score |
|-----------|------|-------------|------------|------------|----------|------------|--------|--------|--------|-----------|
| Primary | W1 | 4.4 | -2.5 | -0.5 | -1 | 0 | 0 | 0 | 0 | 0.4 |
| Secondary | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| Tertiary | | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |


Riverside - K Building

Final RVS Score

| Final Type | Final Score |
|------------|-------------|
| W1 | 0.4 |

FEMA-154 Collapse Potential

High (>10%)

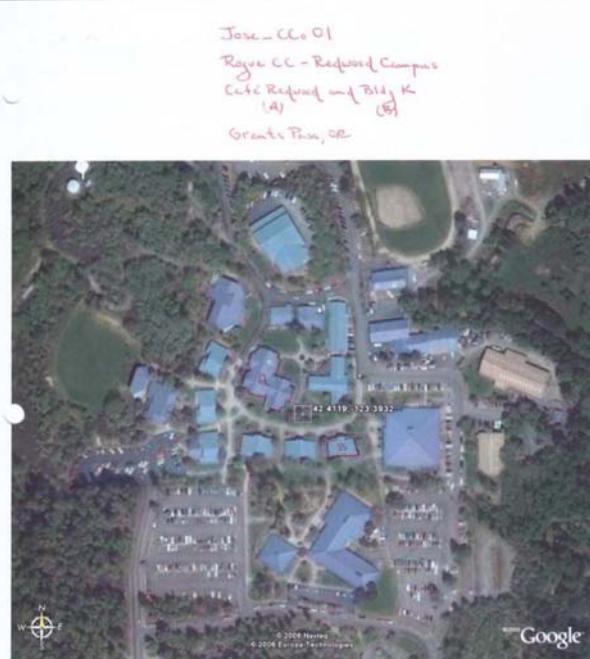

Riverside - K Building

Jose_coc06A

| | | | |
|--|-----------------------------|--|-------------------------------|
| Enrollment | Year Built (Field Verified) | Year Built (Alt. Source) | Est. Decade Built |
| | 1940 | 1940 | 1960 |
| Total Area (square ft) | Number of Stories | Basement | Pounding Potential |
| 8565 | 2 | No | No |
| Plan Irregularities | | Vertical Irregularities | |
| Reentrant Corners: Other | | Steps in Elevation View: 2 to 3 Changes | |
| None | | None | |
| None | | None | |
| Falling Hazards | | Poor Conditions | |
| None | | None | |
| None | | None | |
| None | | None | |
|  | |  | |
| S | Plan Irregularity Primary | S | Vertical Irregularity Primary |
| | |  | |
| | | SE | General Site |



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries