

Madrona Elementary School

Three Rivers/Josephine County SD

Jose_sch19A

Building Type	County	
School	Josephine	
Street		
520 Detrick Dr.		
City	State	Zip
Grants Pass	OR	97527
Latitude	Longitude	
42.3623	123.3628	
Tracking Code	Inspection Date	
RVS in 2006	7/28/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	0	0	0	0	0	0	1.8
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Madrona Elementary School

Final RVS Score

Final Type	Final Score
RM1	1.8

FEMA-154 Collapse Potential

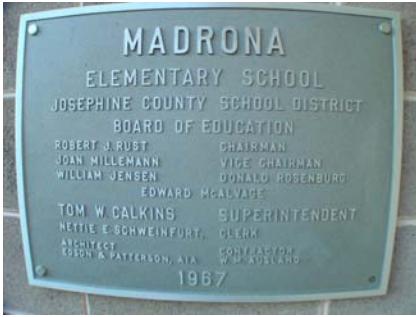
Moderate (>1%)



OregonGeology

Madrona Elementary School

Jose_sch19A

Enrollment 299	Year Built (Field Verified) 1967	Year Built (Alt. Source) 1967	Est. Decade Built 1960
Total Area (square ft) 37816	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities Steps in Elevation View: Single Change None None	
Falling Hazards None None None		Poor Conditions None None None	
 N Field Verified Year Built		 NW Primary Structural Type	

Madrona Elementary School

Three Rivers/Josephine County SD

Jose_sch19B

Building Type	County
School	Josephine
Street	
520 Detrick Dr.	
City	State Zip
Grants Pass	OR 97527
Latitude	Longitude
42.3627	123.3628
Tracking Code	Inspection Date
RVS in 2006	7/28/2006



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	0	0	0	0	0	0	0	2.8
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Madrona Elementary School

Final RVS Score

Final Type	Final Score
RM1	2.8

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Madrona Elementary School

Jose_sch19B

Enrollment 299	Year Built (Field Verified) 1967	Year Built (Alt. Source) 1967	Est. Decade Built 1960
Total Area (square ft) 37816	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	

Madrona Elementary School

Three Rivers/Josephine County SD

Jose_sch19C

Building Type	County
School	Josephine
Street	
520 Detrick Dr.	
City	State Zip
Grants Pass	OR 97527
Latitude	Longitude
42.3627	123.36319
Tracking Code	Inspection Date
RVS in 2006	7/28/2006



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	0	-0.5	0	0	0	0	0	2.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Madrona Elementary School

Final RVS Score

Final Type	Final Score
RM1	2.3

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Madrona Elementary School

Jose_sch19C

Enrollment 299	Year Built (Field Verified) 1967	Year Built (Alt. Source) 1967	Est. Decade Built 1960
Total Area (square ft) 37816	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Non-Parallel System None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	
 W General Site			

Madrona Elementary School

Three Rivers/Josephine County SD

Jose_sch19D

Building Type	County	
School	Josephine	
Street		
520 Detrick Dr.		
City	State	Zip
Grants Pass	OR	97527
Latitude	Longitude	
42.3627	123.3624	
Tracking Code	Inspection Date	
RVS in 2006	7/28/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	0	-0.5	0	0	0	0	0	2.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Madrona Elementary School

Final RVS Score

Final Type	Final Score
RM1	2.3

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Madrona Elementary School

Jose_sch19D

Enrollment 299	Year Built (Field Verified) 1967	Year Built (Alt. Source) 1967	Est. Decade Built 1960
Total Area (square ft) 37816	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Non-Parallel System Reentrant Corners: Other (Adjacent Build/Entity) None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	
 W Plan Irregularity Secondary			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Madrona Elementary School

Three Rivers/Josephine County SD

Jose_sch19E

Building Type	County	
School	Josephine	
Street		
520 Detrick Dr.		
City	State	Zip
Grants Pass	OR	97527
Latitude	Longitude	
42.36299	123.36243	
Tracking Code	Inspection Date	
RVS in 2006	7/28/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	0	-0.5	0	0	0	0	0	2.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Madrona Elementary School

Final RVS Score

Final Type	Final Score
RM1	2.3

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Madrona Elementary School

Jose_sch19E

Enrollment 299	Year Built (Field Verified) 1986	Year Built (Alt. Source) 1967	Est. Decade Built 1980
Total Area (square ft) 37816	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners:Other (Adjacent Build/Entity) None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	
			
W Field Verified Year Built	W Plan Irregularity Primary		