

Nyssa City Police Dept

Malh_pol04A

City of Nyssa

Building Type	County
Police - City	Malheur
Street	
14 South 3rd St	
City	State Zip
Nyssa	OR 97913
Latitude	Longitude
43.87612	116.99608
Tracking Code	Inspection Date
RVS in 2006	6/30/2006



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	0	-0.4	0	0	-1.2	0	0
Secondary	URM	3.4	-1.5	0	-0.4	0	0	-0.8	0	0.7
Tertiary		0	0	0	0	0	0	0	0	0

Nyssa City Police Dept

Final RVS Score

Final Type	Final Score
C2	0

FEMA-154 Collapse Potential

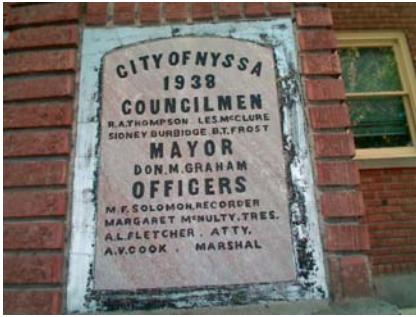
Very High (100%)



OregonGeology

Nyssa City Police Dept

Malh_pol04A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1938	1938	1930
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
17400	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: L Shaped		Steps in Elevation View: Single Change	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Other: General		None	
Other: Brick Veneer		None	
None		None	
			
W	Elevation View	W	General Site
			
W	Vertical Irregularity Primary		
			
S	Elevation View	W	Elevation View
			
		E	Falling Hazard



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries