

Stayton Police Dept

City of Stayton

Mari_pol13A

Building Type Police - City	County Marion	
Street 386 N 3rd Ave		
City Stayton	State OR	Zip 97383
Latitude 44.7977	Longitude 122.79193	
Tracking Code RVS in 2006	Inspection Date 7/18/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	-0.5	-0.4	0	0	-1.2	0	-0.5
Secondary	RM1	3.6	-2	-0.5	-0.4	0	0	-1.2	0	-0.5
Tertiary		0	0	0	0	0	0	0	0	0

Stayton Police Dept

Final RVS Score

Final Type	Final Score
C2	-0.5

FEMA-154 Collapse Potential

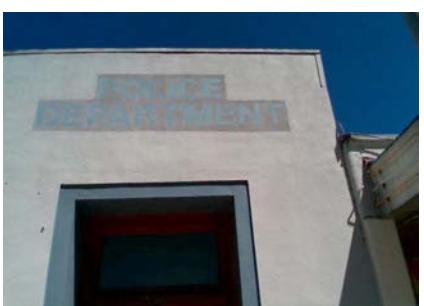
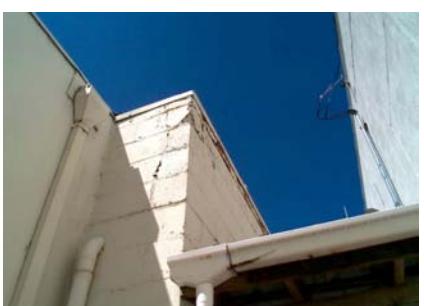
Very High (100%)



OregonGeology

Stayton Police Dept

Mari_pol13A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1946	1930
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
4860	1	No	Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners:Other (Adjacent Build/Entity)		Steps in Elevation View: 2 to 3 Changes	
Reentrant Corners: Other		Steps in Elevation View: 2 to 3 Changes (Adjacent Building/Entity)	
None		None	
Falling Hazards		Poor Conditions	
Parapets: General		Poor Masonry	
None		None	
None		None	
			
NW General Site		NE General Site	
			
NW Primary Structural Type		NW Secondary Structural Type	
		E General Site	
			
W Building Name		SE Poor Condition	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries