

Cascade Junior High School

Mari_sch60A

Cascade SD 5

Building Type		County	
School		Marion	
Street			
10226 Marion Rd SE			
City	State	Zip	
Turner	OR	97392	
Latitude		Longitude	
44.80827		122.9167	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	-2	-0.5	0	0	0	-0.8	0	0.5
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Cascade Junior High School

Final RVS Score

Final Type

Final Score

W2

0.5

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
541	1948	1948	1940
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
113000	1	No	Yes

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Steps in Elevation View: 2 to 3 Changes
None	Steps in Elevation View: Single Change (Adjacent Building/Entity)
None	None

Falling Hazards	Poor Conditions
Other: Brick Veneer	None
Other: General	None
None	None



SW General Site




SW Building Name



E Field Verified Year Built
1948



SW Primary Structural Type

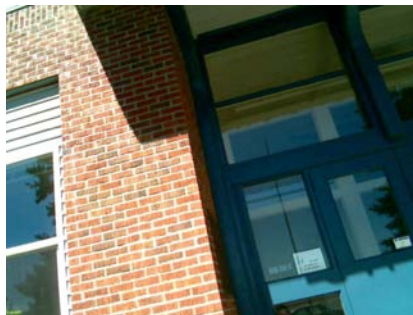

SW Falling Hazard



S General Site



SE General Site



E Falling Hazard



S Falling Hazard



E Pounding Potential
and falling



SE General Site



N General Site



W Falling Hazard



W Pounding Potential



NW Primary Structural Type



Cascade Junior High School

Cascade SD 5

Mari_sch60B

Building Type		County	
School		Marion	
Street			
10226 Marion Rd SE			
City	State	Zip	
Turner	OR	97392	
Latitude		Longitude	
44.80845		122.91654	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	0	-0.6	0	0.7
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Cascade Junior High School

Final RVS Score

Final Type

Final Score

RM1

0.7

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
541		1948	1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
113000	1	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Steps in Elevation View: Single Change
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



S Primary Structural Type



NE General Site



NE General Site



NW General Site