

Irrigon Junior/Senior High School

Morr_sch07A

Morrow SD 1

Building Type		County	
School		Morrow	
Street			
315 E Wyoming Ave			
City	State	Zip	
Irrigon	OR	97844	
Latitude		Longitude	
45.88763		119.49809	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	PC1	3.2	0	-0.5	0	0	0	-1	0	1.7
Secondary	C2	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Tertiary		0	0	0	0	0	0	0	0	0

Irrigon Junior/Senior High School

Final RVS Score

Final Type

Final Score

C2

-0.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Irrigon Junior/Senior High School

Morr_sch07A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
294			1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: L Shaped	Building On Hill or Sloped Site
Reentrant Corners: Other	Steps in Elevation View: 2 to 3 Changes (Adjacent Building/Entity)
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



SE Plan Irregularity Secondary



N Vertical Irregularity Secondary



NE Vertical Irregularity Secondary



NE Elevation View

Irrigon Junior/Senior High School

Morr_sch07B

Morrow SD 1

Building Type		County	
School		Morrow	
Street			
315 E Wyoming Ave			
City	State	Zip	
Irrigon	OR	97844	
Latitude		Longitude	
45.88763		119.4988	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Secondary	W2	4.8	-3	-0.5	0	1.6	0	-1.2	0	1.7
Tertiary	C2	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1

Irrigon Junior/Senior High School

Final RVS Score

Final Type

Final Score

RM1

-0.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries


Irrigon Junior/Senior High School

Morr_sch07B

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
294			1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other (Adjacent Build/Entity)	Steps in Elevation View: Single Change (Adjacent Building/Entity)
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None

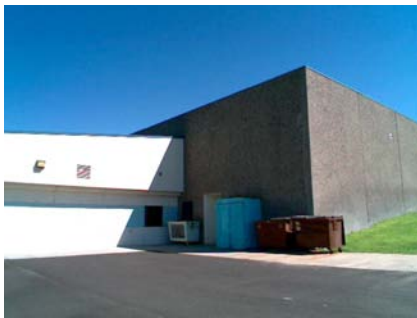

S Vertical Irregularity Primary



SW Elevation View

Irrigon Junior/Senior High School

Morr_sch07C

Morrow SD 1

Building Type		County	
School		Morrow	
Street			
315 E Wyoming Ave			
City	State	Zip	
Irrigon	OR	97844	
Latitude		Longitude	
45.88746		119.49753	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	PC1	3.2	0	-0.5	0	1.8	0	-1	0	3.5
Secondary	C2	3.6	0	-0.5	0	1.6	0	-1.2	0	3.5
Tertiary		0	0	0	0	0	0	0	0	0

Irrigon Junior/Senior High School

Final RVS Score

Final Type

Final Score

PC1

3.5

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
294			2000
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: L Shaped	None
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



SE Plan Irregularity Primary

