


## Adventist Medical Center

Adventist Health System NFP

## Mult hos06A

Building Type	County	
Hospital	Multnomah	
Street		
10123 SE Market St		
City	State	Zip
Portland	OR	97216
Latitude	Longitude	
45.51256	122.55831	
Tracking Code	Inspection Date	
RVS in 2006	7/5/2006	

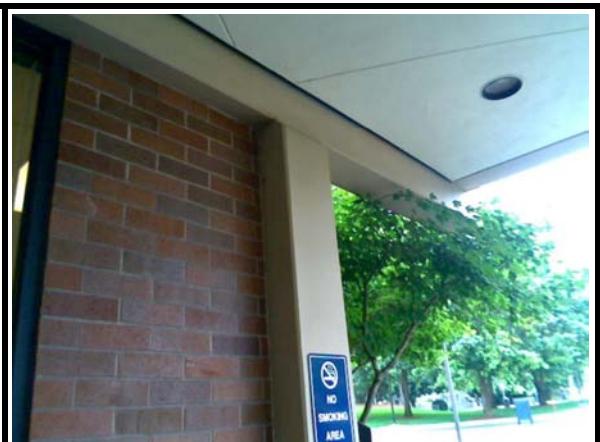

Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C1	2.9	-1.5	-0.5	0	0	-0.4	0	0	0.5
Secondary	C2	3.2	-1	-0.5	0	0	-0.4	0	0	1.3
Tertiary	RM1	3.2	-1	-0.5	0	0	-0.4	0	0	1.3

Adventist Medical Center

## Final RVS Score

Final Type      Final Score

C1 0.5

## FEMA-154 Collapse Potential

### High (>10%)



# OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Adventist Medical Center

Mult\_hos06A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1977	1977	1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
264012	5	No	Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
Reentrant Corners: Other (Adjacent Build/Entity)		Steps in Elevation View: Very Irregular Changes (Adjacent Building/Ent)	
None		Building On Hill or Sloped Site	
Falling Hazards		Poor Conditions	
Other: Brick Veneer		None	
Other: General		None	
None		None	
			
SW	Primary Structural Type	SW	Number of Stories
		S Elevation View	
			
SW	Vertical Irregularity Primary	S	Vertical Irregularity Primary
		SE Vertical Irregularity Tertiary	
			
SE	Plan Irregularity Primary	S	Falling Hazard can also see cmu at dock
		E Vertical Irregularity Primary	



# OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Adventist Medical Center

Mult\_hos06A



NE Plan Irregularity Primary



NE Tertiary Structural Type



NE Secondary Structural Type



N Tertiary Structural Type



N Vertical Irregularity Secondary

## Adventist Medical Center

Adventist Health System NFP

## Mult hos06B

Building Type	County	
Hospital	Multnomah	
Street		
10123 SE Market St		
City	State	Zip
Portland	OR	97216
Latitude	Longitude	
45.5127	122.55905	
Tracking Code	Inspection Date	
New Building	7/5/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

Adventist Medical Center


## Final RVS Score

Final Type      Final Score

C2 1.9

## FEMA-154 Collapse Potential

Low (<1%)

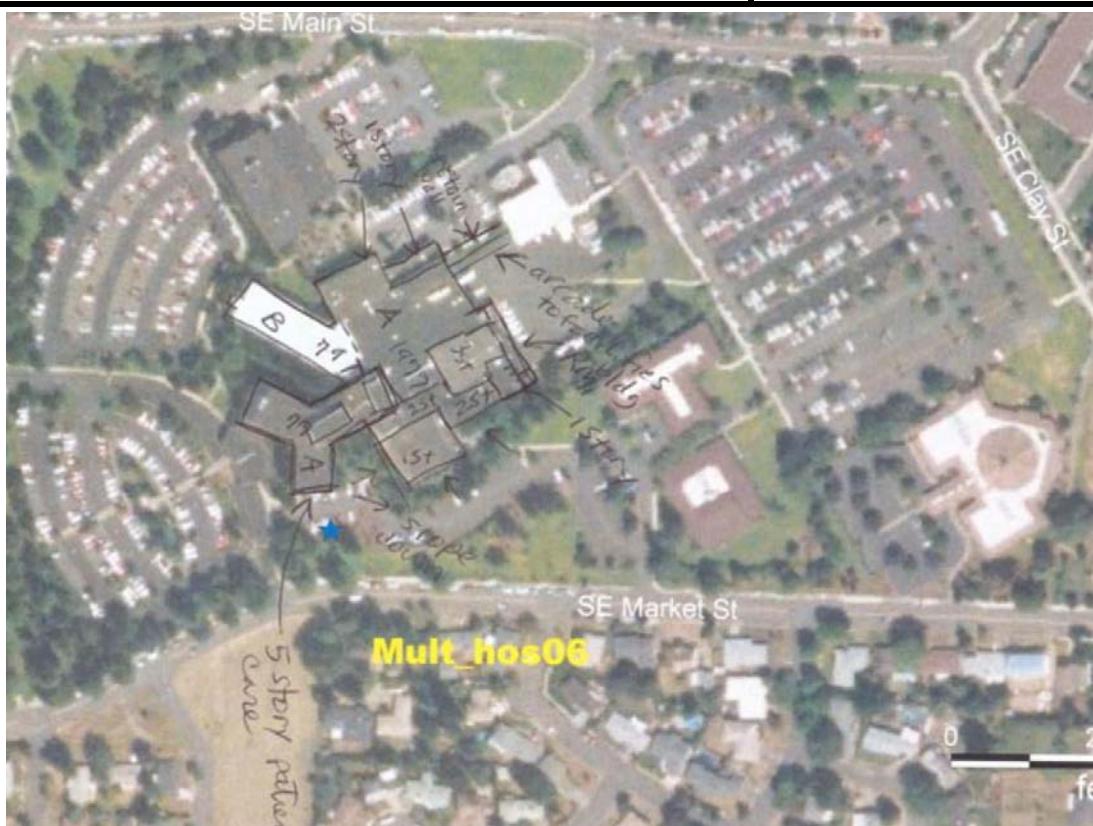

# OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Adventist Medical Center

Mult\_hos06B

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built		
	1979	1977	1970		
Total Area (square ft)	Number of Stories	Basement	Pounding Potential		
264012	2	No	Yes		
Plan Irregularities		Vertical Irregularities			
Reentrant Corners:L shaped (Adjacent Build/Entity)		Building On Hill or Sloped Site			
Reentrant Corners: Other		Steps in Elevation View: Single Change (Adjacent Building/Entity)			
None		None			
Falling Hazards		Poor Conditions			
Other: Brick Veneer		None			
None		None			
None		None			
	NE Primary Structural Type		W Primary Structural Type		S Basement