

Parkrose Middle School

Mult_sch126A

Parkrose SD 3

Building Type		County	
School		Multnomah	
Street			
11800 NE Shaver St			
City	State	Zip	
Portland	OR	97220	
Latitude		Longitude	
45.55093		122.54107	
Tracking Code		Inspection Date	
RVS in 2006		7/13/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary	RM1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Tertiary		0	0	0	0	0	0	0	0	0

Parkrose Middle School

Final RVS Score

Final Type

Final Score

C2

0.9

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
825	1962	1962	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
113603	1	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Steps in Elevation View: Very Irregular Changes
Torsion: Eccentric Stiffness	Building On Hill or Sloped Site
None	None

Falling Hazards	Poor Conditions
Unreinforced Chimneys	None
Other: General	None
None	None



W General Site



NW Falling Hazard



NW Falling Hazard



S Elevation View



SE Plan Irregularity Primary




SE Plan Irregularity Primary



SE Plan Irregularity Secondary



NE Plan Irregularity Secondary

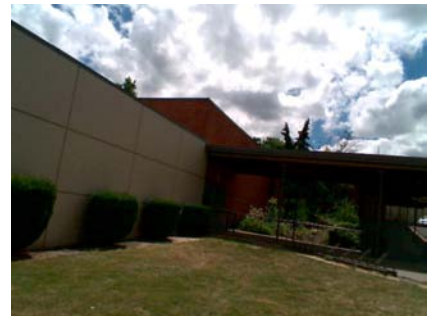

NW Secondary Structural Type



NW Secondary Structural Type



W Field Verified Year Built