

# Earl Boyles Elementary

David Douglas SD 40

Mult\_sch59A

Building Type	County	
School	Multnomah	
Street		
10822 SE Bush		
City	State	Zip
Portland	OR	97266
Latitude		Longitude
45.49445		122.55165
Tracking Code		Inspection Date
RVS in 2006		7/11/2006



Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Earl Boyles Elementary

## Final RVS Score

Final Type

Final Score

C2

0.9

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
423	1956	1956	1950
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
52254	1	No	No

Plan Irregularities	Vertical Irregularities
Out of Plane Lateral-Force-Resistance Elements	Steps in Elevation View: Very Irregular Changes (Adjacent Building/Ent
Reentrant Corners: Other	None
Reentrant Corners: Other (Adjacent Build/Entity	None

Falling Hazards	Poor Conditions
Other: Brick Veneer	None
None	None
None	None



NE Primary Structural Type  
NEW BRICK COVERS OLD CONC STRUCTURE




NE Plan Irregularity Primary  
NEW FRONT CANOPY



NW Plan Irregularity Tertiary  
CONN TO NEW SECTION



N Other  
SECURE CANOPIES

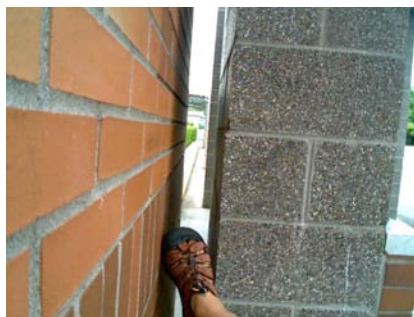

N Building Quality  
NO POUNDING



E Other  
FORM MARKS IN OLD CONC WALL



E Plan Irregularity Secondary



S Elevation View  
CONN TO NEW SECTION



N Field Verified Year Built



N Field Verified Year Built