


Tuality Community Hospital - Hillsboro

Tuality Healthcare NFP

Wash_hos01A

Building Type		County	
Hospital		Washington	
Street			
335 Se 8th Ave			
City	State	Zip	
Hillsboro	OR	97123	
Latitude		Longitude	
45.51949		122.97818	
Tracking Code		Inspection Date	
RVS in 2006		7/11/2006	

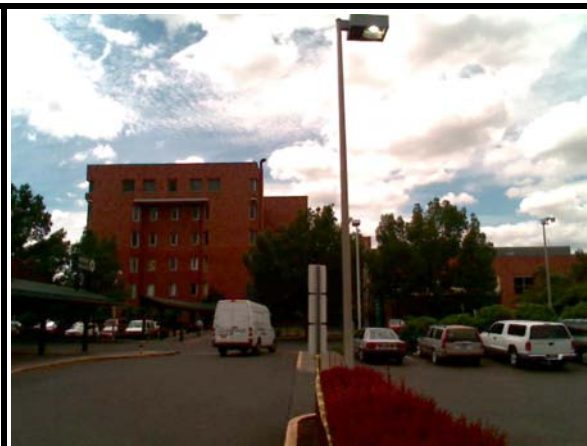

Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.2	-1	-0.5	0	0	0	-0.6	0	1.1
Secondary	S2	3.4	-1.5	-0.5	0	0	0	-0.6	0	0.8
Tertiary		0	0	0	0	0	0	0	0	0

Tuality Community Hospital - Hillsboro

Final RVS Score

Final Type

Final Score

S2

0.8

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Tuality Community Hospital - Hillsboro

Wash_hos01A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1985	1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	6	Yes	Yes

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Steps in Elevation View: Very Irregular Changes
None	None
None	None


Falling Hazards	Poor Conditions
Other: Brick Veneer	None
Other: General	None
None	None



NE Building Name



NE Vertical Irregularity Primary
6 stories on left side

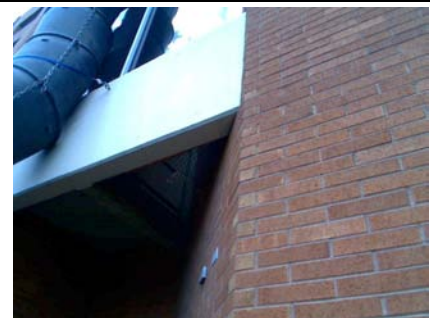

S Primary Structural Type
C2 under brick.



SE General Site



SE Falling Hazard
Heavy cantilevered covered walkway



S Vertical Irregularity Primary



E General Site



SE Plan Irregularity Primary



NW General Site



SE Seismic Upgrade
walkway to new bldg has 4" seismic joint.



SE Falling Hazard
Concrete suspended beam



S Falling Hazard



NW General Site



NE General Site



N General Site