

APPENDIX A

STRUCTURALLY DEFICIENT BRIDGES BRIDGE CONDITION SUMMARIES BY DISTRICT

Appendix A includes the structurally deficient bridges sorted by Interstate, NHS and Non-NHS routes.

Bridge Condition Summaries by District include the following information:

The NBI ratings have been condensed into one column, NBI Rate, in the following order:

- ▶ Deck/Superstructure/Substructure rating, e.g. 7/6/5 would indicate the NBI=7 for the deck; NBI=6 for the superstructure; NBI=5 for the substructure.
- ▶ Where only one entry is provided in the NBI Rate column, the entry is the culvert rating.

Seismic Vulnerability

Until recently, Oregon was considered to be a region of relatively low seismicity and earthquake occurrence. However, as noted in ODOT's 2014 Seismic Plus Report newer analyses are available that indicate "A Cascadia Subduction Zone earthquake (CSZE) with a magnitude of 8.0 or greater will hit Oregon; the question is when, not if." Seismic vulnerabilities of ODOT's bridges for a CSZE were evaluated and assigned the following levels:

- ▶ **Vulnerable (V):** Subject to moderate to severe damage that renders the bridge unusable
- ▶ **Potentially Vulnerable (PV):** Subject to slight to moderate damage that renders the bridge unusable, except potentially by emergency traffic only.
- ▶ **Not Vulnerable (NV):** May suffer slight displacement but still useable by emergency vehicles and potentially by public traffic.



Structurally Deficient Bridges

Structurally Deficient Interstate Bridges

Bridge	Structure Name	Route	MP	Project Action	CN Year/ Program
07832	Hwy 1 Conn over CORP	005	174.74	Deck rehabilitation	2019 (STIP)
08124	Santiam Oflow No 4, Hwy 1 SB at MP 240.42	005	240.42	Bearing Repair	2017 (MBM)
08121	Santiam Oflow No 2, Hwy 1 SB at MP 241.35	005	241.35	Bearing Repair	2017 (MBM)
08591C	Hwy 1 SB over Hwy1 NB to Hwy 61 (W Marquam Intchg)	005	300.10	Fatigue repair	2015 (MBM)
04516A	Hwy 1 over Jantzen Pedestrian Tunnel	005	307.93	Concrete repair	2014 (MBM)
02230A	Columbia River, Hwy 70 EB (Umatilla)	082	0.39	Paint structure	2018 (STIP)
08588C	Hwy1 SB to Hwy2 EB over Hwy1 & Conn (Banfield Int)	084	0.23	Deck overlay; bridge rail replacement	2018 (STIP)
09572	Hwy 227 over Future Hwy 62	105	0.63	Deck overlay; retrofit bridge rail; replace expansion joints	2018 (STIP)
08966	Willamette River & Hwy 227 Conn #1, Hwy 227	105	0.81	Deck overlay; joints; bridge rail; concrete repairs	2018 (STIP)

Structurally Deficient Bridges

Structurally Deficient NHS Bridges

Bridge	Structure Name	Route	MP	Project Action	CN Year/ Program
08033	Hwy 37 over Hwy 102	006	49.09	Deck Overlay: MPCO	2017 (MBM)
0P461	Johnson Creek, Hwy 29 (Twin Pipes)	008	4.97		
08492	Yamhill River Oflow, Hwy 39	018	45.76	Deck seal & overlay; joints; timber repair; spot paint	2018 (STIP)
06758	South Yamhill River, Hwy 483 McMinnville Spur	018	46.75	Timber Repair	2017 (MBM)
00931	Peterson Creek, Hwy 33	020	21.71		
02001	Salt Creek, Hwy 30 at MP 8.38	022	8.38	Timber repair	2017 (MBM)
07253B	Willamette R, Hwy 30 WB & Hwy 72 Conn (Marion St)	022	25.91		
03099	Little Humbug Creek, Hwy 47	026	8.22	Replace bridge	2018 (STIP)
02793A	Powder River, Hwy 66 (Bridge St)	030	52.13	PE only for design of deck repair	TBD (MBM)
07519	Clatskanie River, Hwy 2W	030	61.21	Scour protection	2018 (STIP)
08842	Middle Fork Coquille River, Hwy 35 at MP 23.37	042	23.37		
00805C	Lower Lookingglass Creek, Hwy 35	042	72.52	Deck overlay	2018 (STIP)
02303	West Fork Dairy Creek, Hwy 102 at MP 82.65	047	82.65	Replace bridge	2018 (STIP)
02071A	Salt Creek, Hwy 18 at MP 42.93	058	42.93	Replace bridge	2018 (STIP)
05290	Hwy 1E over UPRR (at N Baldwin St)	099	-3.86	Rehabilitation	2018 (STIP)
02350A	Hwy 1E (SE MLK Blvd) over Hwy 2 & UPRR	099	-0.20	Install micro pile support north end sidewalk span 1	2017 (MBM)
01984	SW Vermont St Viaduct , Hwy 1W	099	3.50	Deck repair	2014 (STIP)
02732	SE Water St Partial Viaduct, Hwy1E (McLoughlin Bd)	099	12.22		
00614A	Coast Fork Willamette River, Hwy 226 at MP 13.79	099	13.79		
0M274	Ashland Creek, Hwy 63 SB	099	19.09	Rehabilitation	2018 (STIP)
06713	Ecola Creek, Hwy 9	101	28.70	Design shelf ready plans to replace bridge	2018 (STIP)
04659	Farmer Creek, Hwy 9	101	82.92	Replace bridge	2018 (STIP)

Structurally Deficient Bridges

Structurally Deficient NHS Bridges, continued

Bridge	Structure Name	Route	MP	Project Action	CN Year/ Program
01820	Yaquina Bay, Hwy 9	101	141.68	Cathodic protection (corrosion control) - South end	2020 (STIP)
01821E	Siuslaw River, Hwy 9 (Florence)	101	190.98	Cathodic protection	2015 (STIP)
01172	Rogue River, Hwy 9 (Gold Beach, Isaac Patterson)	101	327.70	Repair concrete and reinforcing steel; replace end joints; overlay the deck	2018 (STIP)
03853	Buck Creek, Hwy 20	140	22.23	Replace bridge	2018 (STIP)
01418	Rogue River, Hwy 25 SB (6th St, Caveman)	199	-0.14	Deck overlay, concrete repairs, other rehab	2017 (STIP)
08158	Willamette River Oflow, Hwy 140 at MP 23.89	219	23.89	Design shelf ready plans to replace bridge	TBD (STIP)

Structurally Deficient Bridges

Structurally Deficient Non-NHS Bridges

Bridge	Structure Name	Route	MP	Project Action	CN Year/ Program
08743	E Main St over Hwy 1	000	0.00	Deck overlay	2021 (STIP)
08437	SW Multnomah Blvd over Hwy 1	000	296.55	Place a structural overlay on the deck, replace or repair leaking joints and retrofit the bridge rails	2018 (STIP)
08681	Valley View Rd Conn #2 over Hwy 1	005	21.21	Deck Seal	2017 (MBM)
08676B	Barnett Rd over Hwy 1	005	27.58	Deck overlay	2018 (STIP)
04681	Louie Creek, Hwy 32 at MP 10.66	022	10.66	Timber repair	2016 (MBM)
00840	West Multnomah Falls Viaduct, Hwy 100	030	17.68	Bridge repair	2016 (STIP)
04167	McKinney Slough, Hwy 27	034	1.62	Replace bridge	2017 (STIP)
00357	Willamette River & Hwy 1E, Hwy 3 (Oregon City)	043	11.43		
02323	Nehalem River, Hwy 102 at MP 61.28	047	61.28	Paint structure; remove pack rust; heat strengthen portal. Replace rivets and bolts	2018 (STIP)
03151	Beaver Creek, Hwy 102 at MP 65.22	047	65.22	Timber repair	2017 (MBM)
04950	Beaver Creek, Hwy 102 at MP 69.79	047	69.79	Replace bridge	2017 (STIP)
00447	Meacham Creek & UPRR, Hwy 6 Emigrant Hill Frtg Rd	084	239.45	Replace bridge	2021 (STIP)
02061	Molalla River, Hwy 1E NB	099	22.03	SPCO Membrane and Pave: Remove and replace failing membrane	2017 (MBM)
08208	Hwy 1W over Whiteson Dip	099	42.18	Timber repair	2016 (MBM)
06654A	Luckiamute River Overflow, Hwy 1W	099	68.46	Grind, Pave, and Membrane	2017 (MBM)
00330	Youngs Bay, Hwy 105 (Old Youngs Bay)	101	6.89	Paint structural steel; strengthen rotted timber piles & caps; misc elec & mech repairs	2014 (STIP)
01400	Skipanon River, Hwy 485 (Fort Stevens Spur)	104	4.62	Design shelf ready plans for repairs and painting to preserve the steel elements	TBD (STIP)
02496	North Umpqua River, Hwy 138 at MP 17.95 (Lone Rock)	138	17.95	Vertical clearance, paint steel truss, repair and overlay deck	2017 (STIP)

Structurally Deficient Bridges

Structurally Deficient Non-NHS Bridges, continued

Bridge	Structure Name	Route	MP	Project Action	CN Year/ Program
16134	SW Allen Blvd over Hwy 144	217	2.49	Rail retrofit	2018 (STIP)
02284	East Champoeg Creek, Hwy 140	219	33.71	Timber repair	2016 (MBM)
04285	Jordan Creek, Hwy 211	226	20.45	Timber repair	2016 (MBM)
01132F	Isthmus Slough, Hwy 241 (Eastside)	241	0.42	Rehabilitation	2017 (STIP)
02836A	Pine Creek, Hwy 414 (Halfway)	414	0.44	PE only for design of scour repair	TBD (MBM)

OREGON STATE HIGHWAY SYSTEM


ODOT District Map

APRIL 2016



Legend

- State Highways
- Interstate
- US Route
- State Route
- District
- District
- District
- District
- District Number
- County Boundary

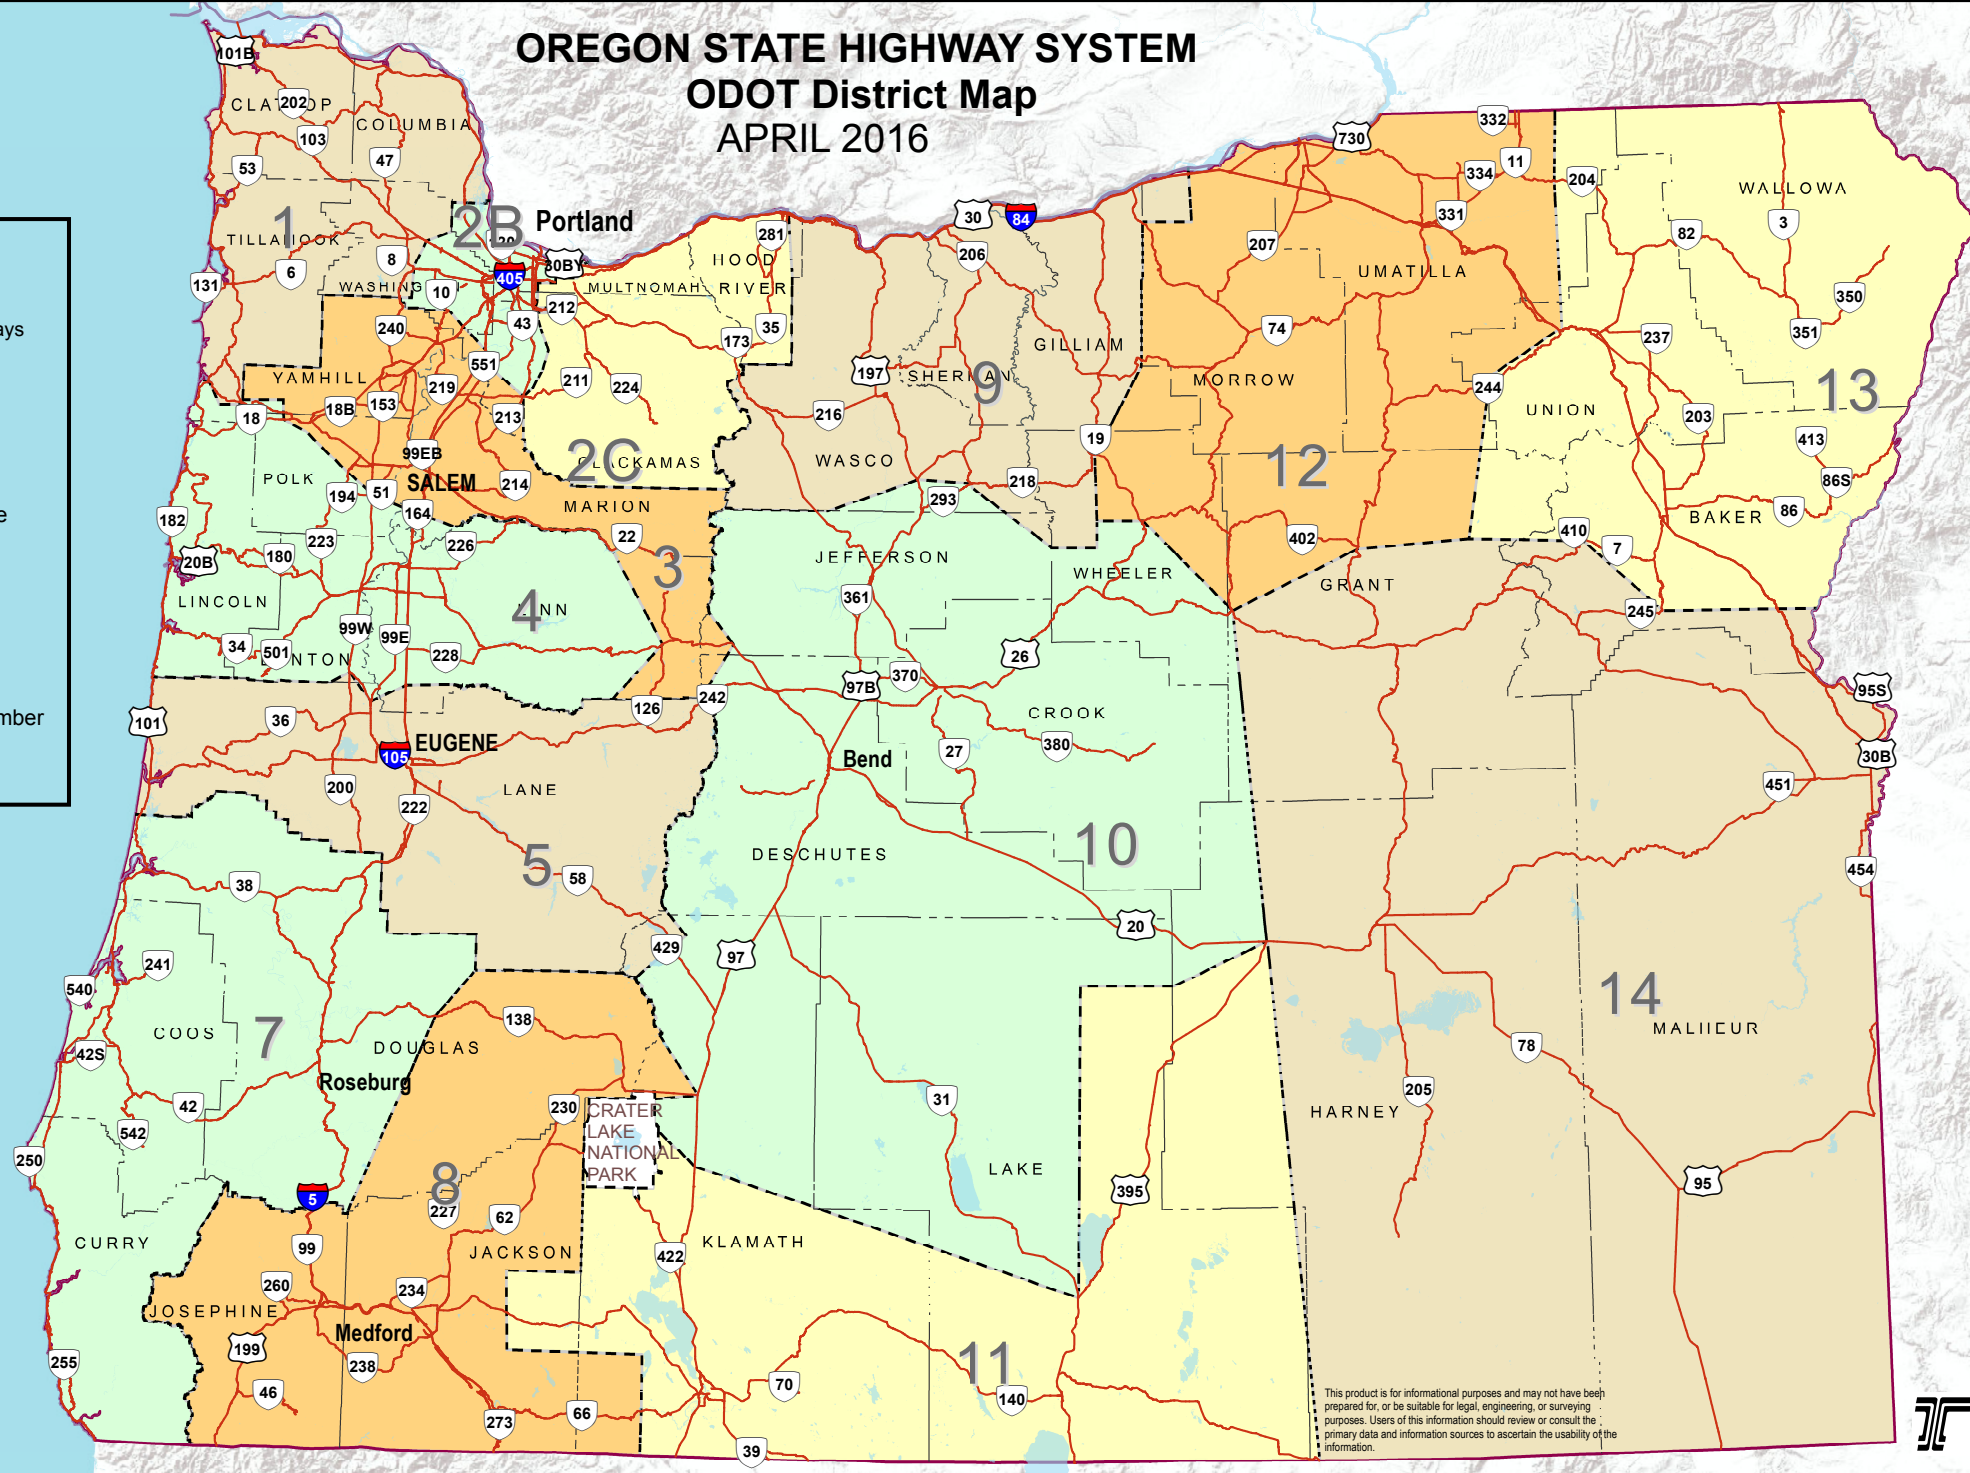


This product is for informational purposes and may not have been prepared for, or be suitable for legal, engineering, or surveying purposes. Users of this information should review or consult the primary data and information sources to ascertain the usability of the information.



OREGON STATE HIGHWAY SYSTEM

2017 BRIDGE CONDITION - DISTRICT 1

APRIL 2017

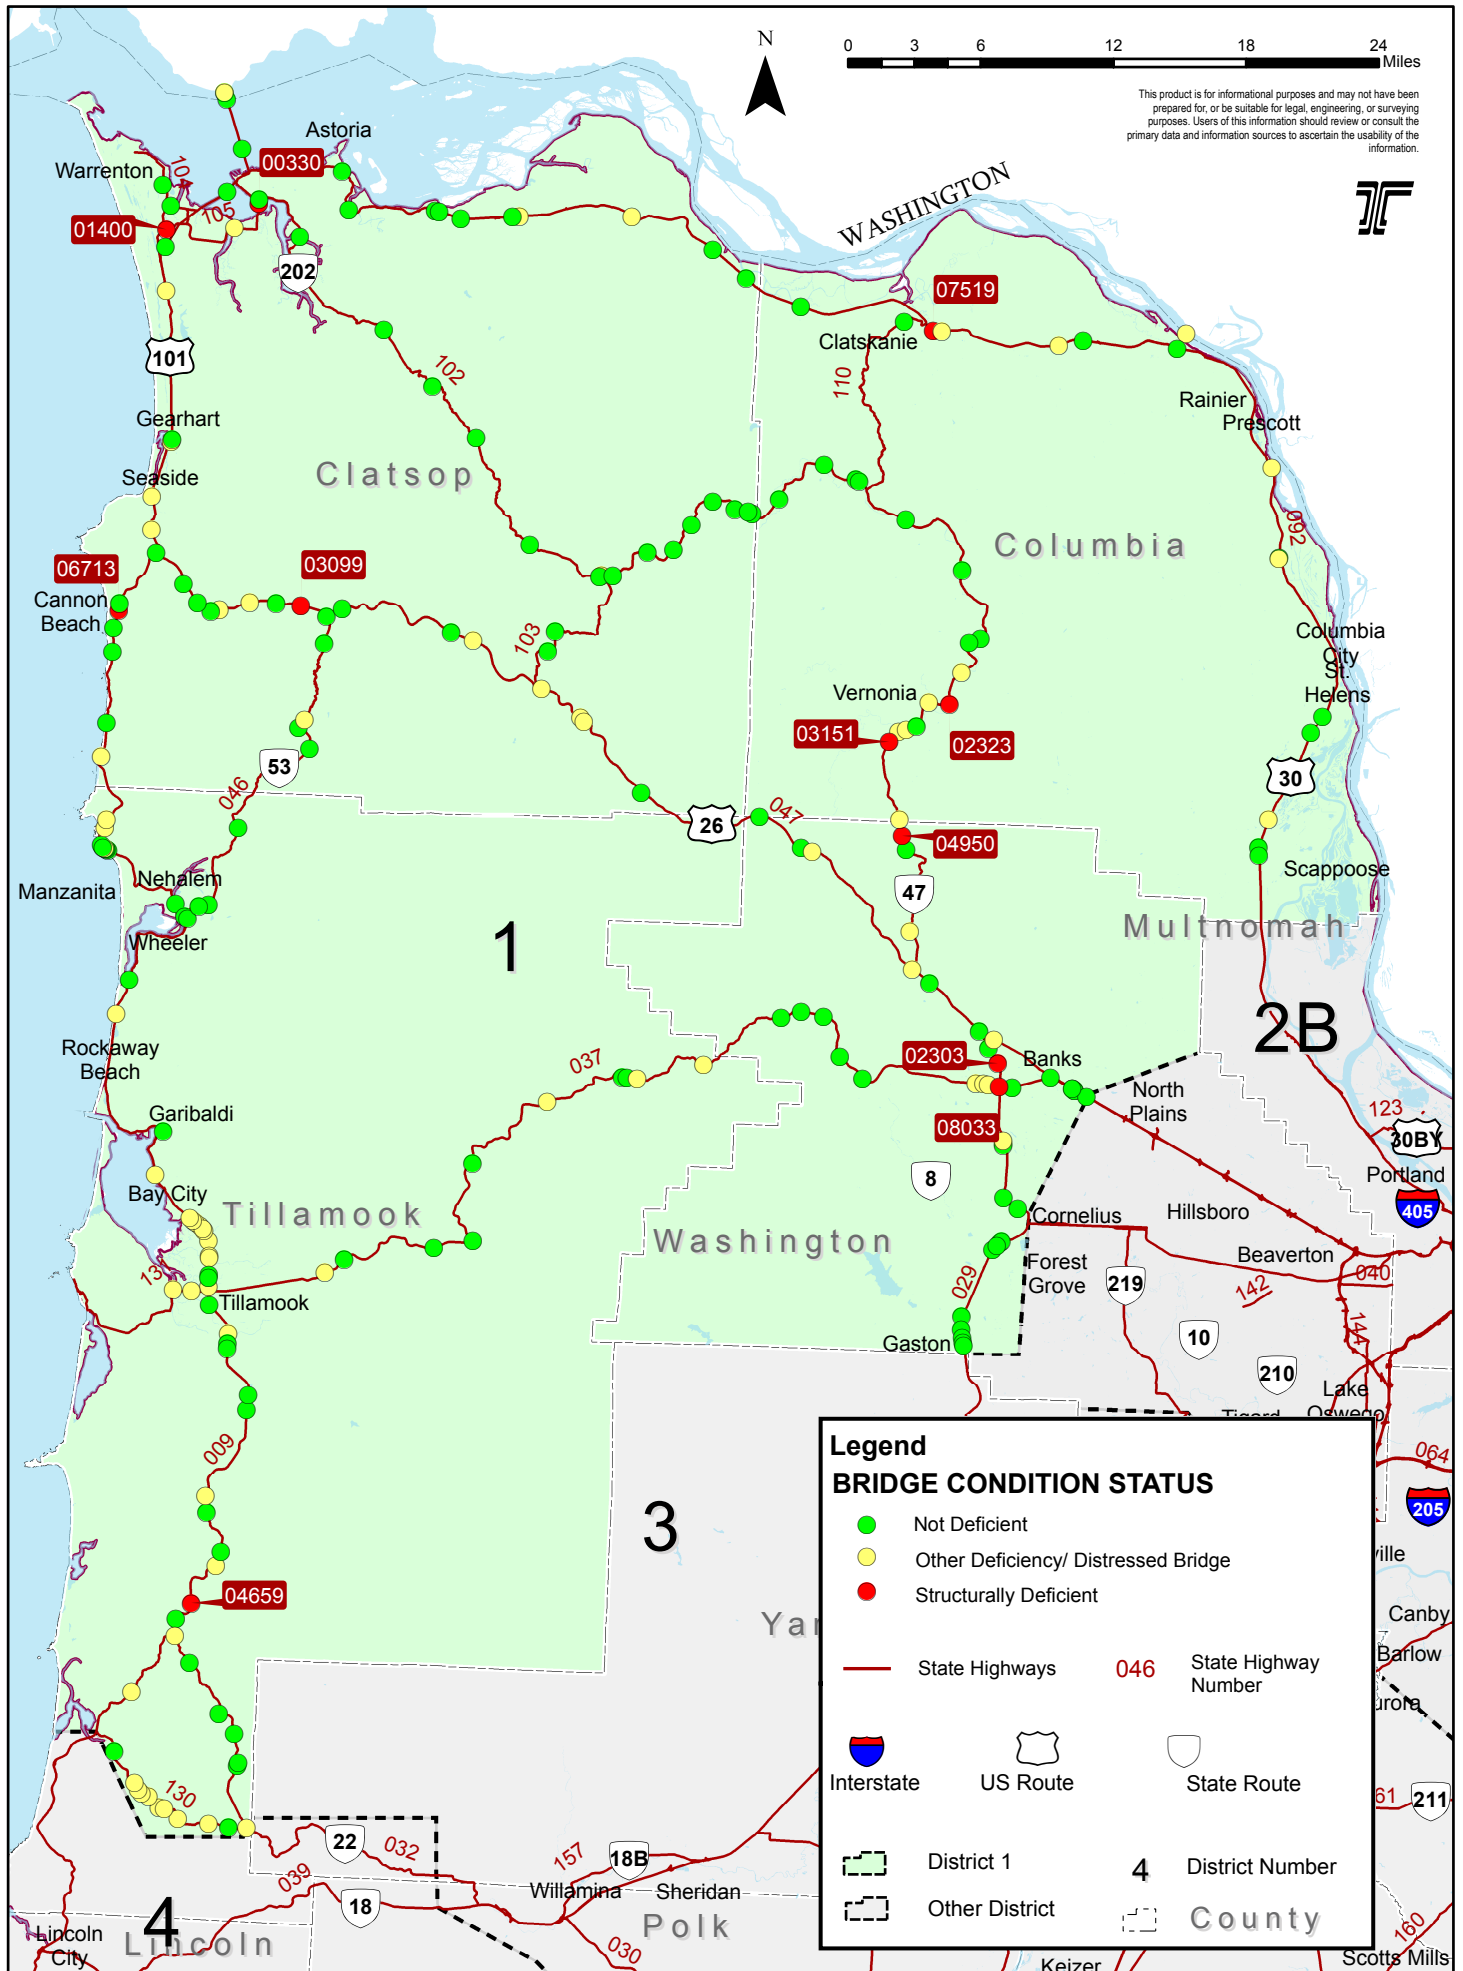

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	Struc NBI Rating	Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	009	0	07949D	Columbia River, Hwy 9 (Astoria-Megler Bridge)	1965	Steel	4,917	7/7/7	VG	OD	DG	NV	
2	01	009	0	07949A	Columbia River, Hwy 9 (Astoria-Megler Br)	1966	Steel	121,347	6/6/6	GD	ND		V	
2	01	009	0.28	07949B	Columbia River, Hwy 9 (Astoria-Megler Br)	1966	Prestressed concrete	369,600	6/6/5	PR	ND		V	
2	01	009	2.41	07949C	Columbia River & Hwy 2W & Hwy 9 (Astoria-Megler)	1966	Steel continuous	219,477	5/6/6	PR	ND		V	
2	01	009	4.91	08306	Youngs Bay, Hwy 9 (New Youngs Bay)	1964	Steel	146,239	5/5/6	PR	ND		V	4
2	01	009	8.73	08317	Skipanon River, Hwy 9	1980	Prestressed concrete	4,224	7/6/7	GD	ND		V	4
2	01	009	12.82	01468	Hwy 9 over Glenwood Private Rd (Pooles)	1930	Concrete	910	6/6/7	GD	OD	LSL DG VC	NV	
2	01	009	19.58	03079A	Mill Creek, Hwy 9	1957	Steel continuous	-	5	FR	ND		PV	4
2	01	009	19.72	01305	Neawanna Creek, Hwy 9	1930	Concrete continuous	8,259	6/5/5	PR	OD	LSL DG	V	4
2	01	009	22.48	03080	Shangri La Creek, Hwy 9 (Dooley)	1960	Concrete	2,713	6/6/6	GD	OD	DG TS	V	4
2	01	009	24.1	01481	Necanicum River, Hwy 9 (Skiiberene)	1930	Concrete continuous	5,217	6/5/5	PR	OD	LSL DG	V	4
2	01	009	25.27	16673	Hwy 9 over Hwy 47	1987	Prestressed concrete	9,480	7/7/6	GD	ND		V	4
2	01	009	28.37	18658	Hwy 9 over Hwy 9 Conn to Cannon Beach	2003	Prestressed concrete	5,409	7/7/7	VG	ND		NV	
2	01	009	28.7	06713	Ecola Creek, Hwy 9	1952	Concrete continuous	6,646	6/6/4	PR	SD	SD LSL TS	V	3
2	01	009	29.53	07226	Hwy 9 over Sunset Blvd (Cannon Beach)	1952	Concrete continuous	4,240	5/7/6	PR	ND		V	3
2	01	009	30.62	07405	Hwy 9 over Warren St (Cannon Beach)	1952	Concrete continuous	4,240	7/6/5	PR	ND		V	3
2	01	009	34.05	01878	Austins Point Half Viaduct, Hwy 9	1933	Wood or Timber	3,824	6/7/6	GD	ND		V	3
2	01	009	35.57	01797	Arch Cape Creek & Webb Ave, Hwy 9	1937	Wood or Timber	5,893	6/7/6	GD	OD	DG	V	3
2	01	009	39.13	02312	Short Sand Beach Creek, Hwy 9	1937	Concrete continuous	4,240	6/6/6	GD	OD	DG	V	3

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	009	39.53	02311	Necarney Creek, Hwy 9 (Sam Reed)	1937	Steel continuous	21,251	6/6/6	GD	OD	DG CP	V	3
2	01	009	40.58	01955	Half Viaduct, Hwy 9 at MP 40.58	1940	Concrete continuous	3,384	7/7/7	VG	ND		V	3
2	01	009	40.65	01954	Half Viaduct, Hwy 9 at MP 40.65	1940	Concrete continuous	1,778	7/7/7	VG	ND		V	3
2	01	009	40.66	01954A	Half Viaduct, Hwy 9 at MP 40.65	1940	Concrete continuous	1,067	7/7/7	VG	ND		V	3
2	01	009	40.71	02723	Neahkahnle Mountain (Chasm)	1937	Concrete continuous	3,861	6/5/6	PR	OD	LSL LC CP	V	3
2	01	009	40.75	01953	Half Viaduct, Hwy 9 at MP 40.75	1940	Concrete continuous	2,178	7/7/7	VG	ND		V	3
2	01	009	40.78	01952	Half Viaduct, Hwy 9 at MP 40.78	1940	Concrete continuous	1,452	7/7/7	VG	ND		V	3
2	01	009	40.86	01951	Half Viaduct, Hwy 9 at MP 40.86	1940	Concrete continuous	8,513	6/6/6	GD	ND		V	3
2	01	009	45.68	00574F	Nehalem River, Hwy 9	1984	Prestressed concrete continuous	46,197	6/6/7	GD	ND		V	4
2	01	009	46.45	00714A	Gallagher Slough, Hwy 9	1984	Prestressed concrete	2,400	7/7/7	VG	ND		V	4
2	01	009	46.6	01051A	Hwy 9 over POTB RR (Wheeler)	1984	Prestressed concrete	13,964	6/7/7	GD	ND		V	4
2	01	009	47.52	20406	Jetty Creek, Hwy 9	2008	Prestressed concrete	3,340	7/7/7	VG	ND		NV	
2	01	009	49.23	02349	Lake Lytle Outlet, Hwy 9	1938	Wood or Timber	5,401	6/7/6	GD	OD	DG	V	4
2	01	009	56.99	01226A	Miami River, Hwy 9	1991	Prestressed concrete	9,527	7/7/6	GD	ND		PV	4
2	01	009	59.32	08828	Hwy 9 over POTB RR at MP 59.32	1962	Concrete continuous	6,281	6/6/7	GD	OD	LSL DG	V	4
2	01	009	62.07	07481	Tidal Slough (Vaughn Cr) & Ctlps, Hwy9 at MP 62.07	1952	Concrete continuous	2,148	6/6/6	GD	OD	DG	V	4
2	01	009	62.25	07480	Tidal Slough & Cattlepass, Hwy 9 at MP 62.25	1952	Concrete continuous	2,148	6/6/6	GD	OD	DG	V	4
2	01	009	62.4	07426	Hathaway Slough, Hwy 9	1952	Concrete	5,385	6/6/6	GD	OD	LSL DG	V	4
2	01	009	62.67	07425	Stasek Slough, Hwy 9	1952	Concrete	8,055	6/6/5	PR	OD	TS	V	4

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	009	62.84	07456	Neilson Slough, Hwy 9	1952	Concrete	3,475	6/6/6	GD	OD	LSL DG	V	4
2	01	009	62.94	07424	Kilchis River & Possetti Road, Hwy 9	1952	Concrete continuous	9,591	6/6/5	PR	OD	VC	V	4
2	01	009	63.48	00505	Hwy 9 over POTB RR (Juno)	1931	Concrete continuous	6,539	5/6/6	PR	OD	Rail DG	V	4
2	01	009	64.14	01498	Wilson River Slough, Hwy 9	1931	Concrete continuous	4,360	6/6/6	GD	OD	DG	V	4
2	01	009	64.23	01499	Wilson River, Hwy 9	1931	Concrete	8,610	5/5/6	PR	OD	LSL	V	4
2	01	009	64.99	17370	Hall Slough, Hwy 9	2000	Prestressed concrete	6,138	7/7/7	VG	ND		NV	
2	01	009	65.12	17371	Dougherty Slough, Hwy 9	2000	Prestressed concrete	12,369	7/7/7	VG	ND		PV	4
2	01	009	65.55	01500	Hoquarten Slough, Hwy 9	1931	Concrete continuous	5,530	6/6/6	GD	OD	DG	V	4
2	01	009	66.36	07224	Drainage Ditch, Hwy 9 at MP 66.36	1950	Concrete continuous	3,801	6/6/6	GD	ND		V	2
2	01	009	67.98	07147	Trask River, Hwy 9	1949	Concrete continuous	13,104	7/6/6	GD	OD	Scour	V	2
2	01	009	68.45	04642A	South Prairie Creek, Hwy 9	1949	Concrete continuous	3,430	7/7/6	GD	ND		V	2
2	01	009	68.67	04643A	Anderson Creek, Hwy 9	1949	Concrete continuous	2,432	7/7/7	VG	ND		V	2
2	01	009	71.18	07181	Fawcett Creek, Hwy 9	1950	Concrete continuous	4,364	7/7/6	GD	ND		V	2
2	01	009	71.85	00877	Simmons Creek, Hwy 9	1989	Steel	-	6	GD	ND		PV	2
2	01	009	76.64	04651	Tiger Creek, Hwy 9 at MP 76.64	1919	Concrete	854	7/6/6	GD	OD	LSL DG	NV	
2	01	009	77.53	02202	West Beaver Creek, Hwy 9	1914	Concrete	2,295	7/5/6	PR	ND		NV	
2	01	009	79.61	04654	Beaver Creek, Hwy 9 at MP 79.61	1916	Concrete continuous	3,282	7/6/6	GD	ND		V	2
2	01	009	80.32	02762	Beaver Creek, Hwy 9 at MP 80.32	1916	Concrete continuous	4,475	6/6/6	GD	OD	LSL DG	V	2
2	01	009	82.92	04659	Farmer Creek, Hwy 9	1916	Steel	988	4/6/5	PR	SD	SD LSL PAINT	NV	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	009	84.08	00555B	Big Nestucca River, Hwy 9 (Condor)	1991	Prestressed concrete	12,391	7/7/6	GD	ND		PV	2
2	01	009	85.01	04660A	Three Rivers, Hwy 9	1949	Concrete continuous	4,865	6/6/6	GD	OD	LSL DG	V	2
2	01	009	88.68	00870	Clear Creek, Hwy 9	1922	Concrete	912	6/6/6	GD	OD	DG	V	2
2	01	029	19.43	16129	Gales Creek Oflow # 1, Hwy 29 at MP 19.43	1975	Prestressed concrete	8,999	6/6/6	GD	ND		PV	
2	01	029	19.54	09637	Gales Creek, Hwy 29	1975	Prestressed concrete	9,900	8/8/8	VG	ND		PV	
2	01	029	19.72	16130	Gales Creek Oflow # 2, Hwy 29 at MP 19.72	1975	Prestressed concrete	14,039	7/5/7	PR	ND		PV	
2	01	029	19.99	09638	Carpenter Creek, Hwy 29	1975	Prestressed concrete	6,301	7/7/6	GD	ND		PV	
2	01	029	23.98	09494	Scoggin Creek & PNWR, Hwy 29	1967	Prestressed concrete	14,481	5/7/6	PR	ND		PV	
2	01	029	24.59	09496	Creek, Hwy 29 at MP 24.59	1967	Prestressed concrete	4,692	6/6/6	GD	ND		PV	
2	01	029	24.97	09497	Creek, Hwy 29 at MP 24.97	1967	Prestressed concrete	4,692	6/6/6	GD	ND		PV	
2	01	029	25.2	09498	Creek, Hwy 29 at MP 25.30	1967	Prestressed concrete	4,692	6/6/7	GD	ND		PV	
2	01	029	25.32	00810A	Tualatin River, Hwy 29 (Gaston)	1967	Prestressed concrete	5,778	7/8/6	GD	ND		PV	
2	01	032	1.47	04673	Cedar Creek, Hwy 32	1920	Concrete	1,017	6/6/6	GD	ND		NV	
2	01	032	4.43	04675A	Three Rivers, Hwy 32	1986	Concrete continuous	4,946	6/6/7	GD	ND		PV	
2	01	032	5.81	04677	Alder Creek, Hwy 32 at MP 5.81	1935	Concrete	804	6/6/6	GD	ND		NV	
2	01	032	7.19	04805	Buck Creek, Hwy 32	1935	Concrete continuous	1,674	6/6/6	GD	ND		V	
2	01	032	7.32	04678	Alder Creek, Hwy 32 at MP 7.32	1935	Concrete continuous	1,197	6/5/6	PR	ND		V	
2	01	032	10.48	04680	Louie Creek, Hwy 32 at MP 10.49	1962	Wood or Timber	754	8/6/5	PR	OD	LC	NV	
2	01	037	5.78	01868	Wilson River, Hwy 37 at MP 5.78 (Mills)	1939	Steel continuous	13,175	5/5/6	PR	OD	DG PAINT	V	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	037	6.9	01979B	Slide Drainage, Hwy 37 at MP 6.90	1967	Prestressed concrete	4,180	7/7/7	VG	ND		NV	
2	01	037	11.8	01869A	Wilson River, Hwy 37 at MP 11.80	1951	Concrete	10,537	6/6/6	GD	ND		V	
2	01	037	13.62	19820	Fall Creek, Hwy 37 AT MP 13.62	2007	Prestressed concrete	5,878	6/7/6	GD	ND		NV	
2	01	037	18.04	01872A	Jordan Creek, Hwy 37	1937	Concrete continuous	5,475	6/6/7	GD	ND		V	
2	01	037	23.64	01873A	Wilson River, Hwy 37 at MP 23.64	1957	Concrete continuous	5,394	6/6/5	PR	OD	LSL	V	
2	01	037	27.69	01874A	Wilson River, Hwy 37 at MP 27.69	1947	Concrete continuous	6,334	6/6/6	GD	ND		V	
2	01	037	27.9	02654A	Wilson River, Hwy 37 at MP 27.90	1957	Concrete continuous	5,851	6/7/6	GD	ND		V	
2	01	037	28.38	02671A	Devils Lake Fork Wilson River, Hwy 37 at MP 28.38	1940	Concrete continuous	5,294	6/6/6	GD	OD	LSL	V	
2	01	037	32.05	02472	Devils Lake Fork Wilson River, Hwy 37 at MP 32.05	1940	Steel continuous	20,390	6/6/6	GD	OD	DG	V	
2	01	037	36.61	02462A	South Fork Gales Creek, Hwy 37	1956	Concrete	1,156	7/7/6	GD	ND		NV	
2	01	037	37.61	02676A	Gales Creek, Hwy 37 at MP 37.61	1956	Concrete continuous	5,433	6/6/6	GD	ND		V	
2	01	037	38.66	02461A	Gales Creek, Hwy 37 at MP 38.65	1956	Concrete continuous	6,060	6/6/6	GD	ND		V	
2	01	037	40.87	19707	BATEMAN CREEK, HWY 037 AT MP 40.87	2006	Prestressed concrete	3,756	8/7/8	VG	ND		NV	
2	01	037	42.34	07677	Gales Creek, Hwy 37 at MP 42.34	1956	Concrete continuous	6,339	7/6/5	PR	ND		V	
2	01	037	48	07683	West Fork Dairy Creek, Hwy 37	1954	Concrete	2,612	7/6/6	GD	OD	DG TS	V	
2	01	037	48.35	07684	Oflow Bridge, Hwy 37 at MP 48.35	1954	Concrete continuous	1,776	7/7/6	GD	OD	DG	V	
2	01	037	48.57	07685	Oflow Bridge, Hwy 37 at MP 48.57	1954	Concrete	1,742	7/7/5	PR	OD	LSL DG	V	
2	01	037	49.09	08033	Hwy 37 over Hwy 102	1956	Concrete continuous	6,340	6/6/6	GD	SD	SD LSL VC LC	V	
2	01	037	49.68	07686	Hwy 37 over PNWR & POTB RR (Wilkesboro)	1954	Concrete continuous	10,867	5/6/6	PR	ND		V	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	Struc NBI Rating	Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	037	51.46	07779	Hwy 37 WB over Hwy 47 EB	1954	Concrete continuous	6,060	5/7/6	PR	ND		V	
2	01	046	0.11	20732	Necanicum River, Hwy 46 at MP 0.11	2010	Prestressed concrete	3,002	7/7/7	VG	ND		NV	
2	01	046	1.46	03086	Bergsvik Creek, Hwy 46 at MP 1.46	1956	Concrete	1,178	6/6/6	GD	ND		V	
2	01	046	5.98	03088	Jack Horner Creek, Hwy 46	1951	Wood or Timber	1,824	6/6/6	GD	OD	LC	V	
2	01	046	6.5	01319	Soapstone Creek, Hwy 46	1928	Concrete	4,154	6/7/7	GD	ND		V	
2	01	046	7.74	02319	North Fork Nehalem River, Hwy 46 at MP 7.74	1937	Steel	4,959	6/5/6	PR	ND		V	
2	01	046	13.51	00883	Big Rack Heap Creek, Hwy 46	1922	Concrete	1,012	7/6/5	PR	ND		NV	
2	01	046	17.76	01217	Nehalem River, Hwy 46	1926	Steel	7,321	6/6/6	GD	ND		V	
2	01	046	17.91	01371A	Mohler Oflow, Hwy 46	1980	Prestressed concrete	7,392	7/7/7	VG	ND		V	
2	01	047	2.24	21188	Volmer Creek, Hwy 47 at MP 2.24	2011	Prestressed concrete	1,276	7/7/7	VG	ND		NV	
2	01	047	3.26	21189	Johnson Creek, Hwy 47 at MP 3.26	2011	Prestressed concrete	1,392	7/7/7	VG	ND		NV	
2	01	047	3.99	19666	Mail Creek, Hwy 47	2004	Prestressed concrete	4,391	7/7/7	VG	ND		NV	
2	01	047	4.4	02601	Necanicum River, Hwy 47 at MP 4.40 (Black)	1939	Concrete continuous	6,300	7/6/6	GD	OD	Rail LSL DG	V	3
2	01	047	5.85	03095	Lindsley Creek, Hwy 47	1955	Concrete	1,217	7/6/5	PR	OD	DG	V	3
2	01	047	7.07	06524	North Fork Necanicum River, Hwy 47 at MP 7.07	1942	Concrete continuous	3,620	6/6/6	GD	ND		V	3
2	01	047	8.22	03099	Little Humbug Creek, Hwy 47	1956	Concrete	1,210	6/6/4	PR	SD	SD LSL DG Scour	V	3
2	01	047	10.23	01812A	Necanicum River, Hwy 47 at MP 10.23	1970	Prestressed concrete	7,055	7/7/7	VG	ND		NV	
2	01	047	16.28	22057	West Humbug Creek, Hwy 47	2014	Prestressed concrete	3,644	7/8/8	VG	ND		NV	
2	01	047	17.37	01832	East Fork Humbug Creek, Hwy 47	1934	Wood or Timber	2,647	7/6/5	PR	OD	Rail LSL DG TS	V	3

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	047	21.73	02165	Nehalem River & Hwy 103, Hwy 47	1939	Concrete	22,152	6/6/6	GD	OD	LSL	V	3
2	01	047	24.23	02164	North Fork Quartz Creek, Hwy 47	1939	Steel continuous	29,083	6/6/6	GD	OD	LSL DG Scour	V	5
2	01	047	24.47	02166	South Fork Quartz Creek, Hwy 47 at MP 24.47	1938	Concrete	963	6/6/5	PR	OD	Scour	NV	
2	01	047	28.92	02479A	South Fork Rock Creek, Hwy 47	1975	Steel	-	6	GD	ND		NV	
2	01	047	34.93	02027A	North Fork Wolf Creek, Hwy 47	1938	Prestressed concrete	5,761	7/7/6	GD	ND		PV	3
2	01	047	37.38	02029	Wolf Creek, Hwy 47	1938	Concrete continuous	6,067	6/7/6	GD	ND		PV	3
2	01	047	37.88	02364A	Nehalem River, Hwy 47	1940	Prestressed concrete	11,717	6/7/5	PR	OD	LSL LC	PV	3
2	01	047	45.31	02672	W Fork Dairy Creek, Hwy 47 at MP 45.31	1940	Wood or Timber	5,801	7/7/5	PR	OD	TS	PV	3
2	01	047	46.3	20945	West Fork Dairy Creek, Hwy 47 at MP 46.30	2013	Prestressed concrete	4,667	7/8/7	VG	ND		NV	
2	01	047	49.47	02363	Hwy 47 over Hwy 102 & POTB RR (Davies)	1941	Concrete continuous	22,424	7/6/6	GD	ND		V	3
2	01	047	50.22	02362A	W Fork Dairy Creek, Hwy 47 at MP 50.22	1941	Concrete continuous	3,863	7/6/6	GD	OD	LSL LC	PV	3
2	01	047	54.45	06999A	Bledsoe Creek, Hwy 47 EB	1971	Prestressed concrete	4,682	7/7/6	GD	ND		V	3
2	01	047	54.45	06999	Bledsoe Creek, Hwy 47 WB	1946	Steel continuous	5,658	6	GD	ND		PV	3
2	01	047	54.55	21323	East Fork Dairy Creek HWY 047 WB at MP 54.55	2010	Prestressed concrete continuous	5,783	7/7/8	VG	ND		NV	
2	01	047	54.55	02366B	East Fork Dairy Creek, Hwy 47 EB	1971	Prestressed concrete	5,078	7/6/6	GD	ND		V	3
2	01	092	21.48	02670A	South Fork Scappoose River, Hwy 2W	1980	Prestressed concrete	11,088	7/6/7	GD	ND		V	2
2	01	092	21.84	02668A	North Fork Scappoose River, Hwy 2W	1980	Prestressed concrete	5,040	7/6/5	PR	ND		NV	
2	01	092	23.15	02667	Honeyman Creek, Hwy 2W	1919	Concrete	-	6	GD	OD	LSL	NV	
2	01	092	27.53	17435	McNulty Creek, Hwy 2W	1996	Prestressed concrete	2,958	6/7/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	Struc NBI Rating	Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	092	28.44	17434	Milton Creek, Hwy 2W	1996	Prestressed concrete	8,091	6/7/5	PR	ND		NV	
2	01	092	36.47	00338	Tide Creek, Hwy 2W Frtg Rd Rt	1920	Concrete continuous	2,025	6/6/6	GD	ND		V	
2	01	092	36.47	00338A	Tide Creek, Hwy 2W	1958	Concrete continuous	7,732	6/6/6	GD	OD	LSL VC	PV	2
2	01	092	40.74	00191A	Goble Creek, Hwy 2W	1960	Concrete	5,380	7/6/5	PR	OD	TS	V	2
2	01	092	48.92	02046	Columbia R, Hwy 2W Conn (Lewis & Clark, Longview)	1929	Steel continuous	197,697	6/6/5	PR	OD	LC	V	
2	01	092	53.05	00146A	Beaver Creek, Hwy 2W	1968	Prestressed concrete	4,978	6/6/6	GD	ND		V	2
2	01	092	55.29	07722	Lost Creek, Hwy 2W	1953	Concrete continuous	1,742	7/7/6	GD	OD	DG	PV	2
2	01	092	60.82	07715	Hwy 2W over Swedetown County Rd	1954	Concrete continuous	4,528	6/6/6	GD	OD	DG VC	V	2
2	01	092	61.21	07519	Clatskanie River, Hwy 2W	1954	Concrete continuous	5,038	7/6/4	PR	SD	SD LSL DG	V	2
2	01	092	67.87	21455	Eilertsen Creek, Hwy 2W	2011	Prestressed concrete	1,776	8/7/8	VG	ND		NV	
2	01	092	70.71	00185A	Plympton Creek, Hwy 2W	1958	Concrete continuous	3,093	7/7/6	GD	ND		V	2
2	01	092	77.25	00921	Gnat Creek, Hwy 2W	1929	Concrete continuous	5,004	6/6/6	GD	OD	LSL DG	V	2
2	01	092	82.52	07417	Big Creek, Hwy 2W	1951	Concrete continuous	6,084	6/6/6	GD	OD	DG	V	2
2	01	092	85.27	09546	Ferris Creek, Hwy 2W	1967	Prestressed concrete continuous	42,419	6/6/6	GD	ND		V	2
2	01	092	86.21	09544	Bear Creek, Hwy 2W	1967	Prestressed concrete	6,900	7/7/7	VG	ND		V	2
2	01	092	86.43	09543	Marys Creek, Hwy 2W	1967	Prestressed concrete continuous	23,712	6/6/7	GD	ND		V	2
2	01	092	92.5	01827B	John Day River, Hwy 2W	1990	Prestressed concrete	47,150	6/6/5	PR	ND		PV	2
2	01	092	94.69	21357	Mill Creek, Hwy 2W	2014	Steel	5,120	7/7/8	VG	ND		NV	
2	01	102	4.58	02320A	Walluski River, Hwy 102	1980	Steel continuous	17,460	6/6/6	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	102	11.85	03104A	North Fork Klaskanine River, Hwy 102 at MP 11.85	1921	Concrete continuous	4,804	5/6/6	PR	ND		V	
2	01	102	15.76	01964	North Fork Klaskanine River, Hwy 102 at MP 15.76	1934	Steel	1,093	6/6/6	GD	ND		NV	
2	01	102	19.27	01963	South Fork Klaskanine River, Hwy 102 at MP 19.27	1934	Steel	2,727	6/7/6	GD	ND		V	
2	01	102	25.43	03108	Hamilton Creek, Hwy 102	1963	Prestressed concrete	2,275	7/7/6	GD	ND		V	
2	01	102	29.32	01991	Beneke Creek, Hwy 102	1934	Steel	5,360	7/6/5	PR	OD	TS	V	
2	01	102	29.84	03110A	Nehalem River, Hwy 102 at MP 29.84	1966	Prestressed concrete	11,755	7/7/6	GD	ND		V	
2	01	102	32.06	03111A	Nehalem River, Hwy 102 at MP 32.06	1953	Concrete continuous	9,300	7/6/6	GD	ND		V	
2	01	102	33.59	18775	Mulak Creek, Hwy 102	2000	Prestressed concrete	3,677	8/7/7	VG	ND		NV	
2	01	102	35.08	03112A	Nehalem River, Hwy 102 at MP 35.08	1953	Concrete continuous	10,499	6/5/6	PR	ND		V	
2	01	102	36.75	01707A	Sager Creek, Hwy 102	1932	Prestressed concrete	3,200	8/8/7	VG	ND		NV	
2	01	102	38.1	01710A	Oflow Channel, Hwy 102 at MP 37.98	1990	Prestressed concrete	1,044	8/7/8	VG	ND		NV	
2	01	102	38.59	03113A	Nehalem River, Hwy 102 at MP 38.59	1966	Prestressed concrete	11,742	5/7/6	PR	ND		V	
2	01	102	38.81	01712A	Grub Creek, Hwy 102	1990	Prestressed concrete	2,160	8/8/8	VG	ND		NV	
2	01	102	40.62	03139A	Nehalem River, Hwy 102 at MP 40.62 (Birkenfeld)	1956	Concrete continuous	8,016	5/6/6	PR	ND		V	
2	01	102	43.7	20848	Nehalem River, Hwy 102 at MP 43.70 (Banzer)	2010	Prestressed concrete continuous	10,822	7/8/7	VG	ND		NV	
2	01	102	45.45	19872	Ford Creek, Hwy 102	2006	Prestressed concrete	5,280	7/8/7	VG	ND		NV	
2	01	102	45.63	19873	Lyons Creek, Hwy 102 AT MP 45.63	2006	Prestressed concrete	3,776	6/7/7	GD	ND		NV	
2	01	102	48.63	19874	Battle Creek, Hwy 102 AT MP 48.63	2007	Prestressed concrete	4,642	7/6/8	GD	ND		NV	
2	01	102	53.07	01748A	Oak Ranch Creek, Hwy 102	1978	Prestressed concrete	2,520	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	Struc NBI Rating	Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	102	57.14	01415	East Fork Nehalem River, Hwy 102 at MP 57.14	1929	Concrete continuous	3,280	7/7/7	VG	ND		V	
2	01	102	57.68	03145A	Nehalem River, Hwy 102 at MP 57.68	1959	Concrete continuous	6,474	6/6/5	PR	ND		V	
2	01	102	59.58	03146A	Nehalem River, Hwy 102 at MP 59.58	1958	Concrete continuous	5,611	6/6/5	PR	OD	Scour	V	
2	01	102	61.28	02323	Nehalem River, Hwy 102 at MP 61.28	1938	Steel	7,967	6/6/4	PR	SD	SD LSL TS	V	
2	01	102	62.27	01508	Rock Creek, Hwy 102	1930	Concrete continuous	5,506	7/5/5	PR	OD	LSL	V	
2	01	102	63.65	02598A	Nehalem River, Hwy 102 at MP 63.65	1959	Steel	7,681	7/6/7	GD	ND		V	
2	01	102	64.21	03148	Beaver Creek, Hwy 102 at MP 64.21	1968	Prestressed concrete	2,715	7/7/5	PR	OD	TS	V	
2	01	102	64.6	02301	Beaver Creek, Hwy 102 at MP 64.60	1936	Wood or Timber	2,581	7/7/5	PR	OD	TS	V	
2	01	102	65.22	03151	Beaver Creek, Hwy 102 at MP 65.22	1964	Prestressed concrete	2,646	7/6/4	PR	SD	SD LSL TS	V	
2	01	102	69.03	03156A	Beaver Creek, Hwy 102 at MP 69.03	1966	Prestressed concrete	2,274	7/7/6	GD	OD	TS	V	
2	01	102	69.79	04950	Beaver Creek, Hwy 102 at MP 69.79	1964	Prestressed concrete	1,166	7/7/5	PR	SD	SD LSL TS	V	
2	01	102	70.51	01760	Beaver Creek, Hwy 102 at MP 70.51	1932	Wood or Timber	1,296	7/7/5	PR	ND		V	
2	01	102	75.09	04953A	Cummings Creek, Hwy 102	1954	Concrete	630	7/7/6	GD	OD	TS	NV	
2	01	102	81.94	20316	Oflow, Hwy 102 at MP 81.94	2006	Prestressed concrete	1,786	7/7/6	GD	ND		NV	
2	01	102	82.65	02303	West Fork Dairy Creek, Hwy 102 at MP 82.65	1936	Wood or Timber	2,237	6/6/3	PR	SD	SD LSL TS LC	V	
2	01	102	86.22	04960A	South Fork Dairy Creek, Hwy 102	1942	Prestressed concrete	3,436	7/7/7	VG	OD	Rail	V	
2	01	102	86.34	02347	West Fork Dairy Creek, Hwy 102 at MP 86.34	1937	Wood or Timber	2,552	7/7/6	GD	OD	Rail DG TS	V	
2	01	102	86.39	02067A	Dairy Creek Oflow, Hwy 102	1978	Prestressed concrete	1,540	7/7/7	VG	ND		NV	
2	01	102	88.84	18615	Culvert, Hwy 102 at MP 88.82	2000	Concrete	-	8	VG	ND		NV	


2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	102	89.69	18618	Culvert, Hwy 102 at MP 89.66	2000	Concrete continuous	-	8	VG	ND		NV	
2	01	103	0.02	03103A	Fishhawk Creek, Hwy 103 (Jewell)	1989	Concrete continuous	3,790	6/7/7	GD	ND		PV	
2	01	103	5.25	02074	Nehalem River, Hwy 103 at MP 5.25	1957	Concrete continuous	11,471	6/5/6	PR	ND		V	
2	01	103	6.32	18165	Cow Creek, Hwy 103	1997	Prestressed concrete	1,260	7/7/7	VG	ND		NV	
2	01	104	2.32	11233B	Power Slough (Alder Creek), Hwy 104	1989	Prestressed concrete	2,520	7/7/7	VG	ND		NV	
2	01	105	0.17	11226A	Skipanon River, Hwy 105	1978	Prestressed concrete	31,537	6/6/6	GD	ND		V	
2	01	105	4.78	00711	Lewis & Clark River, Hwy 105	1924	Steel	22,446	6/5/5	PR	OD	LSL LC CP	V	
2	01	105	6.89	00330	Youngs Bay, Hwy 105 (Old Youngs Bay)	1921	Steel	61,818	6/5/4	PR	SD	PAINT TS LC CP MB	V	
2	01	105	7.1	02418	Hwy 105 over Port of Astoria Belt Line (Abandoned)	1921	Concrete continuous	1,457	6/6/6	GD	ND		V	
2	01	110	1.25	20804	Fish Passage Culvert HWY 110 at MP 1.25	2008	Concrete	1,440	7	VG	ND		NV	
2	01	130	1.27	04691A	Little Nestucca River, Hwy 130 at MP 1.27 (Meda)	1956	Concrete continuous	8,077	6/6/5	PR	ND		V	
2	01	130	3.23	01864	Panther Creek, Hwy 130	1957	Wood or Timber	1,701	7/7/6	GD	OD	LC	V	
2	01	130	3.6	01863	Squaw Creek, Hwy 130	1942	Wood or Timber	1,839	7/6/6	GD	OD	LC	V	
2	01	130	3.82	01862	Austin Creek, Hwy 130	1962	Wood or Timber	1,373	7/6/6	GD	OD	LC	V	
2	01	130	4.15	01861	Little Nestucca River, Hwy 130 at MP 4.15	1934	Steel	3,951	6/5/5	PR	OD	PAINT LC	V	
2	01	130	4.76	01860	Bear Creek, Hwy 130	1954	Wood or Timber	1,651	7/6/6	GD	OD	LC	V	
2	01	130	5.11	01859A	Little Nestucca River, Hwy 130 at MP 5.11 (Yach)	1952	Steel	3,690	6/5/7	PR	OD	LSL	V	
2	01	130	5.97	01858A	Little Nestucca R, Hwy 130 at MP 5.97 (Muscott)	1951	Steel	3,690	6/5/7	PR	OD	LSL	V	
2	01	130	7.55	01857A	Little Nestucca River, Hwy 130 at MP 7.55 (Weed)	1951	Steel	6,150	6/5/6	PR	OD	LSL	V	

2017 BRIDGE CONDITION REPORT - District 1

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rating	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	01	130	8.52	02299A	Little Nestucca River, Hwy 130 at MP 8.52 (Meader)	1972	Prestressed concrete continuous	8,849	7/7/7	VG	ND		V	
2	01	131	7.49	01345C	Tillamook River, Hwy 131	1962	Steel	20,261	6/6/5	PR	OD	LSL PAINT	V	
2	01	131	8.33	05640A	Trask River, Hwy 131 (Stillwell)	1948	Steel	11,777	5/6/6	PR	OD	LSL	V	
2	01	092AX	48.36	09591	Lewis & Clark Br Conn over Hwy 2W	1969	Concrete continuous	11,021	7/6/7	GD	ND		PV	
2	01	092BE	72.75	09598	Hwy 2W Conn over Hwy 2W (Wauna Intchg)	1967	Prestressed concrete	7,182	5/6/7	PR	ND		V	2
2	01	C0000	55.19	06519A	Dersham Rd over Hwy 47	1971	Prestressed concrete continuous	9,039	7/6/6	GD	ND		PV	3
2	01	C0000	82.84	07418	Maggie Johnson Rd over Hwy 2W	1951	Concrete continuous	3,075	7/6/6	GD	ND		V	
2	01	Hwy 485	4.62	01400	Skipanon River, Hwy 485 (Fort Stevens Spur)	1929	Steel	3,548	4/5/6	PR	SD	SD LSL PAINT LC	V	

APRIL 2017

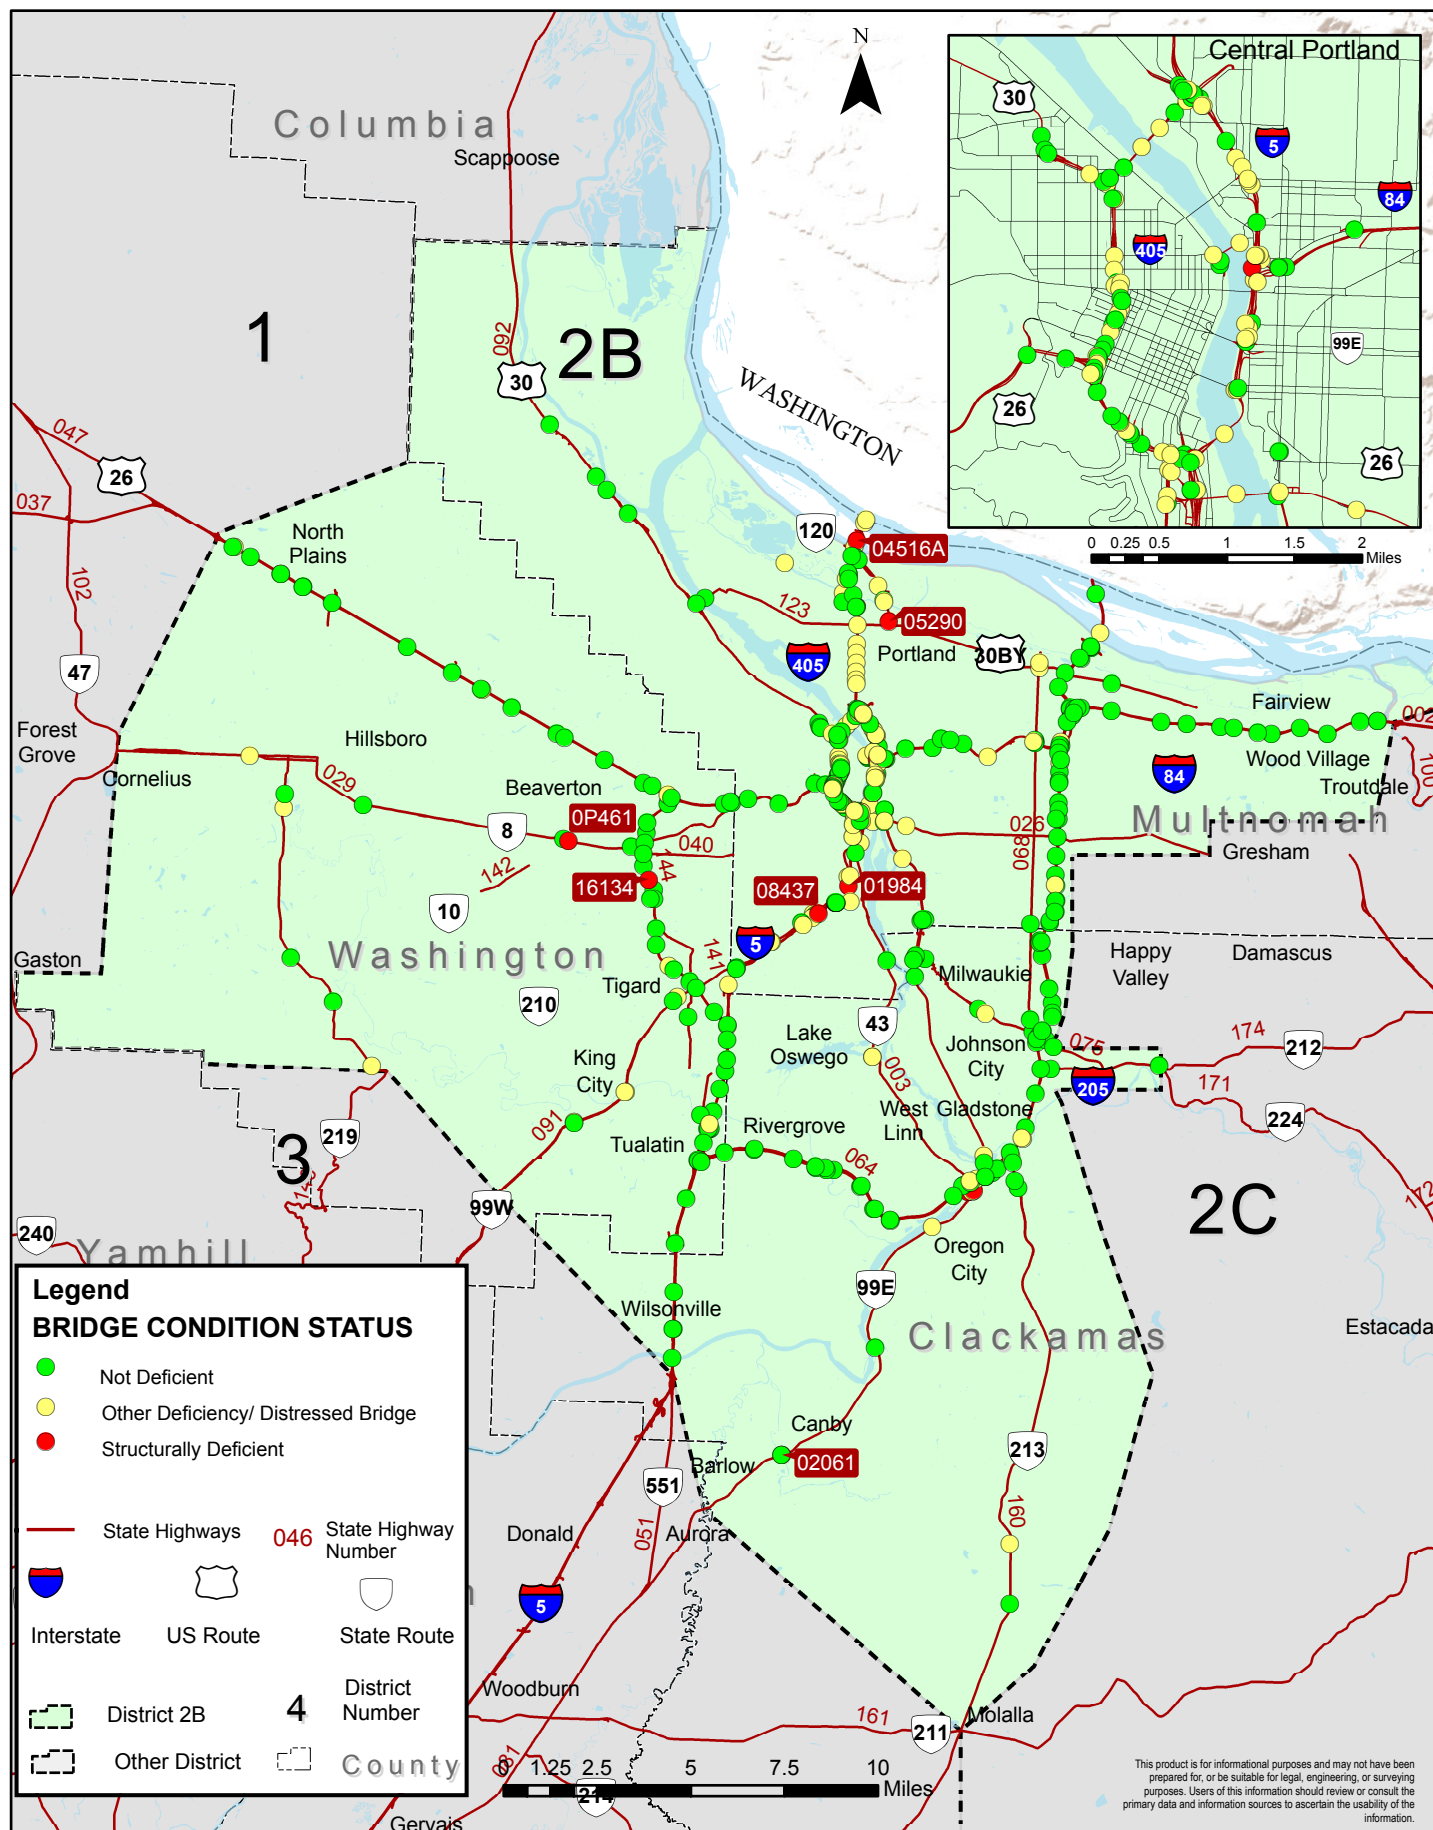

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	061	3.32	02529	Willamette River, Hwy 61 (Fremont)	1973	Steel continuous	308,019	6/6/6	GD	OD	PAINT	V	2
1	22	002	0.24	08588A	Hwy 2 WB to Hwy 1 NB over UPRR (Banfield Intchg)	1963	Steel	39,930	5/6/6	PR	OD	DG	V	3
1	22	002AB	0.52	08588B	Hwy 2 WB to Hwy 1 SB over Hwy 1 (Banfield Intchg)	1963	Steel	52,789	5/6/5	PR	OD	LSL DG VC	V	3
1	22	002	0.23	08588C	Hwy1 SB to Hwy2 EB over Hwy1 & Conn (Banfield Int)	1963	Steel	47,503	4/6/6	PR	SD	VC	V	3
1	22	001UY	301.50	08588D	Hwy 1 NB Conn to Hwy 2 EB over UPRR (Banfield Int)	1963	Steel	57,870	6/6/6	GD	OD	DG VC	V	3
1	22	001TI	301.81	R8588E	Hwy 1 SB Conn #7 to SE Morrison St (Morrison Intg)	1963	Steel	19,813	6/6/7	GD	OD	VC	PV	
1	22	001TD	302.20	08589A	Hwy 1 SB to Belmont St over Hwy 1 (Morrison Int)	1963	Steel	38,936	5/6/6	PR	ND		V	3
1	22	001TE	301.10	08589B	SE Belmont St to Hwy 1 NB over Hwy1 (Morrison Int)	1963	Steel	32,940	5/6/6	PR	OD	DG	PV	
1	22	001TI	301.12	08589C	Hwy1 SB Conn Morrison St over Hwy1 (Morrison Int)	1963	Steel	37,748	5/6/6	PR	OD	LSL DG VC	PV	
1	22	001UY	301.50	08589D	SE Morrison St to Hwy1 NB over Conn (Morrison Int)	1963	Steel	25,435	5/6/7	PR	OD	VC	PV	
1	22	001VK	301.23	19660	SE Morrison St EB Conn #5 to Hwy 2 EB Hwy 1W Conn over Front Ave & UPRR (Steel Br Ramp)	1996	Prestressed concrete	18,030	6/7/7	GD	ND		NV	
1	22	091BW	-0.31	06683A	Hwy 1W NB Conn #1 (Steel Br E Approach)	1950	Steel	28,280	6/5/6	PR	OD	PAINT	V	
1	22	091	-0.44	06683B	Hwy 1W NB Conn #1 (Steel Br E Approach)	1910	Steel	13,376	6/5/6	PR	OD	PAINT	V	
1	22	064	9.51	09702	Hwy 64 over Main St (Oregon City)	1972	Concrete continuous	27,951	6/6/6	GD	ND		PV	1
1	22	064AW	10.24	09750	Parkplace Conn over Hwy 64	1971	Prestressed concrete continuous	24,834	6/6/6	GD	ND		PV	
1	22	064	9.69	09883	Culvert, Hwy 64 at MP 9.69	1971	Concrete continuous	-	6	GD	ND		NV	
1	22	C0000	0.00	08898	Strawberry Lane over Hwy 64	1962	Prestressed concrete	7,399	7/7/7	VG	ND		PV	
1	22	171	4.44	09719	Hwy 64 NB Conn to Hwy 68 NB & Hwy171 WB over Hwy64	1974	Prestressed concrete continuous	19,401	6/5/6	PR	ND		PV	
1	22	C0000	0.00	09757	82nd Dr over Hwy 64 (Gladstone Intchg)	1971	Prestressed concrete continuous	24,021	6/6/6	GD	ND		PV	
1	22	064	10.72	N8837B	Clackamas River, Hwy 64 NB (Parkplace)	1962	Steel	37,570	7/6/6	GD	OD	Scour	V	1
1	22	064	10.72	S8837A	Clackamas River, Hwy 64 SB (Parkplace)	1962	Steel	39,824	6/6/6	GD	OD	Scour	V	1
1	22	064	16.80	09711	Hwy 64 NB over SE 92nd Ave	1974	Prestressed concrete continuous	27,407	7/6/6	GD	ND		PV	1
1	22	064	16.80	09711A	Hwy 64 SB over SE 92nd Ave	1974	Prestressed concrete continuous	27,105	7/6/6	GD	ND		PV	1

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	064DF	16.24	09712B	Johnson Creek Blvd over Hwy 64	1974	Prestressed concrete continuous	34,844	7/6/6	GD	ND		PV	
1	22	C0000	0.00	09713	Otty Road over Hwy 64	1974	Prestressed concrete continuous	24,973	6/6/6	GD	ND		PV	
1	22	064BG	14.58	09715	SE Sunnyside Rd over Hwy 64	1973	Prestressed concrete continuous	27,600	6/5/6	PR	ND		PV	
1	22	064	13.76	09717	Hwy 64 NB over UPRR	1973	Prestressed concrete	19,050	7/7/6	GD	ND		V	1
1	22	064	13.76	09717A	Hwy 64 SB over UPRR	1973	Prestressed concrete	18,501	7/7/6	GD	ND		V	1
1	22	171AK	4.09	09718	Hwy 171 Conn (SE 82nd Dr) over Hwy 64	1975	Prestressed concrete continuous	28,862	6/6/6	GD	ND		PV	
1	22	064DH	16.28	17076	Hwy 64 Conn over Bikepath	1990	Concrete	1,467	7/6/7	GD	ND		NV	
1	22	064DI	16.17	17077	Hwy 64 Conn over Bikepath (Johnson Creek Blvd)	1990	Concrete	1,467	6/6/7	GD	ND		NV	
1	22	C0000	14.32	17118	SE Sunnyside Rd over Hwy 64	2003	Prestressed concrete continuous	28,619	6/6/7	GD	ND		NV	
1	22	064DN	14.23	17258	Mt Scott Creek, NB Hwy 64 Conn to SE Sunnyside Rd	2003	Prestressed concrete continuous	16,258	7/7/6	GD	ND		NV	
1	22	C0000	0.00	18596	SE Monterey Ave over Hwy 64	2002	Prestressed concrete continuous	23,807	6/7/7	GD	ND		NV	
1	22	C0000	18.62	13533	SE Holgate Blvd over Hwy 64	1978	Prestressed concrete continuous	24,854	7/6/6	GD	ND		NV	
1	22	064	17.80	13538	Hwy 64 NB over SE Woodstock Blvd & SE Foster Rd	1978	Prestressed concrete continuous	26,988	6/6/6	GD	ND		PV	1
1	22	064	17.80	13538A	Hwy 64 SB over SE Woodstock Blvd & SE Foster Rd	1978	Prestressed concrete continuous	26,788	6/6/6	GD	OD	LSL	PV	1
1	22	064	17.43	13540	Hwy 64 NB over Portland Traction RR (Abandoned)	1974	Prestressed concrete	20,234	6/7/6	GD	ND		V	1
1	22	064	17.43	13540A	Hwy 64 SB over Portland Traction RR (Abandoned)	1974	Prestressed concrete	21,842	6/7/6	GD	ND		V	1
1	22	064	17.22	13541	Johnson Cr & Mt Scott Blvd (Flavel St), Hwy 64 NB	1974	Prestressed concrete continuous	24,764	6/6/7	GD	ND		PV	1
1	22	064	17.22	13541A	Johnson Cr & Mt Scott Blvd (Flavel St), Hwy 64 SB	1974	Prestressed concrete continuous	24,764	6/6/7	GD	ND		PV	1
1	22	064	19.12	13531	Hwy 64 over Hwy 26 (SE Powell Blvd)	1979	Concrete continuous	31,694	7/6/6	GD	ND		PV	1
1	22	064	18.11	13537	Hwy 64 over SE Harold St	1978	Prestressed concrete	17,824	6/6/6	GD	ND		PV	1
1	22	064	19.82	16302	Hwy 64 over MAX LRT	1978	Concrete	17,776	7/7/6	GD	ND		PV	1
1	22	002	17.37	07046	Hwy 2 EB over NW Graham Rd	1948	Concrete continuous	5,406	6/6/6	GD	OD	VC	PV	
1	22	002	17.37	07046A	Hwy 2 WB over NW Graham Rd	1958	Concrete continuous	5,220	5/6/6	PR	ND		PV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	002	13.03	07089A	Hwy 2 over NE 181st Ave	1992	Prestressed concrete	17,248	6/7/6	GD	ND		PV	1
1	22	002	13.39	07498A	Hwy 2 over UPRR (Cereghino)	1992	Prestressed concrete	20,864	6/7/7	GD	ND		NV	
1	22	C0000	14.43	17208	NE 207th Ave over Hwy 2	1996	Prestressed concrete continuous	20,509	7/7/7	VG	ND		NV	
1	22	002	14.05	17212	Hwy 2 over NE 201st Ave (NE Birdsedale Rd)	1996	Prestressed concrete	15,129	6/6/6	GD	ND		NV	
1	22	002	15.22	17213	Hwy 2 over NE 223rd Ave (NE Fairview Ave)	1996	Prestressed concrete	17,720	7/6/6	GD	ND		NV	
1	22	002IO	16.00	17365	NE Arata Rd (NE 238th Ave) over Hwy 2	1998	Prestressed concrete continuous	25,241	6/6/6	GD	ND		NV	
1	22	C0000	6.73	02163A	NE 102nd Ave over Hwy 2	1936	Steel	42,834	5/6/6	PR	OD	VC	V	
1	22	002	10.08	07043A	Hwy 2 over NE 122nd Ave	1990	Prestressed concrete	23,962	7/7/7	VG	ND		PV	1
1	22	002	11.43	07044A	Hwy 2 over NE 148th Ave	1990	Concrete continuous	23,273	6/6/6	GD	ND		PV	1
1	22	002AW	6.72	13514B	Hwy 2 EB Conn to Hwy 64 NB over Hwy 64 NB Conn	1979	Prestressed concrete	4,824	7/5/7	PR	ND		NV	
1	22	C0000	22.71	13514C	Hwy 64 over Hwy 64 SB Conn to Hwy 2 EB	1979	Concrete	23,400	5/5/5	PR	ND		PV	1
1	22	064	6.64	13514D	Hwy 64 over Hwy 2 WB Conn to Hwy 64 SB	1980	Concrete	21,944	5/5/5	PR	ND		PV	1
1	22	C0000	6.76	13514E	NE 102nd Ave over Hwy 2 Conn 2&3 & Hwy 64 Conn 1&2	1977	Prestressed concrete continuous	30,680	6/7/6	GD	ND		PV	3
1	22	002	6.94	13514F	Hwy 2 WB over Hwy 2 WB Conns to Hwy 64	1979	Prestressed concrete continuous	23,160	6/5/6	PR	ND		V	1
1	22	002	6.60	13514H	Hwy 2 & UPRR over Hwy 2 EB Conn #1 to Hwy 64 NB	1981	Concrete	20,501	5/5/5	PR	ND		NV	
1	22	002AY	6.83	13514L	RR Service Rd over Hwy 2 & Hwy 64 Conns	1979	Prestressed concrete	3,240	7/7/6	GD	ND		NV	
1	22	002BA	6.09	R2163A	NE 102nd Conn to Hwy 2 WB over UPRR	1954	Concrete continuous	8,280	6/6/6	GD	ND		V	
1	22	002	3.55	07032A	Hwy 2 over NE 58th Ave Conn to Hwy 2 WB	1955	Concrete	6,853	6/6/5	PR	OD	VC	NV	
1	22	068	2.43	07999C	Hwy 68 Conn (NE Halsey St) over Hwy 2	1985	Prestressed concrete	15,180	7/6/6	GD	OD	LSL VC	NV	
1	22	002AM	3.26	16553	Hwy 2 WB Conn to NE 43rd Ave over UPRR & MAX LRT	1985	Prestressed concrete continuous	20,709	7/6/7	GD	ND		NV	
1	22	002AJ	1.95	R7025B	NW 33rd Ave Conn to Hwy 2 WB over UPRR & MAX LRT	1985	Concrete continuous	9,765	6/6/6	GD	ND		NV	
1	22	059AA	2.36	R7026A	Hwy 59 Conn over MAX LRT & UPRR	1984	Concrete continuous	40,469	6/6/6	GD	ND		NV	
1	22	002AG	1.27	07036	Hwy 2 WB Conn to NE Lloyd Blvd over UPRR	1958	Concrete continuous	12,740	6/6/6	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	002	1.82	07981A	Hwy 2 over Doernbecher Access Rd	1958	Concrete	5,880	6/5/6	PR	ND		NV	
1	22	002	12.13	07088A	Hwy 2 over NE 162nd Ave	1990	Prestressed concrete	18,267	6/6/6	GD	ND		PV	1
1	22	C0000	5.82	13516	NE Halsey St over Hwy 2 & UPRR & MAXLRT @ MP 5.82	1977	Prestressed concrete continuous	71,375	6/6/6	GD	OD	LSL	NV	
1	22	002	16.90	21816	Hwy 2 WB over Marine Dr	2015	Prestressed concrete	13,433	8/8/8	VG	ND		NV	
1	22	026	0.10	05194R	Arthur St Viaduct, Hwy 26 Conn to Hwy 1W	1947	Concrete	11,187	5/5/6	PR	OD	LSL	V	5
1	22	C0000	1.60	21629	SE 17th Ave over Hwy 26 (SE Powell Blvd)	2013	Prestressed concrete	5,963	7/8/8	VG	OD	LSL VC	NV	
1	22	091	1.41	05194	Hwy 1W over SW Arthur St	1947	Steel continuous	43,545	6/6/6	GD	OD	LSL	V	
1	22	026AD	0.99	06767	Hwy 26 EB Off Ramp to Hwy 1E SB	1956	Steel	11,891	6/7/7	GD	ND		V	4
1	22	026	1.01	06767A	Hwy 26 over Hwy 1E (McLoughlin Bd) (Ross Is Appr)	1966	Prestressed concrete	6,686	6/7/6	GD	OD	DG	V	4
1	22	026	0.77	05054	Willamette R & Hwy 1 & OPR, Hwy 26 (Ross Island)	1926	Steel continuous Prestressed concrete	189,230	6/5/6	PR	OD	VC LC	V	5
1	22	160	12.46	01352A	Molalla River, Hwy 160 (Wrights)	1975	continuous	30,287	7/7/6	GD	ND		PV	
1	22	160	10.81	20666	Milk Creek Hwy 160 at MP 10.81	2009	Prestressed concrete	11,560	7/8/8	VG	OD	LC	NV	
1	22	160	-0.03	09727	HWY 160 (OR 213) over UPRR, MP -0.05	1971	Concrete continuous Prestressed concrete	19,267	6/5/6	PR	OD	Rail	PV	
1	22	160	0.85	16522	Hwy 160 over Redland Rd	1983	continuous	20,008	6/6/7	GD	ND		NV	
1	22	C0000	0.63	16523	Holcomb Blvd (Oregon City) over Hwy 160	1983	Prestressed concrete	8,359	7/7/6	GD	ND		NV	
1	22	160	0.01	21417	Hwy 160 (OR 213) over Washington St at MP 0.01	2012	Steel	14,557	7/8/7	VG	ND		NV	
1	22	068	7.10	04566B	Johnson Creek, Hwy 68 (SE 82nd Ave)	1930	Steel	5,854	7/6/6	GD	ND		V	
1	22	068	2.19	07999	Hwy68 Conn (NE Halsey St) over Hwy68 (NE 82nd Ave)	1956	Steel	17,932	6/6/6	GD	ND		V	
1	22	068AB	0.10	08401B	NE Columbia Blvd over Hwy 68 (NE 82nd Ave)	1960	Concrete continuous	12,254	6/5/6	PR	OD	VC	PV	
1	22	068	2.24	01994	Hwy 68 (NE 82nd Ave) over UPRR & WB MAX LRT	1934	Concrete continuous	13,572	7/6/6	GD	ND		V	
1	22	068	9.67	02135A	Mt Scott Creek & UPRR, Hwy 68 (82nd Ave) @ MP 9.67	1941	Concrete continuous	16,170	6/7/6	GD	ND		V	
1	22	068	2.25	07031A	Hwy 68 (NE 82nd Ave) over Hwy 2 and EB MAX LRT	1985	Prestressed concrete	16,121	6/7/6	GD	ND		NV	
1	22	001	300.69	08590C	Hwy 1 SB over Marquam Bridge Ramp	1966	Steel	146,199	5/6/6	PR	OD	VC	V	3

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	001	300.68	08590D	Hwy 1 NB over Hawthorne Br Ramps (E Marquam Int)	1966	Steel	143,781	7/7/6	GD	OD	LSL	V	3
1	22	001UY	300.68	08590Y	NB Hwy 1 Ramp to Hwy 2 EB (E Marquam Intchg)	1992	Steel continuous	41,733	7/7/7	VG	ND		NV	
1	22	091	1.29	09153	Hwy 1W over Hwy 61	1964	Prestressed concrete	21,600	6/7/6	GD	OD	LSL	PV	
1	22	026AC	0.13	09153R	Hwy 26 Conn (SW Front Ave) over Hwy 61	1964	Prestressed concrete	6,860	6/6/6	GD	OD	VC	V	4
1	22	C0000	0.71	09154	SW 1st Ave over Hwy 61	1964	Concrete continuous	19,162	6/6/6	GD	OD	LSL	PV	
1	22	C0000	0.88	09155	SW 4th Ave over Hwy 61 & Conn #8	1964	Concrete continuous	13,297	6/6/6	GD	ND		PV	
1	22	061	0.99	09156	SW 5th Ave Conn #8 to Hwy 61 SB over Hwy 61	1964	Concrete continuous	7,535	6/6/7	GD	ND		PV	
1	22	061	1.00	09157	SW 5th Ave over Hwy 61	1964	Concrete continuous	14,351	5/5/6	PR	ND		PV	
1	22	061	1.02	09158	SW 6th Ave Conn #3 over Hwy 61	1964	Concrete continuous	13,495	6/5/6	PR	OD	LSL DG	PV	
1	22	061	0.78	09159	SW Broadway Conn #6 to Hwy 61 SB over Hwy 61	1964	Concrete continuous	7,017	6/6/6	GD	OD	VC	PV	
1	22	061	1.09	09160	SW Broadway Conn #4 over Hwy 61	1967	Concrete continuous	11,233	5/6/6	PR	ND		PV	
1	22	C0000	1.18	09161	SW Park Ave over Hwy 61	1967	Concrete continuous	19,336	7/5/6	PR	ND		PV	
1	22	061AO	1.65	09254A	Hwy 61 Conn over Hwy 61 SB Conn to Hwy 47 WB	1967	Concrete	6,732	5/6/6	PR	OD	VC	NV	
1	22	061	1.65	09254B	Hwy 61 over Hwy 47 EB Conn #1 to Hwy 61 NB	1967	Concrete	15,998	5/5/6	PR	ND		NV	
1	22	047	73.97	09254C	SW Clay St Conn to Hwy 47 WB over Hwy 61	1967	Concrete continuous	11,579	6/5/7	PR	ND		PV	3
1	22	047	73.94	09254D	Hwy 47 EB Conn to SW Market St over Hwy 61	1967	Concrete continuous	7,397	6/5/6	PR	OD	DG	PV	3
1	22	061AL	1.57	09254E	Hwy 61 NB Conn #2 to Hwy 47 WB over Hwy 61 & Conns	1967	Concrete continuous	33,088	5/6/6	PR	ND		V	2
1	22	061AQ	1.52	09254F	SW Montgomery St Cpn #7 over Hwy 61	1967	Concrete continuous	6,641	7/5/6	PR	ND		PV	
1	22	061AR	1.14	09254G	SW 13th Ave Conn #8 over Hwy 61	1967	Concrete continuous	6,405	7/5/7	PR	ND		PV	
1	22	061AP	1.17	09254H	Conns 6, 7, & 8 over Hwy 47 Conn #2 to Hwy 61 SB	1967	Concrete	6,764	6/6/6	GD	OD	VC	NV	
1	22	061	1.39	09255	SW 12th Ave over Hwy 61	1967	Concrete continuous	17,487	6/5/6	PR	ND		PV	
1	22	061	1.97	09249	SW Taylor St Conn #4 to Hwy 61 SB over Hwy 61	1968	Concrete continuous	5,730	6/5/6	PR	ND		PV	
1	22	C0000	1.97	09249T	SW Taylor St over Hwy 61	1968	Concrete continuous	8,356	6/5/6	PR	ND		PV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	061	1.92	09250	SW Salmon St over Hwy 61	1968	Concrete continuous	10,388	6/6/6	GD	ND		PV	
1	22	061	1.89	09251	Hwy 61 NB Conn to SW 14th Ave over Hwy 61 & Conns	1968	Concrete continuous	8,482	6/5/6	PR	OD	Rail	PV	
1	22	C0000	1.77	09252	SW Jefferson St over Hwy 61	1967	Steel	14,820	6/7/7	GD	ND		PV	
1	22	061	1.72	09253	SW Columbia St over Hwy 61	1967	Steel	15,795	5/7/7	PR	ND		PV	
1	22	C0000	2.45	09276	NW Glisan St over Hwy 61	1968	Concrete continuous	8,203	7/6/7	GD	OD	VC	PV	
1	22	061	2.35	09277	NW Everett St over Hwy 61	1968	Concrete continuous	10,183	6/6/7	GD	OD	LSL	PV	
1	22	061	2.25	09278	NW Couch St over Hwy 61	1968	Concrete continuous	6,936	6/6/7	GD	ND		PV	
1	22	061	2.26	09279	NW Couch St & W Burnside St over NW 16th Ave Conn	1968	Concrete	13,164	6/6/6	GD	OD	VC	PV	
1	22	061AS	2.25	09280	NW Couch St Conn #2 over Hwy 61 NB Conn #1	1968	Concrete	3,004	6/6/7	GD	OD	VC	NV	
1	22	061	2.20	09281	W Burnside St over Hwy 61	1968	Prestressed concrete continuous	8,786	6/6/6	GD	OD	LSL	PV	
1	22	061	2.14	09282	SW 14th Ave over Hwy 61 & Conn #1	1968	Steel	14,870	6/7/7	GD	ND		PV	
1	22	C0000	2.12	09282A	SW Alder St over Hwy 61	1968	Steel	9,900	6/7/7	GD	ND		PV	
1	22	C0000	2.07	09283	SW Morrison St over Hwy 61	1968	Concrete continuous	9,250	7/5/6	PR	OD	LSL	PV	
1	22	C0000	2.02	09284	SW Yamhill St over Hwy 61	1968	Concrete continuous	9,250	7/6/7	GD	OD	LSL	PV	
1	22	061AA	0.52	08193	Harbor Dr. Conn to Hwy 1 over SW Sheridan St	1959	Concrete continuous	13,316	6/6/6	GD	ND		PV	
1	22	061AB	1.07	08591A	Hwy 61 SB to Hwy 1 NB over Hwy 1 (W Marquam Int)	1965	Steel	71,691	6/6/6	GD	ND		V	2
1	22	001TB	300.42	08591B	Hwy 1 SB to Hwy 61 NB over Streets (W Marquam Int)	1965	Steel	59,487	6/6/6	GD	ND		PV	
1	22	001	300.10	08591C	Hwy 1 SB over Hwy1 NB to Hwy 61 (W Marquam Intchg)	1966	Steel	70,237	6/6/6	GD	SD	SD LSL VC	PV	
1	22	001	300.12	08591D	Hwy 1 NB over SW Moody Ave (West Marquam Intchg)	1966	Steel	64,693	6/6/6	GD	OD	LSL VC	PV	
1	22	061	0.53	08591E	Hwy 61SB Conn to Hwy 1 SB over SW Water Ave	1966	Steel	11,285	6/5/6	PR	ND		V	2
1	22	061	0.48	08591F	Hwy 1 NB Conn to Hwy 61 NB over Conns	1966	Steel	42,180	6/6/6	GD	ND		V	2
1	22	001	300.38	08328	Willamette River, Hwy 1 (Marquam)	1966	Steel	175,391	6/6/5	PR	OD	VC	V	3
1	22	081	22.03	02061	Molalla River, Hwy 1E NB	1936	Steel	21,191	5/5/5	PR	SD	SD LSL	V	3

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	081	22.03	02061A	Molalla River, Hwy 1E SB	1963	Prestressed concrete	22,545	6/7/6	GD	ND		V	3
1	22	171	0.38	09554	Hwy 171 over UPRR AND SE 26TH AVE.	1968	Prestressed concrete continuous	19,976	6/6/6	GD	ND		PV	
1	22	171AH	2.42	09623	Lake Rd (Harmony Rd) over Hwy 171	1970	Prestressed concrete continuous	20,190	7/6/6	GD	ND		PV	
1	22	171	0.11	09668	Hwy 171 (Milw Expy) over Hwy 1E (McLoughlin Blvd)	1969	Concrete continuous Prestressed concrete	33,233	6/6/6	GD	ND		PV	
1	22	171AA	0.33	09669A	Hwy 171 Conn to Hwy 1E NB over Hwy 1E NB	1994	continuous	47,121	6/6/7	GD	ND		NV	
1	22	171	3.89	09386	Hwy 171 over Hwy 68 (SE 82nd Ave) (Lake Rd Intchg)	1965	Prestressed concrete continuous	18,564	6/7/6	GD	ND		PV	
1	22	171	2.64	09831	Mt Scott Creek, Hwy 171	1970	Prestressed concrete	8,942	7/7/7	VG	OD	Rail	NV	
1	22	171	8.13	01439B	Rock Creek, Hwy 171	1985	Prestressed concrete	18,349	7/7/7	VG	ND		V	3
1	22	171	5.20	07867A	Hwy 171 over UPRR Mainline	1984	Prestressed concrete	24,544	6/6/7	GD	ND		V	3
1	22	171	4.91	08911A	Hwy 171 over Hwy 64 (Clackamas Intchg)	1962	Prestressed concrete	23,482	6/7/5	PR	ND		V	3
1	22	123	0.27	06498	Hwy 123 over NW Mill St	1931	Steel	8,400	6/5/6	PR	ND		V	
1	22	123	10.41	08402	Hwy123 (NE Killingsworth St) over Hwy68 (82nd Ave)	1958	Concrete continuous	13,906	6/6/6	GD	OD	VC	V	
1	22	123	5.33	08996	Hwy 123 (N Lombard St) over Hwy 1 & Conns	1964	Concrete continuous	16,055	7/6/6	GD	OD	VC	PV	
1	22	123	12.43	09059	Hwy 123 (NE Sandy Blvd) over NE 122nd Ave	1962	Concrete continuous Prestressed concrete	8,448	7/6/7	GD	ND		PV	
1	22	123	11.12	09666	Hwy 123 (NE Killingsworth St) over Hwy 64	1978	continuous	35,021	6/7/6	GD	ND		NV	
1	22	092	13.19	01740	McCarty Creek, Hwy 2W	1968	Concrete continuous	11,245	7/7/6	GD	ND		V	2
1	22	092	11.23	02014A	Hwy 2W over PNWR	1968	Concrete	10,669	6/6/6	GD	ND		NV	
1	22	092	10.77	02641A	Partial Viaduct, Hwy 2W (Sauvies Island Dr)	1949	Concrete continuous Prestressed concrete	3,232	7/7/7	VG	ND		NV	
1	22	C0000	1.84	16509	NW York St & PTRR over Hwy 2W	1985	continuous Prestressed concrete	9,871	6/6/6	GD	ND		NV	
1	22	C0000	1.74	16510	NW Wilson Street over Hwy 2W	1985	continuous Prestressed concrete	10,339	7/6/6	GD	ND		NV	
1	22	092AA	1.69	16511	NW Vaughn Street over Hwy 2W	1988	continuous	14,415	6/6/6	GD	ND		NV	
1	22	092	10.00	18940	Miller Creek, Hwy 2W	2002	Prestressed concrete	9,825	6/8/7	GD	ND		NV	
1	22	068 Co	10.24	21871	SE 82nd Dr. Conn. to Hwy 068 Over Hwy 64	2015	Steel	17,276	8/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	140	1.39	01081	Tualatin River, Hwy 140	1924	Concrete continuous	6,401	7/6/5	PR	OD	Scour	V	
1	22	140	7.21	02742A	Burriss Creek, Hwy 140 (Christensen Farm)	1960	Prestressed concrete	2,176	7/7/6	GD	ND		PV	
1	22	140	1.02	04962A	Jackson Bottom Slough, Hwy 140	1966	Prestressed concrete	5,594	7/7/5	PR	ND		PV	
1	22	140	9.59	04966A	McFee Creek, Hwy 140 (Bonner)	1959	Concrete	3,356	7/6/5	PR	OD	TS	PV	
1	22	141	5.73	04968	Fanno Creek, Hwy 141 at MP 5.73	1965	Prestressed concrete	3,840	6/7/6	GD	ND		PV	
1	22	141	8.88	04970B	Tualatin River, Hwy 141	1967	Prestressed concrete	15,792	6/7/6	GD	ND		PV	
1	22	141	12.84	07579A	Hwy 141 (SW Elligsen Rd, Stafford Rd) over Hwy 1	1970	Prestressed concrete continuous	27,431	6/6/6	GD	ND		PV	
1	22	140	5.49	19896	Christensen Creek (Campbells Bridge), Hwy 140	2007	Prestressed concrete	9,630	6/7/6	GD	ND		NV	
1	22	003	11.43	00357	Willamette River & Hwy 1E, Hwy 3 (Oregon City)	1922	Steel	23,333	6/6/6	GD	SD	SD LSL VC LC	V	
1	22	003	6.76	00409	Oswego Creek, Hwy 3 SB (Sucker Creek)	1930	Concrete	20,150	6/5/5	PR	OD	LC	PV	4
1	22	003	6.82	00409B	Oswego Creek, Hwy 3 NB (Sucker Ck) Partial Viaduct	1983	Prestressed concrete continuous	11,870	7/7/6	GD	OD	LSL	V	4
1	22	003	4.00	01185A	Riverside Canyon (Partial Viaduct), Hwy 3	1926	Concrete continuous	5,242	7/7/6	GD	ND		PV	4
1	22	003	0.09	08194	Hwy 3 NB over Hwy 1 & Conns (Hood Ave)	1959	Concrete continuous	22,470	5/6/6	PR	OD	DG	V	4
1	22	003AE	0.16	08194R	Hwy 3 NB to Hwy 3 SB (Hood Ave)	1926	Concrete continuous	3,540	5/6/7	PR	ND		V	
1	22	C0000	287.42	07575A	Norwood Road over Hwy 1	1969	Steel continuous	12,457	7/6/6	GD	ND		PV	
1	22	C0000	284.88	07695A	Boeckman Road over Hwy 1	1969	Steel continuous	14,564	6/7/6	GD	ND		PV	
1	22	001	283.88	17995	Hwy 1 NB over Wilsonville Road	1999	Prestressed concrete	8,860	6/6/7	GD	ND		NV	
1	22	001	283.88	17996	Hwy 1 SB over Wilsonville Road	1999	Prestressed concrete	8,860	6/6/6	GD	ND		NV	
1	22	001	283.11	02254A	Willamette River, Hwy 1 (Boone Bridge)	1953	Steel	135,842	6/6/6	GD	ND		V	1
1	22	001	299.23	08195	Hwy 1 over Hwy 3 SB (SW Hood Ave)	1959	Concrete continuous	25,546	6/6/6	GD	OD	VC	PV	
1	22	C0000	297.55	08198	SW Brier Place over Hwy 1	1959	Concrete continuous	14,364	5/6/6	PR	OD	VC	PV	
1	22	001	297.12	08199A	SW Terwilliger Blvd Conn to NB Hwy 1	1993	Prestressed concrete continuous	12,758	6/7/7	GD	ND		NV	
1	22	C0000	296.46	08201	SW 19th Ave over Hwy 1 & Conn	1959	Concrete continuous	16,275	6/6/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	C0000	296.34	08202	SW Spring Garden St over Hwy 1	1959	Concrete continuous	7,920	7/5/7	PR	OD	LSL VC	PV	
1	22	C0000	297.45	08392C	SW Terwilliger Blvd over Hwy 1 & Conns	1993	Prestressed concrete continuous	42,422	7/6/6	GD	ND		NV	
1	22	001VL	297.53	08392D	NB Hwy 1 Ramp to SW Terwilliger Blvd	1993	Concrete continuous	10,616	5/6/7	PR	ND		NV	
1	22	C0000	296.55	08437	SW Multnomah Blvd over Hwy 1	1959	Steel continuous	14,139	4/6/7	PR	SD	SD VC	PV	
1	22	091	297.05	17064	Hwy 1W Conn to Hwy1 NB over Hwy1 (Terwilliger Int)	1993	Prestressed concrete continuous	24,943	6/7/7	GD	ND		NV	
1	22	091	297.21	17176	Hwy 1W Conn to Hwy 1 NB (Terwilliger Blvd Intchg)	1993	Concrete continuous	13,568	5/6/7	PR	ND		NV	
1	22	001	289.38	07494B	Beaver Dam Creek (Nyberg Creek), Hwy 1 SB	1975	Concrete continuous	13,024	7/7/6	GD	ND		PV	
1	22	001	289.38	07494C	Beaver Dam Creek (Nyberg Creek), Hwy 1 NB	1975	Concrete continuous	11,831	6/6/7	GD	ND		PV	
1	22	001RL	289.50	07582A	SW Nyberg Road over Hwy 1	1975	Prestressed concrete continuous	27,490	6/6/6	GD	OD	VC	PV	
1	22	C21651	288.98	07586A	SW Sagert Road over Hwy 1	1969	Steel continuous	12,192	6/7/6	GD	ND		PV	
1	22	001	296.04	08203B	Hwy 1 over SW 26th Ave	1959	Concrete continuous	17,153	5/6/6	PR	OD	VC	PV	
1	22	001	288.51	09743	Hwy 1 NB over Hwy 1 SB Conn to Hwy 64 NB	1969	Steel continuous	12,035	6/7/7	GD	ND		PV	1
1	22	001	288.51	09743A	Hwy 1 SB over Hwy 1 SB Conn to Hwy 64 NB	1969	Steel continuous	12,769	7/7/7	VG	ND		PV	1
1	22	001RJ	288.48	09743C	Hwy 1 NB Conn to Hwy 64 NB over Hwy 1 SB Conn	1969	Steel continuous	10,399	6/7/7	GD	ND		PV	1
1	22	001RK	289.40	16955	Beaver Dam Creek (Nyberg Creek), Hwy 1 NB Conn	1991	Prestressed concrete	28,300	6/6/7	GD	ND		NV	
1	22	001UP	289.41	16956	Beaver Dam Creek (Nyberg Creek), Hwy 1 NB Conn	1991	Concrete continuous	11,214	5/5/7	PR	ND		NV	
1	22	001	290.97	02259C	Hwy 1 over PNWR (Cook)	1975	Prestressed concrete continuous	24,373	6/7/7	GD	ND		PV	
1	22	001	289.85	02376B	Tualatin River, Hwy 1	1975	Prestressed concrete	41,551	6/7/6	GD	ND		PV	
1	22	001SF	293.26	07726A	SW Haines St over Hwy 1	1985	Prestressed concrete	15,655	7/7/6	GD	OD	VC	NV	
1	22	C0000	291.81	07727A	SW Bonita Road over Hwy 1	1975	Prestressed concrete continuous	14,414	6/6/6	GD	ND		PV	
1	22	001RW	291.30	07728A	SW Upper Boones Ferry Rd (Carman Dr) over Hwy 1	1975	Prestressed concrete continuous	25,418	6/6/6	GD	ND		PV	
1	22	001	290.48	07729A	Hwy 1 over SW Lower Boones Ferry Rd	1975	Concrete continuous	30,043	6/6/6	GD	ND		PV	
1	22	C0000	298.83	08196	SW Corbett Ave over Hwy 1	1959	Concrete continuous	17,121	6/7/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	001WC	292.25	18480	Hwy 1 NB Ramp to Hwy 144 NB over Hwy 1 & Conns	2001	Prestressed concrete continuous	64,615	6/6/5	PR	ND		NV	
1	22	001	298.24	20788	SW Iowa Street Viaduct, Hwy 1 Willamette R & Hwy 2W NB & UPRR, Hwy123 (St Johns)	2014	Prestressed concrete	22,295	8/8/8	VG	OD	DG	NV	
1	22	123	0.91	06497		1931	Steel	182,951	6/6/6	GD	ND		V	
1	22	091	12.18	01417N	Tualatin River, Hwy 1W NB	1955	Concrete continuous	17,198	5/6/6	PR	OD	DG	PV	2
1	22	091	12.20	01417S	Tualatin River, Hwy 1W SB	1929	Steel	20,189	5/6/6	PR	OD	LC	V	2
1	22	091	13.82	01578	Rock Creek, OR 99W SB (Onion Flat)	1931	Concrete continuous	5,080	6/6/6	GD	OD	LSL	PV	2
1	22	091	13.83	01578A	Rock Creek, OR 99W NB (Onion Flat)	1955	Concrete continuous	4,900	6/6/6	GD	ND		PV	2
1	22	091	4.86	02010	Hwy 1W over SW Multnomah Blvd	1935	Concrete continuous	10,434	6/6/6	GD	OD	DG	V	
1	22	091	9.21	02532	Hwy 1W over PNWR (Tigard)	1940	Concrete continuous	21,839	6/6/6	GD	OD	LSL	PV	2
1	22	091	9.37	02533	Fanno Creek, Hwy 1W	1940	Concrete continuous	8,122	6/6/6	GD	ND		PV	2
1	22	091	-3.18	04517	Columbia Slough & N Schmeer Rd Conn, Hwy 1W	1916	Steel	33,480	5/5/5	PR	OD	VC	V	
1	22	091	-5.50	06686C	Hwy 1W over N Victory Blvd	1962	Concrete	9,805	6/6/5	PR	OD	TS	PV	
1	22	091	7.40	07758C	Hwy 1W (Barbur Blvd) over Hwy 1 & Hwy 1W NB Conn	1985	Prestressed concrete	37,458	6/7/6	GD	ND		NV	
1	22	091AJ	7.82	07758D	Hwy 1W (Barbur Bd) NB Conn to Hwy 1 NB over Hwy 1	1985	Steel continuous	10,650	6/5/6	PR	ND		NV	
1	22	091	6.22	08205	Hwy 1W (SW Barbur Blvd) over Hwy 1	1959	Concrete continuous	24,037	6/6/6	GD	OD	DG	PV	
1	22	001WC	6.21	08205R	Hwy 1W SB Ramp to Hwy 1 SB	1959	Concrete continuous	6,480	5/6/6	PR	OD	VC	PV	
1	22	091	5.26	08322	Hwy 1W over SW 26th Ave	1958	Concrete continuous	8,750	6/6/6	GD	ND		V	
1	22	091	8.65	09519	Hwy 1W over Hwy 144	1967	Prestressed concrete	18,144	6/6/6	GD	ND		V	2
1	22	091	3.25	01983	SW Newbury St Viaduct, Hwy 1W	1934	Wood or Timber	21,678	5/6/6	PR	OD	DG TS	V	
1	22	091	3.50	01984	SW Vermont St Viaduct , Hwy 1W	1934	Wood or Timber	30,533	5/6/6	PR	SD	LC	V	
1	22	091BX	-0.28	02733B	Hwy 1W Conn over Front Ave (Steel Br Everett Ramp)	1950	Concrete continuous	6,886	6/6/6	GD	ND		V	
1	22	091	-0.29	02733C	Hwy 1W NB Front Ave (Steel Br Ramp)	1950	Concrete continuous	18,913	6/6/5	PR	ND		V	
1	22	091	-4.84	04518	Hwy 1W over N Columbia Blvd & UPRR	1929	Concrete continuous	34,511	6/6/6	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	091	1.67	06895	Hwy 1W over Hwy 26 EB & SW Grover St	1948	Concrete continuous	5,706	6/6/6	GD	ND		V	
1	22	026AA	0.58	06895R	Hwy 26 WB to Hwy 1W over Hwy 26 EB & SW Grover St	1948	Concrete continuous	2,157	6/6/6	GD	OD	DG VC	PV	5
1	22	091	1.61	06896	Hwy 1W over Hwy 26 WB Conn #1 to Hwy 1W SB	1946	Concrete	2,365	6/6/6	GD	OD	VC	NV	
1	22	091	1.93	05195A	Harbor Drive Viaduct, Hwy 1W NB	1949	Concrete continuous	17,389	6/6/6	GD	OD	LSL DG LC	V	
1	22	C0000	1.98	05195B	SW Barbur Blvd over Hwy 1W SB	1949	Concrete	11,360	6/6/6	GD	OD	VC	NV	
1	22	C0000	8.69	09703	Broadway (West Linn) over Hwy 64 & Hwy 3 Conn #1	1970	Prestressed concrete continuous	22,534	7/7/7	VG	ND		PV	
1	22	C0000	8.64	09704	West A St (West Linn) over Hwy 64	1970	Prestressed concrete continuous	14,460	7/6/5	PR	ND		PV	
1	22	C0000	8.28	09724	Sunset Ave (West Linn) over Hwy 64	1970	Prestressed concrete continuous	14,400	7/6/5	PR	ND		PV	
1	22	064	6.40	09728	Hwy 64 NB over 10th Street (West Linn)	1970	Prestressed concrete	6,062	6/6/6	GD	ND		PV	1
1	22	064	6.42	09728A	Hwy 64 SB over 10th Street (West Linn)	1970	Prestressed concrete	6,239	6/6/6	GD	ND		PV	1
1	22	064	5.84	09734	Hwy 64 NB over Blankenship Road	1970	Prestressed concrete	6,018	7/6/6	GD	ND		PV	1
1	22	064	5.90	09734A	Hwy 64 SB over Blankenship Road	1970	Prestressed concrete	6,018	6/6/6	GD	ND		PV	1
1	22	064	5.14	09735	Hwy 64 NB over Woodbine Road	1970	Concrete continuous	9,204	5/6/6	PR	ND		PV	1
1	22	064	5.19	09735A	Hwy 64 SB over Woodbine Road	1970	Concrete continuous	9,204	5/6/6	PR	ND		PV	1
1	22	064	3.82	09738	Hwy 64 NB over Borland Road	1970	Concrete continuous	10,089	5/6/6	PR	ND		PV	1
1	22	064	3.81	09738A	Hwy 64 SB over Borland Road	1970	Concrete continuous	11,726	5/6/6	PR	ND		PV	1
1	22	064	2.08	09740	Hwy 64 NB over Prosperity Park Road	1970	Concrete continuous	18,072	7/6/6	GD	ND		PV	1
1	22	064	2.10	09740A	Hwy 64 SB over Prosperity Park Road	1969	Concrete continuous	15,876	7/6/6	GD	ND		PV	1
1	22	061	3.10	09268	Hwy 61 over NW Front Ave & RR (W Fremont Approach)	1973	Steel continuous	55,054	5/6/6	PR	ND		PV	2
1	22	092	1.26	09268A	NB Hwy 61 Conn to Hwy 2W WB	1972	Steel continuous	100,574	5/6/6	PR	OD	LSL VC	V	2
1	22	092	1.24	09268B	Hwy 2W EB Conn to Hwy 61 SB	1972	Steel continuous	95,962	5/6/6	PR	ND		V	2
1	22	092	1.46	09268E	Hwy 2W EB Conn to Hwy 61 NB	1973	Steel continuous	27,741	5/6/6	PR	OD	DG VC	V	2
1	22	061	2.84	09268N	Hwy 61 NB over City Streets	1972	Steel continuous	131,365	5/6/7	PR	OD	LSL	V	2

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	061	2.84	09268S	Hwy 61 SB over City Streets	1972	Steel continuous	132,309	5/6/6	PR	ND		V	2
1	22	061AY	3.24	09268W	Hwy 61 SB Conn to Hwy 2W WB	1973	Steel continuous	27,579	5/6/6	PR	ND		V	2
1	22	064AQ	9.30	09403R	Hwy 64 NB Conn #1 to Hwy 1E (West Linn Intchg)	1970	Steel	2,151	6/6/6	GD	ND		NV	
1	22	C0000	4.30	09736	Johnson Rd over Hwy 64	1970	Steel continuous	20,739	7/6/6	GD	ND		PV	
1	22	064AC	3.32	09739	Stafford Rd over Hwy 64	1970	Steel continuous	28,907	5/6/6	PR	ND		PV	
1	22	C0000	1.27	09741	Meridian Rd over Hwy 64	1969	Steel continuous	20,099	6/7/6	GD	ND		PV	
1	22	064AA	1.04	09743B	Hwy 64 SB Conn to Hwy 1 SB over Hwy 1	1970	Steel continuous	23,320	6/6/6	GD	ND		V	1
1	22	064	4.10	09737	Tualatin River, Hwy 64 NB	1970	Prestressed concrete continuous	35,621	7/6/6	GD	ND		V	1
1	22	064	4.08	09737A	Tualatin River, Hwy 64 SB	1970	Prestressed concrete continuous	40,273	6/7/7	GD	ND		V	1
1	22	029	14.31	00744B	Dairy Creek, Hwy 29	1923	Concrete continuous	22,374	6/6/6	GD	OD	Scour	V	
1	22	029	10.55	01754A	Dawson Creek, Hwy 29 (Rock Creek)	1961	Prestressed concrete	16,512	7/7/7	VG	ND		PV	
1	22	029	4.97	0P461	Johnson Creek, Hwy 29 (Twin Pipes)	1983	Steel	-	4	PR	SD	SD	NV	
1	22	029	5.13	16185	Hwy 29 over PNWR	1983	Prestressed concrete	15,694	7/7/7	VG	ND		NV	
1	22	029	3.28	01386	Beaverton Creek, Hwy 29	1928	Concrete	-	7	VG	ND		NV	
1	22	141	4.71	09454	Hwy 141 over Hwy 144 @ MP 5.66	1966	Steel	18,678	6/6/6	GD	ND		PV	
1	22	C0000	6.69	09565	SW 72nd Ave over Hwy 144	1967	Steel continuous	14,573	6/7/6	GD	ND		PV	
1	22	144	7.22	09569	Hwy 144 over Hwy 1 & Conn	1966	Steel continuous	23,322	5/7/6	PR	OD	DG VC	V	4
1	22	143	9.20	09672	Hwy 143 over Hwy 144 @ MP 4.27	1968	Concrete continuous	29,898	5/6/6	PR	ND		PV	
1	22	144	5.11	0M080	Ashbrook Creek, Hwy 144	1970	Concrete continuous Prestressed concrete	-	6	GD	ND		PV	4
1	22	144BF	4.95	13574	SW Greenburg Road over Hwy 144	1973	continuous	21,535	6/7/7	GD	OD	VC	PV	4
1	22	144	2.85	09457	Fanno Creek, Hwy 144	1968	Concrete continuous	15,614	7/7/7	VG	ND		PV	4
1	22	144AX	3.02	13074A	Fanno Creek, Hwy 144 Denney Rd Conn	1979	Prestressed concrete	8,201	7/7/7	VG	ND		NV	
1	22	144AQ	2.49	16134	SW Allen Blvd over Hwy 144	1981	Concrete continuous	23,641	4/6/6	PR	SD	SD LSL	NV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	144AW	3.02	16143	SW Denny Rd & Ramps over Hwy 144	1978	Concrete continuous	21,767	6/6/6	GD	ND		PV	4
1	22	144	1.47	09611	Hwy 144 over Hwy 29 (SW Canyon Rd)	1971	Concrete continuous	17,014	7/6/6	GD	ND		PV	4
1	22	144	2.07	09045	Hwy 144 over PNWR & 5th St	1968	Prestressed concrete	32,375	6/7/6	GD	ND		PV	4
1	22	C0000	0.11	09607	Hwy 47 Conn #2 (Parkway) over Hwy 144	1971	Concrete continuous	11,050	6/6/6	GD	ND		PV	4
1	22	C0000	0.19	09608	SW Wilshire Ave over Hwy 144	1971	Concrete continuous	22,316	6/6/6	GD	ND		PV	
1	22	C0000	1.18	09609	SW Cabot Street over Hwy 144	1971	Prestressed concrete	9,629	7/6/6	GD	ND		PV	
1	22	144	1.76	09612	Hwy 144 over Hwy 40	1971	Concrete continuous	15,657	7/6/6	GD	ND		PV	4
1	22	141	2.71	09671	Hwy 141 over Hwy 144 @ MP 3.82	1968	Concrete continuous	13,340	6/6/7	GD	ND		PV	
1	22	144AJ	0.92	13494	SW Walker Road over Hwy 144	1972	Prestressed concrete	17,214	6/6/6	GD	ND		PV	
1	22	047BZ	69.35	16637	47 WB Con to 144 SB over Barnes Rd. Con 144 SB	1985	Concrete	6,237	5/5/5	PR	OD	DG	NV	
1	22	001	308.38	01377A	Columbia R & N Hayden Isl Dr, Hwy1 NB (Interstate)	1916	Steel	160,271	5/5/5	PR	OD	LSL VC LC	V	
1	22	001	308.38	07333	Columbia R & N Hayden Isl Dr, Hwy1 SB (Interstate)	1958	Steel	178,664	6/5/6	PR	OD	LSL VC	V	
1	22	064	24.75	13507	Hwy 64 NB over NE Airport Way	1981	Prestressed concrete	14,900	7/7/6	GD	ND		V	1
1	22	064	24.67	13507A	Hwy 64 SB over NE Airport Way	1981	Prestressed concrete	14,900	7/7/7	VG	ND		V	1
1	22	064CX	24.79	13507B	Hwy 64 NB to NE Airport Way over Hwy 64 & Conns	1981	Prestressed concrete continuous	41,161	7/7/6	GD	ND		NV	
1	22	064	9.03	09403	Willamette R & Hwys 1E & 3, Hwy 64 (Geo Abernethy)	1970	Steel continuous	281,211	7/7/7	VG	OD	VC	V	1
1	22	064	26.32	09555	Columbia River N Channel, Hwy 64 (Glenn Jackson)	1982	Prestressed concrete continuous	1,120,304	6/6/6	GD	ND		V	1
1	22	064	24.34	16055	Columbia Slough & NE Alderwood Rd., Hwy 64 NB	1980	Prestressed concrete	21,615	7/7/6	GD	ND		V	1
1	22	064	24.27	16055A	Columbia Slough & NE Alderwood Rd, Hwy 64 SB	1980	Prestressed concrete	21,615	7/7/6	GD	ND		V	1
1	22	064	25.16	16188	Columbia River South Channel, Hwy 64	1982	Prestressed concrete	423,640	6/6/6	GD	OD	Scour	NV	
1	22	064CQ	21.86	13516C	Hwy 64 SB Conn to Hwy 2 WB over UPRR	1985	Prestressed concrete continuous	16,482	6/6/6	GD	ND		NV	
1	22	003AL	9.00	09403A	Hwy 3 NB Conn to Hwy 64 NB	1970	Steel continuous	17,219	6/7/7	GD	ND		PV	4
1	22	064AP	9.14	09403C	Hwy 64 SB Conn #2 to Hwy 3 (West Linn Intchg)	1970	Steel continuous	16,065	6/7/6	GD	OD	LSL	PV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	C0000	23.27	09667	NE Prescott St over Hwy 64	1978	Prestressed concrete continuous	21,850	6/6/6	GD	ND		NV	
1	22	064	21.57	13516A	Hwy 64 over Hwy 2	1978	Prestressed concrete continuous	66,321	7/6/6	GD	ND		PV	1
1	22	064CP	21.58	13516D	Hwy 64 NB Conn #4 over Hwy 2 & Hwy 64 & MAX LRT	1985	Prestressed concrete continuous	41,606	6/6/6	GD	ND		NV	
1	22	064CM	21.38	13516F	Hwy 64 SB Conn #6 to Glisan St over Hwy 2 EB Conn	1985	Prestressed concrete continuous	4,455	7/7/7	VG	ND		NV	
1	22	064CK	21.19	13516G	NE Glisan St to Hwy 64 NB over Hwy 64 NB Conn	1985	Prestressed concrete continuous	10,463	6/6/6	GD	ND		NV	
1	22	047	57.85	02365A	McKay Creek, Hwy 47 EB	1968	Prestressed concrete	5,513	7/6/6	GD	ND		V	3
1	22	047	55.73	02367	Hwy 47 WB over PNWR (Vadis)	1946	Concrete continuous	14,169	6/6/6	GD	OD	LSL	PV	3
1	22	047	55.69	02367A	Hwy 47 EB over PNWR (Vadis)	1971	Prestressed concrete continuous	24,650	6/7/6	GD	ND		V	3
1	22	C0000	56.24	09915	Gordon Rd over Hwy 47	1970	Prestressed concrete continuous	9,039	7/6/6	GD	ND		PV	
1	22	047DH	58.75	19592	JACKSON SCHOOL ROAD OVER HWY 47	2006	Prestressed concrete continuous	22,794	7/7/6	GD	ND		NV	
1	22	047	57.84	21322	McKay Creek HWY 047 WB at MP 57.84	2010	Prestressed concrete	8,338	7/7/7	VG	ND		NV	
1	22	C0000	57.16	21494	Glencoe Rd Conn (North Plains) over Hwy 47	2013	Steel continuous	22,750	7/8/8	VG	OD	VC	NV	
1	22	047 F	57.16	21530	Ghost Creek, Hwy 47 R/W Left at MP 57.16	2012	Prestressed concrete	3,700	7/8/8	VG	ND		NV	
1	22	064	22.24	13514I	Hwy 64 NB over Light Rail	1979	Concrete	15,980	6/6/6	GD	ND		PV	1
1	22	075	0.52	21869	Hwy 75 over UPRR	2016	Steel continuous	26,835	8/8/8	VG	ND		NV	
1	22	075	0.80	21870	Hwy 075 over Private Streetcar Track	2015	Prestressed concrete	3,449	8/8/8	VG	ND		NV	
1	22	047	63.38	02333	Rock Creek, Hwy 47 WB	1947	Concrete continuous	3,525	5/7/6	PR	OD	LSL DG	PV	3
1	22	047	63.38	02333A	Rock Creek, Hwy 47 EB	1964	Prestressed concrete continuous	4,142	7/7/7	VG	ND		V	3
1	22	047AW	62.47	06735A	NW Cornelius Pass Rd Conn over Hwy 47	1988	Prestressed concrete continuous	34,706	6/7/6	GD	ND		NV	
1	22	047AQ	61.06	09722	NW Helvetia Rd Conn over Hwy 47	1985	Steel continuous Prestressed concrete	33,233	5/7/6	PR	ND		NV	
1	22	047BB	64.29	09770	NW 185th Ave Conn over Hwy 47	1972	Prestressed concrete continuous	29,990	6/6/6	GD	ND		PV	3
1	22	047CK	72.18	17368	Highland Rd Intchg over Hwy 47	1995	Prestressed concrete	5,649	7/6/7	GD	ND		NV	
1	22	047CB	70.64	18207	Camelot Ct Conn over Hwy 47	1999	Prestressed concrete	5,826	7/7/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	047	73.41	09391	Hwy 47 over Jefferson Rd Conn	1968	Concrete	20,265	6/6/5	PR	ND		NV	
1	22	047	73.70	09392	Hwy 47 over SW 18th Ave	1968	Concrete	7,512	6/6/7	GD	ND		NV	
1	22	047	70.83	19199	Hwy 47 over Hwy 29 WB (SW Canyon Rd) (Sylvan)	2004	Concrete	12,730	6/6/6	GD	ND		NV	
1	22	047	68.55	19725	144AG over 047BT MP 69.08 to Cedar Hills Blvd	2006	Prestressed concrete	14,930	5/5/6	PR	ND		NV	
1	22	047	69.19	06980A	Hwy 47 over Hwy 144	1986	Prestressed concrete	43,014	7/7/6	GD	ND		V	3
1	22	047BK	67.15	08404A	NW Murray Blvd Conn over Hwy 47	1991	continuous	22,471	6/6/6	GD	ND		NV	
1	22	047BH	65.80	08910A	NW Cornell Rd Conn over Hwy 47	1993	Prestressed concrete continuous	32,414	7/6/6	GD	ND		NV	
1	22	047	68.34	09345	Hwy 47 EB AND WB over SW Cedar Hills Blvd	1966	Prestressed concrete	34,035	7/7/5	PR	ND		V	3
1	22	047	65.67	16966	NW 158th Ave (Bethany Blvd) over Hwy 47	1991	Prestressed concrete continuous	26,304	7/7/7	VG	ND		NV	
1	22	047	70.87	18647	Hwy 047DQ EB Off-Ramp at MP 70.87 over Hwy 029	2002	Prestressed concrete continuous	18,398	7/6/7	GD	ND		NV	
1	22	047CH	71.32	18674	Sylvan Conn (Skyline Blvd) over Hwy 47	2002	Steel	24,038	6/7/7	GD	ND		NV	
1	22	081	17.87	00580	Beaver Creek (Parrot Creek), Hwy 1E	1929	Concrete continuous	16,717	5/5/5	PR	ND		PV	3
1	22	081	11.38	01618A	Hwy 1E over Clackamette Park Conn	1990	Prestressed concrete	10,712	6/7/6	GD	ND		NV	
1	22	081	13.86	07164	Partial Viaduct, Hwy 1E SB	1949	Concrete continuous	4,950	6/6/6	GD	OD	DG	PV	3
1	22	081	11.79	09865	Abernethy Creek, Hwy 1E (McLoughlin Blvd)	1971	Steel	-	6	GD	ND		NV	
1	22	061BB	3.29	08958G	Ivy St Conn to Hwy 61 SB over Hwy1 (E Fremont Int)	1973	Steel continuous	34,018	6/7/7	GD	ND		V	2
1	22	081	12.29	02374	SE Water Street Viaduct, Hwy 1E (McLoughlin Blvd)	1940	Concrete continuous	22,921	5/6/6	PR	OD	LSL DG	PV	5
1	22	081	12.22	02732	SE Water St Partial Viaduct, Hwy1E (McLoughlin Bd)	1940	Concrete continuous	5,460	6/4/5	PR	SD	SD LSL DG LC	PV	5
1	22	081	11.20	01617	Clackamas River, Hwy 1E (McLoughlin Br)	1933	Steel	44,064	6/6/6	GD	OD	LSL LC	V	
1	22	001TO	303.06	08958E	Hwy 1 NB to Hwy 61 SB over Conn (E Fremont Intchg)	1973	Steel continuous	92,138	6/7/7	GD	ND		V	3
1	22	001	307.93	04516A	Hwy 1 over Jantzen Pedestrian Tunnel	1959	Concrete	6,936	7/6/6	GD	SD	SD LC	NV	
1	22	001	306.86	09015A	Hwy 1 over Hwy 1W NB Conn to Hwy 1 NB	1964	Concrete	10,455	6/6/6	GD	ND		NV	
1	22	001	306.70	09316A	Hwy 1 over N Victory Blvd	1964	Prestressed concrete	22,867	6/7/7	GD	ND		V	2

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	001UI	306.90	16506	N Victory Bd Conn Hwy 1 NB over Conn (Swift- Delta)	1991	Prestressed concrete continuous	29,243	7/6/7	GD	ND		NV	
1	22	001	307.59	16526	Oregon Slough & N Jantzen Dr, Hwy 1 & 120	1987	Prestressed concrete	195,175	6/7/6	GD	OD	Scour	V	2
1	22	001	305.92	08882	Hwy 1 over N Columbia Blvd & UPRR	1964	Prestressed concrete	71,086	6/6/6	GD	ND		V	2
1	22	001	306.27	08883	Columbia Slough & Hwy 1 Conn, Hwy 1	1964	Prestressed concrete continuous	143,005	6/6/6	GD	ND		V	2
1	22	001TX	304.93	08997	Rosa Parks Way (N Portland Blvd) over Hwy 1	1964	Concrete continuous	14,060	7/6/7	GD	OD	VC	PV	
1	22	001UE	305.92	20651	Columbia Blvd Ramp to Hwy 1 SB	2008	Steel continuous	24,638	7/8/7	VG	ND		NV	
1	22	C0000	304.68	09000	N Ainsworth St over Hwy 1	1964	Concrete continuous	12,540	7/6/6	GD	OD	VC	PV	
1	22	C0000	304.43	09002	N Killingsworth St over Hwy 1	1964	Concrete continuous	10,200	6/6/6	GD	OD	VC	PV	
1	22	C0000	304.18	09007	N Alberta St over Hwy 1	1964	Concrete continuous	7,050	7/6/6	GD	OD	VC	PV	
1	22	001TS	303.98	09011	N Going St Conn #2 over Hwy 1 & Conns	1964	Concrete continuous	13,232	7/6/7	GD	OD	VC	PV	
1	22	C0000	303.88	09012	N Skidmore St over Hwy 1 & Conn	1964	Concrete continuous	29,220	6/6/6	GD	OD	VC	PV	
1	22	081	-3.86	05290	Hwy 1E over UPRR (at N Baldwin St)	1916	Concrete continuous	12,615	4/5/5	PR	SD	SD DG	V	
1	22	081	-4.86	07297	Hwy 1E over NE 6th Dr	1950	Concrete	2,912	6/6/6	GD	OD	VC	NV	
1	22	081	-4.46	07298	Hwy1E (MLK Blvd) over N Vancouver Way (Schmeer Rd)	1950	Concrete	3,077	6/6/6	GD	ND		NV	
1	22	081	-5.75	07400A	Hwy 1E over Marine Drive Conn	1990	Concrete continuous	11,522	6/6/7	GD	ND		NV	
1	22	081	-5.95	08995C	Hwy 1E (NE MLK Blvd) over Hwy 1 & Conns	1991	Prestressed concrete continuous	53,935	6/7/7	GD	ND		NV	
1	22	001UI	307.36	17107	Hwy 1 NB Conn to Hwy 1E over Bikepath	1992	Prestressed concrete	2,904	7/7/7	VG	ND		NV	
1	22	081	307.34	17108	Hwy 1E Conn to Hwy 1 NB over Bikepath	1992	Prestressed concrete	3,080	7/7/7	VG	ND		NV	
1	22	081	5.97	01949	Kellogg Lake Outlet, Hwy 1E (SE McLoughlin Blvd)	1934	Concrete continuous	2,806	6/6/6	GD	ND		V	
1	22	081	4.40	16926	SE Tacoma St over Hwy 1E (SE McLoughlin Blvd)	1992	Prestressed concrete	11,550	6/7/7	GD	ND		NV	
1	22	081	4.45	17124	SE Tacoma St over UPRR	1992	Concrete	7,116	6/6/7	GD	ND		NV	
1	22	081	4.43	02008A	Johnson Creek, Hwy 1E (SE McLoughlin Blvd)	1991	Prestressed concrete	11,688	7/7/7	VG	ND		NV	
1	22	C0000	2.62	02237A	SE Milwaukie Ave over Hwy 1E	1968	Steel	11,100	6/6/6	GD	OD	VC	PV	

2017 BRIDGE CONDITION REPORT - District 2B


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	081	-0.20	02350A	Hwy 1E (SE MLK Blvd) over Hwy 2 & UPRR	1908	Steel	37,120	6/4/4	PR	SD	SD LSL PAINT VC	V	
1	22	081	-0.12	07040	Hwy 1E NB (NE Grand Ave) over Hwy 2 Conns & UPRR	1908	Steel	22,774	7/6/5	PR	ND		V	
1	22	081BP	4.50	17082	Johnson Creek, Hwy 1E Conn to SE Tacoma St	1992	Concrete	6,237	7/6/7	GD	ND		NV	
1	22	002IQ	-0.22	R7040A	Hwy 1E NB (NE Grand Ave.) Conn to Hwy 2 EB	1956	Concrete continuous	7,418	6/6/6	GD	ND		V	
1	22	120	0.38	01726	Columbia Slough, Hwy 120	1933	Steel	11,424	6/5/5	PR	OD	LSL DG TS LC	V	
1	22	081	5.51	09670A	Johnson Creek, Hwy 1E SB Conn to Hwy 171	1968	Concrete continuous	5,862	6/6/6	GD	ND		PV	
1	22	081	1.15	19667	HWY 1E At MP 1.15 OVER UPRR & SE DIVISION ST	2009	Prestressed concrete continuous	97,025	6/8/8	GD	ND		NV	
1	22	081	-4.42	01377C	Columbia Slough, Hwy 1E	1934	Steel	19,495	5/5/5	PR	OD	LSL	V	
1	22	081	1.59	02097	SE Grand Ave Viaduct, Hwy 1E	1937	Concrete continuous	23,851	6/6/6	GD	ND		V	
1	22	C0000	302.53	08573	N Flint Ave over Hwy 1	1963	Concrete continuous	29,232	6/6/6	GD	OD	VC	PV	
1	22	C0000	302.43	08574	N Vancouver Ave over Hwy 1	1963	Concrete continuous	27,048	6/6/6	GD	OD	VC	PV	
1	22	C0000	302.29	08575	NE Weidler St over Hwy 1	1963	Concrete continuous	8,880	6/6/6	GD	OD	VC	PV	
1	22	C0000	302.33	08575Q	N Williams Ave over Hwy 1	1963	Concrete continuous	10,340	6/6/6	GD	OD	VC	PV	
1	22	C0000	302.35	08575R	NE Broadway over Hwy 1	1963	Concrete continuous	7,385	6/6/6	GD	OD	VC	PV	
1	22	061	3.58	08958	Hwy 61 over City Streets (E Fremont Approach)	1973	Steel continuous	93,664	6/6/6	GD	OD	PAINT	V	2
1	22	061	3.72	08958B	Hwy 61 over City Strs & RR (E Fremont Bridge Appr)	1973	Steel continuous	101,386	5/7/7	PR	ND		V	2
1	22	061BA	3.89	08958F	Hwy 61 NB Conn (Kerby) over Hwy 1 (E Fremont Int)	1973	Steel continuous	44,675	6/7/7	GD	ND		V	2
1	22	061AZ	3.77	08958D	Hwy 61 NB to Hwy 1 SB over Strs (E Fremont Intchg)	1973	Steel continuous	46,553	6/7/7	GD	OD	VC	V	2
1	22	061	3.88	08958I	Hwy1 SB Conn to Hwy61 SB over Conn (E Fremont Int)	1973	Steel continuous	45,154	6/6/7	GD	ND		V	2
1	22	061	3.88	08958H	Hwy61 NB Conn to Hwy1 NB over Hwy1 (E Fremont Int)	1973	Steel continuous	45,241	6/6/7	GD	OD	VC	V	2
1	22	001	301.99	08583	Hwy 1 over NE Hassalo St & NE Holladay St	1963	Prestressed concrete	47,707	6/7/6	GD	ND		V	3
1	22	002AF	0.33	H8588A	Hwy 2 WB Conn to Hwy 1 NB over Lloyd Blvd.	1963	Steel	16,649	6/6/6	GD	OD	PAINT	V	3
1	22	001	302.65	08782A	Elliot School Viaduct, Hwy 1	1963	Prestressed concrete	57,570	6/6/6	GD	ND		V	3

2017 BRIDGE CONDITION REPORT - District 2B

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	22	001TO	303.04	16358	NB Hwy 1 Conn to N Greeley Ave over City Streets	1986	Prestressed concrete	24,851	7/6/6	GD	ND		NV	
1	22	001TP	303.22	16534	NB Hwy 1 Conn to N Greeley Ave over Hwy 1W	1985	Prestressed concrete	6,992	6/6/6	GD	ND		NV	
1	22	001TQ	303.10	16535	N Greeley Ave Conn to SB Hwy 1 over Hwy 1W	1985	Prestressed concrete continuous	28,823	6/6/6	GD	ND		NV	
1	22	001	301.70	N8588E	Hwy 1 NB over UPRR	1963	Steel	76,109	6/6/6	GD	OD	LSL PAINT VC	V	3
1	22	001	301.70	S8588E	Hwy 1 SB over UPRR	1963	Steel	79,396	6/6/6	GD	OD	PAINT VC	V	3
1	22	001	302.99	N8958A	Fremont Viaduct, Hwy 1 NB	1963	Steel	82,636	5/7/6	PR	OD	LSL VC	V	3
1	22	001	302.99	S8958A	Fremont Viaduct, Hwy 1 SB	1963	Steel	76,215	6/7/7	GD	OD	VC	V	3
1	22	C0000	21.12	13520	NE Glisan Street over Hwy 64	1978	Prestressed concrete continuous	29,645	6/5/5	PR	OD	Rail	NV	
1	22	C0000	20.87	13521	E Burnside St over Hwy 64	1978	Prestressed concrete continuous	30,770	6/6/6	GD	ND		NV	
1	22	C0000	20.62	13522	SE Stark Street over Hwy 64	1979	Prestressed concrete continuous	13,976	6/6/6	GD	ND		NV	
1	22	C0000	20.57	13523	SE Washington St over Hwy 64	1978	Prestressed concrete continuous	16,458	6/7/6	GD	ND		NV	
1	22	C0000	20.06	13527	SE Market St over Hwy 64 at MP 20.06	1978	Prestressed concrete continuous	17,941	6/6/7	GD	ND		NV	
1	22	064	19.62	13528	Hwy 64 over SE Division Street	1979	Concrete continuous	30,199	6/6/6	GD	ND		NV	
1	22	C0000	19.63	13528A	SE Division Street OX Light Rail & Hwy 64 Conn SB	1979	Prestressed concrete	8,999	6/6/6	GD	ND		NV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 2C

APRIL 2017

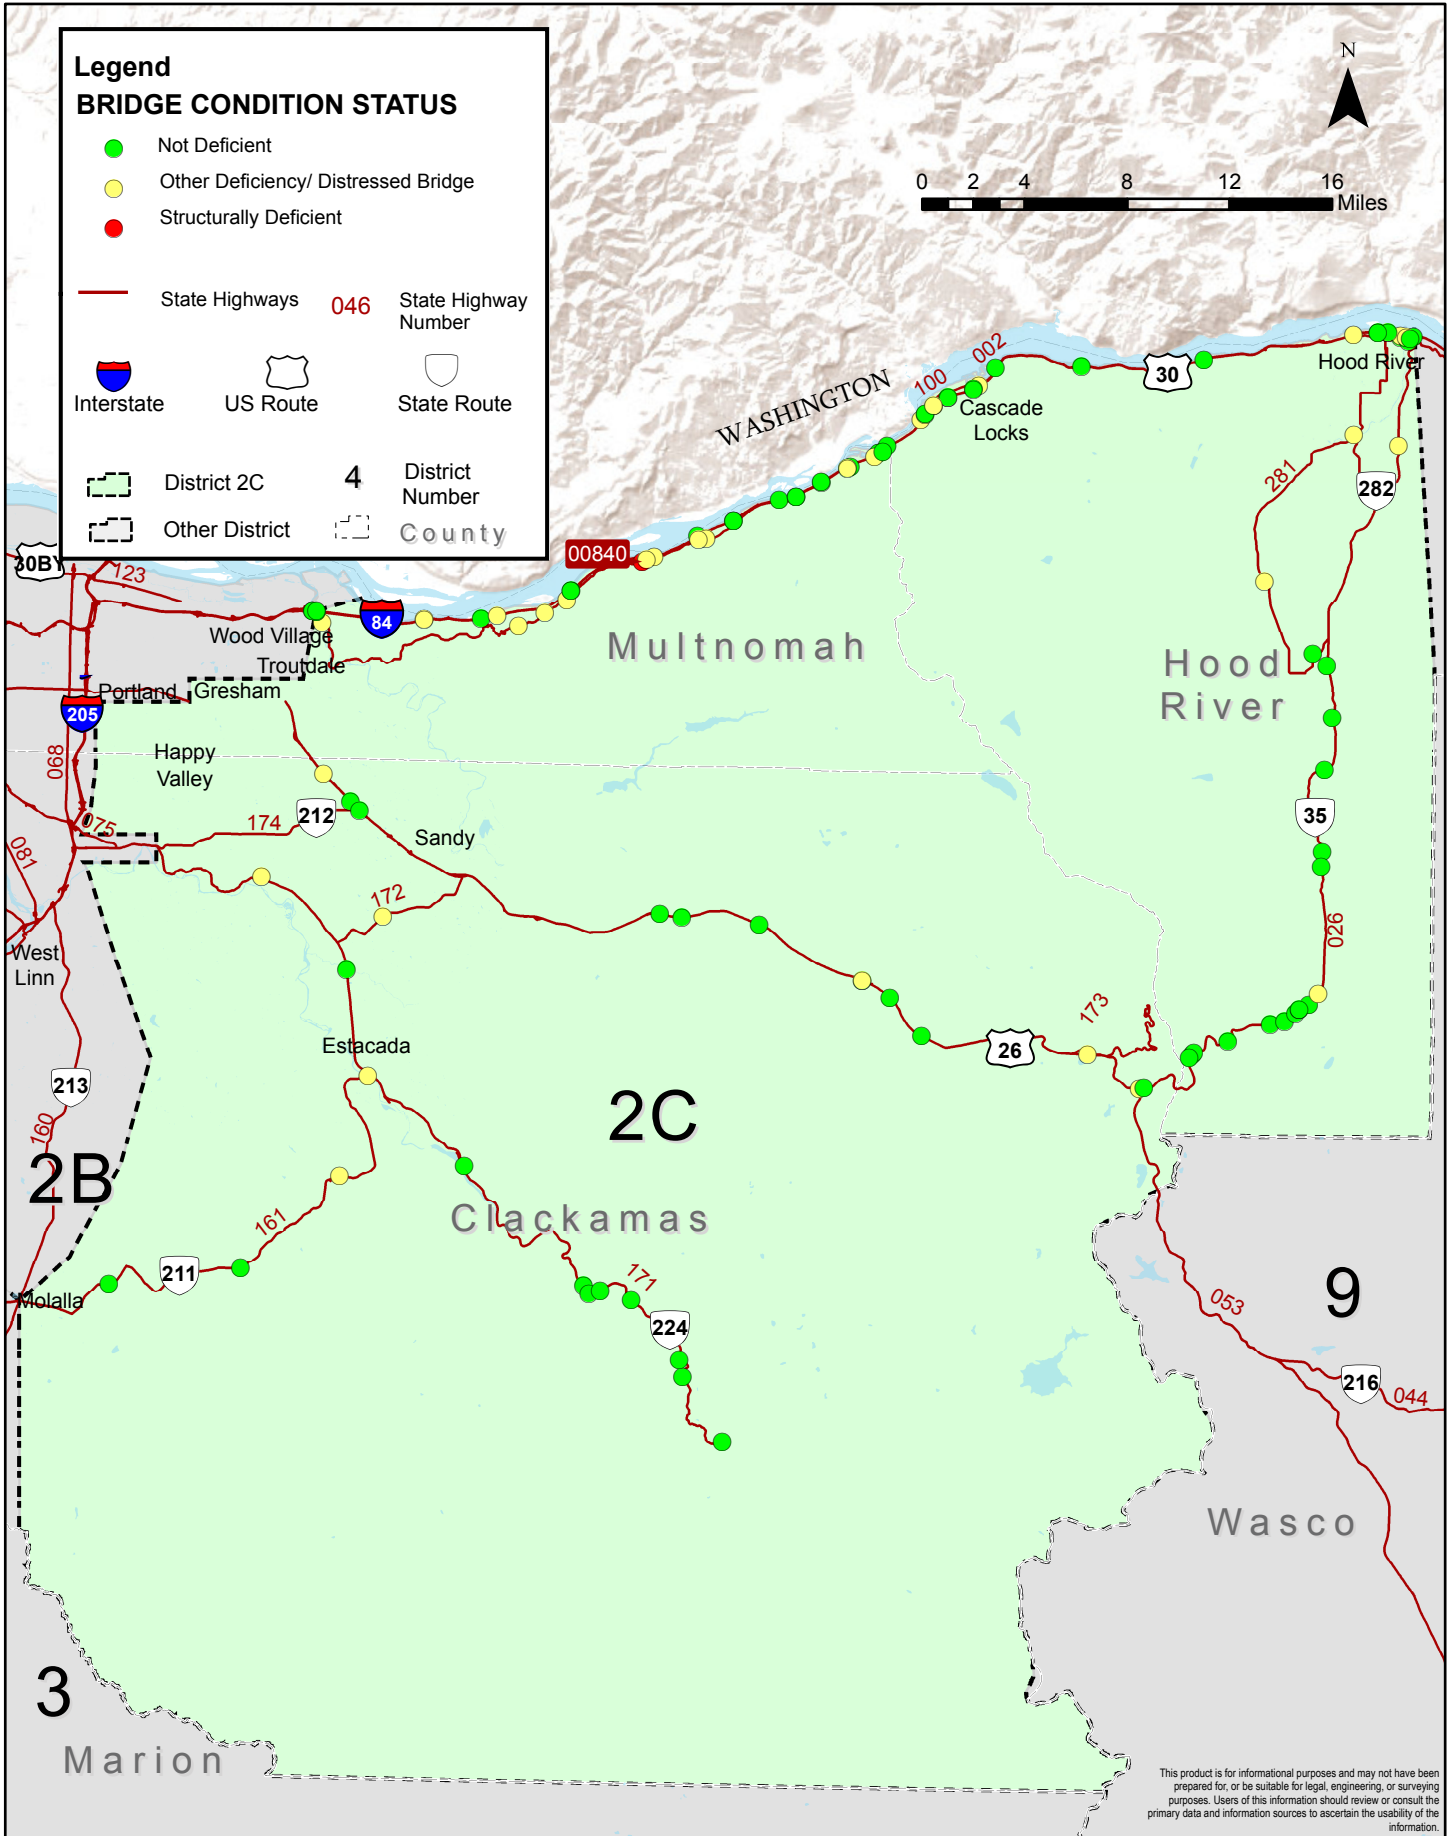

2017 BRIDGE CONDITION REPORT - District 2C

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	23	002	24.33	02565	Rooster Rock Creek, Hwy 2 Rt	1939	Concrete continuous	-	6	GD	ND		NV	
1	23	002	33.60	02682	Horsetail Creek & Oneonta Creek, Hwy 2	1946	Concrete continuous	-	5	FR	ND		NV	
1	23	002	17.82	06945	Hwy 2 EB over Conn #2 (Jordan Rd)	1946	Concrete	1,990	7/7/7	VG	ND		PV	1
1	23	002	17.82	06945A	Hwy 2 WB over Conn #2 (Jordan Rd)	1946	Concrete	2,127	8/8/8	VG	ND		PV	1
1	23	002BY	25.03	08037	Rooster Rock Park Conn over Hwy 2	1957	Concrete continuous	7,276	6/6/7	GD	OD	DG	V	
1	23	002BU	22.11	08470	Corbett Conn #2 to Hwy 2 over Hwy 2 (Corbett Int)	1960	Steel	8,936	6/6/6	GD	OD	VC	PV	
1	23	002BT	22.10	08470R	Hwy 2 Conn #1 to Corbett Conn #2 (Corbett Intchg)	1960	Concrete continuous	14,962	6/6/6	GD	OD	DG	PV	
1	23	002	35.12	02176	Hwy 2 WB over Hwy 100 & UPRR (Dodson)	1949	Steel continuous	22,199	5/6/6	PR	ND		PV	1
1	23	002	35.12	02176A	Hwy 2 EB over Hwy 100 & UPRR (Dodson)	1960	Steel continuous	21,842	5/6/6	PR	ND		PV	1
1	23	002CA	28.09	06671	Hwy 2 Conn Rt over UPRR	1945	Concrete continuous	16,114	7/6/6	GD	ND		V	
1	23	002CB	28.05	06671A	Bridal Veil Conn over Hwy 2	1960	Prestressed concrete	7,824	6/6/7	GD	ND		PV	
1	23	002	17.68	20878	Sandy River, Hwy 002 EB at MP 17.68	2011	Steel continuous	67,897	8/6/8	GD	ND		NV	
1	23	002	17.68	20879	Sandy River, HWY 002 WB at MP 17.68	2013	Steel continuous	53,197	6/8/8	GD	ND		NV	
1	23	026	57.58	16136	Hwy 26 over Hwy 53	1974	Prestressed concrete	6,206	7/7/7	VG	OD	Rail	NV	
1	23	026	42.60	19115	Bear Creek Bridge, Hwy 26 at MP 42.60	2002	Concrete	2,097	7/7/7	VG	ND		NV	
1	23	026	42.61	19265	Bear Creek Access, Hwy 26 at MP 42.60	2005	Steel	838	7/8/8	VG	OD	DG	NV	
1	23	026	46.04	19723	Zig Zag River, Hwy 26 at MP 46.02	2005	Prestressed concrete	4,938	7/7/7	VG	ND		NV	
1	23	026	34.09	19958	Wildcat Creek, Hwy 26	2006	Prestressed concrete	6,153	7/7/8	VG	ND		NV	
1	23	C0000	0.00	20338	Multorpor Mountain Rd over Hwy 26	2006	Steel	5,936	7/7/8	VG	OD	VC	NV	
1	23	026	37.26	08522	Salmon River, Hwy 26	1972	Prestressed concrete continuous	38,554	7/6/6	GD	ND		PV	3
1	23	C0000	0.00	09381	Boring Rd over Hwy 26	1965	Concrete continuous	12,843	6/6/6	GD	OD	VC	PV	
1	23	026	33.24	19957	Alder Creek, Hwy 26	2005	Prestressed concrete	13,976	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 2C

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	23	026	19.05	09135	North Fork Deep Creek, Hwy 26	1965	Concrete continuous	-	6	GD	ND		NV	
1	23	172	2.08	03062	Deep Creek, Hwy 172	1948	Concrete continuous	4,991	6/5/7	PR	OD	LSL	V	
1	23	174	8.47	13492	Hwy 174 over Hwy 26	1973	Prestressed concrete	20,738	7/7/6	GD	ND		V	3
1	23	161	27.33	01607A	Clear Creek, Hwy 161	1931	Concrete continuous	5,363	6/6/5	PR	OD	Scour	V	
1	23	161	21.54	01608A	Canyon Creek, Hwy 161	1932	Prestressed concrete	5,212	6/7/7	GD	ND		V	
1	23	161	33.41	02208	Clackamas River, Hwy 161 (Estacada)	1936	Concrete	13,107	6/6/5	PR	OD	LSL	V	
1	23	161	15.41	17355	Molalla River, Hwy 161 (Meadowbrook)	1996	Prestressed concrete	13,728	7/7/7	VG	ND		NV	
1	23	002	40.14	02062A	Tanner Creek, Hwy 2 WB	1950	Concrete continuous	19,678	5/5/5	PR	ND		PV	1
1	23	002	40.14	02062B	Tanner Creek, Hwy 2 EB	1962	Concrete continuous	17,911	7/6/6	GD	OD	LSL DG	PV	1
1	23	002	41.55	02063	Eagle Creek, Hwy 2 EB	1969	Steel continuous	20,271	6/7/7	GD	ND		PV	1
1	23	002	37.83	02193B	McCord Creek, Hwy 2 EB	1962	Prestressed concrete	13,411	6/6/7	GD	ND		V	1
1	23	002	38.98	02194A	Moffett Creek, Hwy 2 WB	1950	Concrete continuous	10,205	5/6/6	PR	ND		PV	1
1	23	002	64.15	02444	Hood River, Hwy 2 EB	1953	Steel continuous	14,352	5/6/7	PR	OD	DG	PV	1
1	23	002	64.15	02444A	Hood River, Hwy 2 WB	1962	Steel continuous	16,008	6/7/6	GD	OD	DG	PV	1
1	23	002DU	64.25	02471B	Hwy 2 Conn over UPRR & Frontage Rd	1974	Concrete continuous	26,281	6/6/7	GD	ND		NV	
1	23	002	40.27	06924	Hwy 2 over Bonneville Dam Conn	1951	Concrete	2,752	6/7/7	GD	ND		PV	1
1	23	002	37.12	08692	Hwy 2 over Conn to Warrendale	1961	Prestressed concrete	11,898	7/7/8	VG	ND		V	1
1	23	002	37.83	18067	McCord Creek, Hwy 2 WB	1998	Prestressed concrete continuous	18,568	7/8/8	VG	ND		NV	
1	23	002	38.98	20855	Moffett Creek Hwy 002 EB at MP 38.98	2009	Steel continuous	20,815	7/8/8	VG	ND		NV	
1	23	281	12.90	01939	East Fork Hood River, Hwy 281	1934	Steel	5,775	5/5/5	PR	OD	LSL	PV	
1	23	002CS	41.57	02063A	Eagle Creek, Hwy 2 Service Rd Rt	1914	Concrete	2,678	5/5/5	PR	ND		PV	
1	23	002	41.96	09377	Ruckel Creek & UPRR, Hwy 2	1969	Steel continuous	40,151	7/7/7	VG	ND		V	1

2017 BRIDGE CONDITION REPORT - District 2C

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	23	002	41.31	09382	Eagle Creek Viaduct, Hwy 2 WB	1969	Steel continuous	119,987	7/7/7	VG	ND		V	1
1	23	002DS	63.98	07458	Hwy 2 Frontage Rd (2nd St) over UPRR	1952	Concrete continuous	14,016	6/6/6	GD	ND		PV	
1	23	002DS	63.92	07459	Second Street (Hood River) over Hwy 2	1953	Concrete continuous	16,439	6/6/7	GD	OD	VC	PV	
1	23	100	48.95	09017	Hwy 100 over Hwy 2	1963	Steel	8,736	7/6/6	GD	OD	VC	NV	
1	23	171	39.15	08989	Clackamas River, Hwy 171 at MP 39.16 (Armstrg)	1954	Steel	12,508	6/6/6	GD	ND		PV	
1	23	171	45.83	08990	Clackamas R, Hwy 171 at MP 45.83 (Cripple Creek)	1952	Steel	7,901	6/6/6	GD	ND		PV	
1	23	171	38.77	08988	Clackamas River, Hwy 171 at MP 38.77 (Carter)	1954	Steel	10,318	6/6/6	GD	ND		PV	
1	23	171	44.88	08991	Clackamas River, Hwy 171 at MP 44.88 (Whitewater)	1952	Steel	8,286	6/6/6	GD	ND		PV	
1	23	171	49.96	05269	Clackamas R, Hwy 171 at MP 49.96 (Ripple Brook)	1958	Concrete continuous	2,768	7/7/7	VG	ND		PV	
1	23	171	30.04	05272A	North Fork Clackamas River, Hwy 171	1979	Steel	-	6	GD	ND		NV	
1	23	171	39.73	16008	Hwy 171 Half Viaduct at MP 39.73	1970	Prestressed concrete	5,445	6/7/7	GD	ND		NV	
1	23	171	41.48	18178	Roaring River, Hwy 171	1997	Prestressed concrete	5,484	8/8/8	VG	ND		NV	
1	23	171	13.90	02082A	Deep Creek, Hwy 171	1948	Concrete continuous	5,146	6/6/5	PR	OD	LSL	V	
1	23	171	19.05	03060B	Eagle Creek, Hwy 171	1972	Prestressed concrete	17,588	7/7/6	GD	ND		PV	
1	23	100	14.17	00823	Bridal Veil Creek, Hwy 100	1914	Concrete continuous	2,832	6/6/5	PR	OD	LSL	V	
1	23	100	13.14	04528	Youngs Creek, Hwy 100 (Shepperds Dell)	1914	Concrete	3,765	6/5/6	PR	OD	LSL LC	V	
1	23	100	17.89	04534	Multnomah Creek, Hwy 100	1914	Concrete	1,595	7/5/5	PR	OD	LSL	PV	
1	23	100	20.39	04543	Horsetail Creek, Hwy 100	1914	Concrete continuous	1,440	6/7/5	PR	OD	LSL LC	PV	
1	23	100	20.09	07108A	Oneonta Gorge Creek, Hwy 100	1948	Concrete	1,680	6/7/5	PR	OD	LSL Scour	NV	
1	23	100	17.68	00840	West Multnomah Falls Viaduct, Hwy 100	1914	Concrete continuous	8,040	6/5/5	PR	SD	SD LSL LC	PV	
1	23	100	18.21	00841	East Multnomah Falls Viaduct, Hwy 100	1914	Concrete continuous Prestressed concrete	17,220	5/5/5	PR	OD	LSL	PV	
1	23	100	51.11	00200A	Hood River & UPRR, Hwy 100	1982	continuous	32,679	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 2C


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	23	100	0.03	02019	Sandy River, Hwy 100	1912	Steel	8,554	5/5/5	PR	OD	LSL LC	V	
1	23	002	64.44	21218	Hwy 2 over Hood River Bridge Connector (Conn 2)	2009	Steel	8,362	7/8/8	VG	ND		NV	
1	23	002	41.24	22570	Tooth Rock Viaduct, Hwy 2 EB	1970	Concrete	1,544	6/7/7	GD	OD	DG	#N/A	#N/A
1	23	002	46.10	07403A	Herman Creek, Hwy 2	1952	Concrete continuous	11,325	7/6/7	GD	ND		PV	1
1	23	002CV	46.06	07403B	Herman Creek, Hwy 2 Frontage Rd Rt	1965	Concrete continuous	3,738	7/7/7	VG	ND		NV	
1	23	002	63.02	07496	Hwy 2 WB over Jaymar Rd (Westcliff Dr)	1952	Concrete continuous	4,723	6/6/7	GD	ND		PV	1
1	23	002	63.02	07496A	Hwy 2 EB over Jaymar Rd (Westcliff Dr)	1964	Concrete continuous	4,973	7/6/7	GD	ND		PV	1
1	23	002	56.04	08534	Hwy 2 over Conn Viento Intchg	1965	Concrete continuous	8,613	7/6/6	GD	ND		PV	1
1	23	002	50.99	08604	Hwy 2 over Conn (Wyeth Intchg)	1965	Concrete continuous	8,591	7/7/6	GD	ND		PV	1
1	23	002	47.31	08623	Hwy 2 over Herman Creek Conn	1965	Concrete continuous	9,594	6/6/6	GD	ND		PV	1
1	23	002CT	46.35	08634	Hwy 002 Conn (NW Forest Ln) over Hwy 002	1965	Prestressed concrete	8,354	7/7/7	VG	OD	VC	NV	
1	23	002	43.66	08609	Hwy 2 over Hwy 100 EB	1962	Steel	18,630	7/6/6	GD	OD	VC	V	1
1	23	002	43.93	08610	Hwy 2 EB over Moody St (Cascade Locks)	1962	Concrete continuous	8,390	7/7/7	VG	ND		PV	1
1	23	002	43.93	08610W	Hwy 2 WB over Moody St (Cascade Locks)	1962	Concrete continuous	8,732	7/7/7	VG	ND		PV	1
1	23	002	44.40	08611	Hwy 2 EB over Hazel St (Cascade Locks)	1962	Prestressed concrete	5,390	7/7/8	VG	OD	DG	V	1
1	23	002	45.01	20742	Hwy 2 WB over Hwy 002HX to Hwy 100 at MP 45.01	2009	Prestressed concrete	5,254	7/8/8	VG	ND		NV	
1	23	002	45.01	20743	Hwy 2 EB over Hwy 002HX to Hwy 100 at MP 45.01	2009	Prestressed concrete	5,254	7/7/8	VG	ND		NV	
1	23	002	44.40	08611W	Hwy 2 WB over Hazel St (Cascade Locks)	1962	Prestressed concrete	5,390	7/7/8	VG	OD	DG	V	1
1	23	026	97.49	00646A	Hwy 26 over MHR (Van Horn)	1962	Concrete continuous	4,942	6/6/7	GD	OD	DG	NV	
1	23	002	63.41	02443	Hwy 2 WB over UPRR	1953	Prestressed concrete continuous	23,481	6/6/6	GD	OD	LC	PV	1
1	23	026	67.25	03638A	N Fork of East Fork Hood River (Newton Cr), Hwy 26	1964	Concrete	1,248	7/7/7	VG	ND		NV	
1	23	026	68.23	03639A	Hood River, Hwy 26	1964	Concrete continuous	4,914	7/6/7	GD	OD	LSL	NV	

2017 BRIDGE CONDITION REPORT - District 2C

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
1	23	026	73.26	03640A	East Fork Hood River, Hwy 26 at MP 73.26	1962	Concrete continuous	3,510	7/7/7	VG	ND		NV	
1	23	002	63.41	08662	Hwy 2 EB over UPRR	1964	Steel continuous	22,550	7/6/7	GD	ND		PV	1
1	23	026	77.79	0M038	Dog River, Hwy 26	1961	Concrete continuous	-	6	GD	ND		NV	
1	23	026	83.94	0M039	Irrigation Ditch, Hwy 26 at MP 83.94	1961	Concrete continuous	-	7	VG	ND		NV	
1	23	026	77.65	16006	East Fork Hood River, Hwy 26 at MP 77.65	1961	Concrete continuous	4,928	7/7/7	VG	ND		NV	
1	23	C0000	63.80	18571	Mt Hood Meadows Access Rd over Hwy 26	2001	Prestressed concrete	4,884	7/7/8	VG	ND		NV	
1	23	026	57.79	19649	SALMON RIVER FISH PASSAGE HWY 026 AT MP 57.79	2005	Prestressed concrete	3,618	7/7/7	VG	ND		NV	
1	23	026	73.82	21152	Polallie Creek, Hwy 026 at MP 73.82	2010	Prestressed concrete	3,120	8/8/8	VG	ND		NV	
1	23	281	18.20	00640A	East Fork Hood River, Hwy 281	1989	Prestressed concrete	3,470	6/7/7	GD	ND		NV	
1	23	281	4.94	01600	Hood River, Hwy 281 (Tucker)	1931	Concrete	5,170	6/6/5	PR	OD	LSL	PV	
1	23	100	11.93	04527	Latourell Creek, Hwy 100	1914	Concrete continuous	7,750	6/5/5	PR	OD	LSL	V	
1	23	026	61.70	21344	White River HWY 026 at MP 61.70	2011	Prestressed concrete	12,363	7/7/8	VG	ND		NV	
1	23	026	65.88	21345	Clark Creek HWY 026 at MP 65.88	2011	Prestressed concrete	3,864	7/8/8	VG	ND		NV	
1	23	026	61.79	21346	Green Apple Creek HWY 026 at MP 61.79	2011	Concrete continuous	11,712	7/8/8	VG	ND		NV	
1	23	026	61.59	21928	North Fork Mineral Creek Hwy 026 at MP 61.59	2011	Steel	-	8	VG	ND		NV	
1	23	026	66.48	21978	Culvert, Hwy 026 at MP 66.48	2011	Concrete	-	8	VG	ND		NV	
1	23	026	66.99	21981	Culvert, Hwy 026 at MP 66.99	2011	Concrete	-	7	VG	ND		NV	
1	23	026	67.17	21983	Culvert, Hwy 026 at MP 67.17	2011	Concrete	-	7	VG	ND		NV	
1	23	026	67.48	21984	Culvert, Hwy 026 at MP 67.48	2011	Concrete	-	8	VG	ND		NV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 3

APRIL 2017

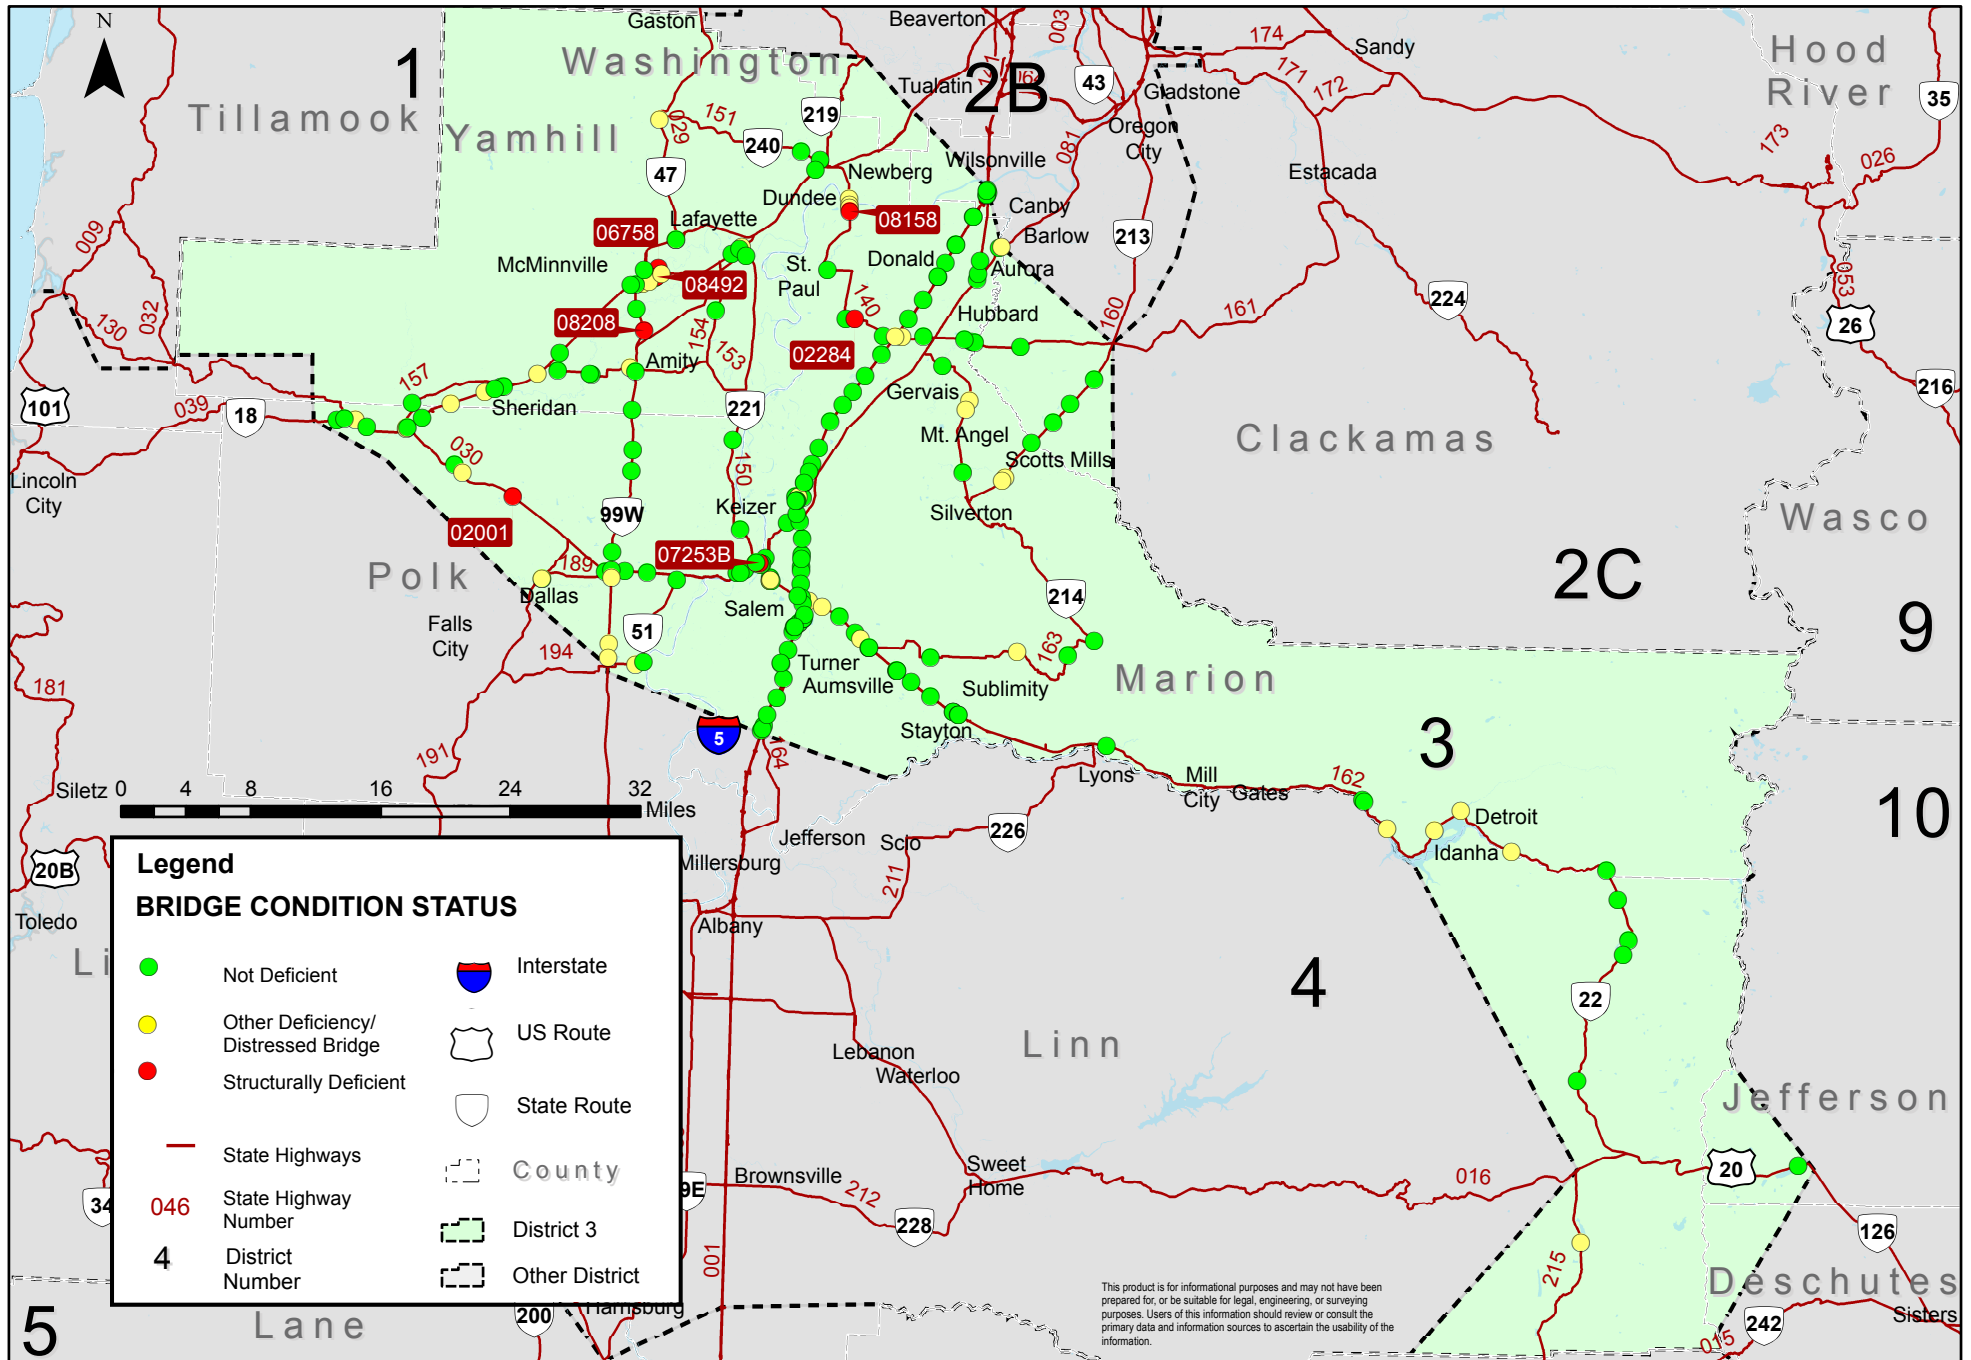

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	001	244.96	00367A	Miller Creek, Hwy 1 at MP 244.96	1957	Concrete continuous	-	6	GD	ND		NV	
2	03	001	245.87	03469A	Miller Creek, Hwy 1 at MP 245.87	1958	Concrete continuous	-	6	GD	ND		NV	
2	03	001	248.41	17477	Hwy 1 over Turner-Sunnyside Rd	1997	Prestressed concrete continuous	21,871	5/6/7	PR	ND		NV	
2	03	001	249.35	16161	Hwy 1 NB over Hwy 1E NB (Commercial St SE)	1981	Concrete continuous	7,462	7/6/6	GD	ND		PV	1
2	03	001	249.38	07524B	Hwy 1 SB over Hwy 1E NB (Commercial St SE)	1954	Concrete continuous	6,534	6/6/6	GD	ND		PV	1
2	03	001	251.79	19126	Hwy 1 over Fairview Industrial Drive SE	2007	Prestressed concrete	17,068	6/7/7	GD	ND		NV	
2	03	001	252.13	20026	Hwy 1 over UPRR Main Line	2007	Prestressed concrete	34,344	6/7/7	GD	ND		NV	
2	03	001	252.22	20032	Hwy 1 over Turner Road SE	2007	Prestressed concrete continuous	27,377	6/7/7	GD	ND		NV	
2	03	001	252.54	20034	Mill Creek, Hwy 1 NB	2007	Prestressed concrete	14,101	6/7/7	GD	ND		NV	
2	03	001	252.57	20035	Mill Creek, Hwy 1 SB AT MP 252.57	2007	Prestressed concrete	14,756	6/7/7	GD	ND		NV	
2	03	001	252.84	20109	Mill Creek Oflow, Hwy 1 at MP 252.84	2007	Concrete continuous	-	7	VG	ND		NV	
2	03	001	253.52	19127	Mill Creek Oflow, Hwy 1 AT MP 253.52	2008	Prestressed concrete	15,643	6/7/7	GD	ND		NV	
2	03	001	254.74	18267	Hwy 1 over State Street	2000	Prestressed concrete	19,910	6/7/6	GD	ND		NV	
2	03	001	256.28	17320	Hwy 1 over Market Street NE	1996	Prestressed concrete continuous	52,034	7/7/7	VG	ND		NV	
2	03	001	256.54	17319	Hwy 1 over Sunnyview Ave NE	1996	Prestressed concrete continuous	27,023	6/7/6	GD	ND		NV	
2	03	001	257.53	17487	Hwy 1 over Silverton Road NE	1999	Prestressed concrete	22,894	6/7/6	GD	ND		NV	
2	03	001	259.10	07854C	Hwy 1 over UPRR Main Line	1975	Prestressed concrete continuous	24,964	6/7/6	GD	ND		PV	1
2	03	001	259.95	07855D	Hwy 1 SB over Hwy 72 NB	1975	Prestressed concrete continuous	23,232	7/6/6	GD	ND		PV	1
2	03	001	259.95	07855C	Hwy 1 NB over Hwy 72 NB	1975	Prestressed concrete continuous	26,825	7/6/6	GD	ND		PV	1
2	03	001	261.12	16086	Labish Bottom, Hwy 1 NB	1975	Concrete continuous	21,808	7/7/6	GD	ND		PV	1
2	03	001	261.12	16086A	Labish Bottom, Hwy 1 SB	1975	Concrete continuous	23,302	7/7/6	GD	ND		PV	1
2	03	001	276.40	07799A	Hwy 1 NB over Fellers Road NE	1955	Concrete continuous	7,425	6/6/7	GD	ND		PV	1

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	001	276.40	07799B	Hwy 1 SB over Fellers Road NE	1955	Concrete continuous	7,425	6/6/7	GD	ND		PV	1
2	03	001	278.67	07796A	Hwy 1 NB over Ehlen Road NE	1955	Concrete continuous	7,425	6/6/6	GD	ND		PV	1
2	03	001	278.67	07796B	Hwy 1 SB over Ehlen Road NE	1955	Concrete continuous	7,425	6/6/6	GD	ND		PV	1
2	03	001	280.67	07795A	Hwy 1 NB over Arndt Road NE	1955	Concrete continuous	8,100	6/6/6	GD	ND		PV	1
2	03	001	280.67	07795B	Hwy 1 SB over Arndt Road NE	1955	Concrete continuous	8,100	6/6/6	GD	ND		PV	1
2	03	001	282.25	20418	Hwy 1 NB over Hwy 51 SB	2007	Prestressed concrete	5,640	7/7/7	VG	ND		NV	
2	03	001	282.28	20419	Hwy 1 SB over Hwy 51 SB	2007	Prestressed concrete	7,526	7/7/7	VG	ND		NV	
2	03	001 F	245.19	07940	Miller Creek, Hwy 1 Frtg Rd Rt	1957	Concrete continuous	-	6	GD	ND		NV	
2	03	001OL	244.86	00365A	Miller Creek, Hwy 1 Frtg Rd Lt	1920	Concrete Prestressed concrete	912	5/6/6	PR	ND		NV	
2	03	001OY	251.52	16967	Kuebler Blvd SE over Hwy 1 & Conn Hwy 1 SB Conn over Fairview Industrial Drive	1989	continuous	24,989	6/6/6	GD	ND		NV	
2	03	001PA	251.79	17015	SE	1989	Prestressed concrete	5,275	6/6/7	GD	ND		NV	
2	03	001PN	260.10	20298	Hwy 1 Conn (Chemawa Rd NE) over Ulali Drive Chemawa Rd NE over Hwy 1 & Hwy 72 NB	2006	Prestressed concrete	8,056	7/7/7	VG	ND		NV	
2	03	001PN	260.20	07855B	Conn Hwy 1 Conn (Chemawa Rd) over UPRR & Indian	1975	Steel continuous	37,432	5/7/7	PR	OD	VC	PV	
2	03	001PN	260.20	16569	Sch Rd Chemawa Rd NE to Hwy 1 SB over Hwy 72	1983	Prestressed concrete Prestressed concrete	18,552	7/7/6	GD	ND		NV	
2	03	001PQ	259.97	07855E	(Salem Pkwy)	1984	continuous	13,183	6/6/7	GD	ND		NV	
2	03	001QX	282.43	09870	Hwy 1 Conn #1 over Hwy 51 NB	1971	Concrete continuous	9,859	6/6/6	GD	ND		PV	
2	03	001RB	282.17	07624B	Hwy 1 Conn #5 over Hwy 51 SB	1971	Concrete continuous Prestressed concrete	9,292	7/6/7	GD	ND		PV	
2	03	001UO	247.10	07939A	Hwy 1 Frtg Rd (Illahee Fr Rd) over Hwy 1	1980	continuous	7,287	7/5/7	PR	ND		NV	
2	03	001XC	251.78	20665	Kuebler Blvd NB On-Ramp Hwy 1 at MP 251.78	2010	Prestressed concrete	3,726	7/7/7	VG	ND		NV	
2	03	016	87.07	19184	LAKE CREEK, HWY 16	2005	Prestressed concrete	3,864	7/7/7	VG	ND		NV	
2	03	029	34.71	00526A	Yamhill Creek, Hwy 29	1958	Concrete	2,280	7/6/5	PR	OD	TS	V	
2	03	030	0.03	02081	South Yamhill River, Hwy 30 (Wallace)	1935	Steel continuous	6,470	6/5/6	PR	OD	DG	V	4

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	151	10.97	17451	East Fork Chehalem Creek, Hwy 151	1996	Prestressed concrete continuous	15,176	5/7/7	PR	ND		NV	
2	03	151	9.65998	19153	Chehalem Creek, Hwy 151 at MP 9.66	2003	Prestressed concrete	3,084	7/7/7	VG	ND		NV	
2	03	150	0.71	01470A	Palmer Creek, Hwy 150	1984	Prestressed concrete	13,010	7/7/6	GD	ND		NV	
2	03	150	12.5	01420A	Spring Valley Creek, Hwy 150	1989	Prestressed concrete	5,978	7/7/7	VG	ND		NV	
2	03	150	18.41	18440	Gibson Creek (Spring Branch), Hwy 150	2000	Prestressed concrete	7,968	7/7/7	VG	ND		NV	
2	03	161	1.85	01437A	Pudding River, Hwy 161 (Killin)	1969	Prestressed concrete continuous	12,441	6/6/6	GD	ND		PV	
2	03	161	5.49999	01802C	Rock Creek, Hwy 161	1986	Prestressed concrete	5,720	7/7/7	VG	ND		NV	
2	03	160	26.9099	02012	Abiqua Creek, Hwy 160	1934	Steel	4,509	5/6/5	PR	OD	LSL Scour	TS	V
2	03	160	27.1999	02013	Abiqua Creek Oflow (Evans Creek), Hwy 160	1934	Concrete continuous	648	7/7/6	GD	OD	TS		V
2	03	160	20.8	03043A	Garrett Creek, Hwy 160	1953	Concrete	2,775	6/6/6	GD	ND		V	
2	03	161	2.34	09793	Butte Creek Oflow, Hwy 161	1969	Prestressed concrete	6,900	6/6/7	GD	ND		PV	
2	03	160	18.66	18277	Rock Creek, Hwy 160	1997	Prestressed concrete	2,901	6/7/7	GD	ND		NV	
2	03	161	2.62999	18849	Butte Creek, Hwy 161	2001	Prestressed concrete	9,557	7/7/7	VG	ND		NV	
2	03	160	22.34	03044A	Marquam Creek, Hwy 160	1985	Prestressed concrete	1,584	7/7/7	VG	ND		NV	
2	03	160	24.2	21281	Butte Creek, Hwy 160 (Jacks Bridge)	2013	Steel	8,441	7/8/8	VG	ND		NV	
2	03	162AD	1.91	07770	Lancaster Drive SE over Hwy 162	1960	Concrete continuous	11,820	6/5/5	PR	OD	VC	PV	3
2	03	162	4.02999	08071	Hwy 162 over Deer Park Drive SE	1960	Prestressed concrete	9,654	6/6/6	GD	ND		V	3
2	03	C0000	2.81999	08473	Cordon Road SE over Hwy 162	1960	Concrete continuous	5,821	6/6/6	GD	OD	DG	PV	
2	03	162	1.42	18268	Hwy 162 over Hwy 1	2000	Prestressed concrete continuous	28,674	7/7/7	VG	ND		NV	
2	03	081	24.81	01830	Pudding River Relief Channel, Hwy 1E	1922	Concrete continuous	3,698	6/6/5	PR	ND		PV	5
2	03	081	27.2599	07657	Hwy 1E over Hwy 51 (White School)	1954	Concrete continuous	4,840	6/6/7	GD	ND		PV	3
2	03	051	4.98999	17398	West Fork Mill Creek, Hwy 51 at MP 4.99	1995	Prestressed concrete	4,752	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	051	4.16999	17399	West Fork Mill Creek, Hwy 51 at MP 4.17	1995	Prestressed concrete	8,580	7/7/7	VG	ND		NV	
2	03	162	65.4799	06806	Minto Creek, Hwy 162 at MP 65.48	1934	Concrete continuous	2,679	6/5/6	PR	ND		PV	3
2	03	162	75.6499	19178	North Santiam River, Hwy 162	2005	Prestressed concrete	6,504	6/7/6	GD	ND		NV	
2	03	162	60.7999	19179	Whitewater Creek, Hwy 162	2005	Prestressed concrete	16,891	6/7/7	GD	ND		NV	
2	03	162	62.7799	19181	Pamelia Creek, Hwy 162	2005	Prestressed concrete	5,389	6/7/6	GD	ND		NV	
2	03	162	66.4199	19183	Marion Creek, Hwy 162	2005	Prestressed concrete	5,473	6/7/7	GD	ND		NV	
2	03	081	24.67	02743	Pudding River, Hwy 1E	1922	Steel	29,849	6/5/5	PR	OD	PAINT	PV	5
2	03	162	54.0899	05978	Boulder Creek, Hwy 162	1932	Concrete	4,023	6/5/5	PR	OD	Scour	V	3
2	03	162	49.8399	07017	Breitenbush River, Hwy 162	1949	Steel continuous	15,418	6/6/6	GD	OD	Rail DG	PV	3
2	03	162	47.6899	07295	Tumble Creek, Hwy 162	1949	Concrete continuous	4,593	6/6/6	GD	OD	Rail LSL DG	PV	3
2	03	162	23.28	07347	Little North Fork Santiam River, Hwy 162	1952	Concrete	23,948	6/6/6	GD	ND		PV	3
2	03	162	42.8899	07817	Slide Viaduct, Hwy 162 at MP 42.88	1954	Concrete continuous	3,644	7/6/6	GD	OD	DG	PV	3
2	03	162	40.3299	07964	Partial Viaduct, Hwy 162 at MP 40.33	1947	Concrete continuous	15,923	7/6/6	GD	ND		PV	3
2	03	162	40.4699	07965A	Sardine Creek, Hwy 162	1967	Concrete continuous	4,000	7/7/7	VG	ND		PV	3
2	03	162	5.43999	08073	Hwy 162 over Joseph St SE	1960	Prestressed concrete	9,878	6/6/6	GD	ND		V	3
2	03	C0000	5.91999	08074	72nd Ave SE over Hwy 162	1960	Steel	6,451	6/6/6	GD	OD	PAINT	PV	
2	03	162	8.87998	08076	Beaver Creek, Hwy 162 EB at MP E8.88	1960	Concrete continuous	7,518	6/6/6	GD	ND		PV	3
2	03	C0000	10.04	08077	Albus Rd SE over Hwy 162	1960	Prestressed concrete	7,946	6/6/6	GD	ND		PV	
2	03	162	6.66999	08471	Hwy 162 EB over Hwy 163	1960	Prestressed concrete	4,907	5/6/6	PR	ND		V	3
2	03	162	6.66999	17418	Hwy 162 WB over Hwy 163	1997	Prestressed concrete continuous	9,040	7/7/7	VG	ND		NV	
2	03	162	8.87998	17424	Beaver Creek, Hwy 162 WB at MP W8.88	1997	Prestressed concrete	7,383	6/7/7	GD	ND		NV	
2	03	C0000	11.53	17425	Golf Club Road SE over Hwy 162	1995	Prestressed concrete continuous	21,139	6/7/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	162	13.23	17426	Hwy 162 over Cascade Hwy SE, EB at MP 13.23	2009	Prestressed concrete	12,217	6/6/6	GD	ND		NV	
2	03	162	13.23	17427	Hwy 162 over Cascade Hwy SE, WB at MP 13.23	2009	Prestressed concrete continuous	14,921	7/7/7	VG	ND		NV	
2	03	162	13.58	17428	Mill Creek, Hwy 162 EB at MP 13.58	2009	Prestressed concrete	3,380	7/7/7	VG	ND		NV	
2	03	162	13.58	17429	Mill Creek, Hwy 162 WB at MP 13.58	2009	Prestressed concrete	2,860	7/7/7	VG	ND		NV	
2	03	C0000	8.93998	18016	Aumsville-Shaw Hwy SE over Hwy 162	1997	Prestressed concrete continuous	18,995	6/7/7	GD	ND		NV	
2	03	030	18.31	00351A	Mud Slough, Hwy 30 (Basket Slough)	1973	Concrete continuous	10,836	6/6/6	GD	ND		PV	4
2	03	030	4.70999	01756A	Mill Creek, Hwy 30	1946	Steel	8,208	6/6/5	PR	OD	LSL Scour	V	4
2	03	030	8.37998	02001	Salt Creek, Hwy 30 at MP 8.38	1934	Wood or Timber	2,679	6/6/4	PR	SD	SD TS	PV	4
2	03	030	3.96999	02015	Gooseneck Creek, Hwy 30	1934	Wood or Timber	3,062	6/6/6	GD	ND		V	4
2	03	030	0.03	02081	South Yamhill River, Hwy 30 (Wallace)	1935	Steel continuous	6,327	6/5/6	PR	OD	DG	V	4
2	03	030	16.94	09872	Hwy 30 over WPRR (Derry)	1973	Prestressed concrete continuous	17,660	6/7/7	GD	ND		PV	4
2	03	140	28.5499	02281	Mission Creek, Hwy 140	1958	Concrete	1,110	6/6/6	GD	ND		PV	4
2	03	140	23.08	08155	Hess Creek, Hwy 140	1958	Concrete	7,837	5/6/6	PR	OD	TS	V	4
2	03	140	23.66	08157	Willamette River Oflow, Hwy 140 at MP 23.66	1958	Concrete	5,225	7/6/5	PR	OD	TS	V	4
2	03	140	23.89	08158	Willamette River Oflow, Hwy 140 at MP 23.89	1958	Concrete continuous	14,803	6/6/4	PR	SD	SD LSL TS	V	4
2	03	140	40.7999	01917A	Pudding River, Hwy 140	1982	Prestressed concrete	14,036	7/6/6	GD	ND		NV	
2	03	140	33.1899	02283	West Champoeg Creek, Hwy 140	1958	Concrete	1,767	6/6/6	GD	ND		PV	4
2	03	140	33.7099	02284	East Champoeg Creek, Hwy 140	1959	Concrete	1,953	7/6/4	PR	SD	SD LSL TS	PV	4
2	03	140	36.0599	04442A	Senecal Creek, Hwy 140	1985	Prestressed concrete	1,800	7/7/7	VG	ND		NV	
2	03	140	44.0699	04444	Bockler Creek, Hwy 140	1920	Concrete	610	6/6/6	GD	OD	LSL	NV	
2	03	140	44.6799	04445	Zollner Creek, Hwy 140	1920	Concrete	610	6/6/7	GD	OD	LSL	NV	
2	03	140	36.7999	07802A	Hwy 140 over Hwy 1 (Woodburn Intchg)	1975	Prestressed concrete continuous	39,837	6/6/6	GD	OD	Rail	PV	3

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	140	48.6999	09564	Abiqua Creek, Hwy 140	1966	Prestressed concrete	8,778	6/7/7	GD	ND		PV	
2	03	C0000	38.6199	13478	N Front St (Woodburn) over Hwy 140	1973	Prestressed concrete	9,120	6/7/6	GD	ND		PV	
2	03	140	37.2099	21735	Hwy 140 over Pedestrian Path (Left & Right)	2014	Prestressed concrete	1,298	8/8/8	VG	OD	DG	NV	
2	03	030	25.88	00123K	Willamette River, Hwy 30 EB (Center St)	1953	Steel continuous	155,042	5/5/5	PR	OD	LSL	V	4
2	03	030	25.91	07253B	Willamette R, Hwy 30 WB & Hwy 72 Conn (Marion St)	1953	Steel continuous	156,742	6/5/6	PR	SD	LC	V	4
2	03	030AP	25.85	07253R	Hwy 30 Conn (Marion St Br) to Hwy 150	1953	Concrete continuous	16,050	7/6/6	GD	ND		V	
2	03	140	23.46	08156	Willamette River, Hwy 140	1958	Steel continuous	38,168	5/6/6	PR	OD	LC	V	4
2	03	030	24.31	08889	Hwy 30 over Hwy 150 at MP 24.30	1963	Steel continuous	45,675	6/6/6	GD	ND		V	4
2	03	030	24.86	08981	Hwy 30 WB over Hwy 150 at MP 24.86	1963	Steel	5,312	6/6/6	GD	ND		V	4
2	03	030	24.53	09055	Hwy 30 over Access to Boat Moorage	1963	Concrete	2,944	7/7/5	PR	ND		NV	
2	03	030AR	26	00123G	Willamette River, EB Hwy 30 Ramp to SB Hwy 72	1977	Concrete continuous	8,192	7/6/7	GD	ND		PV	4
2	03	030	25.62	07366	Hwy 30 WB over Hwy 150 Conn	1952	Concrete continuous	4,635	5/6/6	PR	OD	DG VC	V	4
2	03	C0000	270.469	07803A	Butteville Rd NE over Hwy 1	1975	Steel	24,395	6/7/7	GD	ND		PV	
2	03	001PN	260.2	07855B	Chemawa Rd NE over Hwy 1 & Hwy 72 NB Conn	1975	Steel continuous	37,433	5/7/7	PR	OD	VC	PV	
2	03	001	244.96	00367A	Miller Creek, Hwy 1 at MP 244.96	1957	Concrete continuous	-	6	GD	ND		NV	
2	03	001	249.38	07524B	Hwy 1 SB over Hwy 1E NB (Commercial St SE)	1954	Concrete continuous Prestressed concrete	6,534	6/6/6	GD	ND		PV	1
2	03	001UO	247.1	07939A	Hwy 1 Frtg Rd (Illahee Fr Rd) over Hwy 1	1980	continuous	7,287	7/5/7	PR	ND		NV	
2	03	001 F	245.19	07940	Miller Creek, Hwy 1 Frtg Rd Rt	1957	Concrete continuous	-	6	GD	ND		NV	
2	03	001	249.35	16161	Hwy 1 NB over Hwy 1E NB (Commercial St SE)	1981	Concrete continuous Prestressed concrete	7,462	7/6/6	GD	ND		PV	1
2	03	001	248.41	17477	Hwy 1 over Turner-Sunnyside Rd	1997	continuous Prestressed concrete	21,872	5/6/7	PR	ND		NV	
2	03	C0000	273.209	07801A	Crosby Rd NE over Hwy 1	1973	continuous Prestressed concrete	15,050	7/5/6	PR	ND		PV	
2	03	C0000	268.809	07847A	St Louis Rd NE over Hwy 1	1975	continuous	13,699	6/6/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	C0000	267.549	07848A	Keene Rd NE over Hwy 1	1975	Prestressed concrete continuous	11,040	7/6/6	GD	ND		PV	
2	03	C0000	266.539	07849A	Concomly Rd NE over Hwy 1	1975	Prestressed concrete continuous	12,627	7/6/6	GD	ND		PV	
2	03	C0000	265.249	07850A	Waconda Rd NE over Hwy 1	1975	Prestressed concrete continuous	12,213	6/6/7	GD	ND		PV	
2	03	C0000	263.489	07851A	Brooklake Rd NE over Hwy 1	1975	Prestressed concrete continuous	23,023	6/6/6	GD	ND		PV	
2	03	C0000	262.409	07852A	Quinaby Rd NE over Hwy 1	1975	Prestressed concrete continuous	13,770	7/6/6	GD	ND		PV	
2	03	C0000	261.899	07853A	Perkins Rd NE over Hwy 1	1975	Prestressed concrete continuous	11,040	7/6/6	GD	ND		PV	
2	03	001	261.119	16086	Labish Bottom, Hwy 1 NB	1975	Concrete continuous	21,809	7/7/6	GD	ND		PV	1
2	03	001	261.119	16086A	Labish Bottom, Hwy 1 SB	1975	Concrete continuous	23,303	7/7/6	GD	ND		PV	1
2	03	001PN	260.2	16569	Hwy 1 Conn (Chemawa Rd) over UPRR & Indian Sch Rd	1983	Prestressed concrete	18,552	7/7/6	GD	ND		NV	
2	03	001PN	260.099	20298	Hwy 1 Conn (Chemawa Rd NE) over Ulali Drive	2006	Prestressed concrete	7,860	7/7/7	VG	ND		NV	
2	03	001	259.949	07855D	Hwy 1 SB over Hwy 72 NB	1975	Prestressed concrete continuous	23,223	7/6/6	GD	ND		PV	1
2	03	001PQ	259.97	07855E	Chemawa Rd NE to Hwy 1 SB over Hwy 72 (Salem Pkwy)	1984	Prestressed concrete continuous	13,185	6/6/7	GD	ND		NV	
2	03	001	259.1	07854C	Hwy 1 over UPRR Main Line	1975	Prestressed concrete continuous	24,965	6/7/6	GD	ND		PV	1
2	03	001	259.949	07855C	Hwy 1 NB over Hwy 72 NB	1975	Prestressed concrete continuous	26,826	7/6/6	GD	ND		PV	1
2	03	C0000	255.82	17225	D Street NE over Hwy 1	1993	Prestressed concrete	13,423	6/7/7	GD	ND		NV	
2	03	001	256.54	17319	Hwy 1 over Sunnyview Ave NE	1996	Prestressed concrete continuous	26,120	6/7/6	GD	ND		NV	
2	03	001	256.28	17320	Hwy 1 over Market Street NE	1996	Prestressed concrete continuous	52,035	7/7/7	VG	ND		NV	
2	03	001	257.53	17487	Hwy 1 over Silverton Road NE	1999	Prestressed concrete	22,895	6/7/6	GD	ND		NV	
2	03	081	46.1499	17488	Hwy 1E over Hwy 1 (Hayesville Intchg)	1997	Prestressed concrete continuous	39,820	6/6/7	GD	ND		NV	
2	03	163	24.92	01799	South Fork Silver Creek, Hwy 163	1933	Wood or Timber	3,049	6/7/6	GD	ND		V	
2	03	163	19.55	04468A	West Fork Drift Creek, Hwy 163	1949	Steel	649	7/6/6	GD	OD	PAINT	NV	
2	03	163	27.3599	17382	North Fork Silver Creek, Hwy 163	1995	Concrete continuous	4,452	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	163	13.91	21238	Creek, Hwy 163 at MP 13.91	2012	Prestressed concrete	1,540	8/8/7	VG	ND		NV	
2	03	029	34.7099	00526A	Yamhill Creek, Hwy 29	1958	Concrete	2,281	7/6/5	PR	OD	TS	V	
2	03	157	2.25	00937A	Willamina River, Hwy 157	1963	Concrete continuous	6,678	7/6/5	PR	ND		V	
2	03	091	34.9599	00441	North Yamhill River, Hwy 1W SB	1921	Steel	9,601	5/5/5	PR	OD	LSL PAINT	V	
2	03	091	35.0399	00441A	North Yamhill River, Hwy 1W NB	1959	Concrete continuous Prestressed concrete	13,349	6/6/6	GD	ND		PV	
2	03	091	24.29	02054A	Chehalem Creek, Hwy 1W	1975	continuous	67,404	6/7/6	GD	ND		V	2
2	03	091	38.1799	05023A	Cozine Creek, Hwy 1W	1900	Concrete continuous	-	6	GD	ND		NV	
2	03	091	47.2899	00372A	Ash Swale, Hwy 1W at MP 47.29	1922	Concrete	4,324	6/6/6	GD	ND		PV	3
2	03	091	51.0599	00403A	Ash Swale, Hwy 1W at MP 51.06	1920	Concrete	896	6/6/6	GD	ND		NV	
2	03	091	44.8899	00416A	Ash Swale, Hwy 1W at MP 44.89 (Amity)	1922	Concrete continuous	11,610	6/6/6	GD	ND		PV	3
2	03	091	49.7499	00417	Plum Creek, Hwy 1W at MP 49.75 (Ash Swale)	1919	Concrete	977	6/6/7	GD	ND		NV	
2	03	091	56.3299	00827A	Baskett Slough, Hwy 1W	1923	Concrete continuous	1,849	7/6/7	GD	ND		PV	3
2	03	091	39.2399	08904	Hwy 1W over Hwy 39	1963	Concrete continuous	5,229	6/6/6	GD	ND		PV	
2	03	091	40.7799	18675	South Yamhill River, Hwy 1W (Whiteson)	2002	Prestressed concrete Prestressed concrete	52,896	6/7/5	PR	ND		NV	
2	03	030	15.72	19824	Hwy 30 EB Over Hwy 189	2006	continuous	9,087	7/8/7	VG	ND		NV	
2	03	091	57.4299	19825	Hwy 1W Over Hwy 30	2006	Prestressed concrete	13,969	7/8/7	VG	ND		NV	
2	03	091	57.8899	00492A	Rickreall Creek, Hwy 1W	1960	Concrete continuous	6,279	6/6/6	GD	OD	DG	PV	3
2	03	091	62.0099	07615	North Fork Ash Creek, Hwy 1W	1954	Concrete continuous	2,183	7/7/6	GD	OD	Scour	PV	3
2	03	091	62.8699	07616	Middle Fork Ash Creek, Hwy 1W	1954	Concrete continuous	2,610	6/6/6	GD	OD	DG	PV	3
2	03	091	42.1799	08208	Hwy 1W over Whiteson Dip	1956	Concrete	9,570	6/6/4	PR	SD	SD	V	3
2	03	153	0.88	05038A	Deer Creek, Hwy 153	1987	Prestressed concrete	2,722	7/8/7	VG	ND		NV	
2	03	153	5.87999	05041	Salt Creek (Ash Swale), Hwy 153	1951	Wood or Timber	9,348	5/5/5	PR	OD	LSL TS	V	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	153	3.05999	17482	South Yamhill River, Hwy 153	1997	Prestressed concrete continuous	9,350	7/6/7	GD	ND		NV	
2	03	153	2.88999	17483	South Yamhill River Oflow, Hwy 153 at MP 2.89	1996	Prestressed concrete	2,432	8/8/7	VG	ND		NV	
2	03	215	4.63999	09473	McKenzie River, Hwy 215	1959	Concrete continuous	3,750	6/6/5	PR	OD	LSL	NV	
2	03	215	19.2	09474	Lost Creek, Hwy 215	1961	Prestressed concrete	5,697	6/7/6	GD	ND		NV	
2	03	215	17.26	09845	Boulder Creek, Hwy 215	1956	Concrete continuous	2,705	6/7/7	GD	ND		PV	
2	03	215	17.76	09846	Scott Creek, Hwy 215	1956	Concrete continuous	2,705	6/7/7	GD	ND		PV	
2	03	016	87.0698	19184	LAKE CREEK, HWY 16	2005	Prestressed concrete	3,864	7/7/7	VG	ND		NV	
2	03	483	46.7499	06758	South Yamhill River, Hwy 483 McMinnville Spur	1951	Steel	34,898	5/6/3	PR	SD	SD LSL DG PAINT TS	V	
2	03	193	6.17999	04599A	Ash Creek, Hwy 193	1981	Prestressed concrete	6,344	6/6/6	GD	ND		NV	
2	03	193	0.38	17416	Rickreall Creek, Hwy 193	1995	Prestressed concrete	6,580	7/7/7	VG	ND		NV	
2	03	191	2.98999	00231A	Rickreall Creek, Hwy 191 SB	1918	Concrete	3,920	6/6/5	PR	OD	LSL	NV	
2	03	191	2.98999	09848	Rickreall Creek, Hwy 191 NB	1969	Prestressed concrete	4,480	7/7/6	GD	ND		NV	
2	03	043	1.86	00491A	South Fork Ash Creek, Hwy 43 (Independence)	1950	Concrete continuous	4,000	6/6/5	PR	OD	TS	V	
2	03	001OL	244.86	00365A	Miller Creek, Hwy 1 Frtg Rd Lt	1920	Concrete	696	5/6/6	PR	ND		NV	
2	03	001	245.87	03469A	Miller Creek, Hwy 1 at MP 245.87	1958	Concrete continuous	-	6	GD	ND		NV	
2	03	001OY	251.52	16967	Kuebler Blvd SE over Hwy 1 & Conn Hwy 1 SB Conn over Fairview Industrial Drive	1989	Prestressed concrete continuous	24,990	6/6/6	GD	ND		NV	
2	03	001PA	251.79	17015	SE	1989	Prestressed concrete	5,281	6/6/7	GD	ND		NV	
2	03	001	254.74	18267	Hwy 1 over State Street	2000	Prestressed concrete	19,910	6/7/6	GD	ND		NV	
2	03	001	251.79	19126	Hwy 1 over Fairview Industrial Drive SE	2007	Prestressed concrete	17,068	6/7/7	GD	ND		NV	
2	03	001XC	251.78	20665	Kuebler Blvd NB On-Ramp Hwy 1 at MP 251.78	2010	Prestressed concrete	3,726	7/7/7	VG	ND		NV	
2	03	C0000	282.589	07624A	Boones Ferry Road over Hwy 1 & Hwy 51	1971	Prestressed concrete continuous	16,463	7/6/6	GD	ND		PV	
2	03	001RB	282.169	07624B	Hwy 1 Conn #5 over Hwy 51 SB	1971	Concrete continuous	9,293	7/6/7	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	001QX	282.429	09870	Hwy 1 Conn #1 over Hwy 51 NB	1971	Concrete continuous	9,860	6/6/6	GD	ND		PV	
2	03	001	282.249	20418	Hwy 1 NB over Hwy 51 SB	2007	Prestressed concrete	5,640	7/7/7	VG	ND		NV	
2	03	001	282.279	20419	Hwy 1 SB over Hwy 51 SB	2007	Prestressed concrete	7,526	7/7/7	VG	ND		NV	
2	03	001	280.669	07795A	Hwy 1 NB over Arndt Road NE	1955	Concrete continuous	8,100	6/6/6	GD	ND		PV	1
2	03	001	280.669	07795B	Hwy 1 SB over Arndt Road NE	1955	Concrete continuous	8,100	6/6/6	GD	ND		PV	1
2	03	001	278.669	07796A	Hwy 1 NB over Ehlen Road NE	1955	Concrete continuous	7,425	6/6/6	GD	ND		PV	1
2	03	001	278.669	07796B	Hwy 1 SB over Ehlen Road NE	1955	Concrete continuous	7,425	6/6/6	GD	ND		PV	1
2	03	C0000	277.359	07797A	Donald Road NE over Hwy 1	1973	Prestressed concrete continuous	12,556	7/6/7	GD	ND		PV	
2	03	001	276.399	07799A	Hwy 1 NB over Fellers Road NE	1955	Concrete continuous	7,425	6/6/7	GD	ND		PV	1
2	03	001	276.399	07799B	Hwy 1 SB over Fellers Road NE	1955	Concrete continuous	7,425	6/6/7	GD	ND		PV	1
2	03	C0000	274.689	07800A	Broadacres Road NE over Hwy 1	1973	Prestressed concrete continuous	15,910	7/6/6	GD	ND		PV	
2	03	001	253.52	19127	Mill Creek Oflow, Hwy 1 AT MP 253.52	2008	Prestressed concrete	15,643	6/7/7	GD	ND		NV	
2	03	001	252.13	20026	Hwy 1 over UPRR Main Line	2007	Prestressed concrete	34,345	6/7/7	GD	ND		NV	
2	03	001	252.22	20032	Hwy 1 over Turner Road SE	2007	Prestressed concrete continuous	27,377	6/7/7	GD	ND		NV	
2	03	001	252.54	20034	Mill Creek, Hwy 1 NB	2007	Prestressed concrete	14,101	6/7/7	GD	ND		NV	
2	03	001	252.57	20035	Mill Creek, Hwy 1 SB AT MP 252.57	2007	Prestressed concrete	14,756	6/7/7	GD	ND		NV	
2	03	001	252.84	20109	Mill Creek Oflow, Hwy 1 at MP 252.84	2007	Concrete continuous	-	7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	030	25.88	22519	Willamette River, Hwy 30 EB Ramp N.	1953	Concrete	4,872	6/6/6	GD	OD	DG	NV	
2	03	030	5.05999	22599	Front St. NE, Hwy 072AD	1981	Concrete	5,792	7/6/7	GD	ND		NV	#N/A
2	03	030	25.69	22523	Willamette River, Hwy 30AZ EB Ramp	1953	Concrete	21,333	6/6/6	GD	OD	DG	NV	
2	03	154	3.04999	01730	Farmer River (Palmer Creek), Hwy 154 (Fulgham)	1932	Wood or Timber	2,584	6/7/5	PR	ND		V	
2	03	039	28.3799	0M022	Culvert, Hwy 39 at MP 28.38	1957	Concrete continuous	-	6	GD	ND		PV	2
2	03	039	33.2099	0M023	Culvert, Hwy 39 at MP 33.21	1957	Concrete continuous	-	6	GD	ND		NV	
2	03	C0000	250.32	07442	Battle Creek Road SE over Hwy 1	1954	Concrete continuous	7,692	6/6/6	GD	ND		V	
2	03	072	8.45998	07769A	Mill Creek, Hwy 72 (Mission St SE)	1956	Prestressed concrete continuous	17,496	6/6/6	GD	ND		V	
2	03	072	6.22999	08111	Shelton Ditch, Hwy 72 (12th St SE)	1929	Concrete	2,610	6/6/5	PR	ND		NV	
2	03	072	1.73	16098	Clagget Creek, Hwy 72	1984	Prestressed concrete	6,160	7/7/7	VG	ND		NV	
2	03	072AE	6.48999	16813	Hwy 72 (Mission St SE) over 13th St SE	1988	Prestressed concrete	8,829	6/6/6	GD	ND		NV	
2	03	072AF	6.41999	16814	Hwy 72 (Mission St SE) On Ramp over Bike Path	1988	Concrete	1,098	6/6/7	GD	ND		NV	
2	03	072	4.50999	16883	Mill Creek, Hwy 72	1930	Concrete	3,861	6/6/5	PR	ND		NV	
2	03	072	6.50999	16812E	Hwy 72 EB (Mission St) On-Ramp over 13thSt & UPRR	1988	Prestressed concrete continuous	31,068	5/6/6	PR	OD	DG	NV	
2	03	072	6.54999	16812M	Hwy 72 (Mission St SE) over 14th St SE & UPRR	1988	Concrete continuous	54,549	5/6/6	PR	ND		NV	

2017 BRIDGE CONDITION REPORT - District 3


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	072	6.44999	16812W	Shelton Ditch & 13th St SE, Hwy 72 WB Off-Ramp	1988	Prestressed concrete continuous	19,479	6/6/6	GD	OD	DG	NV	
2	03	C0000	255.56	17226	Center Street NE over Hwy 1	1993	Prestressed concrete continuous	18,459	6/7/7	GD	ND		NV	
2	03	039	51.5699	08003	Yamhill River, Hwy 39 (Dayton)	1957	Steel continuous	23,273	5/5/6	PR	OD	Rail LSL Scour LC	V	2
2	03	C0000	50.7999	08012	Fletcher Rd (Lafayette Rd) over Hwy 39	1957	Concrete continuous	9,055	6/6/7	GD	ND		V	
2	03	039	51.3799	08013	Hwy 39 over Hwy 150	1957	Concrete continuous	5,544	6/6/6	GD	ND		PV	2
2	03	039	45.6299	08490	South Yamhill River, Hwy 39 at MP 45.63	1963	Steel	11,347	5/6/6	PR	ND		V	2
2	03	039	45.7599	08492	Yamhill River Oflow, Hwy 39	1963	Concrete	10,440	4/6/5	PR	SD	SD	V	2
2	03	483	46.3499	08951	Hwy 483 McMinnville Spur over Hwy 39	1964	Concrete continuous	6,782	6/6/7	GD	OD	DG	PV	2
2	03	039	23.77	00745	South Yamhill River, Hwy 39 at MP 23.77	1946	Concrete continuous	9,574	6/5/6	PR	OD	DG	V	2
2	03	039	23.1	01344C	South Yamhill River, Hwy 39 at MP 23.09	1992	Prestressed concrete	8,173	7/7/7	VG	ND		NV	
2	03	039	22.62	17986	Hwy 39 over Casino Entrance Rd	1996	Prestressed concrete	1,899	7/7/7	VG	ND		NV	
2	03	C0000	24.66	20252	Fort Hill Road Over Hwy 39 at MP 24.66	2009	Prestressed concrete continuous	8,894	7/7/6	GD	ND		NV	
2	03	039	37.9799	02404A	Muddy Creek, Hwy 39	1978	Prestressed concrete	4,356	6/6/6	GD	ND		V	2
2	03	039	36.0599	03114	Deer Creek, Hwy 39	1941	Concrete continuous	5,250	6/6/6	GD	OD	DG	V	2
2	03	039	30.3799	08060	Mill Creek, Hwy 39	1957	Concrete continuous	6,264	5/6/6	PR	OD	DG	V	2
2	03	C0000	32.5999	08062	County Road to Sheridan over Hwy 39	1957	Concrete continuous	8,254	5/6/7	PR	OD	VC	V	

2017 BRIDGE CONDITION REPORT - District 3

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	03	039	33.6399	08063	South Yamhill River, Hwy 39 at MP 33.64	1956	Concrete continuous	15,290	5/6/6	PR	ND		PV	2
2	03	039	33.8199	08064	Hwy 39 over Hwy 157 EB	1959	Concrete continuous	9,013	5/6/6	PR	ND		V	2
2	03	039	27.1699	08320	South Yamhill River & Hwy 157, Hwy 39 at MP 27.17	1958	Steel continuous	19,472	5/6/6	PR	OD	PAINT	V	2
2	03	039	27.2799	08321	Hwy 39 over Hwy 30	1958	Concrete continuous	8,986	6/6/6	GD	ND		PV	2
2	03	039	44.7899	08688	Hwy 39 over WPRR	1964	Concrete continuous	5,916	6/6/6	GD	OD	DG	PV	2
2	03	C0000	45.1899	08903	Booth Bend Road over Hwy 39	1964	Concrete continuous	8,640	6/6/7	GD	OD	DG	PV	
2	03	039AK	44.0599	08950	Hwy 39 EB Conn to Hwy 1W over Hwy 39 WB	1964	Concrete continuous	7,450	6/6/7	GD	ND		PV	2

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 4

APRIL 2017

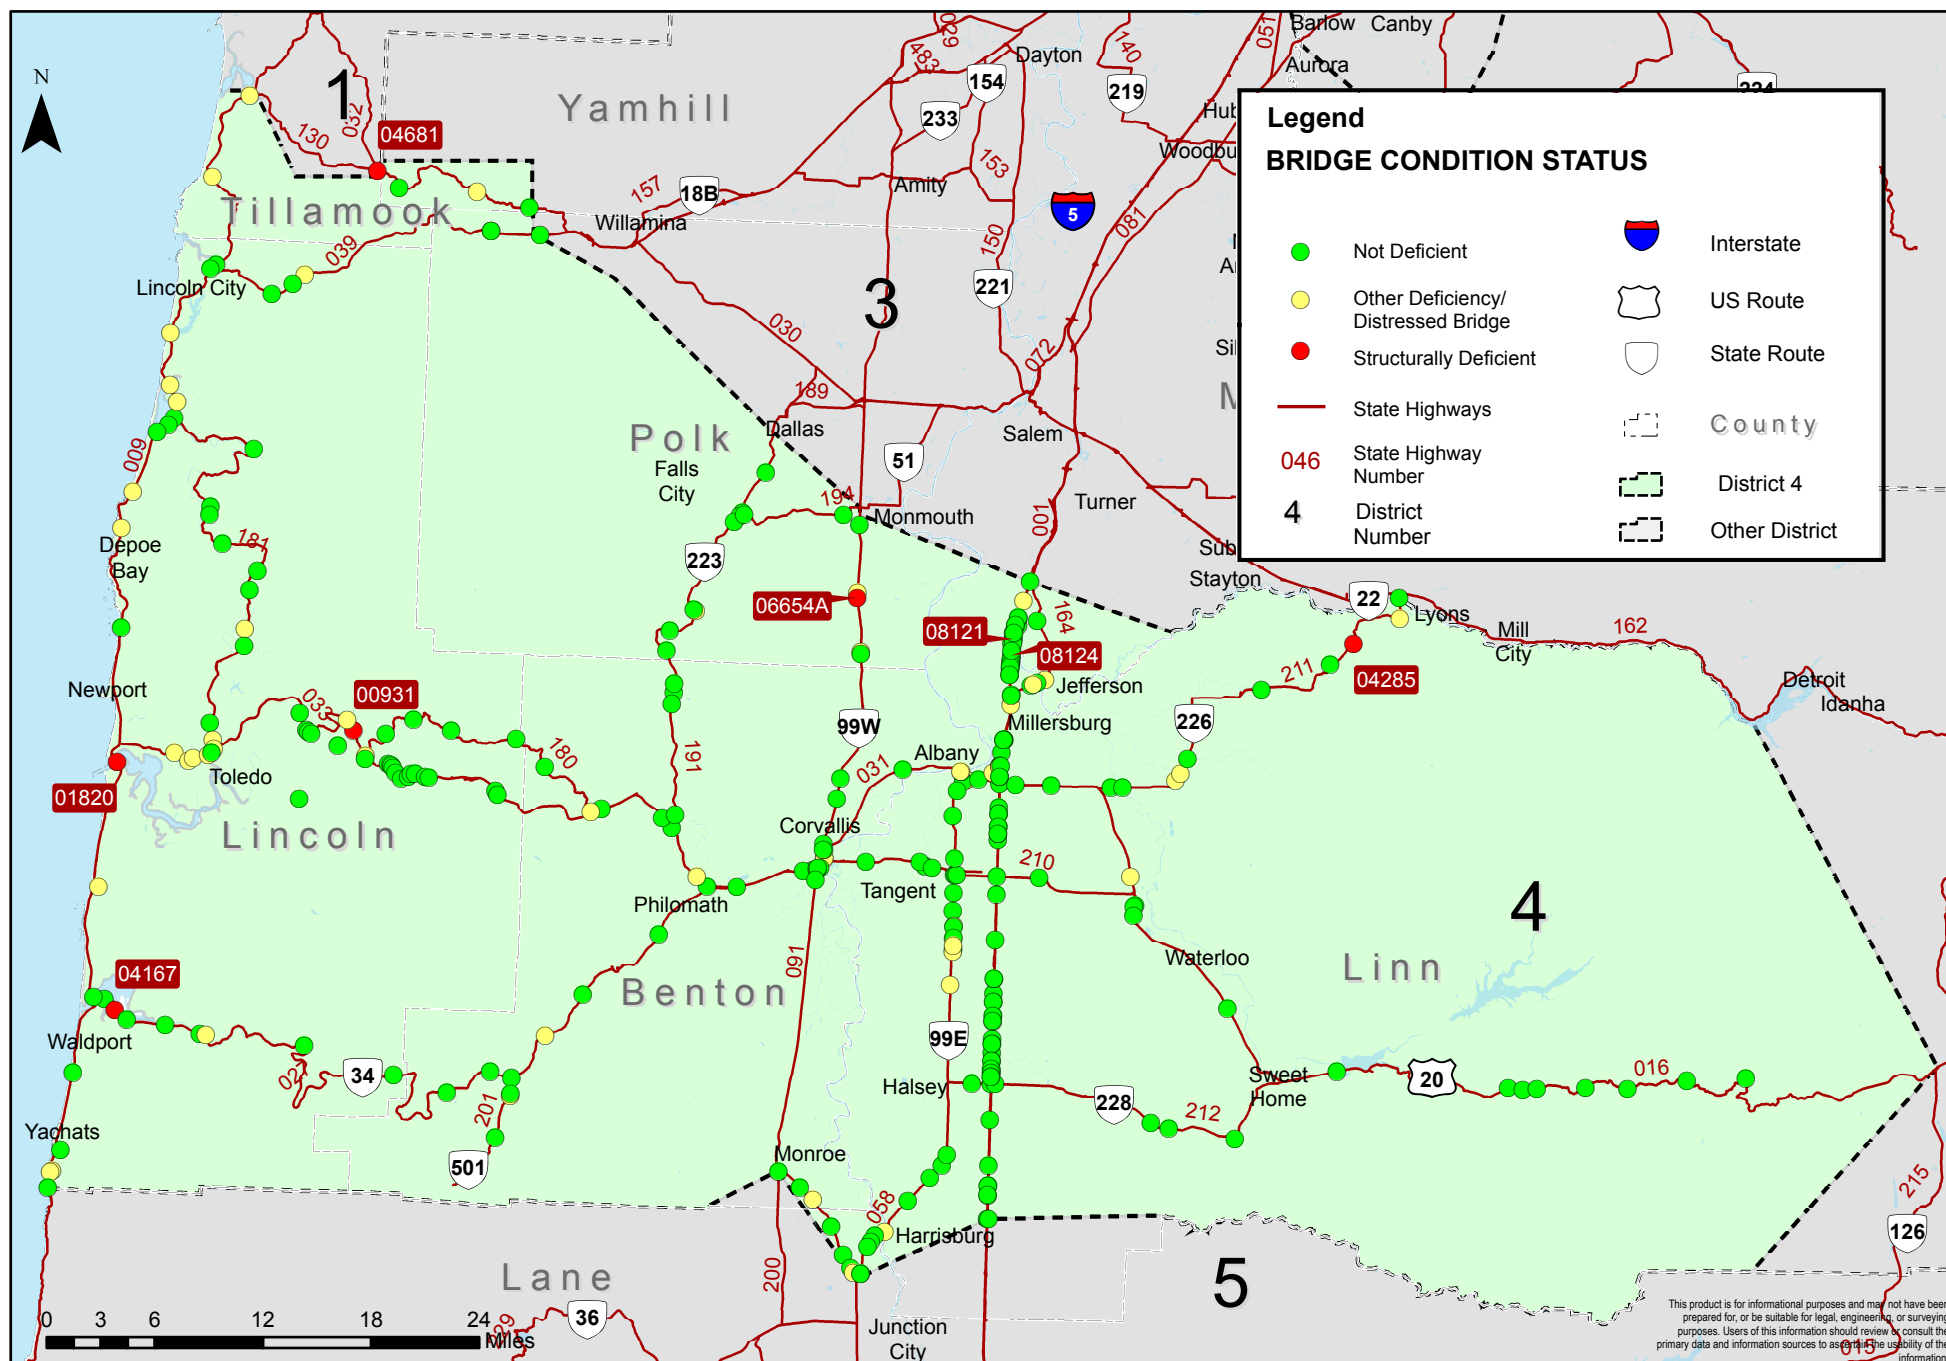

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	027	38.59993	00933	Mill Creek, Hwy 27	1953	Concrete continuous	3,696	7/6/5	PR	ND		V	
2	04	027	4.669991	01690	Southworth Creek, Hwy 27	1932	Concrete continuous	1,990	6/6/6	GD	ND		V	
2	04	027	6.709987	01691	Arnold Creek, Hwy 27	1932	Concrete	2,620	6/6/6	GD	ND		V	
2	04	027	7.059986	02652	Alsea River, Hwy 27	1940	Steel continuous	14,813	6/6/6	GD	OD	PAINT	V	
2	04	027	35.60993	02965	Maltby Creek, Hwy 27	1956	Wood or Timber	1,750	6/6/6	GD	ND		V	
2	04	027	2.349995	04168	Eckman Slough, Hwy 27	1900	Concrete continuous	-	7	VG	ND		NV	
2	04	027	14.21997	04173	Scott Creek, Hwy 27	1949	Concrete continuous	3,565	6/6/6	GD	ND		V	
2	04	027	26.68995	04181	Fall Creek, Hwy 27	1953	Concrete continuous	4,620	5/6/7	PR	ND		V	
2	04	027	0.549999	04166	Lint Creek (Indian Slough), Hwy 27	1931	Concrete	3,037	7/6/6	GD	ND		V	
2	04	091	79.96985	00420A	Jackson Creek, Hwy 1W	1919	Concrete continuous	1,120	7/7/7	VG	ND		PV	3
2	04	091	71.47986	00871A	Berry Creek, Hwy 1W	1923	Concrete	1,600	7/6/6	GD	OD	LSL	NV	
2	04	091	71.56986	00872A	Soap Creek, Hwy 1W	1923	Concrete	1,600	7/6/6	GD	ND		NV	
2	04	091	68.12987	06653A	Luckiamute River, Hwy 1W	1954	Concrete continuous	10,519	6/5/5	PR	OD	LSL	PV	3
2	04	091	68.45987	06654A	Luckiamute River Overflow, Hwy 1W	1958	Concrete continuous	10,728	5/6/4	PR	SD	SD LSL TS	V	3
2	04	091	64.37988	06662	South Fork Ash Creek, Hwy 1W	1957	Concrete	3,008	6/6/6	GD	ND		V	3
2	04	091	82.60984	07321	Hwy 1W over WPRR at MP 82.61	1954	Concrete continuous	16,846	5/5/6	PR	ND		V	3
2	04	091	82.89984	16001	Dixon Creek, Hwy 1W NB	1942	Concrete continuous	-	7	VG	ND		V	3
2	04	091	82.93984	16002	Dixon Creek, Hwy 1W SB	1942	Concrete continuous	-	7	VG	ND		V	3
2	04	091	78.82985	20799	Mountian View Creek, Hwy 1W	2011	Prestressed concrete	2,820	7/7/7	VG	ND		NV	
2	04	033AK	55.85989	08616	Hwy 33 EB Conn. to Hwy 1W NB over Hwy 1W SB	1960	Steel	11,855	5/5/6	PR	OD	VC	V	4
2	04	033	55.72989	08617	Hwy 33 over WPRR	1960	Concrete continuous	14,140	6/6/7	GD	ND		V	4
2	04	033	56.14989	16873	Willamette R., Hwy 33 ("B" Ave) (Corvallis Bypass)	1991	Prestressed concrete	34,320	6/7/7	GD	ND		PV	4

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	033	55.95989	16874	Hwy 33 over SW 3rd St & SW 4th Street (Corvallis)	1992	Prestressed concrete	53,695	5/7/7	PR	OD	VC	PV	4
2	04	091CH	84.44984	16875	Marys River, Hwy 1W NB Conn to Hwy 33 EB	1991	Prestressed concrete	20,275	5/7/7	PR	ND		PV	3
2	04	033AL	56.34989	17053	Hwy 33 WB Conn to Hwy 1W SB over SW 3rd St.	1991	Prestressed concrete	22,960	6/7/7	GD	ND		PV	4
2	04	091	103.6798	00394	Lake Slough, Hwy 1W	1919	Concrete continuous	1,733	6/5/5	PR	OD	LSL	V	3
2	04	091	105.5798	00432	Crow Creek, Hwy 1W	1921	Concrete continuous	1,737	6/6/6	GD	ND		PV	3
2	04	091	101.1598	01587A	Long Tom River, Hwy 1W	1954	Concrete continuous	8,970	6/6/5	PR	ND		PV	3
2	04	091	107.2998	01805B	Flat Creek, Hwy 1W at MP 107.30	1933	Wood or Timber	4,346	6/6/5	PR	ND		PV	3
2	04	091	108.1098	01805C	Creek, Hwy 1W at MP 108.11	1933	Wood or Timber	1,739	7/6/6	GD	ND		PV	3
2	04	091	108.3998	01805E	Creek, Hwy 1W at MP 108.41	1933	Wood or Timber	1,739	7/6/6	GD	OD	TS	V	3
2	04	091	84.75984	02701A	Fishers Millrace, Hwy 1W	1992	Prestressed concrete	6,160	7/7/7	VG	ND		NV	
2	04	091	102.7198	20463	Miller Creek, Hwy 1W	2008	Prestressed concrete	5,460	7/7/7	VG	ND		NV	
2	04	091	84.13984	00706	Marys River, Hwy 1W NB	1933	Steel	12,466	5/6/5	PR	OD	LSL TS	V	3
2	04	091	84.20984	07019	Marys River, Hwy 1W SB	1949	Concrete continuous	20,381	6/6/6	GD	ND		V	3
2	04	033	5.589989	00439B	Depot Slough, Hwy 33	1960	Concrete continuous	-	6	GD	ND		PV	4
2	04	033	39.95992	00773A	Norton Creek, Hwy 33	1975	Prestressed concrete	3,696	7/7/7	VG	ND		V	4
2	04	033	39.33992	00866B	Marys River & WPRR, Hwy 33 at MP 39.34	1955	Concrete continuous	10,098	6/5/5	PR	OD	LSL	PV	4
2	04	033	21.70996	00931	Peterson Creek, Hwy 33	1962	Concrete	1,524	6/6/4	PR	SD	SD LSL DG	V	4
2	04	033	48.87991	01075A	Marys River, Hwy 33 at MP 48.88 (Noon)	1954	Concrete continuous	5,993	6/6/6	GD	OD	DG	PV	4
2	04	033	45.67991	01205A	Hwy 33 over Harris Rd & WPRR (Wren Conn)	1927	Concrete	8,891	6/6/6	GD	ND		V	4
2	04	033	43.90992	01206A	Marys River, Hwy 33 at MP 43.91	1966	Prestressed concrete	11,477	6/6/6	GD	ND		V	4
2	04	033	3.229994	07530	Beaver Creek, Hwy 33 at MP 3.23	1953	Concrete	2,306	6/6/6	GD	OD	DG	V	4
2	04	033	4.189992	07532	Beaver Creek, Hwy 33 at MP 4.19	1953	Concrete	2,306	6/6/6	GD	OD	DG	V	4

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	033	4.469991	07533	Beaver Creek, Hwy 33 at MP 4.47	1953	Concrete	2,306	6/6/6	GD	OD	DG	V	4
2	04	033	5.35999	07534	Little Beaver Creek, Hwy 33	1953	Concrete	2,306	6/6/6	GD	OD	DG	V	4
2	04	033	51.3099	20139	Newton Creek, Hwy 33	2007	Prestressed concrete	4,362	7/7/7	VG	ND		NV	
2	04	033	21.00996	20238	Hayes Creek, Hwy 33	2006	Prestressed concrete	2,752	7/7/7	VG	OD	DG	NV	
2	04	C0533	15.68997	20876	Simpson Creek, Hwy 33 at MP 15.69 R/W Rt	2010	Concrete	-	8	VG	ND		NV	
2	04	033	15.19997	21141	Simpson Creek, Hwy 033 at MP 15.20	2011	Prestressed concrete	4,690	7/7/7	VG	ND		NV	
2	04	164	6.979987	00360A	Santiam River Oflow, Hwy 164 at MP 6.98	1960	Prestressed concrete	13,956	7/6/6	GD	OD	TS	PV	
2	04	164	7.119986	00361	Santiam River Oflow, Hwy 164 at MP 7.12	1958	Concrete	8,488	6/6/6	GD	ND		V	
2	04	031	7.029987	01036A	Bowers Slough, Hwy 31	1964	Prestressed concrete	5,225	7/7/6	GD	ND		PV	
2	04	164	6.729987	18876	Santiam River Oflow, Hwy 164 at MP 6.73	2001	Prestressed concrete	9,316	5/7/7	PR	ND		NV	
2	04	031	10.43998	01025D	Willamette River, Hwy 31 EB (Ellsworth St)	1925	Steel	41,420	6/5/5	PR	OD	LSL VC	V	
2	04	164	6.269988	01582	Santiam River, Hwy 164	1933	Concrete continuous	27,524	5/5/5	PR	OD	LSL LC	V	
2	04	164	0.25	07941	Hwy 164 over Hwy 1	1958	Concrete continuous	8,355	6/6/6	GD	ND		V	
2	04	031	10.44998	09806	Willamette River, Hwy 31 WB (Lyon St)	1971	Steel continuous	55,730	6/7/6	GD	OD	Rail	PV	
2	04	164	2.639995	00366	Chehulpum Creek, Hwy 164 (Sidney Power Canal)	1919	Concrete	558	6/6/6	GD	ND		NV	
2	04	009	164.7297	01173D	Yachats River, Hwy 9	1977	Prestressed concrete	11,613	7/7/6	GD	ND		V	4
2	04	009	166.4597	01175	Cape Perpetua Half Viaduct, Hwy 9	1931	Concrete continuous	1,254	6/6/7	GD	OD	DG	V	4
2	04	009	149.0197	01391A	Beaver Creek, Hwy 9 at MP 149.02	1928	Prestressed concrete	8,528	6/5/5	PR	OD	Rail	V	4
2	04	009	160.1497	01430A	Big Creek, Hwy 9 at MP 160.15	1929	Concrete continuous	4,680	6/6/6	GD	ND		V	4
2	04	009	166.4797	09404	Cape Perpetua Half Viaduct, Hwy 9 at MP 166.48	1963	Prestressed concrete	408	6/6/7	GD	OD	DG	NV	
2	04	009	167.5097	18960	Cooks Chasm, Hwy 9	2003	Prestressed concrete	7,722	7/7/7	VG	ND		PV	
2	04	181	23.09996	00851A	Siletz River, Hwy 181 at MP 23.10 (Fuller)	1956	Steel	12,327	6/6/6	GD	OD	LSL PAINT	V	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	181	20.65996	00852A	Siletz River, Hwy 181 at MP 20.66 (Ojalla)	1946	Steel	10,343	6/6/6	GD	ND		V	
2	04	181	24.09995	00853A	Siletz River, Hwy 181 at MP 24.10	1956	Prestressed concrete	9,665	7/6/7	GD	ND		V	
2	04	181	5.32999	01491A	Skunk Creek, Hwy 181	1989	Prestressed concrete	2,520	7/7/7	VG	ND		NV	
2	04	181	12.86998	01914A	Root Creek, Hwy 181	1989	Prestressed concrete	5,400	7/7/7	VG	ND		V	
2	04	181	19.41996	01968A	Euchre Creek, Hwy 181	1989	Prestressed concrete	4,824	7/7/5	PR	ND		V	
2	04	181	15.46997	01972A	Cedar Creek, Hwy 181	1989	Prestressed concrete	5,040	7/7/7	VG	ND		V	
2	04	181	29.63994	09048	Depot Creek, Hwy 181 at MP 29.64	1963	Prestressed concrete	2,600	7/7/6	GD	ND		V	
2	04	181	30.62994	09049	Depot Creek, Hwy 181 at MP 30.63	1963	Prestressed concrete	2,184	7/7/5	PR	OD	LSL TS	V	
2	04	181	31.13994	09050	Depot Creek, Hwy 181 at MP 31.14	1963	Prestressed concrete	2,912	7/7/6	GD	OD	TS	V	
2	04	181	12.36998	18144	Davis Creek, Hwy 181 (Skalada)	1997	Prestressed concrete	4,056	6/6/7	GD	ND		NV	
2	04	009	118.1698	00924A	Schooner Creek, Hwy 9	1945	Concrete continuous	10,260	5/5/5	PR	OD	LSL DG Scour	V	2
2	04	009	119.2698	00925A	Drift Creek, Hwy 9	1945	Concrete continuous	7,386	7/6/5	PR	OD	LSL DG	V	2
2	04	009	127.6098	02459	Depoe Bay, Hwy 9	1927	Concrete	20,768	6/6/7	GD	OD	LSL LC	V	5
2	04	009	121.6098	04141A	Sijota Creek & Golf Access, Hwy 9	1955	Concrete continuous	2,398	7/7/6	GD	ND		V	2
2	04	009	125.1898	04143A	Fogarty Creek, Hwy 9	1955	Concrete continuous Prestressed concrete	4,385	6/6/6	GD	OD	LSL DG	V	2
2	04	009	120.1598	09906	Siletz River, Hwy 9	1973	continuous	80,114	7/6/7	GD	ND		V	2
2	04	009	133.8597	20198	Spencer Creek, Hwy 9	2008	Prestressed concrete Prestressed concrete	10,763	7/7/7	VG	ND		NV	
2	04	009	120.8398	20401	Millport Slough Hwy 009 at MP 120.84	2011	continuous	29,315	7/8/8	VG	ND		NV	
2	04	180	14.69997	01253	Marys River, Hwy 180	1957	Concrete	1,744	6/6/6	GD	ND		V	
2	04	180	2.399995	01401A	Yaquina River, Hwy 180 at MP 2.40	1982	Prestressed concrete	3,584	7/6/7	GD	ND		PV	
2	04	180	4.929991	01402A	Yaquina River, Hwy 180 at MP 4.93	1981	Prestressed concrete	4,144	7/7/7	VG	ND		PV	
2	04	180	11.80998	02711	Yaquina River, Hwy 180 at MP 11.81	1941	Steel	2,757	6/6/6	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	180	7.729985	04199	Randall Creek, Hwy 180	1961	Concrete	1,178	6/6/6	GD	ND		V	
2	04	009	141.6797	01820	Yaquina Bay, Hwy 9	1934	Steel continuous	118,458	6/4/6	PR	SD	SD LSL VC LC	V	5
2	04	C0000	243.5395	08114	Ankeny Hill Rd over Hwy 1	1958	Concrete continuous	8,540	6/6/6	GD	OD	VC	V	
2	04	058	30.12994	03940A	Slough, Hwy 58 at MP 30.13	1976	Prestressed concrete	5,824	6/6/6	GD	ND		NV	
2	04	058	29.08994	00583E	Willamette R, Hwy 58 (Harrisburg, John B. Yeon)	1925	Steel	50,426	6/6/6	GD	OD	LSL	V	
2	04	058	29.71994	03939A	Slough, Hwy 58 at MP 29.72	1974	Prestressed concrete	22,200	6/6/6	GD	ND		PV	
2	04	058	30.44994	03941A	Slough, Hwy 58 at MP 30.45	1976	Prestressed concrete	3,458	7/7/7	VG	ND		NV	
2	04	058	32.03994	03943A	Slough, Hwy 58 at MP 32.04	1969	Prestressed concrete	2,464	7/7/6	GD	ND		PV	
2	04	058	32.07994	03944A	Slough, Hwy 58 at MP 32.08	1969	Prestressed concrete	2,464	7/7/6	GD	ND		PV	
2	04	201	1.109998	01856	South Fork Alsea River, Hwy 201	1934	Steel	2,576	6/6/5	PR	OD	PAINT TS	V	
2	04	201	0.1	02305	North Fork Alsea River, Hwy 201	1937	Steel	7,314	6/6/6	GD	ND		V	
2	04	201	0.969998	02306	South Fork Alsea River Oflow Channel, Hwy 201	1937	Concrete continuous	1,760	6/6/6	GD	ND		V	
2	04	201	3.649993	03004	Bummer Creek, Hwy 201	1967	Steel continuous	-	7	VG	ND		NV	
2	04	027	58.41989	00771	Marys River, Hwy 27 (Flynn)	1949	Concrete continuous	7,805	6/6/6	GD	ND		V	
2	04	027	46.31991	01008A	Yew Creek, Hwy 27	1966	Steel	-	6	GD	ND		NV	
2	04	027	43.02992	01204	North Fork Alsea River, Hwy 27	1927	Steel	3,973	6/6/6	GD	OD	LSL	V	
2	04	027	54.5299	01259	Rock Creek, Hwy 27 at MP 54.53	1926	Concrete continuous	4,980	6/6/6	GD	ND		V	
2	04	033	13.88997	20038	Highway 33 over UPRR, Hwy 33	2009	Prestressed concrete	10,950	8/8/7	VG	ND		NV	
2	04	033	14.06997	20231	Yaquina River, Hwy 33	2012	continuous	16,297	8/7/7	VG	ND		NV	
2	04	033	14.23997	20232	Trapp Creek, Hwy 33	2012	continuous	16,430	8/8/8	VG	ND		NV	
2	04	058	2.199996	02380	Hwy 58 over City Street & UPRR	1940	Steel continuous	34,042	5/6/6	PR	OD	LSL DG PAINT	V	
2	04	058	0.689999	02515A	Cox Creek, Hwy 58	1940	Concrete continuous	7,633	7/7/7	VG	OD	LC	V	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	058	1.559997	18295	Periwinkle Creek, Hwy 58 NB	1978	Prestressed concrete	2,675	7/7/7	VG	ND		NV	
2	04	212	1.339997	04288A	Spoon Creek, Hwy 212	1994	Prestressed concrete	3,360	7/7/7	VG	ND		NV	
2	04	212	2.639995	04289A	Courtney Creek, Hwy 212	1983	Prestressed concrete	2,720	7/7/7	VG	ND		NV	
2	04	212	2.399995	08252	Hwy 212 over Hwy 1	1958	Concrete continuous	12,838	6/6/6	GD	ND		V	
2	04	016	13.54997	00578A	Lebanon Ditch, Hwy 16 EB	1921	Prestressed concrete	2,080	6/6/6	GD	ND		NV	
2	04	016	11.88998	01162A	Mountain States Power Co Canal, Hwy 16	1950	Concrete continuous	3,283	6/6/5	PR	OD	LSL DG TS	V	
2	04	016	30.21994	01330A	Wiley Creek, Hwy 16	1964	Concrete continuous	16,658	6/6/6	GD	ND		PV	
2	04	016	14.05997	04231A	Mountain States Power Canal, Hwy 16	1961	Prestressed concrete	4,104	7/7/6	GD	ND		PV	
2	04	016	21.68996	04242A	Noble Slough, Hwy 16	1983	Prestressed concrete	4,800	7/7/7	VG	ND		NV	
2	04	016	13.55997	07073	Lebanon Ditch, Hwy 16 WB	1947	Concrete continuous	2,886	7/6/6	GD	ND		V	
2	04	016	1.949996	17439	Cox Creek, Hwy 16	1995	Prestressed concrete	2,200	7/7/7	VG	ND		NV	
2	04	016	3.919992	18893	Burkhart Creek, Hwy 16	2002	Prestressed concrete	2,938	7/7/7	VG	ND		NV	
2	04	058	6.879987	00398A	Culvert, Hwy 58 at MP 6.88	1992	Concrete continuous	-	6	GD	ND		NV	
2	04	058	8.799983	00399	Creek, Hwy 58 at MP 8.80	1954	Concrete	1,776	7/6/5	PR	ND		NV	
2	04	058	10.65998	00552A	Creek, Hwy 58 at MP 10.66	1954	Concrete	1,292	6/6/6	GD	OD	TS	V	
2	04	058	4.459991	00737A	Oak Creek, Hwy 58	1988	Prestressed concrete	8,004	7/7/6	GD	ND		NV	
2	04	058	9.809981	00738	Lake Creek, Hwy 58	1922	Concrete continuous	2,352	6/6/6	GD	ND		V	
2	04	058	3.039994	02481A	Santiam Canal, Hwy 58	1940	Concrete continuous	-	6	GD	ND		NV	
2	04	058	13.95997	00566A	Calapooia Bottoms, Hwy 58 at MP 13.96	1955	Concrete	9,460	6/5/6	PR	OD	TS	V	
2	04	058	25.03995	20344	Big Muddy Creek, Hwy 58	2008	Prestressed concrete continuous	7,169	7/7/7	VG	ND		NV	
2	04	058	24.05995	20345	Creek, Hwy 58 at MP 24.06	2008	Prestressed concrete	2,200	7/7/7	VG	ND		NV	
2	04	058	23.37996	20399	Little Muddy Creek, Hwy 58	2007	Prestressed concrete continuous	7,467	6/8/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	058	26.79995	20400	Camous Creek, Hwy 58	2008	Prestressed concrete	3,080	7/7/7	VG	ND		NV	
2	04	212	11.81998	01428A	Calapooia River, Hwy 212 (McKircher)	1958	Prestressed concrete	5,364	6/7/7	GD	ND		V	
2	04	212	12.93998	01725A	Calapooia R, Hwy 212 at MP 12.94 (Crawfordsville)	1963	continuous	7,308	7/6/7	GD	ND		PV	
2	04	058	2.419995	02447	Hwy 58 over Hwy 31	1940	Steel	8,726	6/6/6	GD	ND		V	
2	04	212	16.77997	17973	Calapooia River, Hwy 212 at MP 16.78 (Matlock)	1997	Concrete continuous	12,888	6/7/6	GD	ND		NV	
2	04	058	10.71998	00553A	Calapooia Bottoms, Hwy 58 at MP 10.72	1954	Prestressed concrete	2,546	6/6/5	PR	ND		V	
2	04	058	11.18998	00561A	Calapooia Bottoms, Hwy 58 at MP 11.19	1954	Concrete	10,821	6/6/5	PR	ND		V	
2	04	058	11.75998	00563A	Calapooia Bottoms, Hwy 58 at MP 11.76	1955	Concrete	3,819	6/6/5	PR	OD	TS	V	
2	04	058	11.98998	00564	Calapooia Bottoms, Hwy 58 at MP 11.99	1963	Concrete	1,978	6/6/6	GD	ND		PV	
2	04	058	12.09998	00565	Calapooia Bottoms, Hwy 58 at MP 12.10	1963	Concrete	1,319	6/6/6	GD	OD	Scour	PV	
2	04	016	41.43992	01512	Dobbin Creek, Hwy 16	1930	Concrete continuous	3,933	6/6/5	PR	ND		V	
2	04	016	42.28992	01513	Wolf Creek, Hwy 16	1930	Concrete continuous	2,816	7/6/6	GD	ND		V	
2	04	016	46.11991	01577A	South Santiam River, Hwy 16 (Garland)	1983	Prestressed concrete	8,462	6/7/7	GD	ND		NV	
2	04	016	52.4399	01706	Soda Fork, Hwy 16	1983	continuous	5,441	6/6/6	GD	ND		PV	
2	04	016	48.81991	18731	Trout Creek, Hwy 16	1936	Concrete continuous	2,124	7/7/7	GD	ND		NV	
2	04	058	11.33998	02322	Calapooia River, Hwy 58	2003	Prestressed concrete	10,243	6/6/5	PR	OD	PAINT TS	V	
2	04	016	43.06992	17971	Canyon Creek, Hwy 16	1937	Prestressed concrete	9,107	6/7/6	GD	ND		NV	
2	04	211	25.45995	00533B	Santiam River, Hwy 211 (Mehama)	1997	Prestressed concrete	28,080	6/6/6	GD	ND		PV	
2	04	211	18.66996	04283	Jordan Creek, Hwy 211	1973	continuous	673	6/6/6	GD	ND		NV	
2	04	211	24.24995	04287	Trask Creek (Gold Creek), Hwy 211	1959	Concrete	1,170	7/6/5	PR	OD	TS	PV	
2	04	027	1.619997	04167	McKinney Slough, Hwy 27	1963	Concrete	1,984	6/6/3	PR	SD	SD LSL TS LC	V	
2	04	211	20.44996	04285	Jordan Creek, Hwy 211	1957	Prestressed concrete	832	6/6/3	PR	SD	SD LSL TS	NV	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	210	0.13	02728	Willamette River, Hwy 210 EB (Van Buren Ave)	1913	Steel	18,406	6/5/5	PR	OD	LSL LC	V	
2	04	194	6.269988	10261A	South Fork Ash Creek, Hwy 194	1966	Prestressed concrete	2,565	6/6/6	GD	ND		PV	
2	04	191	7.199986	04587A	Fern Creek, Hwy 191 at MP 7.20	1953	Wood or Timber	980	6/6/6	GD	ND		V	
2	04	191	9.849981	04588A	Fern Creek, Hwy 191 at MP 9.85	1953	Concrete continuous	2,433	7/7/5	PR	ND		V	
2	04	191	10.10998	04589A	Little Luckiamute River, Hwy 191	1953	Concrete continuous	5,642	6/6/6	GD	ND		V	
2	04	191	10.55998	04590A	Little Luckiamute Oflow, Hwy 191	1953	Concrete continuous	1,457	6/6/6	GD	ND		V	
2	04	191	16.66997	10193	McTimmonds Creek, Hwy 191 at MP 16.67	1956	Concrete	1,865	6/6/5	PR	ND		V	
2	04	194	0.16	10265A	Fern Creek, Hwy 194	1966	Prestressed concrete	2,542	6/6/6	GD	ND		PV	
2	04	191	23.06996	01133A	Luckiamute River, Hwy 191	1966	Concrete continuous	6,270	6/6/6	GD	ND		V	
2	04	191	18.89996	01250	Pedee Creek, Hwy 191	1960	Steel	2,410	5/5/5	PR	ND		V	
2	04	191	21.02996	01251A	Ritner Creek, Hwy 191	1976	Concrete continuous	6,035	6/6/6	GD	ND		PV	
2	04	191	23.58995	01422	Maxfield Creek, Hwy 191	1967	Prestressed concrete	1,689	7/7/6	GD	ND		NV	
2	04	191	30.71994	02625A	Marys River, Hwy 191	1950	Concrete continuous	6,992	5/5/5	PR	ND		V	
2	04	191	24.22995	02997	Price Creek, Hwy 191	1967	Prestressed concrete	1,342	7/7/7	VG	ND		NV	
2	04	009	155.5397	01746B	Alsea Bay, Hwy 9	1992	Steel	233,382	7/6/6	GD	ND		PV	4
2	04	033	24.92995	18046	Little Elk Creek, Hwy 33 at MP 24.93	2000	Prestressed concrete	4,980	7/7/7	VG	ND		NV	
2	04	033	25.06995	18047	Little Elk Creek, Hwy 33 at MP 25.07	2000	Prestressed concrete	8,298	7/7/7	VG	ND		NV	
2	04	033	25.13995	18048	Little Elk Creek, Hwy 33 at MP 25.14	2000	Prestressed concrete	4,558	7/7/7	VG	ND		NV	
2	04	033	25.30995	18049	Little Elk Creek, Hwy 33 at MP 25.31	2000	Prestressed concrete	5,056	7/7/7	VG	ND		NV	
2	04	033	25.59995	18050	Little Elk Creek, Hwy 33 at MP 25.60	2000	Prestressed concrete	5,884	7/7/7	VG	ND		NV	
2	04	033	26.04995	18051	Little Elk Creek, Hwy 33 at MP 26.05	2000	Prestressed concrete	6,187	7/7/7	VG	ND		NV	
2	04	033	26.46995	18052	Little Elk Creek, Hwy 33 at MP 26.47	2000	Prestressed concrete	8,464	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	033	26.68995	18053	Little Elk Creek, Hwy 33 at MP 26.69	2000	Prestressed concrete	8,088	7/7/7	VG	ND		NV	
2	04	033	26.94995	18054	Little Elk Creek, Hwy 33 at MP 26.95	2000	Prestressed concrete	7,544	7/7/7	VG	ND		NV	
2	04	033	27.53995	18055	Little Elk Creek, Hwy 33 at MP 27.54	2000	Prestressed concrete	5,282	7/7/7	VG	ND		NV	
2	04	033	27.74995	18057	Wakefield Creek, Hwy 33	2000	Steel	-	6	GD	ND		NV	
2	04	033	23.37996	00683	Yaquina River, Hwy 33 *(Transferred to Lincoln County)	1923	Steel	4,247	6/6/5	PR	OD	LSL TS	V	4*
							Prestressed concrete							
2	04	016	56.59989	02025	Sheep Creek, Hwy 16	1963	continuous	9,017	5/5/5	PR	ND		NV	
2	04	001NX	242.1395	08117	Chehulpum Creek (Doty Creek), Hwy 1 Conn Rt.	1957	Concrete continuous	1,265	6/6/7	GD	ND		V	
2	04	C0000	242.1295	08118	Talbot Road over Hwy 1	1958	Concrete continuous	8,602	6/6/5	PR	ND		V	
2	04	001OD	241.6595	08363	Santiam Oflow No 1, Hwy 1 Frtg Rd	1958	Concrete continuous	2,890	6/6/6	GD	ND		V	
2	04	001	242.1395	18355	Chehulpum Creek (Doty Creek), Hwy 1 NB	2001	Prestressed concrete	2,200	6/7/7	GD	ND		NV	
2	04	001	242.5795	18356	Sidney Power Canal, Hwy 1 NB	2001	Prestressed concrete	2,290	7/7/7	VG	ND		NV	
2	04	001	242.5795	19217	Sidney Power Canal, Hwy 1 SB	2003	Prestressed concrete	2,038	6/7/7	GD	ND		NV	
2	04	001	242.1395	19218	Chehulpum Creek (Doty Creek), Hwy 1 SB	2003	Prestressed concrete	2,217	6/7/7	GD	ND		NV	
							Prestressed concrete							
2	04	211	1.369997	01771A	South Santiam River, Hwy 211	1973	continuous	49,950	6/6/7	GD	ND		PV	
2	04	211	13.85997	02321	Thomas Creek, Hwy 211 (Schindler)	1938	Concrete continuous	8,331	6/6/6	GD	ND		V	
2	04	211	0.729999	04272	Mill Creek, Hwy 211 at MP 0.73	1961	Concrete	1,167	6/6/6	GD	ND		PV	
2	04	211	6.309988	04278A	Crabtree Creek, Hwy 211 (Tinker Jim)	1954	Concrete continuous	4,805	6/6/6	GD	ND		V	
2	04	211	4.929991	04301	Beaver Creek, Hwy 211	1941	Wood or Timber	2,793	7/6/6	GD	OD	TS	V	
2	04	211	5.42999	04473	Beaver Creek Oflow, Hwy 211	1940	Concrete continuous	587	6/6/6	GD	OD	LSL	V	
2	04	033	55.15989	08628	Oak Creek, Hwy 33	1960	Concrete continuous	-	5	FR	ND		PV	4
2	04	033	32.30994	17027	Tumtum River, Hwy 33 at MP 32.31	1989	Steel	-	6	GD	ND		NV	
2	04	033	32.53994	17028	Tumtum River, Hwy 33 at MP 32.54	1989	Steel	-	6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	039	6.229988	04192	Salmon River, Hwy 39	1930	Concrete	4,180	6/6/5	PR	OD	Rail LSL Scour	V	2
2	04	032	18.56996	00612	South Yamhill River, Hwy 32	1929	Concrete continuous	2,785	5/5/5	PR	OD	LSL	V	
2	04	032	21.84996	01396	Agency Creek, Hwy 32	1929	Concrete continuous	2,697	6/6/6	GD	ND		V	
2	04	191	16.82997	04585	McTimmonds Creek, Hwy 191 at MP 16.83	1967	Prestressed concrete	1,241	6/6/6	GD	OD	TS	NV	
2	04	032	10.65998	04681	Louie Creek, Hwy 32 at MP 10.66	1962	Wood or Timber	1,113	4/6/6	PR	SD	SD Scour LC	V	
2	04	032	12.52998	20197	Sourgrass Creek, Hwy 32 at MP 12.53 (Indian)	2007	Prestressed concrete	4,176	7/7/7	VG	ND		NV	
2	04	210	10.02998	08229B	Hwy 210 over Hwy 1	1994	Prestressed concrete continuous	27,206	6/7/7	GD	ND		NV	
2	04	210	7.629986	09855	Hwy 210 over Hwy 58	1990	Concrete continuous	23,344	6/6/7	GD	ND		NV	
2	04	210	7.729985	16780	Hwy 210 over UPRR	1990	Prestressed concrete	17,297	6/7/6	GD	ND		PV	4
2	04	210	7.799985	17198	Hwy 210 over Tangent Industrial Park Access	1990	Concrete	7,631	7/7/7	VG	ND		NV	
2	04	210	12.47998	18463	Oak Creek, Hwy 210	2000	Prestressed concrete	5,640	6/7/6	GD	ND		NV	
2	04	210	2.449995	04267A	Owl Creek, Hwy 210	1965	Prestressed concrete	8,856	6/6/6	GD	ND		V	4
2	04	210	0.13	09179	Willamette River, Hwy 210 WB (Harrison Blvd)	1964	Steel	34,227	6/6/6	GD	OD	PAINT	PV	
2	04	210	5.849989	09413	Calapooia Oflow, Hwy 210 at MP 5.85	1971	Concrete continuous	15,011	6/6/6	GD	ND		V	4
2	04	210	5.909989	09414	Calapooia Oflow, Hwy 210 at MP 5.91	1971	Concrete continuous	11,302	6/6/6	GD	ND		V	4
2	04	210	5.509989	12205B	Calapooia River, Hwy 210	1971	Concrete continuous	30,446	7/6/6	GD	ND		V	4
2	04	210	6.299988	12208B	Lake Creek, Hwy 210	1971	Concrete continuous	15,011	6/6/6	GD	ND		PV	4
2	04	039	5.33999	01211A	Slick Rock Creek, Hwy 39	1930	Concrete continuous	8,341	7/6/6	GD	ND		V	2
2	04	039	21.54996	01612A	South Yamhill River, Hwy 39 at MP 21.55	1931	Concrete continuous	5,307	6/7/7	GD	ND		V	2
2	04	039	3.959992	04190	Bear Creek, Hwy 39	1930	Concrete	4,235	6/6/6	GD	ND		V	2
2	04	039	18.77996	04573	Rogue River, Hwy 39	1942	Concrete continuous	2,660	7/6/6	GD	OD	DG	V	2
2	04	039	0.04	13491	Hwy 39 over Hwy 9	1962	Concrete continuous	10,247	6/6/7	GD	ND		V	2

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	039	19.15996	19271	Jackass Creek, Hwy 39 at MP 19.16	2005	Prestressed concrete	1,563	7/7/7	VG	ND		NV	
2	04	001	217.1996	08240N	Courtney Creek Oflow, Hwy 1 NB	1959	Concrete continuous	3,556	6/7/6	GD	ND		PV	1
2	04	001	217.1996	08240S	Courtney Creek Oflow, Hwy 1 SB	1959	Concrete continuous	3,556	6/7/6	GD	ND		PV	1
2	04	001	216.9696	08241N	Courtney Creek, Hwy 1 NB	1959	Concrete continuous	5,334	5/6/6	PR	ND		PV	1
2	04	001	216.9696	08241S	Courtney Creek, Hwy 1 SB	1959	Concrete continuous	5,334	5/6/6	PR	ND		PV	1
2	04	C0000	214.5596	08242	Lake Creek Drive over Hwy 1	1958	Concrete continuous	6,890	6/6/6	GD	ND		V	
2	04	C0000	212.0496	08243	Bond Butte Rd over Hwy 1	1958	Concrete continuous	6,890	6/6/6	GD	ND		V	
2	04	001	210.9196	08245N	Little Muddy Creek, Hwy 1 NB	1958	Concrete continuous	3,175	7/7/6	GD	ND		PV	1
2	04	001	210.9196	08245S	Little Muddy Creek, Hwy 1 SB	1958	Concrete continuous	3,175	6/6/6	GD	ND		PV	1
2	04	001	210.3896	08246N	Muddy Creek, Hwy 1 NB	1959	Concrete continuous	5,969	6/7/6	GD	ND		PV	1
2	04	001	210.3896	08246S	Muddy Creek, Hwy 1 SB	1959	Concrete continuous	5,969	6/7/6	GD	ND		PV	1
2	04	C0000	209.0596	08248	Diamond Hill Drive over Hwy 1	1959	Prestressed concrete	7,368	6/7/6	GD	ND		PV	
2	04	001	220.0396	08235N	Calapooia Oflow, Hwy 1 NB at MP 220.04	1958	Concrete continuous	8,443	6/6/6	GD	ND		PV	1
2	04	001	220.0396	08235S	Calapooia Oflow, Hwy 1 SB at MP 220.04	1958	Concrete continuous	8,443	6/6/6	GD	ND		PV	1
2	04	001	218.7896	08236N	Calapooia River, Hwy 1 NB	1958	Concrete continuous	6,835	6/6/6	GD	ND		PV	1
2	04	001	218.7896	08236S	Calapooia River, Hwy 1 SB	1958	Concrete continuous	6,835	6/6/6	GD	ND		PV	1
2	04	C0000	218.2796	08237	Ogle Rd over Hwy 1	1958	Concrete continuous	6,890	6/6/6	GD	ND		V	
2	04	001	217.8496	08238N	Calapooia Oflow, Hwy 1 NB at MP 217.85	1958	Concrete continuous	3,175	6/6/6	GD	ND		PV	1
2	04	001	217.8496	08238S	Calapooia Oflow, Hwy 1 SB at MP 217.85	1958	Concrete continuous	3,175	6/6/6	GD	ND		PV	1
2	04	001	217.3896	08239N	Sodom Ditch Oflow, Hwy 1 NB	1959	Concrete continuous	5,334	5/6/6	PR	ND		PV	1
2	04	001	217.3896	08239S	Sodom Ditch Oflow, Hwy 1 SB	1959	Concrete continuous	5,334	5/6/6	PR	ND		PV	1
2	04	C0000	219.0796	08253	Linn-West Rd over Hwy 1	1958	Concrete continuous	6,890	6/6/6	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	001	220.3696	08234N	Sodom Ditch Oflow, Hwy 1 NB	1958	Concrete continuous	5,431	6/6/6	GD	ND		PV	1
2	04	001	220.3696	08234S	Sodom Ditch Oflow, Hwy 1 SB	1958	Concrete continuous	5,431	5/6/6	PR	ND		PV	1
2	04	001	221.1296	20396	Sodom Ditch, Hwy 1 NB	2009	Prestressed concrete continuous	20,681	6/7/7	GD	ND		NV	
2	04	001	221.1296	20397	Sodom Ditch, Hwy 1 SB	2009	Prestressed concrete continuous	20,681	7/7/7	VG	ND		NV	
2	04	016	1.059998	08223	Hwy 16 over Hwy 1 & Conns	1958	Concrete continuous	25,415	6/6/6	GD	ND		V	
2	04	C0000	231.9096	08224	Grand Prairie Drive over Hwy 1	1958	Concrete continuous	7,769	6/6/6	GD	ND		V	
2	04	C0000	230.1196	08228	Seven Mile Lane over Hwy 1	1958	Concrete continuous	9,496	5/6/6	PR	ND		V	
2	04	C0000	227.0896	08230	Tangent Rd over Hwy 1	1958	Concrete continuous	6,890	5/6/6	PR	ND		V	
2	04	C0000	224.5796	08231	Ridge Drive over Hwy 1	1958	Concrete continuous	6,890	6/6/6	GD	ND		V	
2	04	C0000	221.5796	08254	Boston Mill Rd over Hwy 1	1958	Concrete continuous	6,890	6/6/6	GD	ND		V	
2	04	033	20.50996	20237	Little Elk Creek, Hwy 33 at MP 20.51	2006	Prestressed concrete	6,020	8/7/8	VG	ND		#N/A	#N/A
2	04	033	18.01997	21972	Culvert, Hwy 33 at MP 18.53	2016	Steel	-	7	VG	ND		#N/A	#N/A
2	04	001	235.0095	06931A	Truax Creek, Hwy 1	1947	Concrete continuous	-	7	VG	ND		NV	
2	04	001	230.4796	08227N	Oak Creek, Hwy 1 NB	1958	Concrete continuous	5,334	6/6/6	GD	ND		PV	1
2	04	001	230.4796	08227S	Oak Creek, Hwy 1 SB	1958	Concrete continuous	5,334	6/6/6	GD	ND		PV	1
2	04	001	222.4196	08232N	Butte Creek, Hwy 1 NB	1958	Concrete continuous	5,334	6/6/6	GD	ND		PV	1
2	04	001	222.4196	08232S	Butte Creek, Hwy 1 SB	1958	Concrete continuous	5,334	6/6/6	GD	ND		PV	1
2	04	001	235.7095	08217	Murder Creek, Hwy 1 SB	1958	Concrete continuous	5,649	6/6/7	GD	ND		PV	1
2	04	001	235.6695	08218A	Hwy 1 NB over Murder Creek Rd	1958	Concrete continuous	5,873	6/6/6	GD	ND		PV	1
2	04	001	235.6695	08218B	Hwy 1 SB over Murder Creek Rd	1958	Concrete continuous	5,873	6/6/6	GD	ND		PV	1
2	04	001NA	235.7295	08219	Murder Creek, Hwy 1 Frtg Rd	1958	Concrete continuous	2,220	6/6/7	GD	ND		V	
2	04	001	233.6496	08222N	Cox Creek, Hwy 1 NB	1958	Concrete continuous	4,015	6/6/6	GD	ND		PV	1

2017 BRIDGE CONDITION REPORT - District 4


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	001	233.6496	08222S	Cox Creek, Hwy 1 SB	1958	Concrete continuous	3,407	6/6/6	GD	ND		PV	1
2	04	001	231.5496	08225N	Albany Ditch, Hwy 1 NB	1958	Concrete continuous	3,302	7/7/7	VG	ND		PV	1
2	04	001	231.5496	08225S	Albany Ditch, Hwy 1 SB	1958	Concrete continuous	3,302	6/6/7	GD	ND		PV	1
2	04	001	230.8595	08226N	Hwy 1 NB over AERC (Tallman Branch)	1958	Concrete continuous	8,401	6/6/6	GD	ND		PV	1
2	04	001	230.8596	08226S	Hwy 1 SB over AERC (Tallman Branch)	1958	Concrete continuous	8,401	6/6/6	GD	ND		PV	1
2	04	001	235.7095	18346	Murder Creek, Hwy 1 NB	2001	Prestressed concrete	4,906	6/7/6	GD	ND		NV	
2	04	001MV	233.6596	06661	Cox Creek, Hwy 1 Frtg Rd	1940	Concrete	1,602	6/6/5	PR	ND		V	
2	04	001	234.2296	08221A	Hwy 1 NB over Knox Butte Rd (North Albany Intchg)	1958	Concrete continuous	5,604	6/6/6	GD	ND		PV	1
2	04	001	234.1596	08221B	Hwy 1 NB over Hwy 58 NB (North Albany Intchg)	1958	Concrete continuous	9,504	6/6/6	GD	OD	VC	PV	1
2	04	001	234.2296	08221C	Hwy 1 SB over Knox Butte Rd (North Albany Intchg)	1958	Concrete continuous	6,231	5/6/6	PR	ND		PV	1
2	04	001	234.1596	08221D	Hwy 1 SB over Hwy 58 NB (North Albany Intchg)	1958	Concrete continuous	8,697	6/6/6	GD	OD	VC	PV	1
2	04	058	0.459999	08221E	Hwy58 NB to Hwy1 over Knox Butte Rd (N Albany Int)	1958	Concrete continuous	5,308	6/6/6	GD	ND		V	
2	04	009	114.8798	00922A	Devils Lake Outlet, Hwy 9 (D River)	1949	Concrete continuous	7,300	5/5/5	PR	OD	LSL	V	2
2	04	009	91.78982	02508A	Little Nestucca River, Hwy 9	1980	Prestressed concrete	26,413	6/7/7	GD	OD	Rail	V	2
2	04	009	104.6998	09463	Salmon River, Hwy 9	1960	Concrete continuous	5,950	6/6/6	GD	ND		V	2
2	04	009	98.93981	13490	Neskowin Creek, Hwy 9	1960	Concrete continuous	4,550	6/6/6	GD	OD	Rail LSL	V	2
2	04	C0000	239.6695	08130	Dever-Conner Road over Hwy 1	1958	Concrete continuous	9,372	6/6/6	GD	ND		V	
2	04	C0000	237.6695	08132	Viewcrest Rd over Hwy 1	1958	Concrete continuous	7,582	5/6/6	PR	OD	VC	V	
2	04	001	238.2195	18347	Hwy 1 NB over UPRR & Hwy 164	2001	Prestressed concrete	24,715	6/7/7	GD	ND		NV	
2	04	001	239.3495	18348	Santiam Oflow No 7, Hwy 1 NB at MP 239.35	2001	Concrete continuous	8,659	6/6/7	GD	ND		NV	
2	04	001	239.3496	19226	Santiam Oflow No 7, Hwy 1 SB at MP 239.35	2003	Concrete continuous Prestressed concrete	8,738	6/6/7	GD	ND		NV	
2	04	001	238.2195	19227	Hwy 1 SB over UPRR & Hwy 164	2005	continuous	31,920	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 4

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	04	001	240.4195	08124	Santiam Oflow No 4, Hwy 1 SB at MP 240.42	1958	Concrete continuous	11,407	5/3/6	PR	SD	SD LSL LC	V	1
2	04	001	240.4195	17342	Santiam Oflow No 4, Hwy 1 NB at MP 240.42	1994	Concrete continuous	10,654	5/6/7	PR	ND		NV	
2	04	001	239.8495	18350	Santiam Oflow No 6, Hwy 1 NB at MP 239.85	2001	Concrete continuous	15,060	6/6/7	GD	ND		NV	
2	04	001	240.0295	18351	Santiam Oflow No 10, Hwy 1 NB at MP 240.03	2001	Concrete continuous	4,765	6/6/7	GD	ND		NV	
2	04	001	240.1995	18352	Santiam Oflow No 5, Hwy 1 NB at MP 240.20	2001	Concrete continuous	5,196	6/6/7	GD	ND		NV	
2	04	001	240.1995	19220	Santiam Oflow No 5, Hwy 1 SB at MP 240.20	2003	Concrete continuous	5,097	6/6/7	GD	ND		NV	
2	04	001	240.0295	19222	Santiam Oflow No 10, Hwy 1 SB at MP 240.03	2003	Concrete continuous	5,097	6/6/7	GD	ND		NV	
2	04	001	239.8495	19224	Santiam Oflow No 6, Hwy 1 SB at MP 239.85	2003	Concrete continuous	16,961	7/7/7	VG	ND		NV	
2	04	001	241.3495	08121	Santiam Oflow No 2, Hwy 1 SB at MP 241.35	1958	Concrete continuous	17,480	5/4/6	PR	SD	SD	V	1
2	04	001	241.1195	08122	Santiam Oflow No 3, Hwy 1 SB at MP 241.12	1958	Concrete continuous	9,144	6/6/7	GD	ND		V	1
2	04	001	240.6595	08123D	Santiam River, Hwy 1 SB	1991	Prestressed concrete continuous	53,896	7/7/7	VG	ND		PV	1
2	04	001UV	241.1195	17191	Santiam Oflow No 3, Hwy 1 Conn Left	1992	Concrete continuous Prestressed concrete	7,094	6/6/7	GD	ND		NV	
2	04	001	240.6895	17318	Santiam River, Hwy 1 NB	1995	continuous	53,896	6/7/7	GD	ND		NV	
2	04	001	241.3495	17351	Santiam Oflow No 2, Hwy 1 NB at MP 241.35	1994	Concrete continuous	14,672	5/6/6	PR	ND		PV	1
2	04	001	241.1195	17352	Santiam Oflow No 3, Hwy 1 NB at MP 241.12	1994	Concrete continuous	9,354	6/6/7	GD	ND		PV	1
2	04	001	241.6995	18353	Santiam Oflow No 1, Hwy 1 NB at MP 241.70	2001	Concrete continuous	5,220	6/6/7	GD	ND		NV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 5

APRIL 2017

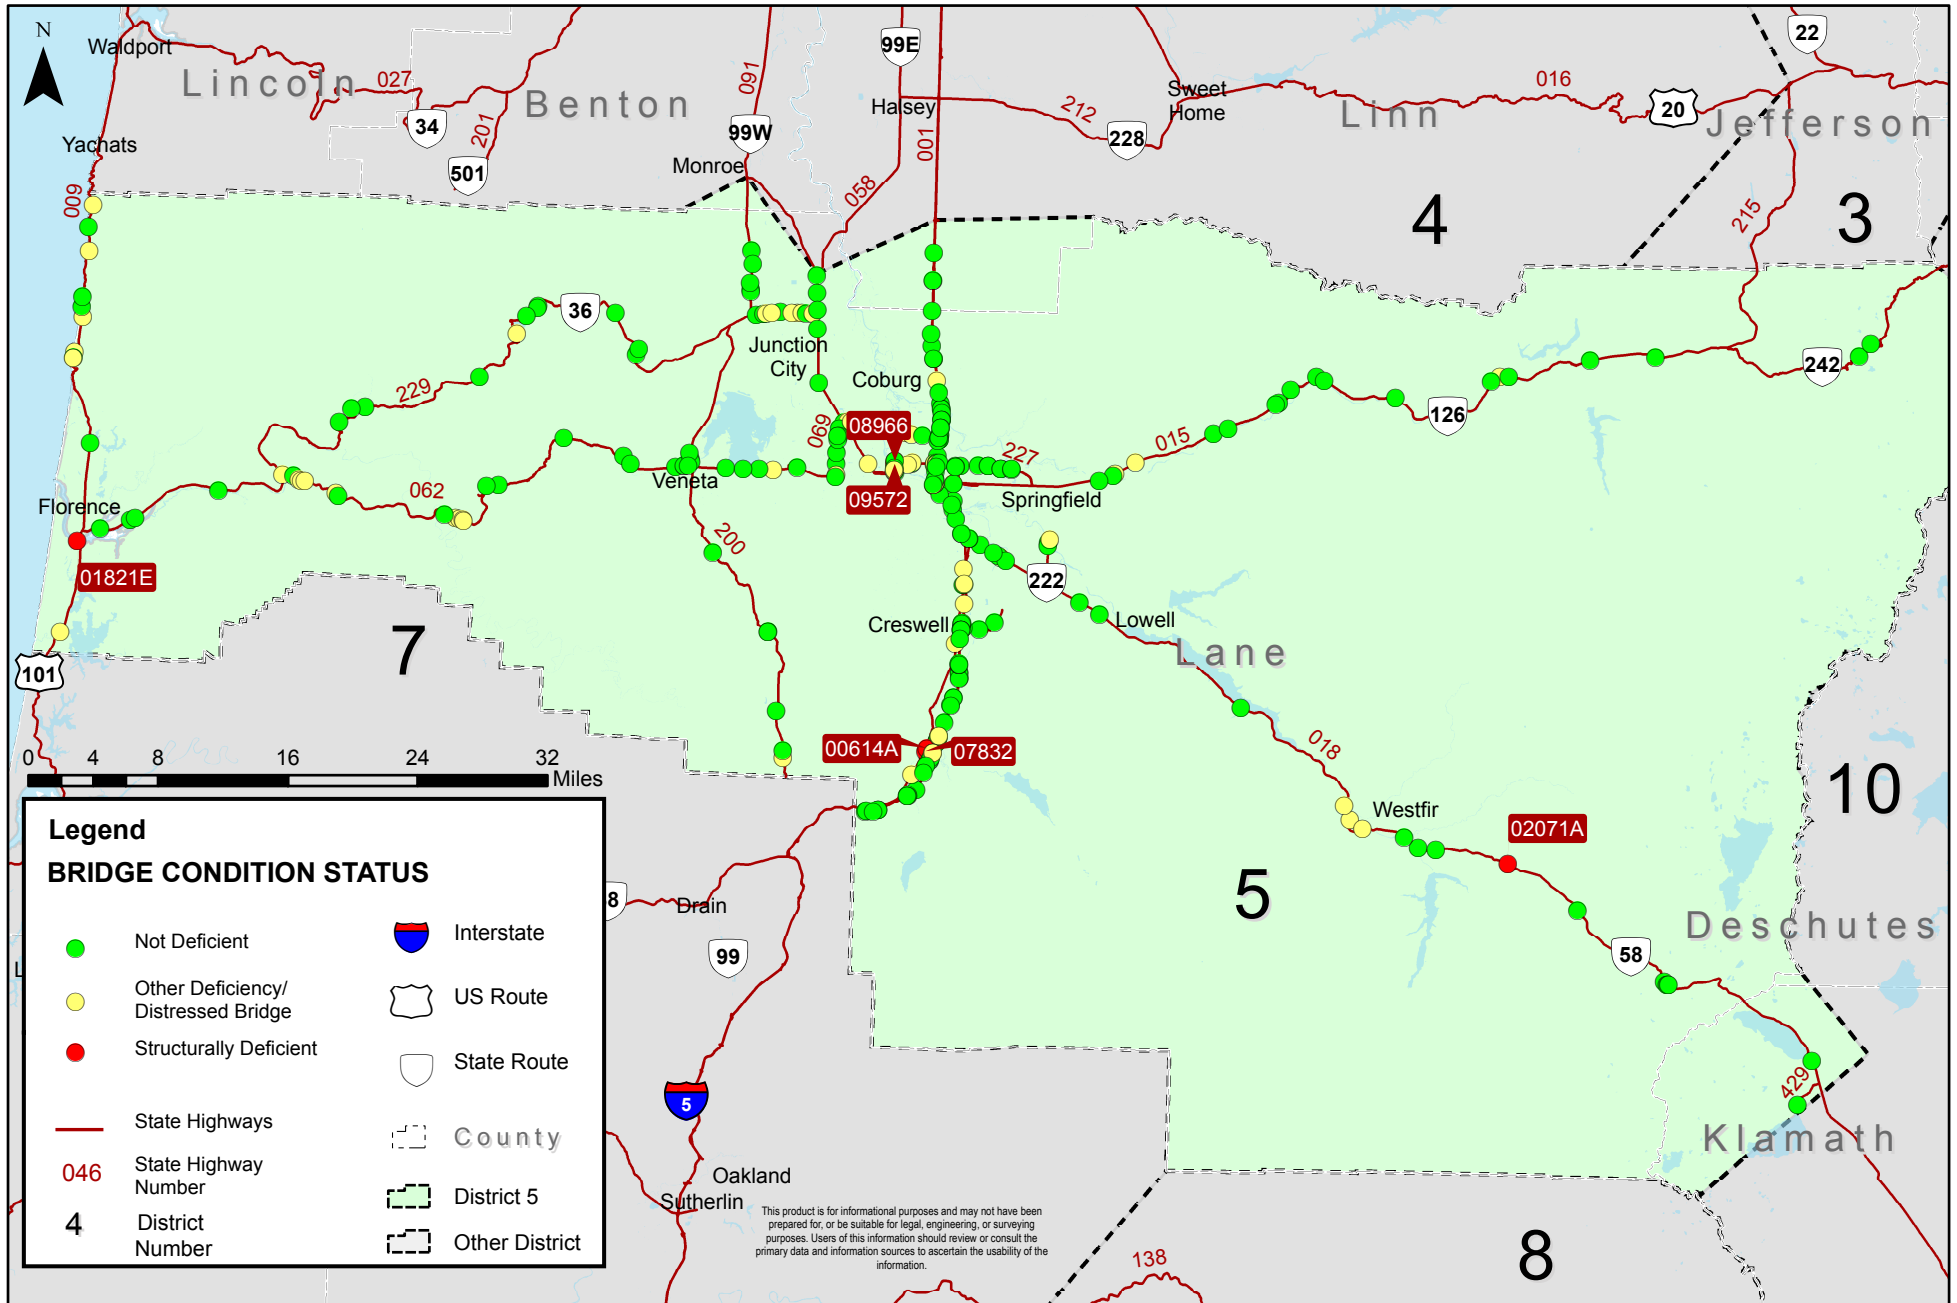

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	C0000	207.05	08250	Priceboro Road over Hwy 1	1959	Prestressed concrete	6,891	7/7/6	GD	ND		PV	
2	05	001LX	199.15	08172	Van Duyn Rd over Hwy 1 (Coburg)	1960	Prestressed concrete	8,325	7/6/6	GD	OD	VC	PV	
2	05	C0000	198.39	08173B	Reed Service Rd over Hwy 1	1960	Prestressed concrete	5,934	6/6/6	GD	ND		PV	
2	05	001	197.07	08176A	McKenzie Oflow, Hwy 1 at MP 197.07	1987	Steel continuous	-	7	VG	ND		NV	
2	05	001LV	197.64	09174	Egge Rd over Hwy 1	1963	Prestressed concrete	5,786	6/6/6	GD	ND		PV	
2	05	001LS	195.9	21657	Hwy 001 SB Conn to Hwy 069 over Multi-Use	2014	Prestressed concrete	1,460	7/8/8	VG	ND		NV	
2	05	C0000	196.74	08177	Sprague Road over Hwy 1	1958	Concrete continuous	6,891	7/6/6	GD	ND		V	
2	05	001	196.69	08178N	McKenzie Oflow, Hwy 1 NB at MP 196.69	1960	Concrete continuous	6,953	5/6/7	PR	ND		PV	1
2	05	001	196.69	08178S	McKenzie Oflow, Hwy 1 SB at MP 196.69	1960	Concrete continuous	6,953	5/6/6	PR	ND		PV	1
2	05	001	196.19	08180N	McKenzie Oflow, Hwy 1 NB at MP 196.19	1960	Concrete continuous	5,271	5/6/7	PR	ND		PV	1
2	05	001	196.19	08180S	McKenzie Oflow, Hwy 1 SB at MP 196.19	1960	Concrete continuous	5,271	5/6/6	PR	ND		PV	1
2	05	001	195.78	20061	Hwy 1 NB over Game Farm Road	2008	Steel	16,040	6/8/7	GD	ND		NV	
2	05	001	197.4	20597	McKenzie River & Frtg Rd, Hwy 1 NB (Spores)	2008	Prestressed concrete continuous	49,507	6/7/7	GD	ND		NV	
2	05	001	197.4	20598	McKenzie River & Frtg Rd, Hwy 1 SB (Spores)	2008	Prestressed concrete continuous	49,507	6/7/6	GD	ND		NV	
2	05	C0000	194.44	08184	Harlow Road over Hwy 1	1960	Concrete continuous	11,848	7/6/6	GD	ND		PV	
2	05	227	3.47999	08689D	Hwy 227 WB over Hwy 1 & Conn #2 & Conn #4	1961	Prestressed concrete	15,323	6/7/7	GD	ND		PV	
2	05	001WR	195.46	20060	Hwy 001 NB Conn to Hwy 69 WB over Hwy 001 & 69	2008	Prestressed concrete continuous	93,377	6/7/6	GD	ND		NV	
2	05	069	12.76	21576	Hwy 69 over Hwy 1	2014	Prestressed concrete continuous	31,029	7/8/7	VG	ND		NV	
2	05	069	12.7	21655	Hwy 69AW to HWY 001 SB at MP 12.70 Over Multi-Use	2014	continuous	1,300	8/8/8	VG	ND		NV	
2	05	C0000	193.49	08186	Centennial Blvd over Hwy 1	1961	Prestressed concrete	15,023	6/7/6	GD	ND		PV	
2	05	001LG	191.98	08443	Hwy1 Conn (Glenwd Bd) over Hwy1 & Conn (Judkins Pt)	1962	Prestressed concrete	10,582	7/8/8	VG	ND		PV	
2	05	227	3.47999	08689E	Hwy 227 EB over Hwy 1 & Conn #2 & Conn #4	1961	Prestressed concrete	14,576	6/7/7	GD	OD	VC	PV	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	001	193.77	08689H	Q St Canal (Floodway Ditch), Hwy 1	1961	Concrete continuous	-	6	GD	ND		NV	
2	05	001	190.76	08870	Hwy 1 over Hwy 225 Conn (McVay Access)	1962	Concrete	-	7/6/6	GD	ND		PV	1
2	05	225	1.54	08445	Hwy 225 over Hwy 1	1961	Steel	13,223	6/6/7	GD	ND		PV	
2	05	225	2.25	08697	Hwy 225 (30th Ave) over Hwy 1	1960	Prestressed concrete	8,081	7/7/8	VG	ND		PV	
2	05	001	188.91	20179	Hwy 1 NB over Franklin Blvd & CORP at MP 188.9	2009	Prestressed concrete continuous	21,423	6/8/7	GD	ND		NV	
3	05	001	192.75	21038	Willamette River & Hwy 15 & UPRR, Hwy 1 & Hwy 1W	2012	Concrete continuous	133,885	6/8/8	GD	ND		NV	
2	05	001	192.75	21039	Willamette R. SB & Hwy 15 & UPRR, Hwys 1 &	2011	Concrete continuous	118,662	6/8/8	GD	OD	VC	NV	
2	05	001	192.99	21077	Patterson Slough, Hwy 001 NB at 192.99	2010	Prestressed concrete	12,101	8/8/8	VG	ND		NV	
2	05	069	3.02999	02052A	Willow Creek, Hwy 69	1973	Prestressed concrete	3,822	6/7/7	GD	ND		NV	
2	05	069	3.20999	16376	Amazon Creek, Hwy 69	1967	Prestressed concrete	3,612	7/7/7	VG	OD	Rail	NV	
2	05	069BE	5.62999	17960	A2 Channel, Hwy 69 EB at MP 5.63	1997	Steel	-	7	VG	ND		NV	
2	05	069	5.40999	17961	A2 Channel, Hwy 69 EB at MP 5.41	1997	Steel	-	7	VG	ND		NV	
2	05	C0000	5.61999	17962	A2 Channel, Barger Drive	1997	Steel	-	7	VG	ND		NV	
2	05	069	0.6	21307	HWY 069 OVER CBRL at MP 0.60	2010	Concrete	9,473	7/7/7	VG	ND		NV	
2	05	069	3.91999	09460	SCS Canal & UPRR, Hwy 69	1967	Prestressed concrete	11,141	6/7/7	GD	ND		V	3
2	05	069	6.57999	09941	Hwy 69 over Hwy 1W & BNSF	1971	Prestressed concrete	28,371	7/6/6	GD	ND		PV	
2	05	069	6.82999	09942	Hwy 69 over Prairie Road	1971	Prestressed concrete	11,765	6/6/6	GD	OD	Rail	NV	
2	05	069	5.71999	17474	Hwy 69 over Barger Drive	1997	Prestressed concrete	12,418	6/6/6	GD	ND		NV	
2	05	069	4.60999	17945	Hwy 69 over Royal Avenue	2001	Prestressed concrete	10,925	7/7/7	VG	ND		NV	
2	05	069	9.91998	08704	Willamette River Oflow, Hwy 69 WB	1961	Prestressed concrete	4,032	7/7/6	GD	OD	DG	PV	
2	05	069	9.91998	08704A	Willamette River Oflow, Hwy 69 EB	1966	Concrete continuous	7,681	7/6/7	GD	ND		PV	
2	05	069	10.15	08705	Debrick Slough, Hwy 69 WB at MP 10.15	1961	Prestressed concrete	4,432	7/7/6	GD	OD	DG	PV	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	069	10.15	08705A	Debrick Slough, Hwy 69 EB at MP 10.15	1965	Prestressed concrete	3,714	7/7/7	VG	ND		PV	
2	05	069AQ	10.15	08705B	Debrick Slough, Hwy 69 WB Conn at MP C10.15	1964	Prestressed concrete	1,560	7/6/7	GD	ND		PV	
2	05	069AM	10.15	08705C	Debrick Slough, Hwy 69 EB Conn at MP C10.15	1964	Prestressed concrete	1,728	7/6/7	GD	ND		PV	
2	05	069	7.45999	16378	Crow Creek, Hwy 69	1964	Prestressed concrete	5,520	7/7/6	GD	ND		PV	
2	05	069	6.08999	17473	A2 Channel, Hwy 69 at MP 6.09	1997	Prestressed concrete	9,520	7/7/7	VG	ND		NV	
2	05	069	9.91998	39C149	Debrick Slough, Hwy 69 WB Conn	1979	continuous	8,753	7/7/7	VG	ND		NV	
2	05	015	0.09	E6099C	Hwy 15 EB (Franklin Blvd) over Hwy 1W NB & UPRR	1961	Steel continuous	23,528	6/6/6	GD	OD	DG	PV	
2	05	015	0.09	W6099C	Hwy 15 WB (Franklin Blvd) over Hwy 1W & UPRR	1961	Steel continuous	25,024	6/6/6	GD	ND		PV	
2	05	069	9.58998	08638	Willamette River & River Ave, Hwy 69 WB	1961	Steel continuous	24,180	6/6/7	GD	OD	VC	PV	
2	05	069	9.58998	08638A	Willamette River & River Ave, Hwy 69 EB	1967	Steel continuous	23,560	6/7/6	GD	OD	VC	PV	
2	05	069	7.05999	08864A	Hwy 69 over UPRR & Northwest Expressway	1963	Steel continuous	56,068	6/6/6	GD	OD	Rail	PV	
2	05	C0000	10.64	09324	Norkenzie Road over Hwy 69	1964	Prestressed concrete	8,652	6/7/7	GD	OD	VC	PV	
2	05	C0000	10.98	09327	Gilham Road over Hwy 69	1964	Prestressed concrete	7,896	6/6/7	GD	OD	VC	PV	
2	05	069AN	10.05	09358	Delta Hwy over Hwy 69	1965	Prestressed concrete	11,212	6/7/6	GD	OD	VC	PV	
2	05	069	8.45998	09744	Hwy 69 over River Road	1970	Prestressed concrete	20,363	6/7/6	GD	ND		PV	
2	05	018	2.46	05286	Coast Fork Willamette River, Hwy 18	1950	Steel	15,111	6/6/5	PR	OD	LSL	V	
2	05	091	109.97	02229C	Creek, Hwy 1W at MP 109.97	1981	Prestressed concrete	4,960	7/7/7	VG	ND		NV	
2	05	091	111.05	02229D	Creek, Hwy 1W at MP 111.05	1981	Prestressed concrete	5,200	7/7/7	VG	ND		NV	
2	05	091	108.9	03945	Flat Creek, Hwy 1W at MP 108.90	1947	Concrete continuous	10,959	6/6/6	GD	ND		PV	3
2	05	225	1.01	00373	Hwy 225 over CORP (McVay)	1921	Concrete continuous	11,972	5/6/6	PR	ND		V	
2	05	226	15.75	00613C	Coast Fork Willamette River, Hwy 226 at MP 15.75	1949	Concrete continuous	13,424	6/6/5	PR	OD	Rail	V	
2	05	062	14.49	02049A	Siuslaw River & Riverview Ave, Hwy 62 (Mapleton)	1970	Prestressed concrete continuous	34,568	6/6/5	PR	OD	Rail VC	V	3

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	062	27.3799	08553	Wildcat Creek, Hwy 62 at MP 27.38	1961	Concrete continuous	5,858	6/6/6	GD	OD	DG	PV	3
2	05	062	27.6599	08554	Wildcat Creek, Hwy 62 at MP 27.66	1961	Concrete continuous	5,612	6/6/6	GD	OD	DG	PV	3
2	05	062	27.8899	08555	Wildcat Creek, Hwy 62 at MP 27.89	1961	Concrete continuous	7,369	5/6/6	PR	OD	LSL DG	PV	3
2	05	226	19.56	00163B	Hwy 226 over CORP	1981	Prestressed concrete	10,665	6/7/6	GD	ND		NV	
2	05	226	13.79	00614A	Coast Fork Willamette River, Hwy 226 at MP 13.79	1949	Concrete continuous	7,144	5/4/5	PR	SD	SD Rail LSL	V	
2	05	226	3.13999	01471	Camas Swale, Hwy 226	1930	Concrete continuous	3,640	7/5/5	PR	ND		V	
2	05	229	48.3599	01755E	Creek, Hwy 229 at MP 48.36	1932	Wood or Timber	1,273	6/7/5	PR	OD	TS	V	
2	05	229	48.7799	01755G	Creek, Hwy 229 at MP 48.78	1932	Wood or Timber	3,183	6/7/6	GD	OD	LSL TS	V	
2	05	226	6.80999	02486	Hill Creek, Hwy 226	1938	Wood or Timber	2,650	6/7/6	GD	OD	TS	V	
2	05	226	19.65	16272	Hwy 226 over Hwy 1	1981	Prestressed concrete continuous	11,408	6/6/6	GD	ND		NV	
2	05	062	37.4399	04079A	Poterf Creek (Elk Creek), Hwy 62	1984	Steel continuous	-	7	VG	ND		PV	3
2	05	062	18.24	08369	Knowles Creek, Hwy 62 at MP 18.24	1958	Concrete continuous	7,061	6/5/6	PR	OD	Rail DG	V	3
2	05	062	27.9799	08556	Hwy 62 over CBRL	1961	Concrete continuous	7,770	6/6/6	GD	OD	DG	PV	3
2	05	062	32.3999	08939	Chickahominy Creek, Hwy 62	1962	Concrete continuous	4,180	5/6/5	PR	ND		PV	3
2	05	062	31.5599	08940	Walker Creek, Hwy 62	1962	Prestressed concrete	1,881	7/7/6	GD	ND		V	3
2	05	062	15.61	14378A	Knowles Creek, Hwy 62 at MP 15.61	1958	Concrete continuous	4,440	7/6/6	GD	OD	Rail DG	V	3
2	05	062	15.79	14379A	Knowles Creek, Hwy 62 at MP 15.79	1958	Concrete continuous	4,958	6/6/6	GD	OD	Rail DG	V	3
2	05	062	16.02	14380A	Knowles Creek, Hwy 62 at MP 16.02	1958	Concrete continuous	7,462	6/6/6	GD	OD	Rail DG	V	3
2	05	062	26.4799	21234	Siuslaw River, Hwy 62	2010	Prestressed concrete	9,586	6/7/6	GD	ND		NV	
2	05	062	18.47	21235	Knowles Creek, Hwy 62 at MP 18.47	2010	Prestressed concrete	7,722	7/8/8	VG	ND		NV	
2	05	229	50.1599	01755K	Creek, Hwy 229 at MP 50.16	1932	Wood or Timber	1,273	7/7/5	PR	OD	TS	V	
2	05	229	50.3599	01755L	Creek, Hwy 229 at MP 50.36	1932	Wood or Timber	1,273	7/7/6	GD	OD	TS	V	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	229	50.6199	01755M	Creek, Hwy 229 at MP 50.62	1932	Wood or Timber	701	6/7/6	GD	OD	TS	NV	
2	05	229	50.8999	01755O	Creek, Hwy 229 at MP 50.90	1985	Steel continuous	-	6	GD	ND		NV	
2	05	229	51.2899	01755Q	Creek, Hwy 229 at MP 51.29	1932	Wood or Timber	1,273	6/7/6	GD	OD	TS	V	
2	05	229	47.8099	17441	Long Tom River, Hwy 229 (Cheshire)	1995	Prestressed concrete	4,944	7/7/7	VG	ND		NV	
2	05	229	49.2999	17939	Amazon Creek, Hwy 229	1995	Prestressed concrete	4,128	7/7/7	VG	ND		NV	
2	05	229	48.2599	20379	Lingo Slough, Hwy 229	2007	Prestressed concrete	7,488	7/7/7	VG	ND		NV	
2	05	062	40.9899	04076B	Poodle Creek, Hwy 62	1994	Prestressed concrete	6,107	6/7/6	GD	ND		NV	
2	05	062	46.4699	0M594	Culvert, Hwy 62 at MP 46.47	1988	Concrete continuous	-	7	VG	ND		NV	
2	05	062	42.1799	15443	Long Tom River, Hwy 62 at MP 42.18	1994	Prestressed concrete	20,304	6/7/6	GD	ND		PV	3
2	05	062	44.5599	16199	Long Tom River Overflow, Hwy 62 at MP 44.56	1988	Prestressed concrete	8,712	7/7/6	GD	ND		NV	
2	05	062	45.8999	16200	Long Tom River, Hwy 62 at MP 45.90	1988	Prestressed concrete	3,080	7/7/7	VG	ND		NV	
2	05	062	45.4499	16649	Long Tom River Overflow, Hwy 62 at MP 45.45	1988	Prestressed concrete	2,728	7/7/7	VG	ND		NV	
2	05	018	30.7599	03994A	Deception Creek, Hwy 18	1953	Concrete continuous	3,293	7/7/6	GD	OD	LSL DG	PV	
2	05	018	1.96	05285A	Coast Fork Willamette River Relief Opening, Hwy 18	1955	Concrete	5,016	6/6/6	GD	ND		V	
2	05	018	0.89	09653	Coast Fork Willamette River Oflow, Hwy 18	1967	Prestressed concrete	2,400	8/7/6	GD	ND		PV	
2	05	018	8.07998	20120	Hwy 18 over UPRR (Pleasant Hill)	2008	Steel continuous	21,875	6/8/6	GD	ND		NV	
2	05	018	9.50998	20360	Lost Creek, Hwy 18	2008	Prestressed concrete continuous	10,797	7/7/7	VG	ND		NV	
2	05	018	2.70999	20395	Willamette River Relief Opening, Hwy 18	2008	Prestressed concrete	5,244	6/7/7	GD	ND		NV	
2	05	018	2.29	18386	Coast Fork Willamette River Relief Oflow, Hwy 18	2000	Concrete continuous	-	7	VG	ND		NV	
2	05	009	168.44	01182	Cummins Creek, Hwy 9	1931	Concrete	6,721	6/6/6	GD	OD	LSL	V	4
2	05	009	178.75	01741B	Slide Viaduct, Hwy 9 at MP 178.75	1962	Prestressed concrete	5,005	7/6/6	GD	ND		V	4
2	05	009	178.82	01741C	Slide Viaduct, Hwy 9 at MP 178.82	1962	Prestressed concrete	5,751	6/6/6	GD	OD	LSL	V	4

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	009	169.94	19086	Bob Creek, Hwy 9	2004	Prestressed concrete	4,381	7/7/7	VG	ND		NV	
2	05	009	174.4	20004	Rock Creek, Hwy 9	2008	Prestressed concrete	7,246	7/7/7	VG	ND		NV	
2	05	009	196.93	00982	Siltcoos River, Hwy 9	1930	Concrete continuous	6,249	6/6/5	PR	OD	LSL DG	V	2
2	05	009	178.35	01113	Cape Creek, Hwy 9	1931	Concrete	23,578	6/6/6	GD	OD	Rail LSL	V	5
2	05	009	175.68	01114	China Creek, Hwy 9 at MP 175.68	1931	Concrete continuous	2,398	7/6/6	GD	OD	DG	V	4
2	05	009	175.02	01180	Big Creek, Hwy 9 at MP 175.02	1931	Concrete	9,454	6/6/6	GD	ND		V	4
2	05	009	184.78	01494A	Sutton Creek, Hwy 9	1930	Concrete continuous	6,234	6/6/6	GD	ND		V	4
2	05	009	190.98	01821E	Siuslaw River, Hwy 9 (Florence)	1936	Steel	59,917	5/5/5	PR	SD	SD LSL LC	V	5
2	05	009	171.44	01181	Tenmile Creek, Hwy 9	1931	Concrete	8,055	6/6/6	GD	OD	LSL	V	4
2	05	091	121.42	02138	Hwy 1W over CBRL Coos Bay Branch	1937	Concrete continuous	13,226	5/6/6	PR	OD	LSL	PV	3
2	05	091	112.22	02399A	Creek, Hwy 1W at MP 112.22	1981	Steel continuous	-	7	VG	ND		NV	
2	05	091	115.56	02408A	Creek, Hwy 1W at MP 115.56	1981	Prestressed concrete	5,200	7/6/7	GD	ND		NV	
2	05	091	125.99	06837	Hwy 1W over Riverview Street	1951	Concrete continuous	4,583	7/6/6	GD	ND		PV	3
2	05	015	66.6999	21084	Creek, Hwy 15 at MP 66.70	2008	Prestressed concrete	1,570	8/8/8	VG	ND		NV	
2	05	015	68.3599	21085	Creek, Hwy 15 at MP 68.36	2008	Prestressed concrete	783	8/8/8	VG	ND		NV	
2	05	062	49.9299	02522A	Middle Fork Coyote Creek, Hwy 62	1984	Prestressed concrete	5,016	7/7/6	GD	ND		V	3
2	05	062	51.7699	02765	Creek, Hwy 62 at MP 51.77	1941	Wood or Timber	760	6/7/6	GD	OD	DG	NV	
2	05	200	32.1799	04057A	North Fork Coyote Creek, Hwy 200	1980	Prestressed concrete	1,952	7/7/8	VG	ND		NV	
2	05	200	32.2399	04058A	South Fork Coyote Creek, Hwy 200	1980	Prestressed concrete	1,312	7/7/7	VG	ND		NV	
2	05	200	37.9299	04059	North Fork Siuslaw River (Hawley Creek), Hwy 200	1957	Concrete	1,748	7/6/5	PR	ND		V	
2	05	200	40.8499	04063	Small Stream, Hwy 200 at MP 40.85	1960	Concrete	659	7/6/6	GD	OD	TS	NV	
2	05	200	25.49	07271	Coyote Creek, Hwy 200	1955	Concrete continuous	5,612	6/6/6	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	062	48.8899	17410	West Fork Coyote Creek, Hwy 62	1996	Prestressed concrete	3,360	7/7/7	VG	ND		NV	
2	05	200	40.4299	21434	South Fork Siuslaw River, Hwy 200	2012	Prestressed concrete	3,352	7/8/7	VG	ND		NV	
2	05	200	18.98	01699A	Long Tom Oflow, Hwy 200 at MP 18.98	1966	Prestressed concrete	2,240	6/6/6	GD	ND		PV	
2	05	200	19.28	01700A	Long Tom Oflow, Hwy 200 at MP 19.28	1967	Prestressed concrete	13,950	6/6/6	GD	ND		PV	
2	05	200	4.58999	04037	Ferguson Creek, Hwy 200	1963	Prestressed concrete	1,472	7/7/6	GD	ND		PV	
2	05	200	5.42999	04040	Small Stream, Hwy 200 at MP 5.43	1959	Concrete	693	6/6/6	GD	ND		NV	
2	05	200	7.05999	04042	Small Stream, Hwy 200 at MP 7.06	1967	Prestressed concrete	3,066	6/6/6	GD	ND		PV	
2	05	200	7.13999	04043	Cattlepass, Hwy 200 at MP 7.14	1967	Prestressed concrete	986	7/7/6	GD	ND		NV	
2	05	200	18.72	04050A	Long Tom River, Hwy 200	1966	Concrete continuous	5,800	7/7/6	GD	ND		PV	
2	05	200	6.59999	21406	Bear Creek, Hwy 200	2011	Prestressed concrete	7,734	7/8/7	VG	ND		NV	
2	05	062	50.9099	02520A	Coyote Creek, Hwy 62	1984	Prestressed concrete	4,664	7/7/7	VG	ND		V	3
2	05	222	5.40999	07880	Willamette River Oflow, Hwy 222 at MP 5.41	1953	Concrete	4,625	6/6/6	GD	ND		V	
2	05	222	5.63999	07890	Willamette River Oflow, Hwy 222 at MP 5.64	1953	Concrete	2,312	6/6/6	GD	ND		V	
2	05	222	12.19	08386	Bear Creek, Hwy 222	1958	Concrete continuous	2,097	6/6/6	GD	ND		V	
2	05	222	13.36	08388	Coast Fork Willamette River, Hwy 222	1967	Concrete continuous	23,180	6/5/6	PR	ND		PV	
2	05	222	14.44	20103	Hill Creek, Hwy 222	2006	Prestressed concrete	5,360	6/8/7	GD	ND		NV	
2	05	222	14.59	20104	Hwy 222 over Hwy 1 (Creswell)	2007	Prestressed concrete continuous	14,557	6/7/6	GD	ND		NV	
2	05	229	29.5099	01098A	Lake Creek Oflow, Hwy 229	1960	Concrete	2,403	6/6/6	GD	ND		V	
2	05	229	29.3799	01099A	Lake Creek, Hwy 229	1960	Concrete	4,005	6/6/6	GD	ND		V	
2	05	229	10.55	01403	Indian Creek, Hwy 229	1929	Concrete continuous	4,432	6/5/6	PR	ND		V	
2	05	229	12.24	04019A	Green Creek, Hwy 229	1985	Prestressed concrete	1,440	7/7/7	VG	ND		NV	
2	05	229	21.38	04025A	Greenleaf Creek, Hwy 229	1951	Concrete continuous	4,326	6/6/5	PR	ND		V	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	229	26.0899	04029	Little Lake Creek, Hwy 229	1959	Concrete	695	6/6/5	PR	OD	TS	NV	
2	05	229	28.1899	04031A	Swamp Creek, Hwy 229	1960	Concrete	766	6/6/6	GD	ND		NV	
2	05	229	38.3899	00728A	Long Tom River, Hwy 229 at MP 38.39	1949	Concrete continuous	1,963	6/6/6	GD	ND		V	
2	05	229	37.8599	00729A	Long Tom River, Hwy 229 at MP 37.86	1949	Concrete continuous	3,689	6/6/6	GD	ND		V	
2	05	018	20.71	03988A	Goodman Creek, Hwy 18	1950	Concrete	-	6	GD	ND		NV	
2	05	229	13.09	01331	Deadwood Creek, Hwy 229	1928	Steel	4,765	6/6/6	GD	ND		V	
2	05	227	4.68999	08844	Hwy 227 over Hwy 228 (Pioneer Pkwy E & W) Conns	1964	Prestressed concrete	20,169	7/7/6	GD	ND		PV	
2	05	228	0.37	09193A	Floodway Ditch, Hwy 228 NB at MP 0.37N	1964	Concrete continuous	5,627	7/6/6	GD	ND		PV	
2	05	228	0.37	09193B	Floodway Ditch, Hwy 228 SB at MP 0.37S	1964	Concrete continuous	4,505	7/6/6	GD	ND		PV	
2	05	062RW	15.19	0M203	Knowles Cr, Hwy 62 Frtg Rd Lt at MP F15.19 (Camps)	1962	Steel	1,111	8/6/7	GD	ND		NV	
2	05	222	5.19999	04117A	Willamette River, Hwy 222 (Jasper)	1952	Steel	22,410	6/5/6	PR	OD	LSL	V	
2	05	018	38.2499	01519A	Salt Creek, Hwy 18 at MP 38.25	1965	Steel	8,786	7/6/7	GD	ND		V	
2	05	018	42.9299	02071A	Salt Creek, Hwy 18 at MP 42.93	1965	Steel	13,981	4/6/7	PR	SD	SD	V	
2	05	018	55.9799	21567	Half Viaduct, Hwy 18 at MP 55.98	2015	Prestressed concrete	6,671	8/8/8	VG	ND		NV	
2	05	018	56.2299	21568	Half Viaduct, Hwy 18 at MP 56.23	2015	Prestressed concrete	3,901	8/8/8	VG	ND		NV	
2	05	018	56.2899	21569	Half Viaduct, Hwy 18 at MP 56.29	2015	Prestressed concrete	1,538	8/8/8	VG	ND		NV	
2	05	018	56.3199	21570	Half Viaduct, Hwy 18 at MP 56.32	2015	Prestressed concrete	1,920	8/8/8	VG	ND		NV	
2	05	015	11.43	01109B	McKenzie River, Hwy 15	1964	Prestressed concrete	35,793	6/7/5	PR	ND		PV	
2	05	015	1.33	01223	Willamette River, Hwy 15 WB	1929	Steel continuous	46,647	5/5/6	PR	OD	VC LC	V	
2	05	015	13.06	01516	Eugene Water Bd Cnl, Hwy15 @ MP13.06 (Walterville)	1930	Concrete continuous	5,025	6/6/6	GD	OD	LSL DG	V	
2	05	015	18.32	01536	Holden Creek, Hwy 15	1929	Concrete continuous	-	6	GD	ND		NV	
2	05	015	10.44	03964A	Gray Creek (Cedar Flat Creek), Hwy 15	1990	Prestressed concrete	1,980	7/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	015	11.59	03965	Oflow Ditch, Hwy 15 R/W Right at MP 11.59	1964	Concrete	1,260	7/6/6	GD	OD	DG	PV	
2	05	015	19.23	03966	Hwy 15 over Leaburg Dam Overflow Spillway	1930	Concrete continuous	-	6	GD	ND		NV	
2	05	015	1.34	08051	Willamette River, Hwy 15 EB	1957	Steel continuous	29,491	6/6/6	GD	ND		V	
2	05	015	40.6999	01323A	Blue River Bridge, Hwy 15	1972	Concrete continuous	12,722	6/6/7	GD	ND		NV	
2	05	015	26.5199	01324A	Gate Creek, Hwy 15 (Vida)	1930	Concrete continuous	10,429	6/6/6	GD	ND		V	
2	05	015	50.4599	01399A	McKenzie River, Hwy 15	1968	Prestressed concrete	12,439	7/7/6	GD	ND		NV	
2	05	018	31.7599	01626	Willamette River, Hwy 18 Frtg Rd (Barnard)	1932	Steel	11,689	6/6/5	PR	OD	LSL	V	
2	05	015	39.5199	03970B	Elk Creek, Hwy 15	1957	Concrete continuous	4,750	6/6/6	GD	ND		PV	
2	05	018	33.2399	07894	Willamette River, Hwy 18 (Barnard)	1955	Steel continuous	21,170	6/6/6	GD	OD	PAINT	PV	
2	05	015	40.1799	13570	McKenzie River, Hwy 15 (Fish Hole)	1972	Prestressed concrete	4,532	6/7/7	GD	OD	LSL	NV	
2	05	015	25.97	18240	Indian Creek, Hwy 15	2000	Prestressed concrete	2,455	7/7/7	VG	ND		NV	
2	05	015	22.79	18333	Montgomery Creek, Hwy 15	1998	Prestressed concrete	2,334	7/7/7	VG	ND		NV	
2	05	015	22.59	18518	Eugene Water Board Cnl, Hwy 15 at MP 22.59 (Ward)	1997	Prestressed concrete	3,572	6/7/8	GD	ND		NV	
2	05	015	23.92	18534	Eugene Water Board Cnl (Leaburg Dam) Part Viaduct	1999	Prestressed concrete	4,416	7/7/7	VG	ND		NV	
2	05	015	31.2999	19019	Bear Creek, Hwy 15	2006	Prestressed concrete	2,068	7/8/8	VG	ND		NV	
2	05	001	169.58	07861A	Martin Creek, Hwy 1 NB	1963	Concrete continuous	3,387	7/6/7	GD	ND		PV	2
2	05	C0000	169.25	07862A	Hawley Rd over Hwy 1	1956	Concrete continuous	6,575	5/5/5	PR	ND		V	
2	05	001	173.84	07864A	Hwy 1 over 16th Street (Landess Rd)	1956	Concrete continuous Prestressed concrete	9,442	5/6/6	PR	ND		V	2
2	05	C0000	172.24	20039	London Rd over Hwy 1	2008	continuous Prestressed concrete	16,430	7/7/6	GD	ND		NV	
2	05	001	171.62	20641	Coast Fork Willamette River, Hwy 1 SB	2008	continuous Prestressed concrete	9,827	6/7/7	GD	ND		NV	
2	05	001	171.62	20642	Coast Fork Willamette River, Hwy 1 NB	2008	continuous Prestressed concrete	9,827	7/7/7	VG	ND		NV	
2	05	001	171.56	20643	Hwy 1 SB over Latham Rd	2008	continuous	8,755	6/7/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	001	171.56	20644	Hwy 1 NB over Latham Rd	2008	Prestressed concrete continuous	8,755	7/7/7	VG	ND		NV	
2	05	001	169.58	20645	Martin Creek, Hwy 1 SB	2008	Prestressed concrete	3,440	7/8/8	VG	ND		NV	
2	05	001	175.84	07828A	Creek, Hwy 1 NB at MP 175.84	1961	Concrete continuous	3,333	6/6/7	GD	ND		PV	2
2	05	001	175.84	07828B	Creek, Hwy 1 SB at MP 175.84	1956	Concrete continuous	2,800	7/6/7	GD	OD	DG	PV	2
2	05	001	174.41	07830	Hwy 1 SB over OP&ERR (Abandoned)	1956	Concrete continuous	5,600	6/6/6	GD	ND		V	2
2	05	001	174.41	07830A	Hwy 1 NB over OP&ERR (Abandoned)	1962	Concrete continuous	5,187	7/6/6	GD	ND		V	2
2	05	001	174.74	07833A	Hwy 1 SB over Row River Rd (Cottage Grove)	1956	Concrete continuous	4,983	6/6/6	GD	OD	DG VC	PV	2
2	05	001	174.74	07833B	Hwy 1 NB over Row River Rd (Cottage Grove)	1962	Concrete continuous	4,183	7/6/6	GD	OD	VC	PV	2
2	05	001	175.4	19848	Row River, Hwy 1 SB	2005	Prestressed concrete continuous	15,456	6/7/6	GD	ND		NV	
2	05	001	175.6	19849	Row River Oflow, Hwy 1 SB	2005	Prestressed concrete continuous	9,534	6/7/7	GD	ND		NV	
2	05	001	175.4	19850	Row River, Hwy 1 NB	2005	Prestressed concrete continuous	15,456	6/7/6	GD	ND		NV	
2	05	001	175.6	19851	Row River Oflow, Hwy 1 NB	2005	Prestressed concrete continuous	9,534	6/6/6	GD	ND		NV	
2	05	001	174.24	20040	Hwy 1 NB over Main St (Whiteaker Ave)	2008	Prestressed concrete	4,780	6/7/7	GD	ND		NV	
2	05	001	174.24	20041	Hwy 1 SB over Main St (Whiteaker Ave)	2008	Prestressed concrete	4,668	6/8/8	GD	ND		NV	
2	05	001	180.49	07743B	Tunnel Mill Race, Hwy 1 NB	1956	Concrete continuous	2,092	6/6/6	GD	ND		PV	2
2	05	001	177.89	07793A	Brown Creek, Hwy 1 NB	1956	Concrete continuous	3,347	6/6/8	GD	ND		PV	2
2	05	001	179.99	19237	Coast Fork Willamette River, Hwy 1 SB	2003	Prestressed concrete continuous	24,953	6/7/6	GD	ND		NV	
2	05	001	179.64	20241	Coast Fork Relief Opening, Hwy 1 NB	2005	Prestressed concrete continuous	4,545	6/6/7	GD	ND		NV	
2	05	001	179.99	20242	Coast Fork Willamette River, Hwy 1 NB	2005	Prestressed concrete continuous	25,695	6/7/6	GD	ND		NV	
2	05	001	178.4	20335	Gettings Creek, Hwy 1 SB	2006	Prestressed concrete	10,755	6/7/6	GD	ND		NV	
2	05	001	179.64	20336	Coast Fork Relief Opening, Hwy 1 SB	2006	Prestressed concrete continuous	4,658	6/7/6	GD	ND		NV	
2	05	C0000		0 20370	Saginaw Road over Hwy 001 AT MP 176.76	2008	Prestressed concrete continuous	17,812	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	001	177.89	20376	Brown Creek Hwy 001 SB at MP 177.89	2009	Prestressed concrete	4,638	6/6/6	GD	ND		NV	
2	05	001	180.49	20413	Tunnel Mill Race, Hwy 1 SB	2007	Prestressed concrete	2,700	7/7/6	GD	ND		NV	
2	05	001	178.4	20421	Gettings Creek, Hwy 1 NB	2006	Prestressed concrete	12,402	6/7/8	GD	ND		NV	
2	05	C0000	186.43	07735A	Peebles Road over Hwy 1	1986	Prestressed concrete	7,491	6/6/6	GD	OD	LSL	NV	
2	05	001	185.46	07736A	Camas Swale, Hwy 1 NB	1961	Concrete continuous	5,020	6/6/6	GD	OD	Scour	V	2
2	05	001	185.46	20377	Camas Swale, Hwy 1 SB	2008	Prestressed concrete	5,954	6/8/6	GD	ND		NV	
2	05	C0000	180.55	20423	Trunnell Road over Hwy 1	2007	Prestressed concrete continuous	6,038	7/7/6	GD	ND		NV	
2	05	001	188.34	20486	Hwy 1 NB over Hwy 18 & Conn (Goshen Grade)	2008	Prestressed concrete	7,855	6/7/7	GD	ND		NV	
2	05	001	188.34	20487	Hwy 1 SB over Hwy 18 & Conn	2008	Prestressed concrete	9,317	6/8/6	GD	ND		NV	
2	05	C0000	184.24	07737A	Dale Kuni Road over Hwy 1	1956	Concrete continuous	6,907	6/6/6	GD	OD	VC	V	
2	05	001	183.04	07738A	Old Lane Creek (Hill Slough), Hwy 1 SB	1956	Concrete continuous	3,747	6/6/6	GD	ND		V	2
2	05	001KU	183.18	07738C	Old Lane Cr (Hill Sl), Hwy1 Frtg Rd Rt (Melton Rd)	1956	Concrete continuous	1,542	7/6/7	GD	ND		V	
2	05	001	183.04	07738D	Old Lane Creek (Hill Slough), Hwy 1 NB	1961	Concrete continuous	2,092	6/6/6	GD	ND		V	2
2	05	001	182.63	07740A	Hill Creek, Hwy 1 SB	1956	Concrete continuous	3,125	6/6/6	GD	ND		PV	2
2	05	001	182.63	07740B	Hill Creek, Hwy 1 NB	1956	Concrete continuous	3,665	5/6/6	PR	ND		V	
2	05	001KR	182.63	07740C	Hill Creek Hwy 001KR NB at MP 182.63	1967	Concrete continuous	1,275	7/6/6	GD	ND		V	2
2	05	C0000	182.06	07741A	Market Rd over Hwy 1	1956	Concrete continuous	6,429	6/6/6	GD	ND		V	
2	05	001KC	174.74	07832	Hwy 1 Conn over CORP	1956	Concrete continuous	9,660	4/6/6	PR	SD	SD Rail DG	V	
2	05	001	173.4	07865A	Hwy 1 over Taylor Ave	1956	Concrete continuous	10,300	5/6/6	PR	ND		PV	2
2	05	018	35.9799	02073C	Salmon Creek, Hwy 18	1991	Prestressed concrete	15,696	6/7/7	GD	ND		PV	
2	05	018	48.3299	03995A	Eagle Creek, Hwy 18	1965	Prestressed concrete	1,910	7/7/7	VG	ND		NV	
2	05	018	37.0899	20359	Hwy 18 over Private Logging Road	2008	Prestressed concrete	5,507	7/8/8	VG	ND		NV	


2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	229	35.1999	00730A	Long Tom River, Hwy 229 at MP 35.22	1987	Steel continuous	-	5	FR	ND		NV	
2	05	062	3.15999	03996A	Patterson Creek, Hwy 62	1966	Steel continuous	-	6	GD	ND		PV	3
2	05	062	9.26998	04006A	Divide Creek, Hwy 62	1974	Prestressed concrete	2,600	7/7/7	VG	ND		NV	
2	05	062RW	3.30999	06688A	Patterson Creek, Hwy 62 R/W Lt	1986	Prestressed concrete	560	7/7/6	GD	ND		NV	
2	05	062	1.17	20153	North Fork Siuslaw River, Hwy 62	2009	Prestressed concrete continuous	30,279	7/7/7	VG	ND		NV	
2	05	429	2.27	0M007	Crescent Creek, Hwy 429	1954	Concrete	1,518	7/6/6	GD	ND		PV	
2	05	018	67.9499	20155	Odell Creek, Hwy 18	2006	Prestressed concrete	5,520	7/7/8	VG	ND		NV	
2	05	015	46.3399	0P261	Mill Creek, Hwy 15 at MP 46.34	1966	Steel	-	7	VG	ND		NV	
2	05	227	3.35999	08689B	Hwy 227 EB over Garden Way (Eugene) & Conn #2	1961	Prestressed concrete	6,641	5/7/7	PR	OD	DG	PV	
2	05	227	3.34999	08689C	Hwy 227 WB over Garden Way (Eugene)	1961	Prestressed concrete	6,865	5/7/7	PR	OD	DG	PV	
2	05	227	3.64999	08689F	Hwy 227 WB over Hwy 227 Conn #3	1961	Concrete continuous	5,904	6/6/6	GD	ND		PV	
2	05	227	6.70999	09066E	Hwy 227 EB over 28th St (Springfield) & UPRR	1965	Prestressed concrete	8,358	7/7/7	VG	ND		PV	
2	05	227	6.70999	09066W	Hwy 227 WB over 28th St (Springfield) & UPRR	1965	Prestressed concrete	8,565	7/7/6	GD	ND		PV	
2	05	227	7.51999	09067E	Hwy 227 EB over 42nd St (Springfield)	1966	Prestressed concrete	21,707	6/7/6	GD	ND		PV	
2	05	227	7.51999	09067W	Hwy 227 WB over 42nd St (Springfield)	1966	Prestressed concrete	16,391	6/7/6	GD	ND		PV	
2	05	227	4.99999	09208	Hwy 227 over 5th St (Springfield)	1964	Prestressed concrete	11,822	7/7/6	GD	ND		PV	
2	05	227	8.19998	09563E	McKenzie Oflow, Hwy 227 EB	1966	Concrete continuous	6,187	7/6/7	GD	ND		PV	
2	05	227	8.19998	09563W	McKenzie Oflow, Hwy 227 WB	1966	Concrete continuous	6,187	7/6/7	GD	ND		PV	
2	05	227AU	6.22999	09596	Mohawk Blvd Conn over Hwy 227	1966	Prestressed concrete	21,472	7/7/5	PR	ND		PV	
2	05	227	3.36999	08689A	Hwy 227 Conn #1 over Garden Way (Eugene)	1961	Concrete continuous	5,461	6/5/6	PR	ND		PV	
2	05	227	1.96	08700A	Hwy 227 over Coburg Rd (Eugene) Conns	1964	Steel continuous	32,160	6/6/6	GD	ND		PV	
2	05	227	1.97	08700B	Hwy 227 Conn #1 over Coburg Rd (Eugene)	1961	Steel	9,288	7/6/7	GD	OD	VC	PV	

2017 BRIDGE CONDITION REPORT - District 5

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
2	05	227	1.71	08965E	Hwy 227 over Country Club Rd (Eugene)	1963	Prestressed concrete	13,458	6/7/6	GD	OD	LSL	PV	
2	05	227	0.81	08966	Willamette River & Hwy 227 Conn #1, Hwy 227	1967	Concrete continuous	68,504	4/6/6	PR	SD	SD	PV	
2	05	227AD	1.01	08966R	Willamette River, Hwy 227 Conn #3	1967	Concrete	3,048	6/6/7	GD	ND		NV	
2	05	227BD	123.52	09600	Hwy 1W Ramp to Hwy 227 EB over Washington St	1973	Prestressed concrete continuous	8,555	6/6/6	GD	ND		PV	
2	05	227AA	0.26	09600C	Hwy 227 WB Ramp to Hwy 1W NB over Jefferson St	1973	Prestressed concrete continuous	8,998	6/7/7	GD	OD	DG	PV	
2	05	227	0.26	09600E	1st to 7th Ave Viaduct, Hwy 227 EB	1973	Prestressed concrete continuous	47,874	5/6/6	PR	OD	Rail	PV	
2	05	227	0.28	09600L	Hwy 227 NB over 1ST Ave and Rail Road at MP 0.28	1973	Prestressed concrete continuous	102,857	6/6/6	GD	ND		PV	
2	05	227	0.26	09600W	1st to 7th Ave Viaduct, Hwy 227 WB	1973	Prestressed concrete continuous	62,418	5/6/6	PR	OD	Rail LSL	PV	
2	05	069	11.66	16267	Hwy 69 over Coburg Road	1977	Prestressed concrete	10,705	7/5/6	PR	ND		NV	
2	05	227	0.63	09572	Hwy 227 over Future Hwy 62	1967	Steel continuous	22,107	4/7/6	PR	SD	SD	PV	
2	05	C0000	203.44	08167	Coleman Rd over Hwy 1	1960	Prestressed concrete	6,890	6/6/6	GD	ND		PV	
2	05	C0000	201.28	08170	Wilkins Rd over Hwy 1	1960	Prestressed concrete	6,891	7/7/6	GD	ND		PV	
2	05	001	200.5	08171N	Muddy Creek, Hwy 1 NB	1960	Concrete continuous	5,334	6/6/6	GD	ND		PV	1
2	05	001	200.5	08171S	Muddy Creek, Hwy 1 SB	1960	Concrete continuous	5,334	7/6/6	GD	ND		PV	1
2	05	001	205.34	08251N	Small Creek, Hwy 1 NB at MP 205.34	1958	Concrete continuous	3,175	7/6/6	GD	ND		PV	1
2	05	001	205.34	08251S	Small Creek, Hwy 1 SB at MP 205.34	1958	Concrete continuous	3,175	7/6/6	GD	ND		PV	1
2	05	001	201.95	0M407	Culvert, Hwy 1 at MP 201.95	1960	Concrete continuous	-	6	GD	ND		NV	
2	05	001	195.78	20062	Hwy 1 SB over Game Farm Road	2008	Steel	13,529	6/8/7	0	ND		NV	
2	05	001	188.91	20601	Hwy 1 SB over Franklin Blvd & CORP at MP 188.9	2009	Prestressed concrete continuous	20,605	6/7/6	0	ND		NV	
2	05	001	192.99	21041	Patterson Slough, Hwy 001 SB at MP 192.99	2010	Prestressed concrete	12,097	6/8/6	0	ND		NV	
2	05	069	12.92	21656	Hwy 069AZ to HWY 001 SB @ MP 12.92 Over Multi-Use	2014	Prestressed concrete	1,276	7/8/7	0	ND		NV	

APRIL 2017

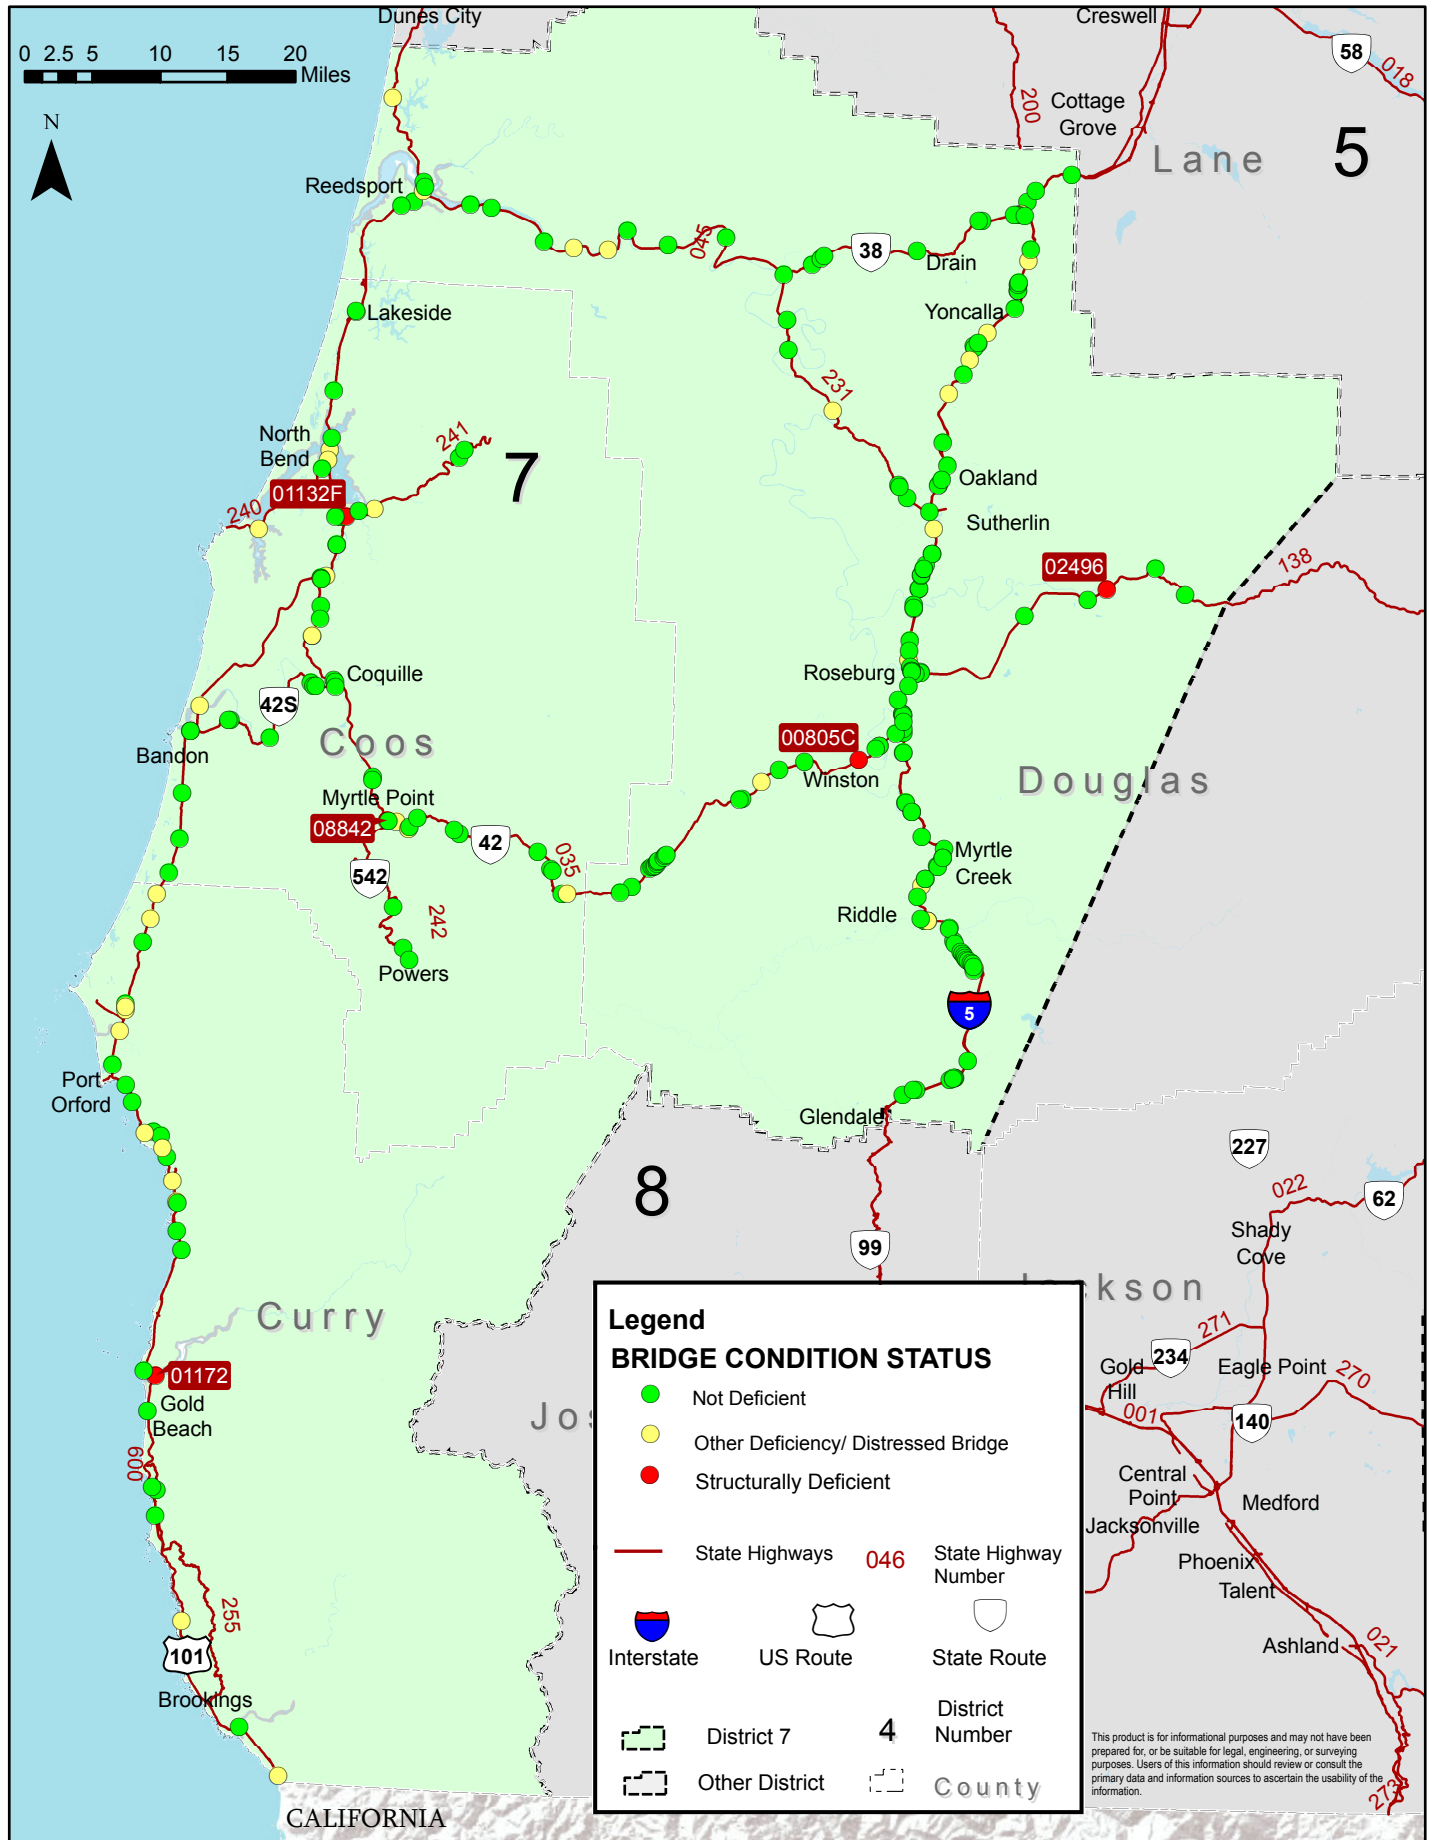

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	009	357.98	01143D	Chetco River, Hwy 9	1972	Prestressed concrete continuous	97,010	6/6/6	GD	ND		V	3
3	07	009	362.61	09091A	Winchuck River, Hwy 9	1965	Concrete continuous	15,720	7/5/7	PR	OD	LSL	PV	3
3	07	009	336.94	08718	Myers Creek, Hwy 9	1961	Concrete continuous	10,550	7/5/6	PR	ND		PV	3
3	07	009	202.72	01602	Tahkenitch Creek, Hwy 9	1929	Concrete continuous	7,565	7/6/7	GD	OD	DG	V	2
3	07	009	241.81	03166B	Shinglehouse Slough, Hwy 9 SB	1989	Prestressed concrete	6,883	7/7/6	GD	ND		V	2
3	07	009	213.23	09559	Hwy 9 over Ranch Rd	1966	Prestressed concrete	6,118	7/7/7	VG	ND		V	2
3	07	009	210.46	18175	Smith River, Hwy 9	1999	Prestressed concrete continuous	75,463	7/7/6	GD	ND		PV	
3	07	009	210.88	18177	Hwy 9 over LPN RR Tenmile Creek & CBRL, Hwy 9 & Frtg Rd	2000	Prestressed concrete	6,895	8/7/7	VG	ND		NV	
3	07	009	223.21	00949A	(Lakeside)	1954	Prestressed concrete	14,664	7/6/6	GD	OD	LSL	V	2
3	07	009BD	223.32	00949B	Tenmile Creek, Hwy 9 Frtg Rd	1989	Prestressed concrete	4,032	7/7/6	GD	ND		V	
3	07	009	241.81	06514A	Shinglehouse Slough, Hwy 9 NB	1990	Prestressed concrete	5,483	7/7/6	GD	ND		PV	2
3	07	009	229.43	07493	North Slough, Hwy 9	1953	Concrete continuous	-	5	FR	ND		V	2
3	07	009	244.82	18628	Davis Slough, Hwy 9 at MP 244.82	2001	Prestressed concrete continuous	20,343	6/7/6	GD	ND		PV	
3	07	009	234.76	01950	Hwy 9 over CBRL (North Bend)	1935	Concrete continuous	9,714	5/6/6	PR	OD	DG	V	5
3	07	009	239.20	02478C	Coalbank Slough, Hwy 9	1987	Concrete continuous	31,554	6/6/6	GD	ND		V	2
3	07	009	233.09	18544	Haynes Inlet Slough, Hwy 9	2001	Prestressed concrete continuous	65,515	7/7/7	VG	ND		PV	
3	07	255	338.33	00995	Myers Creek, Hwy 255	1924	Concrete continuous	2,848	6/6/6	GD	ND		V	
3	07	009	309.56	02382A	Brush Creek, Hwy 9 at MP 309.56	1955	Concrete continuous	5,225	7/6/6	GD	ND		V	3
3	07	009	308.84	02386A	Bear Trap Creek, Hwy 9	1955	Concrete continuous	2,787	7/6/7	GD	OD	LSL	V	3
3	07	009	313.15	02387A	Mussel Creek, Hwy 9	1955	Concrete	2,612	7/6/6	GD	ND		V	3
3	07	009	313.02	07720	Myrtle Creek, Hwy 9	1955	Concrete	3,776	6/6/7	GD	OD	VC	V	3
3	07	009	330.48	08290	Hunter Creek, Hwy 9	1959	Concrete continuous	12,391	6/6/7	GD	ND		PV	3

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	009	339.10	08719	Pistol River, Hwys 9 & 255	1962	Concrete continuous	19,808	6/6/6	GD	ND		V	3
3	07	009	326.47	16014	Hwy 9 over Conn Rd at MP 326.47	1956	Concrete	-	7/7/6	GD	ND		V	3
3	07	009	315.53	18989	Frankport Hwy 9	2004	Prestressed concrete	13,801	7/7/7	VG	ND		NV	
3	07	009	316.98	20724	Euchre Creek, Hwy 9	2009	Prestressed concrete	8,401	6/7/7	GD	ND		NV	
3	07	009	297.37	00902C	Elk River, Hwy 9	1969	Prestressed concrete continuous	33,971	7/7/7	VG	OD	LSL	V	3
3	07	009	295.49	00928A	Crystal Creek, Hwy 9	1971	Prestressed concrete	5,352	7/7/6	GD	OD	Rail	V	3
3	07	009	327.70	01172	Rogue River, Hwy 9 (Gold Beach, Isaac Patterson)	1930	Concrete continuous Prestressed concrete	68,897	6/6/6	GD	SD	SD LSL LC	V	5
3	07	009	303.72	07780A	Rocky Point Viaduct, Hwy 9	1995	continuous	18,638	7/7/6	GD	ND		PV	
3	07	009BP	307.02	07786	Brush Creek, Hwy 9 Frtg Rd at MP F307.02	1955	Concrete continuous	2,118	7/6/7	GD	ND		V	3
3	07	009	307.79	07787	Brush Creek, Hwy 9 at MP 307.79	1955	Concrete continuous	3,483	7/6/7	GD	ND		V	3
3	07	009	295.27	09875	Drainage Ditch & Access Rd, Hwy 9 at MP 295.27	1971	Prestressed concrete	832	7/6/7	GD	ND		NV	
3	07	009	306.35	18096	Brush Creek, Hwy 9 at MP 306.35	1998	Concrete	12,853	7/7/7	VG	OD	LSL	PV	
3	07	009	282.11	00762	Fourmile Creek, Hwy 9	1929	Concrete continuous Prestressed concrete	3,760	7/6/6	GD	ND		V	3
3	07	009	295.75	00901C	Sixes River, Hwy 9	1971	continuous	25,250	7/6/6	GD	OD	Rail	V	3
3	07	009	290.38	00910A	Willow Creek, Hwy 9	1925	Prestressed concrete	5,172	7/6/6	GD	ND		V	3
3	07	009	286.61	00912	Morton Creek, Hwy 9	1925	Concrete	785	7/6/6	GD	OD	DG	NV	
3	07	009	273.80	01236A	Ferry Creek, Hwy 9	1962	Prestressed concrete	1,512	7/6/6	GD	ND		NV	
3	07	009	278.72	03190	Twomile Creek, Hwy 9	1965	Prestressed concrete	1,591	7/7/6	GD	ND		NV	
3	07	009	302.28	03339A	Hubbard Creek, Hwy 9	1984	Prestressed concrete Prestressed concrete	6,003	7/7/7	VG	ND		NV	
3	07	009	288.50	09370	Floras Creek, Hwy 9	1967	continuous	16,378	6/6/7	GD	OD	LSL	PV	3
3	07	009	300.00	16231	Garrison Slough, Hwy 9	1976	Prestressed concrete	36,000	8/7/7	VG	ND		V	3
3	07	009	273.80	17967	Ferry Creek, Hwy 9 R/W Rt at MP 273.80	1999	Prestressed concrete	432	7/8/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	009	284.78	19015	Bethel Creek, Hwy 9	2004	Prestressed concrete	4,742	7/8/7	VG	ND		NV	
3	07	009	233.99	01823	Coos Bay, Hwy 9 (McCullough)	1936	Steel continuous	185,916	6/6/6	GD	OD	Rail LSL	V	5
3	07	001	124.54	07404A	South Umpqua River, Hwy 1 NB (Vets)	1976	Steel	34,361	6/6/6	GD	ND		V	2
3	07	001	124.54	07404	South Umpqua River, Hwy 1 SB (Vets)	1955	Steel	37,039	6/6/6	GD	ND		V	2
3	07	001	128.92	07663C	N Umpqua R & CORP & Co Rd, Hwy 1 NB (Winchester)	1955	Steel	57,295	5/6/6	PR	ND		V	2
3	07	001	128.92	07663A	N Umpqua R & CORP & Co Rd, Hwy 1 SB (Winchester)	1964	Steel	56,779	6/6/6	GD	ND		V	2
3	07	242	17.13	01745A	South Fork Coquille R, Hwy 242 at MP 17.13 (White)	1966	Prestressed concrete	15,086	7/7/6	GD	ND		V	
3	07	242	11.55	03247A	Beaver Creek, Hwy 242 S Fork Coquille R, Hwy 242 at MP 18.22	1979	Prestressed concrete	2,448	7/6/7	GD	ND		NV	
3	07	242	18.22	01942A	(Powers)	1934	Steel	16,859	6/6/6	GD	ND		V	
3	07	009	259.65	07020	Coquille River, Hwy 9 (Bullards)	1952	Steel	21,715	6/6/5	PR	OD	Rail LSL VC CP	V	3
3	07	241	3.73	07176	Coos River, Hwy 241 (Chandler)	1952	Steel	28,729	6/6/6	GD	OD	VC MB	V	
3	07	240	8.33	01940G	South Slough, Hwy 240 Umpqua River & McIntosh Slough, Hwy	1991	Steel	57,431	6/6/6	GD	OD	MB	PV	
3	07	009	211.11	01822	9	1936	Steel continuous	80,019	6/6/6	GD	OD	Rail LSL VC CP	V	2
3	07	009	212.27	00983	Scholfield Creek, Hwy 9	1952	Steel	25,340	6/6/6	GD	ND		V	2
3	07	009	347.78	08459	Thomas Creek, Hwy 9	1961	Steel continuous	33,495	6/6/6	GD	OD	PAINT	V	3
3	07	009	311.40	07514	Reinhart Creek, Hwy 9	1954	Steel	13,135	6/5/6	PR	OD	LC	V	3
3	07	001	82.34	06784	Swamp Creek, Hwy 1	1948	Concrete continuous	-	6	GD	ND		PV	2
3	07	001	83.08	06785	Woodford Creek, Hwy 1	1948	Concrete continuous	-	6	GD	ND		PV	2
3	07	001	96.05	06795A	Canyon Creek, Hwy 1 at MP 96.05	1951	Concrete	-	5	FR	ND		NV	
3	07	001	97.50	06787A	Canyon Creek, Hwy 1 at MP 97.50	1951	Steel	-	6	GD	ND		NV	
3	07	001	97.34	06788A	Canyon Creek, Hwy 1 at MP 97.34	1951	Steel	-	6	GD	ND		NV	
3	07	001	97.13	06789A	Canyon Creek, Hwy 1 at MP 97.13	1951	Concrete	-	6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	001	96.96	06790A	Canyon Creek, Hwy 1 at MP 96.96	1951	Concrete	-	6	GD	ND		NV	
3	07	001	96.82	06791A	Canyon Creek, Hwy 1 at MP 96.82	1951	Concrete	-	5	FR	ND		NV	
3	07	001	96.64	06792A	Canyon Creek, Hwy 1 at MP 96.64	1951	Concrete	-	6	GD	ND		NV	
3	07	001	96.42	06793A	Canyon Creek, Hwy 1 at MP 96.42	1951	Concrete	-	5	FR	ND		NV	
3	07	001	96.27	06794A	Canyon Creek, Hwy 1 at MP 96.27	1951	Concrete	-	6	GD	ND		NV	
3	07	244	16.74	00598D	Coquille River, Hwy 244	1986	Steel	24,765	7/7/5	PR	ND		V	
3	07	244	3.05	00953A	Bear Creek, Hwy 244	1978	Prestressed concrete	4,312	8/7/7	VG	ND		V	
3	07	244	15.27	01058A	Pulaski Creek, Hwy 244	1977	Prestressed concrete	6,294	8/7/6	GD	ND		V	
3	07	244	15.08	01059A	Fat Elk Creek, Hwy 244	1977	Prestressed concrete	10,127	8/7/6	GD	ND		V	
3	07	244	2.91	01097A	Bear Creek Oflow, Hwy 244	1981	Prestressed concrete	2,376	8/8/7	VG	ND		NV	
3	07	244	7.28	03184A	Lampa Creek, Hwy 244	1987	Prestressed concrete	2,332	8/8/7	VG	ND		NV	
3	07	244	14.79	17396	Reservoir Creek, Hwy 244	1996	Prestressed concrete	5,760	8/8/7	VG	ND		PV	
3	07	240	0.42	03225A	Pony Creek, Hwy 240	1983	Prestressed concrete	4,098	7/7/7	VG	ND		NV	
3	07	231	6.32	03451A	Umpqua River, Hwy 231 (Kellogg)	1962	Steel continuous	25,248	5/6/6	PR	ND		V	
3	07	231	3.82	01311B	Umpqua River, Hwy 231 (Smith)	1967	Prestressed concrete continuous	28,500	6/7/6	GD	ND		V	
3	07	231	22.10	20861	Calapooya Creek, Hwy 231 at MP 22.10	2009	Steel continuous	14,001	7/8/6	GD	ND		NV	
3	07	231	20.95	21162	Dodge Creek, Hwy 231 at MP 20.95	2010	Prestressed concrete	3,696	8/7/8	VG	ND		NV	
3	07	231	21.15	21163	Dodge Creek, Hwy 231 at MP 21.15	2010	Steel	5,504	7/8/7	VG	ND		NV	
3	07	241	14.07	01492A	West Fork Millicoma River, Hwy 241	1956	Concrete continuous	11,344	6/5/6	PR	ND		V	
3	07	241	14.90	03240A	Marlow Creek, Hwy 241	1989	Steel	-	6	GD	ND		NV	
3	07	241	2.19	02278E	Catching Slough, Hwy 241	1995	Prestressed concrete continuous	54,618	7/7/7	VG	ND		PV	
3	07	241	0.14	02390	Hwy 241 over CBRL	1939	Concrete continuous	5,750	6/6/7	GD	ND		V	

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	035	0.07	08281	Hwy 35 over Hwy 9 NB	1959	Concrete continuous	7,104	7/6/7	GD	OD	DG VC	PV	4
3	07	035	0.57	03168A	Davis Slough, Hwy 35 EB	1962	Concrete	7,385	7/6/6	GD	OD	LSL	V	4
3	07	035	4.14	03172A	Hwy 35 over CBRL	1949	Concrete continuous	11,214	5/6/6	PR	ND		V	4
3	07	035	5.37	03173A	Beaver Creek, Hwy 35 EB	1949	Concrete continuous	24,156	6/6/6	GD	OD	LSL DG TS	V	5
3	07	035	5.37	03173B	Beaver Creek, Hwy 35 WB	1960	Concrete continuous	24,156	6/6/6	GD	OD	DG	V	4
3	07	035	0.77	06516A	Davis Slough, Hwy 35 WB	1987	Prestressed concrete	7,348	7/7/6	GD	ND		V	4
3	07	035	2.80	17931	Manning Gulch Slough, Hwy 35 Cunningham Creek, Hwy 35 at MP	1997	Prestressed concrete	3,564	7/8/6	GD	ND		NV	
3	07	035	10.45	17140	10.45	1993	Prestressed concrete	7,296	7/7/6	GD	ND		PV	4
3	07	035	10.59	17165	Cunningham Creek Oflow, Hwy 35	1993	Prestressed concrete	14,294	7/8/6	GD	ND		PV	4
3	07	035	37.31	00482B	Sandy Creek, Hwy 35 Middle Fork Coquille River, Hwy 35 at	1979	Prestressed concrete	8,060	7/7/6	GD	ND		V	4
3	07	035	40.56	09185	MP 40.56 Middle Fork Coquille River, Hwy 35 at	1964	Prestressed concrete	10,125	7/7/6	GD	ND		V	4
3	07	035	40.77	09186	MP 40.77	1964	Prestressed concrete	12,654	7/6/6	GD	ND		V	4
3	07	035	19.57	01056A	North Fork Coquille River, Hwy 35	1970	Prestressed concrete continuous	113,578	6/7/6	GD	ND		V	4
3	07	035	19.80	08512A	Overflow Channel, Hwy 35 at MP 19.80	1970	Prestressed concrete	9,152	7/7/6	GD	ND		V	4
3	07	035	26.72	03212A	Endicot Creek, Hwy 35	1962	Concrete continuous	4,180	6/6/6	GD	ND		V	4
3	07	035	23.48	08843	Hwy 35 over Hwy 242 Middle Fork Coquille River, Hwy 35 at	1962	Concrete continuous	8,509	6/6/6	GD	ND		V	4
3	07	035	30.10	08936	MP 30.10 South Umpqua River, Hwy 35 EB	1962	Steel	11,675	6/6/6	GD	ND		V	4
3	07	035	74.47	01923	(Winston) Middle Fork Coquille River, Hwy 35 at	1934	Steel	18,493	6/5/6	PR	OD	LSL	V	4
3	07	035	48.63	09311	MP 48.63 Middle Fork Coquille River, Hwy 35 at	1976	Prestressed concrete	12,463	6/7/7	GD	ND		V	4
3	07	035	50.70	16410	MP 51.46 Middle Fork Coquille River, Hwy 35 at	1984	Prestressed concrete	11,789	6/7/6	GD	ND		V	4
3	07	035	50.93	16411	MP 51.69 Middle Fork Coquille River, Hwy 35 at	1983	Prestressed concrete	12,485	6/7/6	GD	ND		V	4
3	07	035	51.08	16412	MP 51.85	1984	Prestressed concrete	9,570	6/7/6	GD	ND		V	4

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	035	51.20	16413	Middle Fork Coquille River, Hwy 35 at MP 51.97	1984	Prestressed concrete	5,568	7/7/6	GD	ND		NV	
3	07	035	51.40	16414	Middle Fork Coquille River, Hwy 35 at MP 52.16	1984	Prestressed concrete	7,830	6/7/6	GD	ND		V	4
3	07	035	51.50	16415	Middle Fork Coquille River, Hwy 35 at MP 52.26	1984	Prestressed concrete	11,963	6/7/6	GD	ND		V	4
3	07	035	51.62	16416	Holmes Creek, Hwy 35	1984	Steel	-	7	VG	ND		NV	
3	07	035	52.42	00559B	Middle Fork Coquille River, Hwy 35 at MP 52.42	1948	Concrete continuous	6,214	6/5/5	PR	ND		PV	4
3	07	035	67.61	00587C	Olalla Creek, Hwy 35 (Upper Lookingglass)	1949	Concrete continuous	8,493	6/6/6	GD	ND		PV	4
3	07	035	63.97	00588C	Tenmile Creek, Hwy 35	1949	Concrete continuous	4,340	6/6/5	PR	OD	LSL	PV	4
3	07	035	72.52	00805C	Lower Lookingglass Creek, Hwy 35	1949	Concrete continuous	5,642	4/5/5	PR	SD	SD LSL DG	PV	4
3	07	035	62.00	00808A	Shields Creek, Hwy 35 at MP 62.00	1982	Prestressed concrete	2,816	8/7/7	VG	ND		NV	
3	07	035	65.66	00809A	Porter Creek, Hwy 35	1986	Prestressed concrete	2,640	8/7/7	VG	ND		NV	
3	07	035	61.80	00855A	Muns Creek, Hwy 35	1982	Prestressed concrete	2,948	8/7/6	GD	ND		NV	
3	07	035	52.16	16606	Middle Fork Coquille River, Hwy 35 at MP 52.90	1984	Prestressed concrete	10,005	6/7/6	GD	ND		V	4
3	07	035	52.30	16607	Middle Fork Coquille River, Hwy 35 at MP 53.05	1984	Prestressed concrete	4,350	6/7/7	GD	ND		NV	
3	07	035	74.47	01923A	South Umpqua River, Hwy 35 WB (Winston)	1976	Prestressed concrete continuous	29,168	7/8/7	VG	ND		V	4
3	07	035	74.13	01986A	South Umpqua Oflow, Hwy 35 at MP 74.13	1976	Concrete continuous	11,000	6/6/6	GD	ND		PV	4
3	07	035	75.99	02173A	Creek & CORP, Hwy 35 (Shady)	1976	Prestressed concrete continuous	36,445	6/7/6	GD	ND		PV	4
3	07	035	76.65	20333	Hwy 35 over Hwy 1	2006	Prestressed concrete	12,800	6/6/6	GD	ND		NV	
3	07	241	0.42	01132F	Isthmus Slough, Hwy 241 (Eastside)	1931	Steel	61,214	4/6/6	PR	SD	SD LSL LC MB	V	
3	07	138	16.32	01623	Little River, Hwy 138 (Glide)	1976	Prestressed concrete continuous	15,457	6/7/5	PR	ND		NV	
3	07	234	17.10	02279A	Deer Creek, Hwy 234	1937	Concrete continuous	20,875	6/6/5	PR	ND		V	
3	07	138	10.66	02493A	Oak Creek, Hwy 138	1972	Prestressed concrete	3,650	8/5/6	PR	ND		NV	
3	07	138	0.04	06821A	Deer Creek, Hwy 138	1967	Concrete continuous	14,833	6/6/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	138	22.30	07904	Rock Creek, Hwy 138	1954	Concrete continuous	6,400	6/6/5	PR	ND		V	
3	07	138	-0.46	08899	South Umpqua River, Hwy 138 Conn (Washington Ave)	1961	Concrete continuous	34,958	5/6/7	PR	ND		PV	
3	07	138	25.62	19933	Honey Creek, Hwy 138	2006	Prestressed concrete	3,740	8/7/7	VG	ND		NV	
3	07	231	12.36	01995	Yellow Creek, Hwy 231	1934	Steel	3,780	7/6/5	PR	OD	TS	V	
3	07	138	-0.36	07016A	South Umpqua River, Hwy 138 Conn (Oak Ave)	1971	Prestressed concrete continuous	27,060	5/6/6	PR	ND		PV	
3	07	138	17.95	02496	North Umpqua River, Hwy 138 at MP 17.95 (Lone Rock	1954	Steel	15,307	4/6/5	PR	SD	SD LSL Scour	V	
3	07	001	112.57	07841A	S Umpqua R & CORP & Cnty Rd, Hwy1 SB (Booth Ranch)	1965	Steel	31,824	6/6/6	GD	ND		V	2
3	07	045	53.93	00196A	Rock Creek, Hwy 45	1976	Concrete	-	7	VG	ND		NV	
3	07	045	4.11	01683	Koepeke Slough, Hwy 45	1933	Concrete continuous	-	6	GD	ND		V	2
3	07	045	5.76	01685A	Dean Creek, Hwy 45	1981	Prestressed concrete	7,207	7/7/6	GD	ND		V	2
3	07	045	13.24	01688A	Mill Creek, Hwy 45	1952	Concrete continuous	5,933	7/6/6	GD	OD	DG	V	2
3	07	045	28.28	01697	Paradise Creek, Hwy 45	1932	Concrete continuous	9,175	6/6/7	GD	ND		V	2
3	07	045	22.84	18262	Weatherly Creek, Hwy 45	1999	Prestressed concrete	7,356	7/7/6	GD	ND		NV	
3	07	045	19.05	18965	Wells Creek, Hwy 45	2002	Prestressed concrete	6,035	7/7/6	GD	ND		NV	
3	07	045	10.67	20201	Charlotte Creek Hwy 045 @ MP 10.67	2008	Prestressed concrete	4,316	6/7/6	GD	ND		NV	
3	07	045	53.68	00444B	Sand Creek, Hwy 45	1976	Prestressed concrete	4,690	6/6/7	GD	ND		NV	
3	07	045	56.81	07470C	Hwy 45 over Buck Creek Road	1981	Prestressed concrete	5,980	7/8/6	GD	ND		NV	
3	07	045	56.45	07471B	Pass Creek, Hwy 45	1981	Prestressed concrete continuous	8,475	7/7/6	GD	ND		V	2
3	07	045	36.39	20582	Elk Creek, Hwy 45 at MP 36.39	2008	Prestressed concrete continuous	25,873	6/7/7	GD	ND		NV	
3	07	045	38.76	20583	Elk Creek, Hwy 45 at MP 38.76	2008	Prestressed concrete continuous	15,718	6/7/7	GD	ND		NV	
3	07	045	39.64	20584	Elk Creek, Hwy 45 at MP 39.64	2008	Steel continuous	12,252	7/8/6	GD	ND		NV	
3	07	045	39.97	20585	Elk Creek, Hwy 45 at MP 39.97	2008	Prestressed concrete	8,487	7/6/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	045	47.50	20586	Hardscrabble Creek, Hwy 45	2008	Prestressed concrete	3,281	8/7/7	VG	ND		NV	
3	07	045	57.01	07470B	Hwy 45 over Hwy 1 (Anlauf)	1981	Prestressed concrete	11,336	6/6/6	GD	OD	LSL	NV	
3	07	045	56.62	07471A	Hwy 45 over CORP	1981	Prestressed concrete	15,675	6/7/6	GD	ND		NV	
3	07	001JD	149.71	07641	Yoncalla Creek, Hwy 1 Conn	1954	Concrete continuous	1,893	7/6/7	GD	ND		PV	2
3	07	001	98.51	07324	Hwy 1 over First St (Canyonville)	1951	Concrete continuous	8,327	6/6/6	GD	ND		PV	2
3	07	001ES	95.82	09372	Canyon Cr Rd (Bates Rd) over Hwy 1 (W Fork Intchg)	1965	Prestressed concrete	6,912	7/6/6	GD	OD	VC	PV	
3	07	001ES	95.96	09374	West Fork Canyon Creek, Hwy 1 Conn #2	1965	Concrete continuous	2,720	6/7/7	GD	ND		PV	
3	07	001	101.54	19142	South Umpqua River, Hwy 1 NB (Fords)	2003	Steel continuous	26,717	5/7/7	PR	ND		NV	
3	07	001	101.54	19143	South Umpqua River, Hwy 1 SB (Fords)	2003	Steel continuous	26,717	5/7/6	PR	ND		NV	
3	07	001	101.33	19144	Hwy 1 NB over Yokum Road	2003	Prestressed concrete	7,489	6/7/6	GD	ND		NV	
3	07	001	101.33	19145	Hwy 1 SB & Conn over Yokum Road	2003	Prestressed concrete	10,393	6/7/6	GD	OD	LC	NV	
3	07	001	99.53	20093	Hwy 1 NB over Creekside Dr (Irwin Access)	2007	Prestressed concrete	5,096	6/8/6	GD	ND		NV	
3	07	001	99.53	20094	Hwy 1 SB over Creekside Dr (Irwin Access)	2007	Prestressed concrete	4,550	6/8/8	GD	ND		NV	
3	07	001	98.28	20477	Hwy 1 & Conn over 5th St (Canyonville)	2008	Prestressed concrete	7,219	6/8/6	GD	ND		NV	
3	07	001EN	88.01	09346	Conn over Hwy 1 (Azalea Intchg)	1965	Prestressed concrete	9,792	6/6/6	GD	ND		PV	
3	07	001EI	86.14	09348	Quines Creek Rd Conn over Hwy 1	1965	Prestressed concrete	11,880	6/7/6	GD	ND		PV	
3	07	001EF	83.29	09351	Barton Rd Conn over Hwy 1	1965	Prestressed concrete	9,324	6/7/6	GD	ND		PV	
3	07	001	86.52	19106	Cow Creek, Hwy 1 NB	2006	Prestressed concrete	11,550	6/6/6	GD	ND		NV	
3	07	001	86.52	19107	Cow Creek, Hwy 1 SB	2005	Prestressed concrete	9,746	7/7/7	VG	ND		NV	
3	07	001	86.40	19312	QUINES CREEK, HWY 1 SB	2005	Prestressed concrete	4,957	6/7/7	GD	ND		NV	
3	07	001	86.40	19313	Quines Creek, Hwy 1 NB	2005	Prestressed concrete	4,592	6/7/6	GD	ND		NV	
3	07	001	107.52	07952A	Hwy 1 SB over CORP (Weaver)	1958	Concrete continuous	11,548	6/6/5	PR	ND		PV	2

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	001FY	106.78	07954	Weaver Road over CORP	1958	Concrete continuous	4,008	7/6/6	GD	ND		V	
3	07	C0000	0.00	08023	Chadwick Lane over Hwy 1	1958	Concrete continuous	7,215	6/5/6	PR	OD	LC	V	
3	07	001FO	101.89	08026A	Gazley Rd over Hwy 1	1975	Prestressed concrete	7,698	7/7/7	VG	ND		PV	
3	07	001	107.52	20303	Hwy 1 NB over CORP (Weaver)	2008	continuous	11,582	7/7/7	VG	ND		NV	
3	07	001	105.41	20611	South Umpqua River, Hwy 1 NB (Missouri Bottom)	2008	Prestressed concrete	26,599	6/7/7	GD	ND		NV	
3	07	001	105.41	20612	South Umpqua River, Hwy 1 SB (Missouri Bottom)	2008	Prestressed concrete	26,599	7/7/7	VG	ND		NV	
3	07	001FY	106.71	20627	Weaver Road Conn over Hwy 1	2008	continuous	11,117	6/6/6	GD	ND		NV	
3	07	001FU	104.05	20628	Riddle Rd (Pruner Rd) over Hwy 1	2007	Prestressed concrete	13,245	6/7/7	GD	ND		NV	
3	07	C0000	0.00	07824	Grant Smith Road over Hwy 1	1956	Concrete continuous	6,660	6/5/6	PR	ND		V	
3	07	001	113.44	07839	Hwy 1 SB over Clarks Branch Rd Conn #2	1956	Concrete continuous	6,477	6/6/6	GD	ND		PV	2
3	07	001	113.44	07839A	Hwy 1 NB over Clarks Branch Rd Conn #2	1964	Concrete continuous	5,229	6/6/6	GD	ND		PV	2
3	07	001	108.31	07950	Hwy 1 over Myrtle Creek Conn (Myrtle Creek Intchg)	1958	Concrete continuous	19,421	6/6/6	GD	ND		PV	2
3	07	001	112.57	19105	S Umpqua R & CORP & Round Prairie Rd, Hwy 1 NB	2004	Prestressed concrete	42,777	6/6/6	GD	ND		NV	
3	07	001	117.74	20389	Roberts Creek Rd, Hwy 1 SB	2006	continuous	8,325	6/6/6	GD	ND		NV	
3	07	001	117.74	20422	Roberts Creek Rd, Hwy 1 NB	2006	Prestressed concrete	8,775	6/6/7	GD	ND		NV	
3	07	001	110.35	20717	Hwy 1 over Boomer Hill Rd Conn #2	2008	Prestressed concrete	8,323	6/6/6	GD	ND		NV	
3	07	001	124.22	07668A	Hwy 1 over Bellows St	1976	Concrete continuous	17,547	6/6/6	GD	ND		PV	2
3	07	001HM	124.24	07668B	Hwy 1 Conn over Bellows St	1976	Concrete continuous	5,229	6/6/6	GD	ND		PV	2
3	07	001	124.15	07669A	Hwy 1 & Conn over Harvard Ave	1976	Concrete continuous	22,842	6/6/6	GD	ND		PV	2
3	07	001	123.01	07670A	Hwy 1 over Portland Ave (Fairgrounds Intchg)	1954	Concrete continuous	11,895	6/6/6	GD	ND		PV	2
3	07	001	120.03	07804N	Hwy 1 over Speedway Rd	1955	Concrete continuous	12,616	7/6/6	GD	ND		PV	2
3	07	001	120.57	19738	South Umpqua River & CORP, Hwy 1 NB (Shady)	2006	Prestressed concrete	58,997	6/6/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	001	120.57	19739	South Umpqua River & CORP, Hwy 1 SB (Shady)	2007	Prestressed concrete continuous	58,997	7/6/6	GD	ND		NV	
3	07	001	120.49	19740	Hwy 1 NB over Hwy 234 (Shady)	2007	Prestressed concrete	6,337	6/8/7	GD	ND		NV	
3	07	001	120.49	19741	Hwy 1 SB over Hwy 234 (Shady)	2007	Prestressed concrete	6,338	6/8/7	GD	ND		NV	
3	07	001	121.69	21087	McLain Ave. Bridge hwy 1 over McLain Ave Frontage	2009	Prestressed concrete	12,354	6/7/7	GD	ND		NV	
3	07	001	132.00	07629A	Hwy 1 SB over Wilbur-Umpqua Rd	1965	Concrete continuous	4,811	7/6/6	GD	ND		PV	2
3	07	C0000	125.07	07667	Garden Valley Road over Hwy 1	1955	Concrete continuous	12,137	6/6/6	GD	OD	VC	V	
3	07	C0000	0.00	17235	Edenbower St over Hwy 1 (North Roseburg Intchg)	1996	Prestressed concrete continuous	17,581	6/7/6	GD	ND		NV	
3	07	C0000	125.72	18990	Stewart Parkway (Airport Rd) over Hwy 1	2002	Prestressed concrete continuous	16,908	6/8/6	GD	ND		NV	
3	07	001	130.46	20212	Hwy 1 SB over CORP	2007	Prestressed concrete continuous	6,368	6/7/7	GD	ND		NV	
3	07	001	130.46	20213	Hwy 1 NB over CORP	2005	Prestressed concrete continuous	6,368	6/6/7	GD	ND		NV	
3	07	001	131.47	20214	Sutherlin Creek & County Rd, Hwy 1 NB	2006	Prestressed concrete continuous	9,450	6/6/6	GD	ND		NV	
3	07	001	131.47	20215	Sutherlin Creek & County Rd, Hwy 1 SB	2005	Prestressed concrete	10,800	6/7/6	GD	ND		NV	
3	07	001	132.00	20337	Hwy 1 NB over Wilbur-Umpqua Rd	2006	Prestressed concrete	3,610	6/6/6	GD	ND		NV	
3	07	001HV	129.22	20571	Del Rio Rd over Hwy 1 (Winchester)	2008	Prestressed concrete	18,725	7/7/7	VG	ND		NV	
3	07	001	156.03	07567A	Elk Creek, Hwy 1 SB	1964	Concrete continuous	5,625	7/7/5	PR	ND		PV	2
3	07	001	156.03	07567B	Elk Creek, Hwy 1 NB	1953	Concrete continuous	5,222	6/6/5	PR	ND		PV	2
3	07	001	162.06	07569A	Hwy 1 over Buck Creek Rd	1953	Concrete continuous	7,688	6/6/6	GD	ND		PV	2
3	07	001	159.28	07594A	Hwy 1 over Scotts Valley Conn	1953	Concrete continuous	9,343	7/6/6	GD	ND		PV	2
3	07	001	133.25	07627A	Hwy 1 SB over Rogers Rd Conn	1965	Concrete continuous	5,020	7/6/6	GD	ND		PV	2
3	07	001	133.25	07627B	Hwy 1 NB over Rogers Rd Conn	1954	Concrete continuous	3,571	7/6/6	GD	ND		PV	2
3	07	001IM	140.79	07508A	OR Route 99 over Hwy 1 (N Oakland Intchg)	1976	Concrete continuous	10,089	6/6/6	GD	ND		NV	
3	07	C0000	139.09	07562A	Green Valley Road (Cemetery Rd) over Hwy 1	1979	Prestressed concrete	6,653	6/6/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 7


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	001	132.28	07718	Culvert, Hwy 1 at MP 132.28	1954	Concrete continuous	-	6	GD	ND		PV	2
3	07	001IA	135.14	09285	Deady Conn over Hwy 1	1965	Prestressed concrete	6,897	7/7/6	GD	OD	LSL VC	PV	
3	07	001	136.52	20216	HWY 1 OVER HWY 231	2005	Concrete	10,431	6/6/6	GD	ND		NV	
3	07	001	138.71	20239	Calapooya Creek, Hwy 1	2006	Prestressed concrete	26,040	6/7/6	GD	ND		NV	
3	07	001	138.60	20240	Hwy 1 over Stearns Lane	2006	Prestressed concrete	5,580	6/7/7	GD	ND		NV	
3	07	001	164.45	07584A	Hwy 1 over Comstock Cemetery Rd	1981	Concrete continuous	11,438	6/6/6	GD	ND		NV	
3	07	C0000	156.65	07587A	Cox Creek Rd over Hwy 1	1953	Concrete continuous	4,723	5/5/6	PR	ND		V	
3	07	001	158.35	07595	Curtis Creek Bridge, Hwy 001 Ft Rd Rt at MP 158.35	1953	Concrete continuous	756	7/6/6	GD	OD	TS	V	
3	07	C0000	151.81	07639A	Wilson Rd over Hwy 1	1953	Concrete continuous	7,053	6/5/5	PR	OD	LC	V	
3	07	C0000	167.65	16299	Ward Butte Rd over Hwy 1	1980	Prestressed concrete	7,663	6/6/6	GD	ND		NV	
3	07	001	163.43	21161	Bear Creek, Hwy 1 at MP 163.43	2009	Prestressed concrete continuous	17,055	6/7/6	GD	ND		NV	
3	07	001	156.49	07572A	Curtis Creek, Hwy 001 SB at MP 156.49	1963	Concrete continuous	5,233	7/6/6	GD	ND		PV	2
3	07	001	150.76	07640	Hwy 1 NB over CORP (Yoncalla)	1954	Concrete continuous	7,473	5/6/6	PR	ND		PV	2
3	07	001	150.79	07640A	Hwy 1 SB over CORP (Yoncalla)	1963	Concrete continuous	8,698	6/6/6	GD	ND		PV	2
3	07	001	154.54	21305	Hwy 1 over Elkhead Rd	2010	Prestressed concrete	7,013	6/8/6	GD	ND		NV	
3	07	001	156.49	21306	Curtis Creek, Hwy 1 NB at MP 156.49	2010	Prestressed concrete continuous	3,783	6/8/7	GD	ND		NV	
3	07	045	16.43	01318	Umpqua River, Hwy 45 (Scottsburg)	1929	Steel continuous	23,111	6/6/5	PR	OD	Rail LSL Scour VC	V	2
3	07	035	24.32	08830	Middle Fork Coquille River, Hwy 35 at MP 24.32	1962	Steel	11,760	6/6/5	PR	OD	LSL	V	4
3	07	035	23.37	08842	Middle Fork Coquille River, Hwy 35 at MP 23.37	1962	Concrete continuous	16,450	6/6/6	GD	SD	SD LSL LC	PV	4
3	07	035	25.52	08875	Middle Fork Coquille River, Hwy 35 at MP 25.52	1962	Steel	14,000	6/5/6	PR	OD	LSL	V	4
3	07	035	25.67	08876	Middle Fork Coquille River, Hwy 35 at MP 25.67	1962	Steel	9,209	7/6/7	GD	ND		V	4
3	07	035	30.59	08935	Middle Fork Coquille River, Hwy 35 at MP 30.59	1962	Steel	16,880	6/6/6	GD	ND		V	4

2017 BRIDGE CONDITION REPORT - District 7

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	07	035	43.15	09215	Middle Fork Coquille River, Hwy 35 at MP 43.15	1964	Prestressed concrete	12,844	6/7/6	GD	ND		V	4
3	07	035	43.58	09216	Middle Fork Coquille River, Hwy 35 at MP 43.58	1965	Prestressed concrete	13,452	6/7/6	GD	OD	LSL	V	4
3	07	035	47.68	09310A	Middle Fork Coquille River, Hwy 35 at MP 47.68	1976	Prestressed concrete	19,281	6/7/6	GD	ND		V	4
3	07	001IO	142.18	07549	Metz Hill Road (Chenoweth Park Rd) over Hwy 1	1953	Concrete continuous	5,397	6/6/6	GD	ND		V	
3	07	001JA	150.36	07642	Hwy 1 Conn (Yoncalla Jct) over Hwy 1	1954	Concrete continuous	4,969	6/6/6	GD	ND		V	
3	07	C0000	149.39	07643	Equipment Pass, Hwy 1 at MP 149.39	1953	Concrete continuous	4,150	6/6/6	GD	OD	VC	V	
3	07	001	148.21	07644A	Hwy 1 over Rice Hill Frtg Rd	1954	Concrete continuous	8,603	6/6/6	GD	ND		PV	2
3	07	001IW	146.81	08852	Rice Valley Rd over Hwy 1	1962	Prestressed concrete	7,785	7/7/6	GD	OD	VC	PV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 8

APRIL 2017

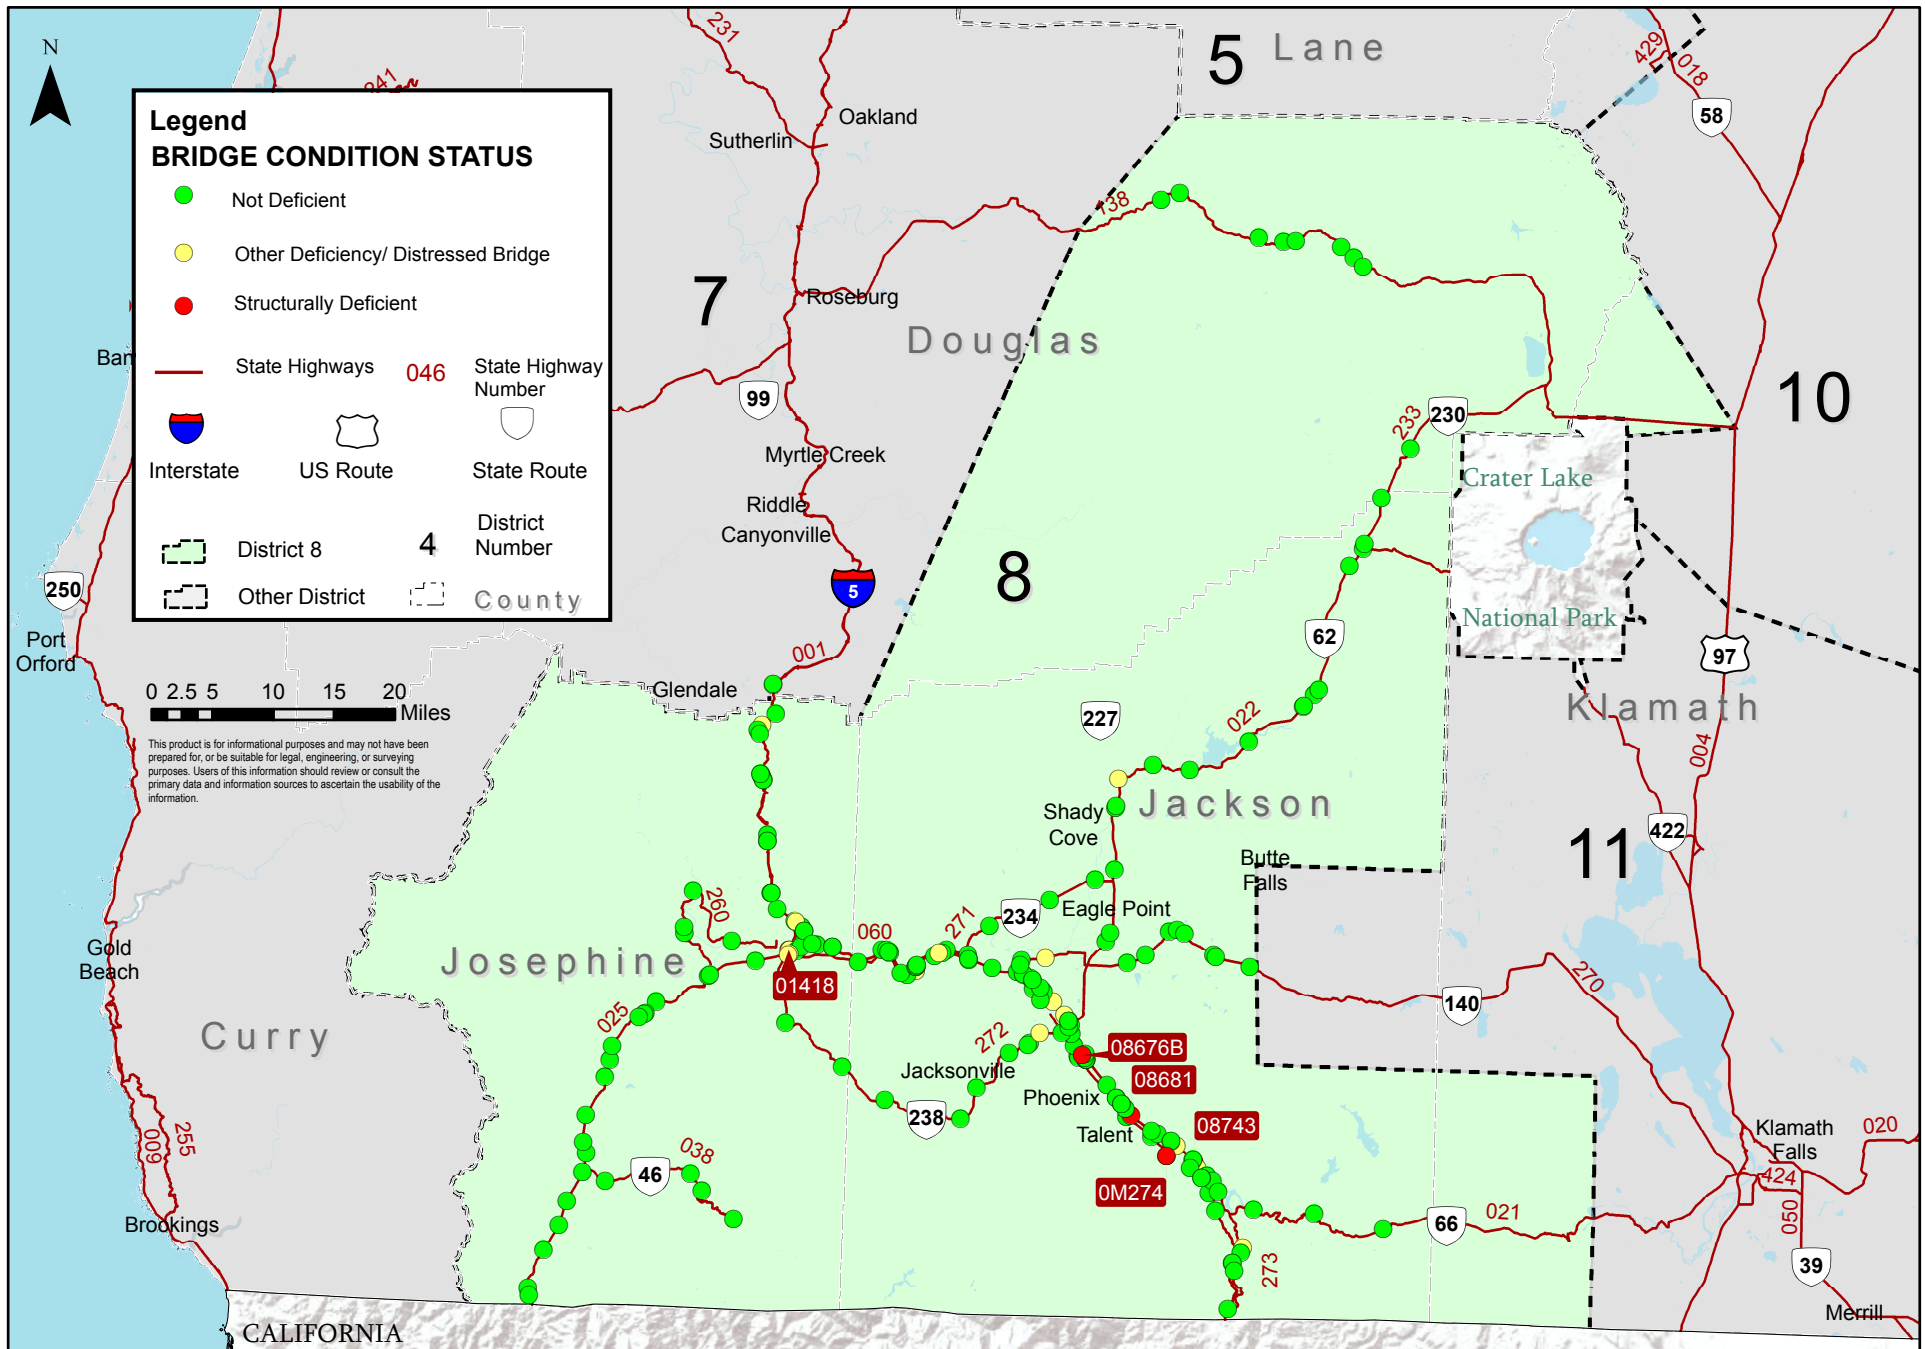

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	271	16.01	01245B	Rogue River, Hwy 271 (Dodge)	1953	Steel	12,572	6/6/6	GD	ND		V	
3	08	260	16.64	01338A	Shan Creek, Hwy 260	1988	Concrete continuous	5,133	7/6/7	GD	ND		PV	
3	08	260	5.66	03826	Eisman Creek (Vannoy Creek), Hwy 260	1966	Prestressed concrete	2,520	7/7/6	GD	ND		PV	
3	08	260	17.43	18214	Limpy Creek, Hwy 260	1998	Prestressed concrete	5,493	7/7/6	GD	ND		NV	
3	08	260	12.91	18273	Rogue River, Hwy 260 (Robertson)	2001	Prestressed concrete continuous	25,740	6/8/6	GD	ND		NV	
3	08	021	0.76	00406A	Hwy 21 over CORP	1974	Prestressed concrete continuous	27,061	6/6/6	GD	ND		PV	
3	08	021	23.42	00660A	Jenny Creek, Hwy 21	1983	Concrete continuous	3,753	7/6/6	GD	ND		NV	
3	08	021	8.83	08452	Emigrant Creek, Hwy 21	1959	Concrete continuous	3,083	7/6/6	GD	ND		PV	
3	08	021	16.19	17362	Keene Creek, Hwy 21	1997	Concrete	4,617	6/5/6	PR	ND		NV	
3	08	021	2.50	17459	Neil Creek, Hwy 21at MP 2.50	1996	Prestressed concrete	1,496	8/8/6	GD	ND		NV	
3	08	021	3.17	17460	Neil Creek, Hwy 21 at MP 3.17	1996	Prestressed concrete	1,936	8/7/6	GD	ND		NV	
3	08	021	4.26	21378	Neil Creek, Hwy 21 at MP 4.26	2011	Prestressed concrete	2,592	8/7/7	VG	ND		NV	
3	08	271	0.09	00332A	Rogue River +, Hwy 271 (Rock Point)	1919	Concrete	11,876	6/6/6	GD	OD	LC	V	
3	08	271	0.80	01937	Sardine Creek, Hwy 271	1938	Concrete continuous	4,593	7/6/6	GD	ND		V	
3	08	271	11.86	06912	East Fork Snider Creek, Hwy 271	1949	Concrete continuous	-	6	GD	ND		NV	
3	08	271	5.99	07362	Sams Creek, Hwy 271	1951	Concrete continuous	-	6	GD	ND		NV	
3	08	486	2.65	00576	Rogue River, Hwy 486 (Gold Hill Spur)	1927	Concrete	10,528	6/6/7	GD	ND		V	
3	08	022	55.98	03722	Union Creek, Hwy 22	1927	Concrete continuous	1,560	7/6/5	PR	ND		PV	
3	08	022	42.45	0M229	Hwy 22 over PP&L Spillway	1963	Concrete continuous	-	7	VG	ND		NV	
3	08	022	42.19	16017	Hwy 22 over Cal-Ore Power Flumes	1963	Concrete continuous	5,539	7/6/7	GD	ND		PV	
3	08	022	43.54	16018	Rogue Rive, Hwy 22 at MP 43.54 (Prospect)	1963	Concrete continuous	5,837	7/6/7	GD	ND		PV	
3	08	022	44.09	16019	Copco Canal, Hwy 22	1963	Prestressed concrete	2,025	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	022	29.23	16087	Rogue River, Hwy 22 at MP 29.23 (McLeod)	1975	Prestressed concrete	38,220	6/7/6	GD	ND		PV	
3	08	022	19.81	00678	Indian Creek, Hwy 22	1921	Concrete	1,480	7/6/6	GD	ND		NV	
3	08	022	9.33	00681B	Little Butte Creek, Hwy 22	1981	Prestressed concrete	12,914	7/7/6	GD	ND		NV	
3	08	022	14.62	00682A	Reese Creek, Hwy 22	1921	Concrete continuous	3,366	7/6/5	PR	ND		V	
3	08	022	20.00	00684B	Rogue River, Hwy 22 at MP 20.00 (Shady Cove)	1965	Prestressed concrete	17,643	6/6/5	PR	ND		PV	
3	08	022	25.85	00830B	Elk Creek, Hwy 62	1993	Prestressed concrete	10,640	6/7/6	GD	ND		NV	
3	08	270	12.20	03759A	Salt Creek, Hwy 270	1968	Prestressed concrete	3,440	8/7/6	GD	ND		V	3
3	08	270	12.47	03760A	Long Branch Creek, Hwy 270	1968	Prestressed concrete	2,805	8/7/6	GD	ND		V	3
3	08	270	15.44	05283A	North Fork Little Butte Creek, Hwy 270 at MP 15.44	1968	Prestressed concrete	2,795	8/7/6	GD	ND		V	3
3	08	022	22.32	08412	Trail Creek, Hwy 22	1958	Concrete continuous	5,200	7/6/5	PR	OD	LSL	V	
3	08	022	8.56	18427	Antelope Creek, Hwy 22	1999	Prestressed concrete	8,512	6/7/6	GD	ND		NV	
3	08	270	-6.55	18869	Bear Creek, Hwy 270 (Kirtland Road) at MP - 6.55	2003	Prestressed concrete continuous	14,071	6/6/6	GD	ND		NV	
3	08	270	8.46	03756A	Schoolhouse Creek, Hwy 270	1968	Prestressed concrete	2,795	7/7/6	GD	ND		V	3
3	08	270	9.15	03757B	Lick Creek, Hwy 270	1968	Prestressed concrete	3,440	7/7/6	GD	ND		V	3
3	08	022	0.38	06605A	Bear Creek, Hwy 22	1961	Prestressed concrete	20,811	5/7/6	PR	ND		V	3
3	08	270	-4.52	06701A	Whetstone Creek, Kirkland Rd	1953	Concrete continuous	2,312	7/6/5	PR	OD	DG	V	
3	08	022	0.57	09590	Hwy 22 over Biddle Rd	1967	Concrete continuous	24,735	5/6/6	PR	ND		PV	3
3	08	270	3.33	09774	Dry Creek, Hwy 270 at MP 3.33	1969	Prestressed concrete continuous	8,392	7/8/6	GD	ND		PV	3
3	08	270	4.99	09775	Antelope Creek, Hwy 270	1969	Prestressed concrete	5,528	7/8/7	VG	ND		NV	
3	08	270	7.75	09777	Little Butte Creek, Hwy 270	1969	Prestressed concrete continuous	16,130	6/6/6	GD	ND		V	3
3	08	270	-7.02	21064	Multi-use path undercrossing Hwy 270 at MP -7.02	2009	Concrete	-	6	GD	ND		NV	
3	08	022	35.41	16063	Rogue River, Hwy 22 at MP 35.41 (Peyton)	1975	Steel continuous	80,364	6/7/7	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	272	33.04	03774A	Jackson Creek, Hwy 272	1964	Concrete continuous	-	6	GD	ND		NV	
3	08	272	35.44	07813	Jackson Creek, Hanley Rd #789 at MP 3.34	1954	Concrete continuous	-	6	GD	ND		NV	
3	08	272	38.26	18525	Hwy 272 over CORP (Medford)	2002	Prestressed concrete continuous	22,025	6/7/6	GD	ND		NV	
3	08	272	25.23	18857	Forest Creek, Hwy 272	2000	Prestressed concrete	1,050	8/7/5	PR	ND		NV	
3	08	272	34.94	19727	Jackson Creek, Hanley Rd #789 at MP 3.87	2006	Prestressed concrete	3,090	8/8/7	VG	ND		NV	
3	08	272	36.44	29C269	Griffin Creek, Rossanley Rd	1968	Prestressed concrete	974	7/7/6	GD	OD	DG	NV	
3	08	272	28.39	03771A	Poormans Creek, Hwy 272	1975	Prestressed concrete	1,320	8/7/6	GD	ND		NV	
3	08	272	0.06	08461B	Hwy 272 over NB Hwy 25	1959	Concrete continuous	5,650	7/6/7	GD	OD	LSL DG VC	PV	
3	08	272	6.14	17363	Applegate River, Hwy 272 at MP 6.14 (Murphy)	2004	Steel continuous	20,525	6/7/7	GD	ND		NV	
3	08	272	13.04	18066	Williams Creek, Hwy 272	1996	Prestressed concrete	4,474	6/7/7	GD	ND		NV	
3	08	060	6.05	00072A	Savage Creek, Hwy 60	1916	Concrete continuous	-	7/6/6	GD	ND		V	
3	08	060	10.83	00412A	Birdseye Creek, Hwy 60	1920	Concrete	2,130	6/6/7	GD	ND		V	
3	08	060	12.21	00413	Millers Gulch, Hwy 60	1920	Concrete continuous	1,782	6/5/6	PR	OD	LSL	V	
3	08	060	11.36	01349	Foots Creek, Hwy 60	1928	Concrete continuous	2,749	7/7/6	GD	ND		V	
3	08	060	14.64	08382	Hwy 60 over Hwy 1	1961	Concrete continuous	10,102	6/6/5	PR	ND		PV	
3	08	060	0.21	08461A	Hwy 60 SB & Hwy 25 over Hwy 272	1959	Concrete	8,350	7/7/6	GD	OD	VC	NV	
3	08	C0508	30.33	19273	Rogue River, Depot St	2006	Prestressed concrete	25,830	6/6/6	GD	ND		NV	
3	08	272	18.04	01992	Applegate River, Hwy 272 at MP 18.04 (Applegate)	1934	Steel	7,700	6/6/6	GD	ND		V	
3	08	273	3.63	03780	Hwy 273 over CORP and Hwy 273 (Steinman)	1914	Concrete continuous	2,067	6/6/5	PR	OD	LSL	V	
3	08	273	4.70	03781	Hwy 273 over CORP (Dollarhide)	1914	Concrete continuous	2,355	6/6/6	GD	ND		V	
3	08	001	5.32	09259	Hwy 1 SB over Hwy 273	1965	Prestressed concrete	13,502	5/6/6	PR	ND		V	2
3	08	001	5.36	09259A	Hwy 1 NB over Hwy 273	1965	Prestressed concrete	8,383	5/7/6	PR	ND		V	2

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	001	4.63	09260A	Hwy 1 over Hwy 273 at MP 4.63	1965	Prestressed concrete	12,018	6/6/6	GD	ND		V	2
3	08	273	12.13	09312A	Hwy 273 over Hwy 1	1965	Prestressed concrete	15,169	6/6/6	GD	ND		PV	
3	08	001	17.29	20676	Hwy 1 SB over Eagle Mill Rd	2008	Prestressed concrete	10,254	6/7/6	GD	ND		NV	
3	08	001	17.29	20677	Hwy 1 NB over Eagle Mill Rd	2008	Prestressed concrete	9,260	6/7/6	GD	ND		NV	
3	08	021	1.33	08745	Hwy 21 over Hwy 1	1963	Prestressed concrete continuous	20,773	6/8/6	GD	OD	VC	PV	
3	08	001	13.29	08746N	Hwy 1 NB over Crowson Rd	1963	Prestressed concrete	8,519	6/7/6	GD	ND		V	2
3	08	001	13.29	08746S	Hwy 1 SB over Crowson Rd	1963	Prestressed concrete	6,275	5/7/6	PR	ND		V	2
3	08	001	10.34	20673	Hwy 1 over Neil Creek Rd	2008	Prestressed concrete	7,600	7/8/6	GD	ND		NV	
3	08	001	14.96	20674	Bear Creek, Hwy 1 SB at MP 14.96	2008	Steel	8,934	6/8/6	GD	ND		NV	
3	08	001	14.96	20675	Bear Creek, Hwy 1 NB at MP 14.96	2008	Steel	8,934	6/8/6	GD	ND		NV	
3	08	001AO	21.21	08681	Valley View Rd Conn #2 over Hwy 1	1962	Concrete continuous	12,470	6/4/6	PR	SD	SD LSL	PV	
3	08	C0000	0.00	08683	Suncrest Rd over Hwy 1	1962	Prestressed concrete	8,460	6/7/6	GD	ND		PV	
3	08	C0000	0.00	08736	Butler Creek Rd over Hwy 1	1962	Prestressed concrete	7,987	6/7/6	GD	ND		PV	
3	08	C0000	0.00	08739	Mountain Ave over Hwy 1	1963	Prestressed concrete	7,986	5/7/6	PR	OD	VC	PV	
3	08	C0000	0.00	08743	E Main St over Hwy 1	1962	Concrete continuous	11,935	4/5/6	PR	SD	SD LSL VC	PV	
3	08	001AJ	19.17	21358	Valley View Rd Conn #1 over Hwy 1 (N Ashland Int)	2011	Steel continuous	16,263	6/8/6	GD	ND		NV	
3	08	001	23.07	08890N	Bear Creek, Hwy 1 NB at MP 23.07	1962	Prestressed concrete	9,815	6/7/7	GD	ND		V	2
3	08	001	23.07	08890S	Bear Creek, Hwy 1 SB at MP 23.07	1962	Prestressed concrete	9,815	6/7/7	GD	ND		V	2
3	08	001	22.42	08891N	Bear Creek, Hwy 1 NB at MP 22.42	1962	Prestressed concrete	9,815	6/7/7	GD	ND		V	2
3	08	001	22.42	08891S	Bear Creek, Hwy 1 SB at MP 22.42	1962	Prestressed concrete	9,815	6/7/7	GD	ND		V	2
3	08	C0000	0.00	19286	LAZY CREEK, HIGHLAND DRIVE (MEDFORD) GARFIELD ST OVER HWY 1 (SOUTH	2005	Prestressed concrete	2,968	8/7/6	GD	ND		NV	
3	08	C0000	0.00	19108	MEDFORD) INTERCHANGE	2008	Prestressed concrete	35,736	6/8/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	001WS	27.07	19109	BEAR CREEK, HWY 1 NB RAMP TO HIGHLAND DR	2002	Prestressed concrete continuous	10,973	6/8/8	GD	ND		NV	
3	08	001	27.07	19110	BEAR CREEK, HIGHLAND DRIVE (MEDFORD)	2005	Prestressed concrete	43,491	6/6/6	GD	ND		NV	
3	08	C0000	0.00	19111	LARSON CREEK, HIGHLAND DRIVE (MEDFORD)	2007	Prestressed concrete	10,914	6/6/6	GD	ND		NV	
3	08	001WZ	27.04	19114	BEAR CREEK, GARFIELD ST RAMP TO HWY 1 SB	2005	Prestressed concrete continuous	13,408	6/7/7	GD	ND		NV	
3	08	001	27.09	19282	BEAR CREEK, HWY 1 NB @ 27.09	2005	Prestressed concrete	19,327	6/6/6	GD	ND		NV	
3	08	001	27.09	19283	BEAR CREEK, HWY 1 SB @ MP 27.09	2008	Prestressed concrete	14,674	6/8/6	GD	ND		NV	
3	08	001WV	27.26	19284	BEAR CREEK, HIGHLAND BR RAMP TO HWY 1 NB	2005	Prestressed concrete continuous	19,450	6/6/6	GD	ND		NV	
3	08	233	0.58	03459	Castle Creek, Hwy 233	1932	Concrete	2,547	7/6/7	GD	ND		PV	
3	08	233	0.96	03460	Bybee Creek, Hwy 233	1932	Concrete	2,973	6/6/6	GD	ND		PV	
3	08	233	5.16	03461	Rogue River, Hwy 233	1933	Concrete continuous	7,110	6/6/5	PR	ND		PV	
3	08	233	10.32	03462	Muir Creek, Hwy 233	1933	Concrete	4,148	7/6/6	GD	ND		PV	
3	08	138	57.36	16861	Rough Creek, Hwy 138 (Penstock) at MP 57.36	1962	Concrete	3,901	6/6/6	GD	ND		NV	
3	08	138	58.71	16862	Toketee Point Viaduct, Hwy 138 at MP 58.71	1963	Prestressed concrete	1,065	7/7/7	VG	ND		NV	
3	08	138	50.01	02492	North Umpqua River, Hwy 138 at MP 50.03 (Marsters)	1959	Concrete continuous	9,552	7/6/5	PR	ND		PV	
3	08	138	39.01	02737	Steamboat Creek, Hwy 138 at MP 39.01	1949	Steel	12,103	6/6/5	PR	ND		V	
3	08	138	47.16	16858	Dry Creek, Hwy 138	1958	Concrete continuous	3,721	7/7/7	VG	ND		V	
3	08	138	51.20	16859	Copeland Creek, Hwy 138	1960	Concrete continuous	4,914	7/6/7	GD	ND		PV	
3	08	138	55.95	16860	Fish Creek, Hwy 138	1962	Prestressed concrete	10,546	7/6/6	GD	ND		PV	
3	08	138	37.14	20966	Williams Creek HWY 138 at MP 37.14	2010	Prestressed concrete	4,056	7/7/7	VG	ND		NV	
3	08	001	65.74	08094N	Jumpoff Joe Creek, Hwy 1 NB	1957	Concrete continuous	12,015	6/6/6	GD	ND		PV	2
3	08	001	65.74	08094S	Jumpoff Joe Creek, Hwy 1 SB	1957	Concrete continuous	12,015	6/6/6	GD	ND		PV	2
3	08	001CU	61.46	08100A	Louse Creek, Hwy 1 Conn #2	1972	Prestressed concrete	2,714	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	001	54.10	08335N	Hwy 1 NB over Foothill Blvd	1960	Concrete continuous	12,610	6/6/6	GD	ND		PV	2
3	08	001	54.10	08335S	Hwy 1 SB over Foothill Blvd	1960	Concrete continuous	13,121	6/6/6	GD	ND		PV	2
3	08	001	57.06	20459	Hwy 1 NB over Beacon Dr	2008	Prestressed concrete continuous	12,022	6/7/6	GD	ND		NV	
3	08	001	57.06	20460	Hwy 1 SB over Beacon Dr	2008	Prestressed concrete continuous	11,515	6/8/6	GD	ND		NV	
3	08	001	61.45	20549	Louse Creek & Conn, Hwy 1 NB	2008	Prestressed concrete	8,326	6/7/7	GD	ND		NV	
3	08	001	61.45	20550	Louse Creek & Conn, Hwy 1 SB	2008	Prestressed concrete	8,326	6/7/7	GD	ND		NV	
3	08	001	55.78	20551	Hwy 1 over Hwy 482 Spur	2008	Prestressed concrete continuous	29,363	6/6/6	GD	ND		NV	
3	08	C2600	60.17	08019A	Merlin Hill Frtg Rd (Highland Av) over Hwy 1 Monument Dr. (Jumpoff Joe Conn) Over	1957	Concrete continuous	8,387	6/5/6	PR	ND		V	
3	08	001DF	66.22	08093B	Hwy 001	1958	Concrete continuous	8,510	6/5/6	PR	ND		PV	2
3	08	001	55.40	08333	Hwy 1 over Foothill Blvd	1960	Concrete continuous	19,176	6/6/6	GD	ND		PV	2
3	08	001	57.50	08338	Hwy 1 over Hillcrest Dr	1960	Concrete continuous	14,784	6/6/6	GD	ND		V	2
3	08	001	58.18	08500	Hwy 1 over Scoville Rd	1959	Prestressed concrete	17,265	6/7/6	GD	ND		V	2
3	08	001	58.06	08501	Hwy 1 over Hwy 25 NB	1960	Prestressed concrete	15,920	6/7/7	GD	OD	VC	V	2
3	08	038	2.19	01144	Chapman Creek, Hwy 38	1926	Concrete	1,577	7/6/6	GD	ND		NV	
3	08	038	9.98	03818A	Little Grayback Creek, Hwy 38	1967	Prestressed concrete	1,062	7/7/7	VG	ND		NV	
3	08	038	11.75	03820A	Grayback Creek, Hwy 38	1966	Prestressed concrete	1,504	7/6/6	GD	ND		NV	
3	08	038	18.17	18141	Lake Creek, Hwy 38	1999	Prestressed concrete	4,006	7/7/6	GD	ND		NV	
3	08	025	40.24	01074A	Elk Creek, Hwy 25	1959	Concrete continuous	4,842	6/6/6	GD	ND		PV	4
3	08	025	40.87	01118A	Dwight Creek, Hwy 25	1924	Concrete continuous	2,987	7/6/5	PR	ND		PV	4
3	08	025	26.80	01200A	Holton Creek, Hwy 25	1926	Concrete	1,258	7/6/6	GD	ND		NV	
3	08	025	36.67	19268	West Fork Illinois River, Hwy 25 at MP 36.67	2005	Prestressed concrete Prestressed concrete	7,010	7/7/6	GD	ND		NV	
3	08	025	34.28	19708	Rough and Ready Creek, Hwy 25	2005	continuous	11,621	7/8/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	025	27.78	20391	George Creek, Hwy 25	2008	Prestressed concrete	4,080	7/7/7	VG	ND		NV	
3	08	025	19.28	01194A	Anderson Creek, Hwy 25 at MP 19.28	1927	Concrete	1,480	7/6/7	GD	ND		NV	
3	08	025	24.57	01199A	Reeves Creek, Hwy 25	1926	Concrete	1,149	7/6/6	GD	ND		V	4
3	08	025	20.74	09187	Deer Creek, Hwy 25	1964	Prestressed concrete	20,896	7/7/6	GD	ND		V	4
3	08	025	29.40	19267	East Fork Illinois River, Hwy 25	2006	Steel continuous Prestressed concrete	22,018	7/8/6	GD	ND		NV	
3	08	025	32.10	19709	West Fork Illinois River, Hwy 25 at MP 32.10	2006	continuous	17,099	7/8/6	GD	ND		NV	
3	08	025	18.15	01201A	Anderson Creek, Hwy 25 at MP 18.15	1927	Concrete	1,110	7/6/6	GD	ND		NV	
3	08	025	12.86	01268A	Waters Creek, Hwy 25 (Slate Creek)	1927	Concrete	1,103	6/6/6	GD	ND		V	4
3	08	025	2.95	08800	Sand Creek, Hwy 25	1960	Concrete continuous	-	7	VG	ND		PV	4
3	08	025	14.17	01269A	Slate Creek, Hwy 25 at MP 14.17	1927	Concrete	2,489	7/6/5	PR	ND		V	4
3	08	025	14.28	01270A	Slate Creek, Hwy 25 at MP 14.28	1927	Concrete	1,289	6/6/5	PR	ND		V	4
3	08	025	14.32	01271A	Butcher Knife Creek, Hwy 25	1927	Concrete	1,474	7/6/5	PR	ND		NV	
3	08	025 C	7.10	18091	Slate Creek, Hwy 25 Frtg Rd Lt at MP F7.10	1961	Steel Prestressed concrete	658	6/6/5	PR	ND		NV	
3	08	025	6.97	21343	Applegate River, Hwy 25	2012	continuous	24,483	7/6/7	GD	ND		NV	
3	08	025	-0.24	08432	Rogue River, Hwy 25 NB (7th St)	1960	Steel continuous	25,561	6/6/6	GD	OD	VC	V	4
3	08	025	-0.14	01418	Rogue River, Hwy 25 SB (6th St, Caveman)	1931	Concrete continuous Prestressed concrete	21,633	6/4/5	PR	SD	VC	V	4
3	08	482	0.14	16844	Rogue River, Hwy 482 Spur	1990	continuous	45,652	6/7/7	GD	ND		PV	4
3	08	482	0.68	16845	Hwy 482 Spur over CORP	1990	Prestressed concrete	21,653	6/7/6	GD	ND		PV	4
3	08	001	30.69	08771N	Bear Creek, Hwy 1 NB at MP 30.69	1961	Prestressed concrete	9,238	6/7/6	GD	ND		V	2
3	08	001	30.69	08771S	Bear Creek, Hwy 1 SB at MP 30.69	1961	Prestressed concrete	9,210	6/7/6	GD	ND		V	2
3	08	022	0.47	08821	Hwy 22 over Hwy 1	1961	Prestressed concrete	26,150	7/7/6	GD	ND		V	3
3	08	001	29.64	08851	Hwy 1 over McAndrews Rd	1961	Prestressed concrete	14,147	6/7/6	GD	ND		V	2

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	001	34.28	0M220	Griffin Creek, Hwy 1	1961	Concrete continuous	-	6	GD	ND		PV	2
3	08	001	35.24	0M221	Jackson Creek, Hwy 1	1961	Concrete continuous	-	6	GD	ND		PV	2
3	08	001	36.09	20021	Hwy 1 SB over CORP (Seven Oaks)	2008	Prestressed concrete continuous	17,340	6/7/7	GD	ND		NV	
3	08	001	36.09	20022	Hwy 1 NB over CORP (Seven Oaks)	2008	Prestressed concrete continuous	17,340	6/7/6	GD	ND		NV	
3	08	C0000	0.17	20557	Upton Rd over Hwy 1	2008	Prestressed concrete continuous	11,371	6/8/6	GD	ND		NV	
3	08	001 F	40.85	21439	Kane Creek, Hwy 1 Front Rd Lt	2011	Prestressed concrete	3,432	8/7/7	VG	ND		NV	
3	08	001	75.71	06530A	Coyote Creek, Hwy 1 Creek & County Rd + CORP, Hwy 1 at MP	1965	Concrete	5,475	7/6/5	PR	ND		NV	
3	08	001	49.46	08375	49.46	1961	Concrete continuous	51,567	6/5/5	PR	ND		V	2
3	08	001	49.07	08376	Evans Creek, Hwy 1	1961	Concrete continuous	22,228	6/6/6	GD	ND		PV	2
3	08	001	48.82	08377	Hwy 1 over Depot St	1961	Prestressed concrete	12,792	6/7/6	GD	ND		V	2
3	08	001	48.71	08378	Ward Creek, Hwy 1	1962	Concrete continuous	-	5	FR	ND		PV	2
3	08	001	45.61	08381N	Rogue River, Hwy 1 NB (Homestead)	1961	Concrete continuous	26,491	6/5/6	PR	ND		V	2
3	08	001	45.61	08381S	Rogue River, Hwy 1 SB (Homestead)	1961	Concrete continuous	27,978	6/5/5	PR	ND		V	2
3	08	001	45.47	08383N	Hwy 1 NB over Hwy 60	1961	Steel	12,950	6/6/5	PR	ND		V	2
3	08	001	45.47	08383S	Hwy 1 SB over Hwy 60	1961	Steel	9,544	6/5/5	PR	ND		V	2
3	08	001	43.08	07596	Hwy 1 over Galls Creek Front Rd Conn	1952	Concrete	2,699	6/6/6	GD	ND		NV	
3	08	486	3.07	07601B	Hwy 486 Spur over Hwy 1 (S Gold Hill)	1953	Concrete continuous	7,425	6/5/5	PR	ND		V	
3	08	C0000	0.00	07776	Tolo Road over Hwy 1 Central Point Rd Conn #2 (East Pine St) over	1955	Concrete continuous	5,673	6/6/6	GD	ND		V	
3	08	C0000	32.75	08542	Hwy 1 Bear Creek & Table Rock Rd, Hwy 1 at MP	1961	Concrete continuous	29,854	6/5/6	PR	OD	VC	PV	
3	08	C0000	0.00	08543	31.30	1961	Concrete continuous	25,846	6/5/5	PR	OD	LSL	PV	
3	08	063AE	0.35	20151	Hwy 1 SB On-Ramp over Jackson Creek	2008	Prestressed concrete	1,650	6/8/7	GD	ND		NV	
3	08	001	38.73	20559	Hwy 1 over Foley Lane Frontage Rd	2008	Prestressed concrete	10,361	6/7/6	GD	ND		NV	


2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	001AV	24.40	21383	Fern Valley Rd Conn AV over Hwy 001	2016	Prestressed concrete continuous	16,762	7/8/7	VG	ND		NV	
3	08	063	1.09	00392A	Jackson Creek, Hwy 63	1954	Concrete continuous	-	6	GD	ND		NV	
3	08	063	14.39	02403	Wagner Creek, Hwy 63	1937	Concrete	2,990	6/6/6	GD	ND		NV	
3	08	C0971	0.03	07991	Bear Creek, County Rd 971	1956	Concrete continuous	6,282	6/6/5	PR	ND		V	
3	08	063	19.07	08049	Ashland Creek, Hwy 63 NB	1956	Concrete continuous	10,836	5/6/6	PR	ND		V	
3	08	063	23.79	08749	Hwy 63 over Hwy 1 (S Ashland Intchg)	1963	Concrete continuous	9,204	6/5/5	PR	ND		PV	
3	08	063	19.09	0M274	Ashland Creek, Hwy 63 SB	1911	Concrete	1,447	4/4/4	PR	SD	SD	NV	
3	08	063	0.37	20020	Hwy 63 over Hwy 1 (Seven Oaks Intchg)	2008	Prestressed concrete continuous	19,008	6/7/6	GD	ND		NV	
3	08	063	2.18	01935A	Griffin Creek, Hwy 63	1954	Concrete continuous	-	6	GD	ND		NV	
3	08	063	8.03	03660	Crooked Creek, Hwy 63	1952	Concrete continuous	-	6	GD	ND		NV	
3	08	063	8.17	03661	Irrigation Canal, Hwy 63 at MP 8.17	1952	Concrete continuous	-	7	VG	ND		NV	
3	08	045	11.79	22314	Luder Creek, Hwy 45	2016	Prestressed concrete	3,784	7/8/7	VG	ND		#N/A	#N/A
3	08	001	76.60	09337	Hwy 1 over N Wolf Creek Conn	1965	Prestressed concrete	21,941	7/7/6	GD	OD	VC	V	2
3	08	001	76.03	09339	Hwy 1 over S Wolf Creek Conn	1965	Prestressed concrete continuous	16,254	7/6/6	GD	ND		PV	2
3	08	001	80.76	09352	Hwy 1 NB & Conn over Conn (Glendale Intchg)	1965	Prestressed concrete	9,012	7/6/7	GD	ND		V	2
3	08	001	80.80	09352A	Hwy 1 SB & Conn over Conn (Glendale Intchg)	1965	Prestressed concrete	11,056	7/7/6	GD	ND		V	2
3	08	001	71.39	09439	Hwy 1 NB & Conn over Sunny Valley Rd	1966	Concrete continuous	6,949	6/6/6	GD	ND		PV	2
3	08	001	71.39	09439A	Hwy 1 SB & Conn over Sunny Valley Rd	1966	Concrete continuous	7,409	7/6/6	GD	ND		PV	2
3	08	001	71.93	09440	Hwy 1 NB over Leland Rd	1966	Prestressed concrete	7,056	7/7/6	GD	ND		V	2
3	08	001	71.93	09440A	Hwy 1 SB over Leland Rd	1966	Prestressed concrete	7,350	7/8/6	GD	ND		V	2
3	08	001	71.72	19626	Grave Creek, Hwy 1 SB	2004	Prestressed concrete continuous	13,283	6/7/7	GD	ND		NV	
3	08	001	71.72	19627	Grave Creek, Hwy 1 NB	2004	Prestressed concrete continuous	15,658	6/8/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 8

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
3	08	001	28.66	08332	Medford Viaduct, Hwy 1	1962	Steel	217,795	5/6/6	PR	ND		V	5
3	08	001DX	78.83	09334	Speaker Rd over Hwy 1	1965	Prestressed concrete	8,309	6/7/6	GD	ND		PV	
3	08	001BE	27.58	08676B	Barnett Rd over Hwy 1	1962	Steel continuous	21,170	4/6/6	PR	SD	SD	PV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 9 APRIL 2017

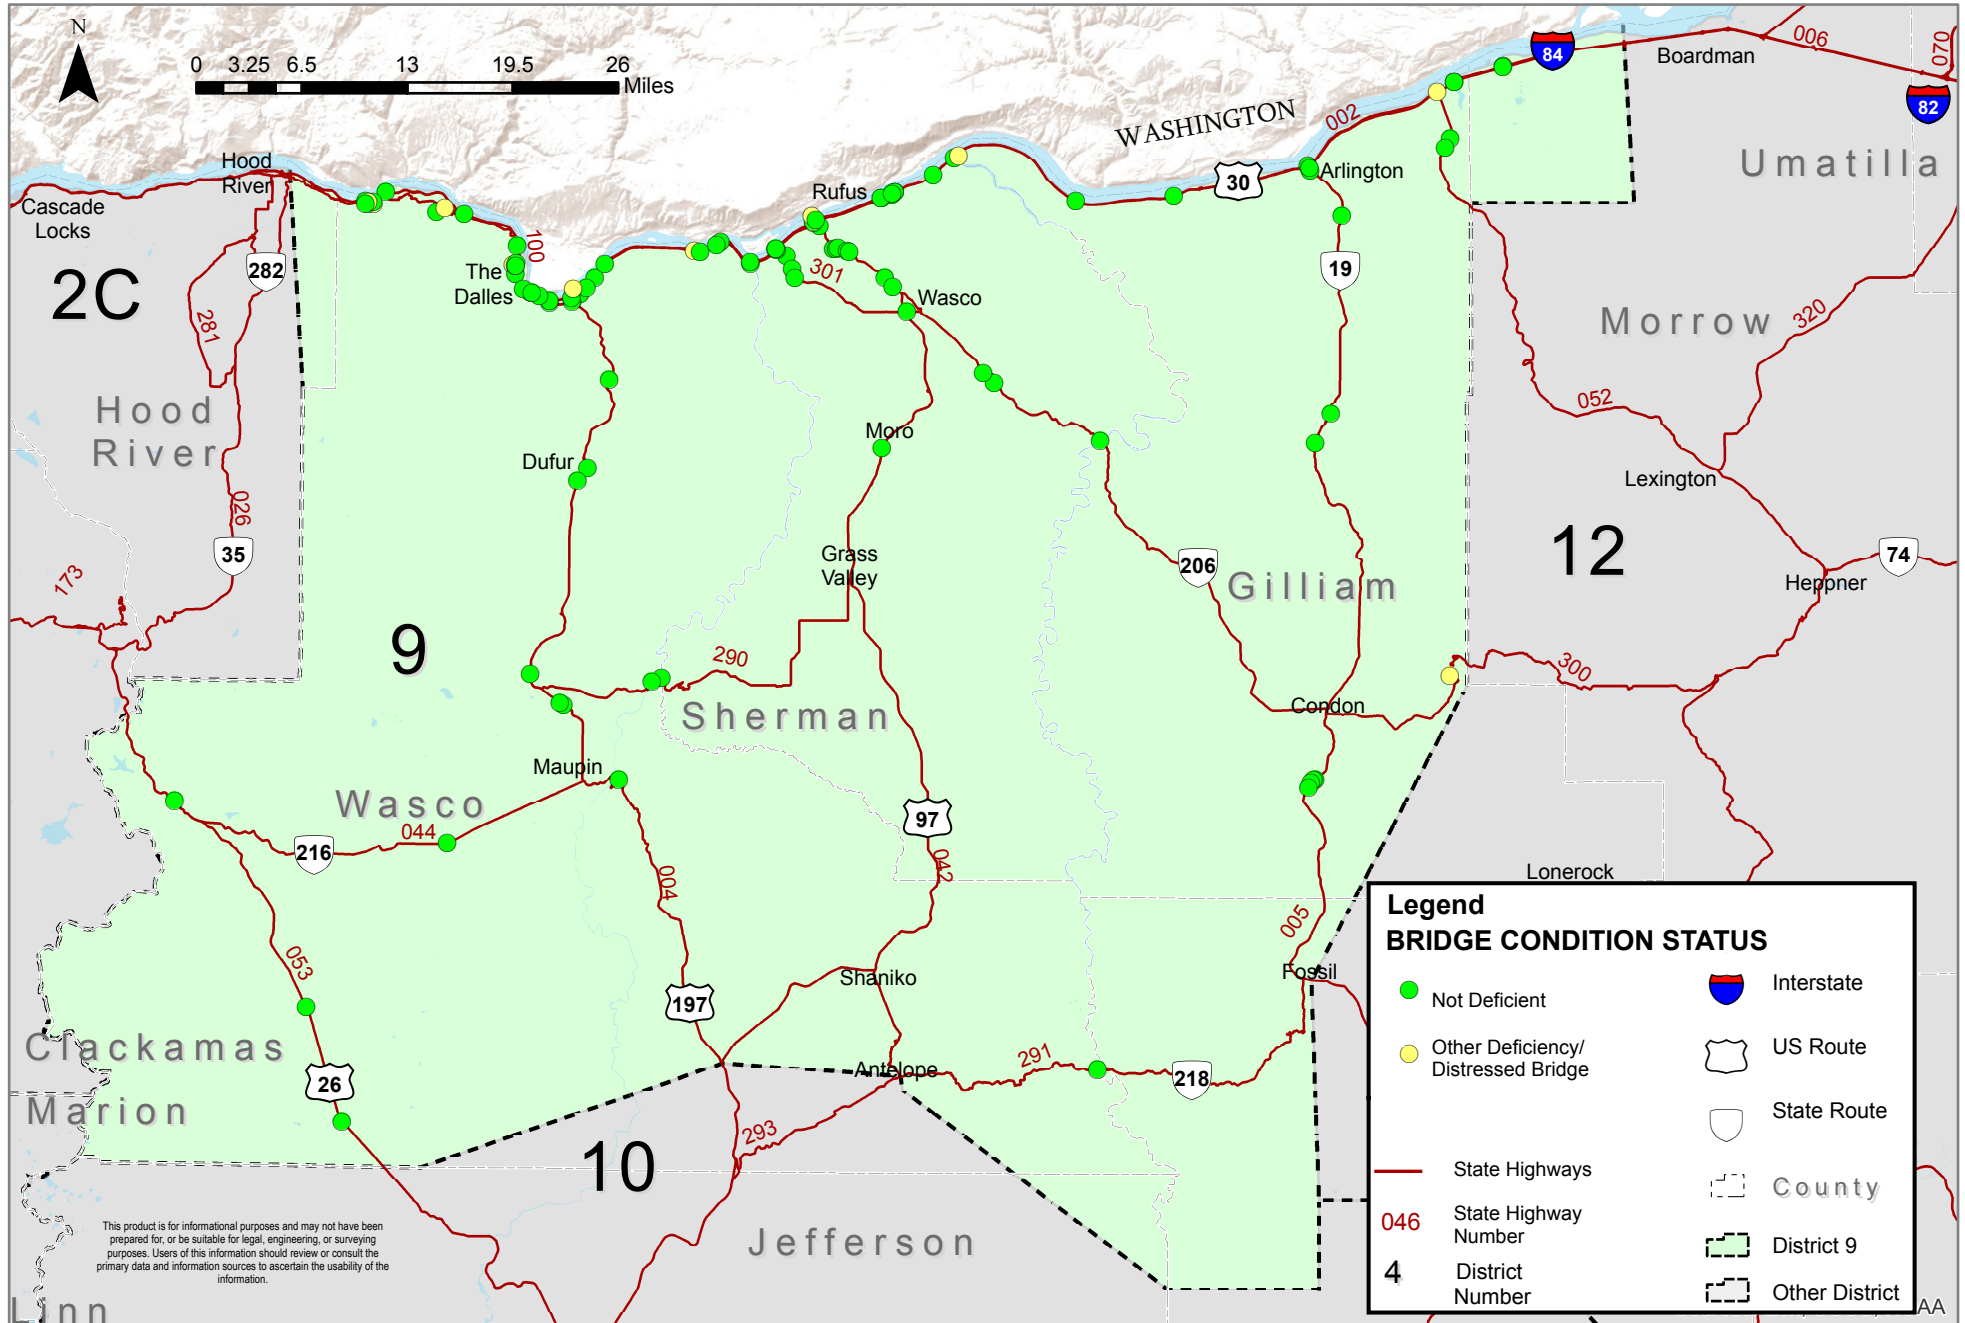

2017 BRIDGE CONDITION REPORT - District 9

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	09	042	-0.43	00849A	Columbia River, Hwy 42 (Biggs Rapids, Sam Hill)	1962	Steel	82,144	5/5/6	PR	OD	LSL VC	PV	1
4	09	002	69.62	07392	Rock Creek, Hwy 2	1953	Concrete continuous	9,324	6/6/6	GD	ND		PV	1
4	09	002IA	69.85	07397	Mosier Conn over UPRR	1953	Concrete continuous	6,143	6/6/7	GD	ND		PV	
4	09	002	76.64	07552A	Hwy 2 over Rowena Conn	1954	Concrete continuous	7,551	6/6/6	GD	ND		PV	1
4	09	002IC	69.65	07626A	Mosier WB Conn over Hwy 2	1953	Concrete continuous	5,845	6/6/6	GD	OD	DG	PV	
4	09	002	88.83	07771	Hwy 2 over The Dalles Dam Access Conn	1954	Concrete	2,980	6/6/7	GD	ND		NV	
4	09	002	97.45	08831	Hwy 2 over UPRR	1965	Steel continuous	38,159	7/6/6	GD	ND		PV	1
4	09	002	89.89	08924	Hwy 2 WB over UPRR (Big Eddy WB)	1965	Steel continuous	13,015	6/7/7	GD	ND		PV	1
4	09	002	97.14	08934	Hwy 2 over Hwy 301	1965	Prestressed concrete	11,481	7/6/8	GD	ND		PV	1
4	09	301	14.73	13548	Hwy 301 over Hwy 42 (Wasco Intchg)	1973	Prestressed concrete	7,238	7/7/7	VG	ND		NV	
4	09	100	57.28	65C63	Rock Creek, Hwy 100	1930	Concrete continuous	1,017	6/6/6	GD	ND		PV	
4	09	002	114.23	08942	Hwy 2 over Conn (W John Day Intchg)	1963	Concrete	2,837	7/7/7	VG	ND		NV	
4	09	002FV	123.31	08944	Phillipi Canyon Rd over Hwy 2	1964	Prestressed concrete	5,715	7/8/8	VG	ND		NV	
4	09	002	129.43	08945	Hwy 2 over Blalock Conn	1964	Prestressed concrete	12,230	7/7/8	VG	ND		NV	
4	09	002	109.95	09225	Hwy 2 EB over Rufus Conn	1965	Concrete continuous	5,292	7/7/8	VG	ND		NV	
4	09	002	109.95	09225A	Hwy 2 WB over Rufus Conn	1965	Concrete continuous	5,334	7/7/8	VG	ND		NV	
4	09	002	112.57	0P141	Helms Creek, Hwy 2	1964	Steel	-	8	VG	ND		NV	
4	09	002	80.79	07550	Hwy 2 over Taylor-Frantz Rd Conn	1954	Concrete continuous	7,434	6/6/7	GD	ND		PV	
4	09	002	84.28	08603	Hwy 2 EB over UPRR	1964	Steel	9,792	7/6/6	GD	ND		PV	1
4	09	002	84.28	08603W	Hwy 2 WB over UPRR	1964	Steel	10,135	6/6/6	GD	ND		PV	1
4	09	002	84.15	08775	Hwy 2 over Hwy 292 at MP 84.15	1964	Steel continuous	30,600	6/6/6	GD	ND		PV	1
4	09	002	83.67	19745	Hwy 2 over Hwy 292 at MP 83.67	2005	Prestressed concrete	17,039	7/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 9

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	09	290	7.65	00939A	Deschutes R Hwy 290 (Sherars)	1979	Prestressed concrete	2,389	7/8/8	VG	ND		NV	
4	09	290	8.30	05208	Buck Hollow Creek, Hwy 290	1947	Concrete continuous	5,966	6/6/6	GD	ND		PV	
4	09	002	82.62	08276	Hwy 2 over Hostetler Way Conn	1957	Concrete continuous	12,802	7/6/7	GD	ND		PV	
4	09	005	19.25	00795A	Juniper Canyon, Hwy 5	1982	Prestressed concrete	1,373	8/8/8	VG	ND		NV	
4	09	005	43.92	01103A	Thirtymile Creek, Hwy 5	1972	Prestressed concrete continuous	16,293	7/8/8	VG	ND		NV	
4	09	300	51.67	01792	Rock Creek, Hwy 300	1934	Steel	2,703	6/5/6	PR	OD	TS	PV	
4	09	005	4.03	03456	China Creek, Hwy 5 at MP 3.99	1995	Concrete	-	7	VG	ND		NV	
4	09	005	0.58	09168	China Creek Hwy 005 at MP 0.58	1964	Prestressed concrete	3,761	7/8/7	VG	ND		NV	
4	09	005AA	0.73	09170	China Creek Hwy 005AA Cottonwood Conn at MP 0.73	1964	Concrete	2,730	7/7/7	VG	ND		NV	
4	09	005	43.23	13567	Condon Canyon Creek, Hwy 5 at MP 43.23	1972	Steel	-	7	VG	ND		NV	
4	09	005	43.36	13568	Condon Canyon Creek, Hwy 5 at MP 43.36	1972	Steel	-	7	VG	ND		NV	
4	09	005	43.62	13569	Condon Canyon Creek, Hwy 5 at MP 43.62	1972	Steel	-	7	VG	ND		NV	
4	09	005	17.03	19893	Rock Creek, Hwy 5 (Olex)	2005	Prestressed concrete	4,995	8/8/8	VG	ND		NV	
4	09	301	2.92	00332	Deschutes River, Hwy 301	1955	Concrete continuous	22,960	6/6/5	PR	ND		PV	
4	09	301	4.76	01750A	Fulton Canyon Creek, Hwy 301 at MP 4.76	1955	Concrete continuous	4,830	7/7/6	GD	ND		PV	
4	09	044	16.79	04936A	Wapinitia Creek, Hwy 44	1975	Prestressed concrete	3,827	7/7/7	VG	ND		NV	
4	09	301	5.64	09456	Fulton Canyon Creek, Hwy 301 at MP 5.64	1966	Prestressed concrete	1,440	7/7/6	GD	ND		NV	
4	09	301	6.45	0M093	Culvert, Hwy 301 at MP 6.45	1920	Concrete continuous	750	6	GD	ND		NV	
4	09	301	7.05	0M116	Culvert, Hwy 301 at MP 7.05	1955	Concrete continuous	-	7	VG	ND		NV	
4	09	002	71.16	18408	Hwy 2 over UPRR (Shogren)	2001	Prestressed concrete	32,471	7/8/7	VG	ND		NV	
4	09	002	84.78	19156	Hwy 2 over Union St (The Dalles)	2003	Prestressed concrete continuous	6,795	7/8/8	VG	ND		NV	
4	09	002	88.04	20875	Fifteen Mile Creek HWY 002 at MP 88.04	2010	Prestressed concrete continuous	26,400	7/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 9

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	09	004	45.84	00966	Deschutes River & BNSF, Hwy 4 (Maupin)	1929	Steel	24,367	5/6/6	PR	ND		PV	4
4	09	004	35.52	08993	White River, Hwy 4	1962	Prestressed concrete	10,199	7/7/6	GD	ND		PV	4
4	09	004	35.25	08994	Tygh Creek, Hwy 4	1962	Prestressed concrete	5,240	7/7/7	VG	ND		PV	4
4	09	291	23.07	09691	John Day River, Hwy 291	1975	Steel	16,155	7/6/7	GD	ND		NV	
4	09	053	92.68	01660	Mill Creek, Hwy 53	1948	Steel continuous	18,760	6/6/6	GD	ND		PV	3
4	09	100	57.84	00498	Mosier Creek, Hwy 100	1920	Concrete	4,186	5/5/6	PR	OD	LSL	PV	
4	09	100	72.10	00506	Chenoweth Creek, Hwy 100	1920	Concrete continuous	1,492	6/5/5	PR	OD	LSL	PV	
4	09	100	63.15	00523	Hog Creek Canyon, Hwy 100 (Rowena Dell)	1920	Concrete	554	6/6/6	GD	ND		NV	
4	09	100	63.79	00524	Dry Canyon Creek, Hwy 100	1921	Concrete	2,323	5/5/6	PR	OD	LSL	PV	
4	09	002	70.10	20798	Mosier Creek Bridge HWY 002 at MP 70.10	2009	Prestressed concrete	14,960	7/8/8	VG	ND		NV	
4	09	002FI	109.71	01833	Gurkin Canyon Creek, Hwy 2 Frontage Rd	1933	Concrete continuous	1,570	6/6/6	GD	ND		PV	
4	09	002	104.76	02133A	Spanish Hollow Creek, Hwy 2	1964	Prestressed concrete	14,638	7/6/7	GD	ND		PV	1
4	09	002	109.02	09213	Hwy 2 WB over UPRR	1965	Steel continuous	16,488	6/6/7	GD	ND		NV	
4	09	002	109.02	09213A	Hwy 2 EB over UPRR	1965	Steel continuous	16,200	6/6/7	GD	ND		NV	
4	09	002	109.78	09232	Scott Canyon, Hwy 2 WB	1965	Prestressed concrete	12,741	7/7/7	VG	ND		NV	
4	09	002	109.78	09232A	Scott Canyon, Hwy 2 EB	1965	Prestressed concrete	9,223	7/7/7	VG	ND		NV	
4	09	042	19.62	00817	Slaughterhouse Creek, Hwy 42	1961	Prestressed concrete	1,260	7/7/6	GD	ND		NV	
4	09	002FI	104.75	02133	Spanish Hollow Creek, Hwy 2 Frontage Rd	1936	Concrete continuous	14,342	5/6/6	PR	ND		PV	
4	09	042	6.20	09997	Spanish Hollow Creek, Hwy 42 at MP 6.20	1973	Prestressed concrete	6,098	7/7/7	VG	ND		PV	
4	09	042	6.98	09998	Spanish Hollow Creek, Hwy 42 at MP 6.98	1973	Prestressed concrete	5,661	7/6/6	GD	ND		PV	
4	09	052	3.94	00906A	Willow Creek, Hwy 52 EB	1979	Prestressed concrete	5,232	7/6/7	GD	ND		NV	
4	09	002	148.57	07520A	Willow Creek WB, Hwy 2	1954	Prestressed concrete	10,074	6/7/7	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 9


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	09	002	137.91	08820	Arlington Viaduct, Hwy 2 over Hwy 5 NB	1964	Steel	98,167	6/6/6	GD	ND		NV	
4	09	002	148.60	09197	Willow Creek EB, Hwy 2	1965	Prestressed concrete	11,832	7/7/7	VG	OD	LSL	NV	
4	09	052	0.31	09198	Hwy 52 over Hwy 2	1964	Prestressed concrete	8,875	7/8/7	VG	OD	VC	NV	
4	09	002	151.79	09307	Three Mile Canyon, Hwy 2 WB	1965	Prestressed concrete	5,976	7/7/7	VG	ND		NV	
4	09	052	3.21	09126	Hwy 52 over UPRR	1964	Concrete continuous	6,222	7/6/7	GD	ND		NV	
5	09	002	151.75	09307A	Three Mile Canyon, Hwy 2 EB	1964	Prestressed concrete	8,134	7/7/7	VG	ND		NV	
4	09	042	-0.06	21487	Hwy 42 over UPRR	2014	Concrete	12,767	8/8/8	VG	OD	DG	NV	
4	09	042	-0.08	21488	Hwy 42 over Hwy 2	2014	Concrete	9,492	8/8/8	VG	ND		NV	
4	09	002	114.60	00108B	John Day River, Hwy 2	1963	Steel	109,341	5/7/7	PR	OD	LSL	NV	
4	09	004	32.85	01001A	Butler Creek, Hwy 4	1962	Concrete continuous	4,242	7/6/6	GD	ND		PV	4
4	09	004	14.46	01066A	Pine Creek, Hwy 4 (Pine Hollow Creek, Larch Creek)	1963	Concrete continuous	5,722	6/6/6	GD	ND		PV	4
4	09	002	101.68	01750B	Fulton Canyon, Hwy 2 EB	1964	Concrete continuous	4,754	7/6/7	GD	ND		PV	1
4	09	004	0.00	06635Q	Columbia River, Hwy 4 (The Dalles)	1954	Steel continuous	107,040	5/5/6	PR	OD	Rail LSL VC	PV	4
4	09	004	0.64	08526	Hwy 4 over Hwy 2	1964	Concrete continuous	7,343	7/6/7	GD	ND		PV	4
4	09	004	6.90	08567	Eightmile Creek, Hwy 4	1959	Concrete continuous	3,495	6/6/7	GD	ND		PV	4
4	09	002ET	85.64	08804	Hwy 2 Brewery Grade Conn over UPRR & Fire Rd	1964	Steel	21,385	7/7/7	VG	ND		NV	
4	09	002ET	85.51	08805	Brewery Grade Conn over Hwy 2	1964	Prestressed concrete	6,406	7/7/7	VG	ND		NV	
4	09	002	96.04	08933	Hwy 2 over UPRR (W Celilo Junction)	1965	Steel continuous	26,984	6/5/6	PR	ND		PV	1
4	09	004	13.35	09188	Fifteenmile Creek, Hwy 4	1963	Prestressed concrete	8,680	7/8/8	VG	ND		PV	4
4	09	100	20.20	19152	Three Mile Creek, Hwy 100	2003	Steel	-	8	VG	ND		NV	
4	09	002	86.83	22248	Three Mile Creek, Hwy 2	2016	Prestressed concrete	11,266	7/8/8	VG	ND		#N/A	#N/A
4	09	002	101.68	W1750B	Fulton Canyon, Hwy 2 WB	1964	Concrete continuous	4,754	7/6/7	GD	ND		PV	1

2017 BRIDGE CONDITION REPORT - District 9

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	09	002	87.45	08776	Hwy 2 over UPRR	1964	Steel continuous	42,880	6/6/6	GD	ND		NV	
4	09	002	95.76	08923	Hwy 2 over UPRR (WB Celilo)	1965	Steel continuous	19,314	7/7/6	GD	OD	LSL	PV	1
4	09	002	99.85	00332C	Deschutes River, Hwy 2	1964	Steel	43,500	6/6/6	GD	ND		PV	1
4	09	300	14.95	04623A	John Day River, Hwy 300	1962	Concrete continuous	13,583	6/6/5	PR	ND		NV	
4	09	300	6.63	08613	Hay Canyon, Hwy 300	1959	Concrete continuous	4,511	7/6/7	GD	ND		NV	
4	09	300	5.51	08614	Grass Valley Canyon Creek, Hwy 300	1959	Concrete continuous	5,717	7/6/7	GD	ND		NV	
4	09	004	0.76	06635	Hwy 4 over UPRR & Frontage Rd	1954	Steel continuous	17,585	6/6/7	GD	OD	DG	PV	4
4	09	002	81.89	07553	Chenoweth Creek, Hwy 2	1954	Concrete continuous	30,000	7/6/7	GD	ND		PV	
4	09	002IE	82.07	18153	Hwy 2 River Rd Conn over Hwy 2 (Chenoweth Intchg)	1997	Prestressed concrete	15,197	7/7/7	VG	ND		NV	
4	09	002IE	82.12	18154	Hwy 2 River Rd Conn over UPRR (Chenoweth Intchg)	1998	Concrete	8,757	7/7/8	VG	ND		NV	
4	09	053	69.07	02204	Clear Creek, Hwy 53	1932	Concrete continuous	2,245	6/6/6	GD	ND		PV	3
4	09	053	85.25	18431	Warm Springs River, Hwy 53	1998	Prestressed concrete continuous	9,868	7/7/7	VG	ND		NV	
4	09	042	0.39	08855	Spanish Hollow Creek, Hwy 42 at MP 0.39	1962	Prestressed concrete	13,755	6/7/7	GD	ND		PV	
4	09	042	2.18	08892	Spanish Hollow Cr, Hwy 42 Rt @ MP2.18 (Mud Hollow)	1963	Concrete continuous	1,615	6/5/5	PR	ND		NV	
4	09	042	2.37	08893	Spanish Hollow Creek, Hwy 42 at MP 2.37	1963	Concrete continuous	4,524	5/6/6	PR	ND		PV	
4	09	042	2.48	08894	Spanish Hollow Creek, Hwy 42 at MP 2.48	1963	Concrete continuous	5,775	5/6/6	PR	ND		PV	
4	09	042	3.10	08895	Spanish Hollow Creek, Hwy 42 at MP 3.11	1963	Prestressed concrete	11,827	6/7/7	GD	ND		PV	
4	09	042	3.25	08896	Spanish Hollow Creek, Hwy 42 at MP 3.25	1963	Prestressed concrete	11,653	6/8/7	GD	ND		PV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 10

APRIL 2017

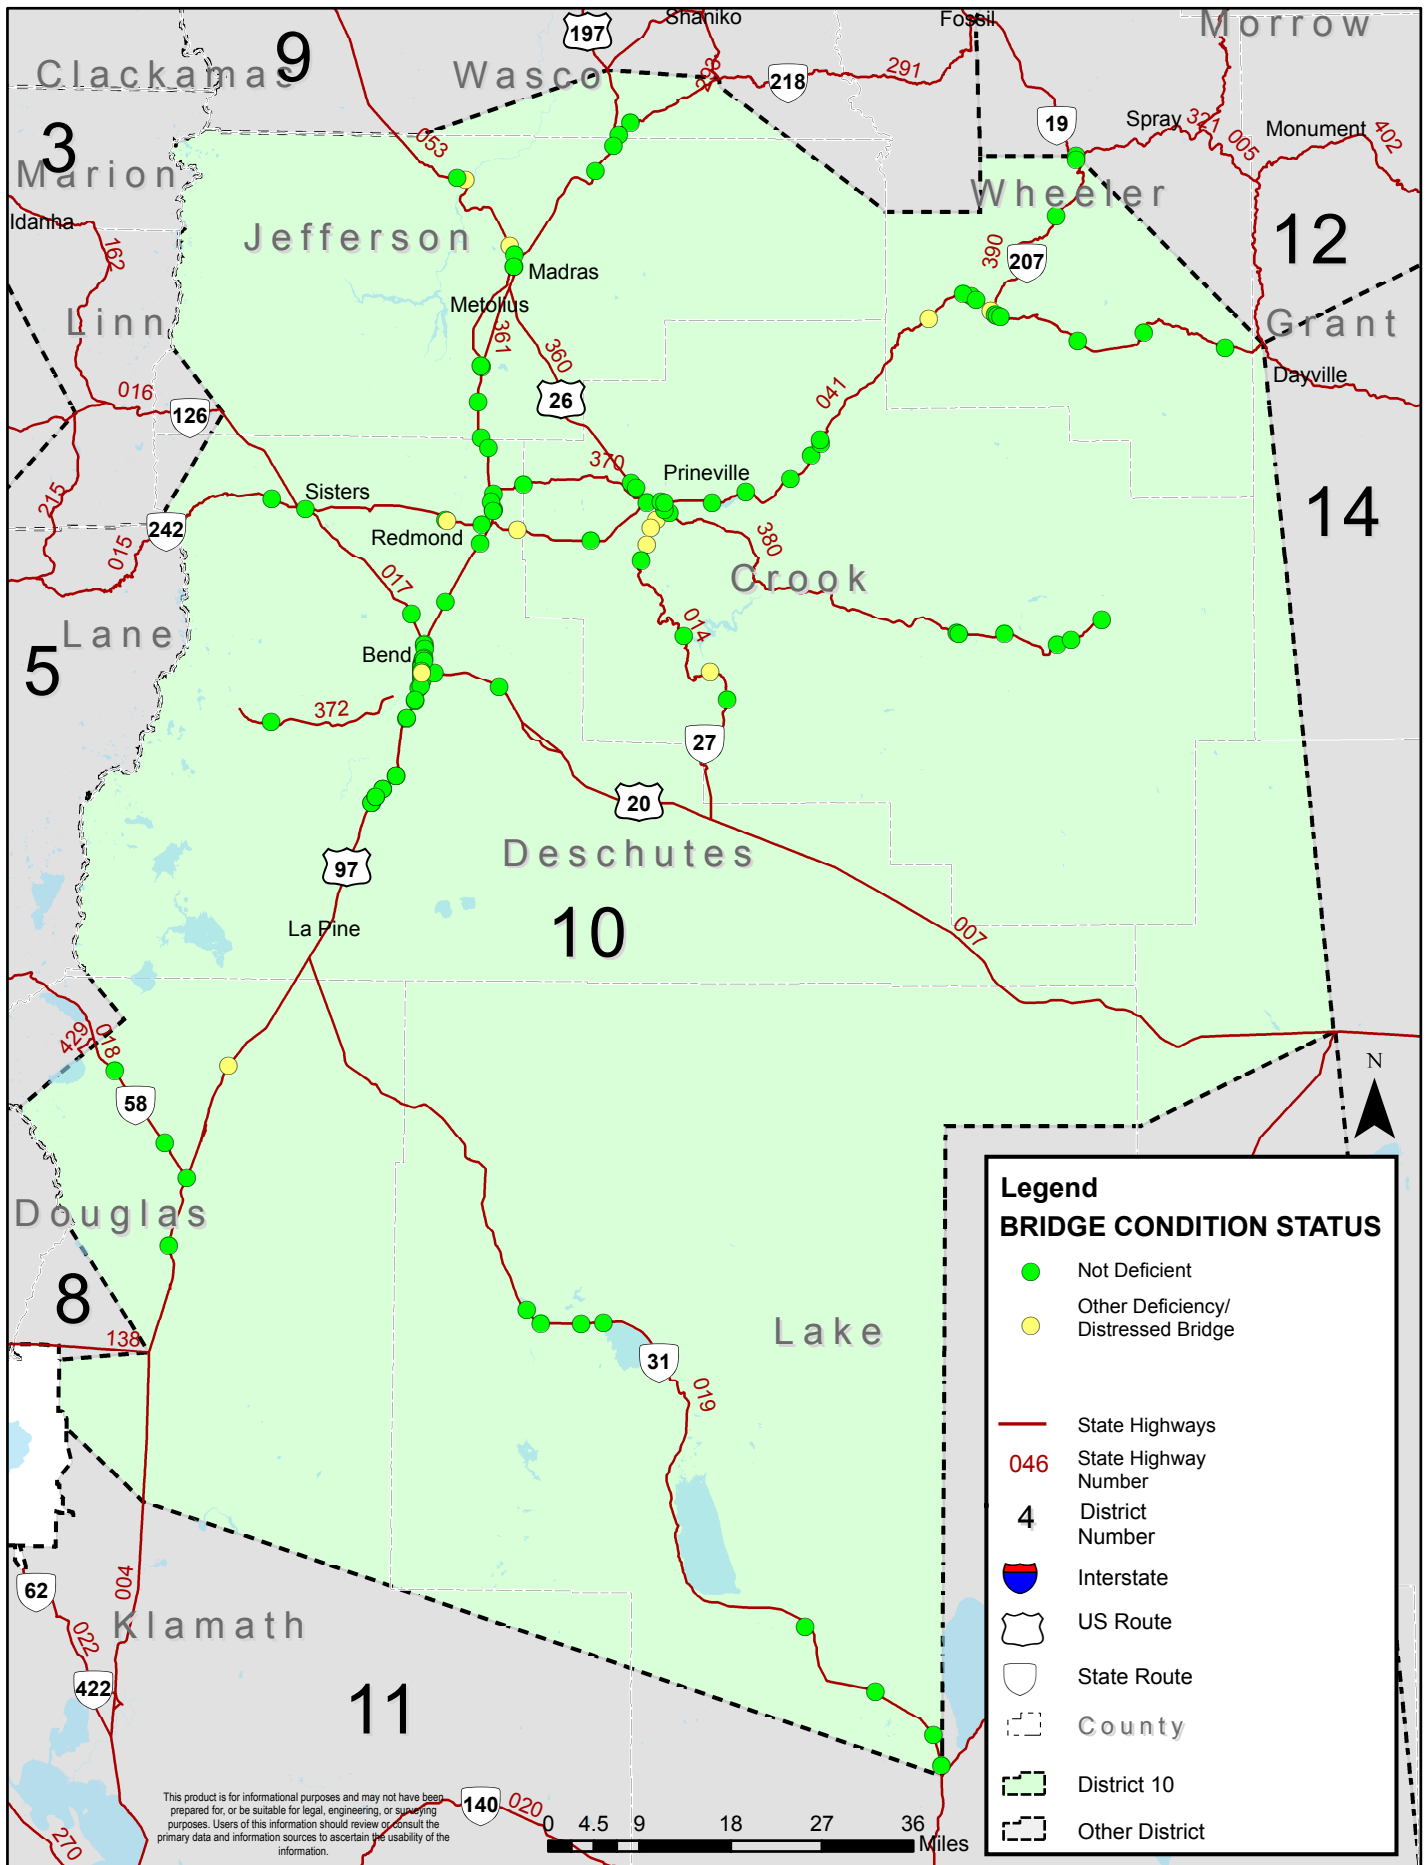

2017 BRIDGE CONDITION REPORT - District 10

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	10	004	138.25	17332	Hwy 4 over Colorado Ave (Bend) & BNSF	1998	Prestressed concrete	17,136	7/8/8	VG	ND		NV	
4	10	004	138.34	18173	Hwy 4 over BNSF Spur & Access Rd	1998	Prestressed concrete	11,710	7/7/8	VG	ND		NV	
4	10	004	151.30	20552	HWY 004 NB OXING Cottonwood Rd Con. at MP 151.30	2009	Prestressed concrete	2,860	7/8/8	VG	ND		NV	
4	10	004	152.00	21014	HWY 004 SB OXING (Wildlife Passage) at MP 152.00	2011	Prestressed concrete	2,288	7/8/8	VG	ND		NV	
4	10	004	149.55	21015	HWY 004 SB OXING Cottonwood Road at MP 149.55	2010	Prestressed concrete	4,928	7/8/8	VG	ND		NV	
4	10	004	149.56	21016	HWY 004 NB OXING Cottonwood Road at MP 149.56	2009	Prestressed concrete	5,016	7/8/8	VG	ND		NV	
4	10	004	152.00	21017	HWY 004 NB OXING (Wildlife Passage) at MP 152.00	2010	Prestressed concrete	2,288	7/8/8	VG	ND		NV	
4	10	004	123.60	16561	Hwy 4 over Yew Ave (Airport Way)	1992	Prestressed concrete	5,600	7/7/6	GD	ND		NV	
4	10	C0000	0.00	18208	Deschutes Market Rd over Hwy 4	1998	Prestressed concrete	5,488	7/8/8	VG	ND		NV	
4	10	C0000	4.11	19837	Maple/Negus Ave Over US97 & BNSF	2005	Prestressed concrete	13,299	8/8/7	VG	ND		NV	
4	10	C0000	0.00	19838	COI Canal & Canal Blvd, Maple/Negus Ave	2006	Prestressed concrete	7,958	8/8/8	VG	ND		NV	
4	10	004	139.50	17333	Central Oregon Canal, Hwy 4 at MP 139.48	2001	Concrete	-	7	VG	ND		NV	
4	10	370	3.85	02770	North Unit Ochoco Main Canal, Hwy 370	1945	Concrete continuous	1,405	6/7/7	GD	ND		PV	
4	10	361	11.25	06827A	North Unit Ochoco Main Canal, Hwy 361	1971	Prestressed concrete	3,224	7/7/6	GD	ND		NV	
4	10	004	112.63	18211	Crooked R Gorge, Hwy 4 (Rex T Barber VeteransMem)	2000	Concrete	42,530	7/7/7	VG	ND		NV	
4	10	004	105.44	19960	North Unit Main Canal, Hwy 4 at MP 105.44	2005	Prestressed concrete	3,120	7/8/8	VG	ND		NV	
4	10	004	108.99	19961	North Unit Main Canal, Hwy 4 at MP 108.99	2005	Prestressed concrete	3,120	7/8/8	VG	ND		NV	
4	10	370	0.21	03379	Pilot Butte Canal, Hwy 370	1961	Prestressed concrete	644	7/7/6	GD	ND		NV	
4	10	017	15.09	17251	Deschutes River, Hwy 17	1993	Prestressed concrete	9,026	7/8/7	VG	ND		NV	
4	10	004BK	135.50	17323	Hwy 4 NB Conn to Hwy 17 EB over Hwy4 (Sisters Int)	2001	Prestressed concrete	6,756	6/7/7	GD	ND		NV	
4	10	380	43.61	03323A	Camp Creek, Hwy 380	1961	Concrete continuous	2,684	6/6/6	GD	ND		NV	
4	10	380	50.56	03325A	South Fork Crooked River, Hwy 380 at MP 50.56	1956	Concrete continuous	3,355	5/6/7	PR	ND		PV	

2017 BRIDGE CONDITION REPORT - District 10

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	10	380	52.09	03326A	Beaver Creek, Hwy 380 at MP 52.09	1956	Concrete continuous	3,355	5/6/7	PR	ND		PV	
4	10	380	55.91	08052	Beaver Creek, Hwy 380 at MP 55.91	1956	Concrete continuous	3,050	6/6/5	PR	ND		PV	
4	10	380	38.48	08701	North Fork Crooked River, Hwy 380	1961	Concrete continuous	3,660	5/6/7	PR	ND		NV	
4	10	380	38.73	08702	South Fork Crooked River, Hwy 380 at MP 38.73	1961	Concrete continuous	3,660	5/6/7	PR	ND		NV	
4	10	041	83.52	01457A	Mountain Creek, Hwy 41 at MP 83.52	1978	Steel	-	8	VG	ND		NV	
4	10	041	94.04	01469	Rock Creek, Hwy 41	1930	Concrete continuous	4,110	6/6/7	GD	ND		PV	
4	10	041	75.84	18432	Mountain Creek, Hwy 41 at MP 75.84	1998	Prestressed concrete	2,156	7/7/8	VG	ND		NV	
4	10	017	18.41	08829	Hwy17 WB over Hwy4 SB Conn to Hwy17 (Sisters Int)	1961	Steel	4,644	6/6/6	GD	OD	DG VC	PV	3
4	10	C0000	0.00	18552	Wilson Ave over Hwy 4	1999	Prestressed concrete	7,056	7/7/7	VG	ND		NV	
4	10	390	9.07	02457A	Shoofly Creek, Hwy 390	1975	Prestressed concrete	1,036	7/7/7	VG	ND		NV	
4	10	390	0.02	05017A	Service Creek, Hwy 390	1966	Prestressed concrete	3,010	7/7/7	VG	ND		NV	
4	10	390	0.46	05018A	John Day River, Hwy 390	1957	Concrete continuous	10,458	6/5/6	PR	ND		PV	
4	10	015	89.40	03372A	Trout Creek, Hwy 15	1981	Concrete	849	7/6/6	GD	ND		NV	
4	10	004	151.30	16712	HWY 004 SB OXING Cottonwood Rd Con at MP 151.30	1984	Prestressed concrete	2,146	8/7/7	VG	ND		PV	
4	10	372	18.28	17202	Hwy 372 over Snow Trail	1991	Prestressed concrete	2,800	7/7/7	VG	ND		NV	
4	10	C0000	139.17	18816	Reed Market Road (Bend) over Hwy 4	2001	Prestressed concrete	14,577	7/7/7	VG	ND		NV	
4	10	041	39.08	07650A	Marks Creek, Hwy 41 at MP 39.08	1965	Prestressed concrete	2,262	7/7/7	VG	ND		NV	
4	10	041	39.43	07651A	Marks Creek, Hwy 41 at MP 39.43	1966	Prestressed concrete	2,280	7/7/7	VG	ND		NV	
4	10	041	28.18	18551	Mill Creek, Hwy 41	1999	Prestressed concrete	3,080	7/8/8	VG	ND		NV	
4	10	041	33.99	20326	Marks Creek, Hwy 41 at MP 33.99	2008	Prestressed concrete	3,584	7/8/8	VG	ND		NV	
4	10	041	37.44	20327	Marks Creek, Hwy 41 at MP 37.44	2009	Prestressed concrete	3,584	7/8/8	VG	ND		NV	
4	10	014	6.32	00537B	Dry Creek, Hwy 14 at MP 6.32	1988	Prestressed concrete	3,412	7/8/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 10

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	10	014	28.67	00990A	Bear Creek, Hwy 14 at MP 28.67	1961	Steel	780	7/5/7	PR	ND		NV	
4	10	014	27.23	08964	Bear Creek, Hwy 14 at MP 27.23	1961	Wood or Timber	1,365	6/6/6	GD	OD	TS LC	NV	
4	10	014	19.62	13597	Crooked River Dam Spillway, Hwy 14	1961	Concrete	528	7/7/7	VG	ND		NV	
4	10	014	1.90	13598	Irrigation Ditch, Hwy 14 at MP 1.90	1961	Wood or Timber	726	7/5/7	PR	OD	TS LC	NV	
4	10	014	2.88	13599	Irrigation Ditch, Hwy 14 at MP 2.88	1961	Wood or Timber	1,389	6/6/7	GD	OD	LC	NV	
4	10	014	4.62	13600	Irrigation Ditch, Hwy 14 at MP 4.59	1961	Wood or Timber	823	6/6/7	GD	OD	LC	NV	
4	10	004	113.94	19962	Hwy 4 over BNSF (Terrebonne) Hwy 4 (Bend Parkway) over Butler Market Rd	2005	Prestressed concrete	8,000	7/7/7	VG	ND		NV	
4	10	004	136.31	17327	(Bend)	1997	Prestressed concrete	15,735	7/7/7	VG	ND		NV	
4	10	004	136.48	17328	Hwy 4 (Bend Parkway) over Hwy 17	1997	Prestressed concrete	14,144	7/7/7	VG	ND		NV	
4	10	017	19.82	17390	U.S.B.R. Canal, Hwy 017 MP 19.81	1993	Steel	-	7	VG	ND		NV	
4	10	004	92.13	00971B	Willow Creek, Hwy 4 SB	1966	Prestressed concrete	2,891	7/6/7	GD	ND		PV	
4	10	053	105.24	01910	Deschutes River, Hwy 53	1934	Steel continuous	25,807	6/7/5	PR	OD	LSL	PV	5
4	10	053	104.36	01987A	Shitike Creek, Hwy 53	1966	Concrete continuous	5,834	6/6/6	GD	ND		PV	3
4	10	004	92.11	20008	Willow Creek, Hwy 4 NB	2006	Prestressed concrete	3,236	7/8/8	VG	ND		NV	
4	10	C0000	0.00	20417	LARCH AVE OVER C.O.I.D. CANAL	2008	Prestressed concrete	1,748	8/8/8	VG	ND		NV	
4	10	C0000	0.00	20416	NORTH CANAL AVE OVER HWY 4	2008	Prestressed concrete	9,938	7/8/8	VG	ND		NV	
4	10	041	24.51	00781	Ochoco Irrigation Canal, Hwy 41	1966	Prestressed concrete	1,067	7/7/7	VG	ND		NV	
4	10	007	8.39	01421A	Central Oregon Canal, Hwy 7	1988	Prestressed concrete	2,160	7/7/7	VG	ND		NV	
4	10	004	1.65	22316	Pedestrian Crossing, Hwy 007 at MP 1.65	2014	Concrete	1,350	8	VG	ND		NV	
4	10	004	137.66	16532	Hwy 4 (Bend Pkwy) SB over Greenwood Ave	1985	Prestressed concrete	4,212	7/7/7	VG	ND		NV	
4	10	004	137.65	16532N	Hwy 4 (Bend Pkwy) NB over Greenwood Ave	2001	Prestressed concrete	3,494	6/7/7	GD	ND		NV	
4	10	004	136.92	17329	Hwy 4 (Bend Pkwy) over Division St (Bend)	1997	Prestressed concrete continuous	30,839	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 10

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	10	004	137.13	17330	Hwy 4 (Bend Pkwy) over Revere Ave (Bend)	1997	Prestressed concrete	12,959	7/7/7	VG	ND		NV	
4	10	004	137.33	17331	Hwy 4 (Bend Pkwy) over Olney Ave (Bend)	1997	Prestressed concrete	8,720	7/7/7	VG	ND		NV	
4	10	004	183.16	19964	Hwy 4 over Crescent Conn	2005	Prestressed concrete	3,162	7/8/7	VG	OD	VC	NV	
4	10	004	202.09	19965	Hwy 4 over UPRR	2006	Prestressed concrete	8,696	7/7/7	VG	ND		NV	
4	10	018	86.30	20394	Hwy 18 WB over Hwy 4 SB	2008	Prestressed concrete	4,136	7/8/8	VG	ND		NV	
4	10	015	93.00	00806A	Wychus Creek, Hwy 15	1957	Prestressed concrete	5,439	7/6/6	GD	ND		PV	
4	10	015	107.65	03373A	Deschutes River, Hwy 15	1957	Concrete continuous	11,868	6/6/6	GD	OD	LSL	PV	
4	10	015AJ	107.48	18283	Cline Falls Rd over Hwy 15	1997	Prestressed concrete	3,744	7/7/7	VG	ND		NV	
4	10	015	111.11	20023	111.11 Glacier Highland Couplet, HWY 015 at MP	2004	Concrete	1,891	7	VG	ND		NV	
4	10	018	82.20	17447	Little Deschutes River, Hwy 18	1995	Prestressed concrete	2,880	8/8/8	VG	ND		NV	
4	10	018	73.40	20156	Crescent Creek, Hwy 18	2006	Prestressed concrete	5,520	7/7/7	VG	ND		NV	
4	10	004	75.04	00815A	Trout Creek, Hwy 4	1954	Concrete continuous	6,486	5/6/6	PR	ND		PV	
4	10	004	78.17	20426	Hay Creek Culvert Hwy 4 at MP 78.17	2007	Steel	-	8	VG	ND		NV	
4	10	053	115.58	07074	North Unit Canal, Hwy 53	1948	Concrete continuous	1,512	6/6/7	GD	OD	Rail	PV	3
4	10	053	116.57	19959	Hwy 53 over BNSF	2005	Prestressed concrete	8,277	7/7/8	VG	ND		NV	
4	10	041	62.54	07372	Bridge Creek, Hwy 41 at MP 62.54	1951	Concrete continuous	3,701	5/5/7	PR	ND		PV	
4	10	041	61.71	07486	West Branch Bridge Creek, Hwy 41	1953	Concrete continuous	2,750	5/6/6	PR	ND		PV	
4	10	041	63.22	07487	Bridge Creek, Hwy 41 at MP 63.22	1953	Concrete continuous	2,511	5/6/6	PR	ND		PV	
4	10	041	65.03	07489	Bridge Creek, Hwy 41 at MP 65.03	1953	Concrete continuous	2,790	5/5/5	PR	OD	LSL	PV	
4	10	041	57.49	07507A	Hwy 41 Frtg Rd over Access Rd Rt	1984	Prestressed concrete	832	7/7/7	VG	OD	DG	NV	
4	10	041	65.63	20051	Bridge Creek, Hwy 41 at MP 65.63	2008	Prestressed concrete	5,760	7/7/8	VG	ND		NV	
4	10	041	65.85	20052	Bridge Creek, Hwy 41 at MP 65.85	2006	Prestressed concrete	4,522	7/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 10

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	10	041	66.19	21397	Bridge Creek, Hwy 41 R/W Right (Mitchell Access)	2012	Concrete	3,456	8/8/8	VG	ND		NV	
4	10	004	153.05	20206	South Century Bridge (NB)	2006	Prestressed concrete	4,128	7/8/8	VG	ND		NV	
4	10	004	153.08	20207	SOUTH CENTURY BRIDGE (SB)	2005	Prestressed concrete	4,128	7/7/8	VG	ND		NV	
4	10	041	10.54	02741	Central Oregon Canal, Hwy 41	1940	Concrete continuous	704	5	FR	ND		NV	
4	10	360	23.71	02745A	McKay Creek, Hwy 360	1985	Prestressed concrete	2,800	8/8/8	VG	ND		NV	
4	10	360	24.42	02746A	Ochoco Creek, Hwy 360	1985	Prestressed concrete	2,800	7/7/8	VG	ND		NV	
4	10	041	3.04	02769	Ochoco North Main Canal, Hwy 41	1945	Concrete continuous	1,536	6/6/6	GD	OD	DG	PV	
4	10	380	0.11	22324	Ochoco Creek, Hwy 380	2014	Prestressed concrete	4,279	8/7/8	VG	ND		NV	
4	10	004	136.62	08887B	Hwy 17 over BNSF	1962	Steel	19,000	6/6/6	GD	ND		NV	
4	10	004	137.94	17324	Hwy 4 (Bend Pkwy) SB over Franklin Ave (Bend)	1979	Prestressed concrete	2,376	7/6/7	GD	ND		NV	
4	10	004	137.98	17324N	Hwy 4 (Bend Pkwy) NB over Franklin Ave (Bend)	2000	Prestressed concrete	1,659	7/8/8	VG	OD	DG	NV	
4	10	004BM	135.46	17325	Empire Ave over Hwy 4 (Bend Parkway)	1997	Prestressed concrete	12,672	7/7/8	VG	ND		NV	
4	10	C0000	0.00	17281	Baker Road over Hwy 4	1994	Prestressed concrete	5,488	7/7/8	VG	ND		NV	
4	10	C0000	143.27	17437	Arnold Ditch, Hwy 4 Conn	1994	Prestressed concrete	743	8/8/8	VG	ND		NV	
4	10	019	116.50	00571A	Chewaucan River, Hwy 19 (Gravelley Ford)	1965	Prestressed concrete	5,700	7/7/6	GD	ND		NV	
4	10	019	98.23	00572A	Chewaucan River, Hwy 19 (Paisley)	1966	Prestressed concrete	9,416	7/7/6	GD	ND		NV	
4	10	019	52.96	01552A	Paulina Marsh, Hwy 19	1985	Prestressed concrete	3,240	7/6/7	GD	ND		NV	
4	10	019	44.76	03907A	South Branch Buck Creek, Hwy 19	1986	Prestressed concrete	1,260	8/8/8	VG	ND		NV	
4	10	019	50.74	03909A	Murdock Creek, Hwy 19	1986	Prestressed concrete	1,260	8/8/8	VG	ND		NV	
4	10	019	109.27	18787	Chewaucan River, Hwy 19 (The Narrows)	2001	Steel	8,840	7/8/7	VG	ND		NV	
4	10	019	119.60	18789	Crooked Creek, Hwy 19 at MP 119.60	2000	Prestressed concrete	2,828	7/8/8	VG	ND		NV	
4	10	019	46.75	19782	Silver Creek, Hwy 19	2006	Prestressed concrete	3,091	8/7/8	VG	ND		NV	


2017 BRIDGE CONDITION REPORT - District 10

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	10	293	3.10	09452	Antelope Creek, Hwy 293 at MP 3.10	1966	Concrete continuous	2,925	7/7/7	VG	ND		NV	
4	10	380	1.37	18716	Flood Control Channel, Hwy 380 at MP 1.37	1987	Steel	756	5	FR	ND		NV	
4	10	380	0.75	18717	Flood Control Channel, Hwy 380 at MP 0.75	1987	Steel	1,080	7	VG	ND		NV	
4	10	293	0.99	19822	Antelope Creek, Hwy 293 at MP 0.99	2005	Prestressed concrete	1,472	7/7/7	VG	ND		NV	
4	10	041	17.97	19889	Crooked River, Hwy 41	2006	Prestressed concrete	11,310	7/7/7	VG	ND		NV	
4	10	041	19.40	20649	Ochoco Creek, Hwy 41	2008	Prestressed concrete	3,712	7/8/8	VG	ND		NV	
4	10	3rd St	140.87	22019	US 97 (HWY 004) at U XING 3RD ST BR	2014	Concrete	4,432	7/8/8	VG	ND		NV	
4	10	3rd St	0.00	22021	US 97 (HWY 004) at U XING MURPHY BR	2014	Concrete	9,851	7/8/8	VG	ND		NV	

OREGON STATE HIGHWAY SYSTEM

2017 BRIDGE CONDITION - DISTRICT 11

APRIL 2017

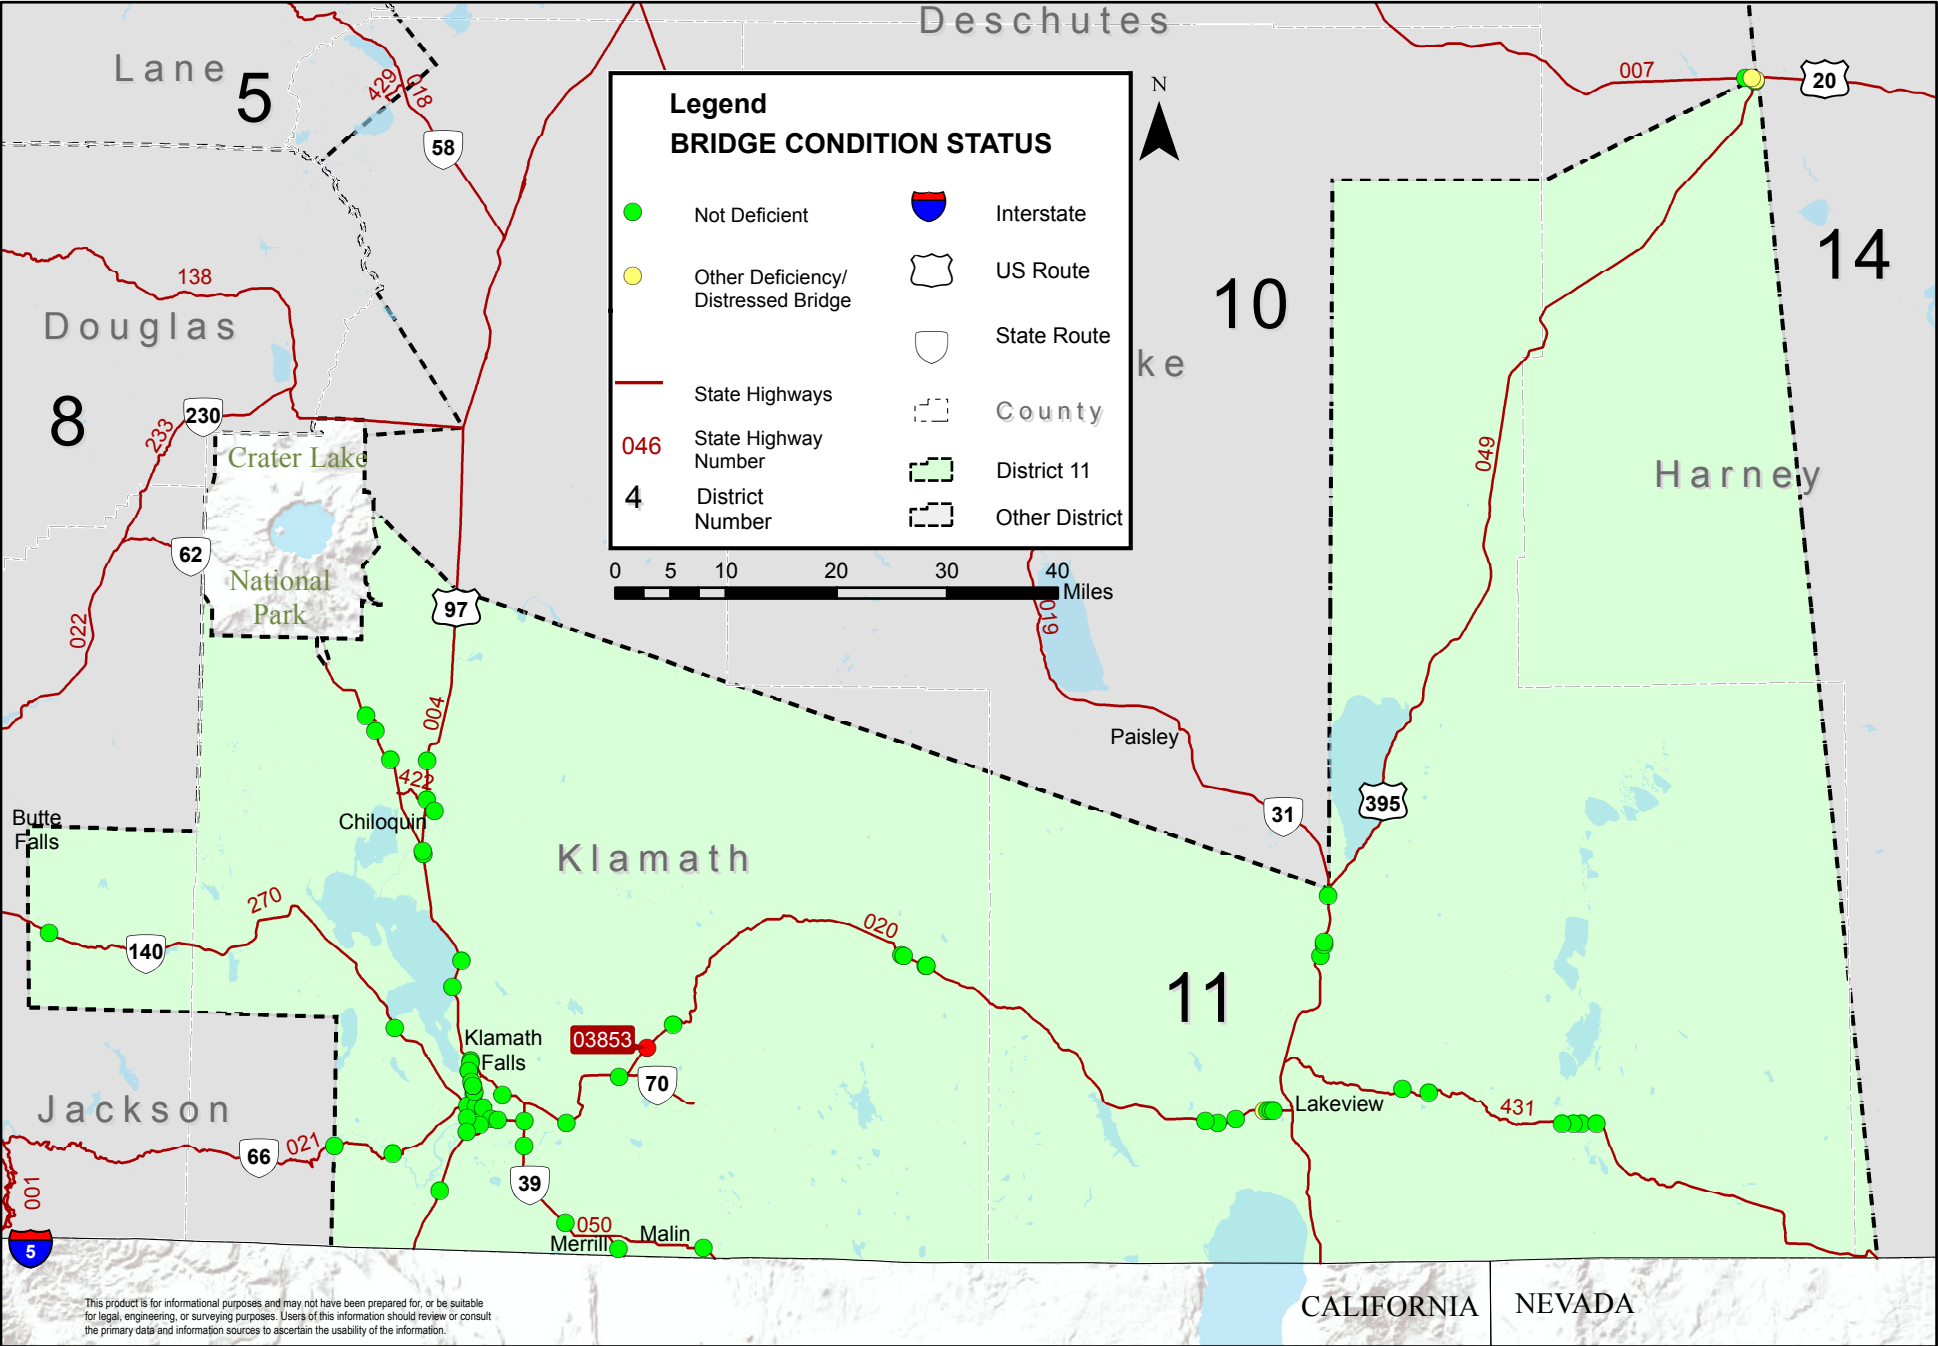

This product is for informational purposes and may not have been prepared for, or be suitable for legal, engineering, or surveying purposes. Users of this information should review or consult the primary data and information sources to ascertain the usability of the information.

2017 BRIDGE CONDITION REPORT - District 11

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	11	020	22.23	03853	Buck Creek, Hwy 20	1960	Concrete	730	5/5/4	PR	SD	SD TS	NV	
4	11	020	54.24	03862A	Fish Hole Creek, Hwy 20 at MP 54.24	1964	Prestressed concrete	2,812	7/7/6	GD	ND		NV	
4	11	020	54.49	03863A	Fish Hole Creek, Hwy 20 at MP 54.49	1964	Prestressed concrete	1,900	7/7/6	GD	ND		NV	
4	11	020	56.62	03864A	South Fork Paradise Creek, Hwy 20	1964	Prestressed concrete	1,137	6/6/7	GD	ND		NV	
4	11	020	56.71	03865A	Paradise Creek, Hwy 20	1964	Prestressed concrete	1,125	6/6/6	GD	ND		NV	
4	11	020	25.35	22110	Wild Horse Creek, Hwy 20 at MP 25.36	2013	Concrete	-	8	VG	ND		NV	
4	11	004	275.03	08347	Link River & Hwy 20, Hwy 4	1963	Steel continuous	34,943	6/7/6	GD	OD	VC	V	
4	11	004AZ	275.38	08347A	Link River, Hwy 4 NB Conn	1967	Concrete continuous	13,913	5/7/6	PR	OD	DG VC	NV	
4	11	020	-0.07	08347R	Hwy 20 over Hwy 4 Ramp to Hwy 20	1963	Concrete continuous	3,024	7/6/8	GD	ND		NV	
4	11	270	58.83	18142	Geary Canal, Hwy 270	1997	Prestressed concrete continuous	10,035	7/7/7	VG	ND		NV	
4	11	270	18.23	03761A	North Fork Little Butte Creek, Hwy 270 at MP 18.23	1962	Concrete continuous	2,558	7/6/6	GD	ND		PV	3
4	11	004	252.52	02474B	Hwy 4 over UPRR (Lobert)	1989	Prestressed concrete	16,753	6/7/7	GD	ND		V	
4	11	004	252.21	02475A	Williamson River, Hwy 4	1989	Prestressed concrete continuous	20,759	6/7/7	GD	ND		NV	
4	11	422Y	4.57	21396	Williamson River, Hwy. 422 (Chocktoot St.)	2011	Prestressed concrete	6,254	8/8/8	VG	ND		NV	
4	11	007	103.67	03504A	Silver Creek Irrigation Ditch, Hwy 7	1988	Prestressed concrete	2,080	7/7/8	VG	ND		NV	
5	11	007	104.23	03505A	Silver Creek, Hwy 7	1956	Concrete	1,527	6/6/6	GD	OD	TS	PV	
5	11	049	0.25	03606	Silver Creek, Hwy 49 at MP 0.25	1963	Prestressed concrete	806	7/7/7	VG	ND		NV	
5	11	049	0.35	03607	Silver Creek, Hwy 49 at MP 0.34	1963	Prestressed concrete	806	7/7/6	GD	ND		NV	
5	11	049	0.41	03608	Silver Creek, Hwy 49 at MP 0.41	1963	Prestressed concrete	806	7/7/6	GD	OD	TS	NV	
4	11	050	25.70	00920A	USRS Canal, Hwy 50 at MP 25.70	1962	Concrete continuous	2,531	7/6/6	GD	ND		NV	
4	11	004	285.85	01794A	Klamath Straits, Hwy 4	1981	Prestressed concrete	3,519	7/7/8	VG	ND		PV	
4	11	004	279.95	02020A	Hwy 4 over UPRR	1994	Prestressed concrete	6,439	7/7/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 11

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	11	426	18.09	02224A	USRS Canal J, Hwy 426	1982	Prestressed concrete	2,883	7/8/8	VG	ND		NV	
4	11	050	-4.14	08343	Hwy 50 SB over Hwy 4 NB	1962	Concrete continuous	10,359	6/6/7	GD	ND		NV	
4	11	050	3.81	02716A	Lost River Diversion Canal, Hwy 50	1966	Prestressed concrete	5,628	7/6/7	GD	ND		NV	
4	11	050	1.57	18276	USRS Main Canal A, Hwy 50	1997	Prestressed concrete	4,488	7/7/8	VG	ND		NV	
4	11	020	93.81	18870	Goose Lake Swale, Hwy 20	2001	Prestressed concrete	1,872	8/8/8	VG	ND		NV	
4	11	020	93.92	18871	Irrigation Canal, Hwy 20 at MP 93.92 (R/W Br Lt)	2001	Prestressed concrete	936	8/8/8	VG	OD	DG	NV	
4	11	020	94.15	18872	Thomas Creek, Hwy 20 at MP 94.15	2001	Prestressed concrete	2,984	8/8/8	VG	ND		NV	
4	11	020	94.44	18874	Thomas Creek, Hwy 20 at MP 94.44	2001	Prestressed concrete	1,868	8/8/8	VG	ND		NV	
4	11	020	94.70	18875	Warner Canyon Creek, Hwy 20	2001	Prestressed concrete	2,264	8/8/8	VG	ND		NV	
4	11	020	88.24	19129	Muddy Creek, Hwy 20	2004	Prestressed concrete	1,547	8/8/8	VG	ND		NV	
4	11	020	89.38	19130	Cottonwood Creek, Hwy 20	2004	Prestressed concrete	2,362	8/8/8	VG	ND		NV	
4	11	022	90.37	00957A	Wood River, Hwy 22 (Middley)	1965	Prestressed concrete	3,154	7/6/7	GD	ND		NV	
4	11	050	12.21	02417	Lost River, Hwy 50	1941	Concrete continuous	5,124	6/6/6	GD	ND		PV	
4	11	424	1.48	16334	Hwy 424 (South Side Bypass) over UPRR	1986	Prestressed concrete	9,360	6/8/7	GD	ND		NV	
4	11	022	95.36	19124	Crooked Creek, Hwy 22	2004	Prestressed concrete	2,565	7/8/8	VG	ND		NV	
4	11	022	92.32	20442	FORT CREEK FISH PASSAGE, HWY 022 @ MP 92.32	2008	Prestressed concrete	2,254	8/8/8	VG	ND		NV	
4	11	424	3.50	35C34	1-C Drainage Ditch, Hwy 424 (South Side Bypass)	1979	Prestressed concrete	1,344	7/7/7	VG	ND		NV	
4	11	004	275.93	09693	Riverside St (Klamath Falls) over Hwy 4	1968	Steel continuous	9,342	7/7/7	VG	ND		NV	
4	11	004	277.13	09694	Hwy 4 over Hwy 21	1968	Steel continuous	21,362	6/7/6	GD	ND		PV	
4	11	021	50.10	00986A	Klamath River, Hwy 21 (Keno)	1985	Prestressed concrete	18,499	7/7/6	GD	ND		NV	
4	11	021	43.67	19789	Klamath River Hwy 21 (Spencer)	2005	Steel continuous	23,726	7/8/8	VG	ND		NV	
4	11	004	274.73	19940	Hwy 4 over California Ave (Klamath Falls)	2004	Steel continuous	29,500	7/8/7	VG	ND		NV	


2017 BRIDGE CONDITION REPORT - District 11

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	11	004	275.74	19941	Hwy 4 over Green Springs Dr (Old Alignment) & BNSF	2005	Prestressed concrete continuous	40,754	6/7/8	GD	ND		NV	
4	11	431	12.72	03935A	Mud Creek, Hwy 431	1967	Prestressed concrete	910	7/7/6	GD	ND		NV	
4	11	431	15.41	03936A	Blue Creek, Hwy 431	1967	Prestressed concrete	910	7/7/7	VG	ND		NV	
4	11	431	29.65	08848A	Deep Creek, Hwy 431	1966	Prestressed concrete	5,023	6/5/6	PR	ND		NV	
4	11	431	31.40	08849	Canal, Hwy 431 at MP 31.40	1962	Concrete	1,806	7/6/6	GD	ND		NV	
4	11	431	30.67	08850	Canal, Hwy 431 at MP 30.67	1962	Concrete	1,355	7/6/6	GD	ND		NV	
4	11	431	32.74	09538	Twentymile Creek, Hwy 431	1966	Prestressed concrete	3,463	7/7/6	GD	ND		NV	
4	11	004	278.69	01895A	Klamath River & BNSF, Hwy 4	1995	Prestressed concrete continuous	56,834	7/7/7	VG	ND		PV	
4	11	424	0.81	16333	Klamath River & BNSF, Hwy 424 (South Side Bypass)	1986	Prestressed concrete	40,755	7/7/6	GD	ND		NV	
4	11	420	3.66	20049	USRS Diversion Canal, Hwy 420	2006	Prestressed concrete	4,500	8/8/8	VG	ND		NV	
4	11	020	3.25	01419A	USRS Canal, Hwy 20 (Altamont)	1930	Concrete continuous	8,010	6/7/7	GD	ND		PV	
4	11	020	9.77	03851A	USRS B Canal, Hwy 20	1966	Prestressed concrete	2,633	7/7/6	GD	ND		NV	
4	11	004	247.54	06886	Hwy 4 over Hwy 422 (Chiloquin)	1946	Concrete continuous	4,670	7/6/6	GD	ND		PV	
4	11	C0000	2.91	17446	Washburn Way over Hwy 424	1998	Prestressed concrete	13,440	6/7/7	GD	ND		NV	
4	11	004	243.98	19769	Spring Creek, Hwy 4 (Collier's Promenade)	2005	Prestressed concrete	11,998	7/8/8	VG	ND		NV	
4	11	004	263.11	19823	Barkley Springs Irrigation Canal, Hwy 4	2005	Prestressed concrete	8,136	7/7/7	VG	ND		NV	
4	11	004	265.65	19927	Algoma Log Pond, HWY 4	2005	Prestressed concrete	5,428	7/8/8	VG	ND		NV	
4	11	020	18.39	21377	Hwy 20 over BNSF	2011	Prestressed concrete	3,208	7/8/8	VG	ND		NV	
4	11	019	121.20	00765A	Crooked Creek, Hwy 19 at MP 121.20	1966	Prestressed concrete	2,100	7/7/7	VG	ND		NV	
4	11	019	125.78	0M014	Crooked Creek, Hwy 19 at MP 125.78	1960	Concrete continuous	-	6	GD	ND		NV	
4	11	019	125.52	0M015	Crooked Creek, Hwy 19 at MP 125.52	1960	Concrete continuous	-	6	GD	ND		NV	
4	11	019	126.92	20768	Crooked Creek, Hwy 19 at MP 126.92	2008	Prestressed concrete	5,360	7/7/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 11

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	11	020	0.02	01579	Link River, Hwy 20	1931	Concrete continuous	10,400	6/6/5	PR	OD	LSL	PV	
4	11	004	273.62	08344	Hwy 4 over Nevada Ave (Klamath Falls)	1959	Prestressed concrete	11,471	7/7/7	VG	ND		V	
4	11	004	273.71	08345	USBR Canal, Hwy 4	1959	Steel	17,027	7/6/7	GD	ND		V	
4	11	004	272.99	08352	Hwy 4 over UPRR & Pelican City Rd (Lakefront Blvd)	1959	Prestressed concrete	7,818	7/7/7	VG	ND		V	
4	11	004AV	273.68	08510	USBR Canal, Nevada Ave Conn to Hwy 4	1959	Steel	6,960	6/7/7	GD	ND		NV	

APRIL 2017

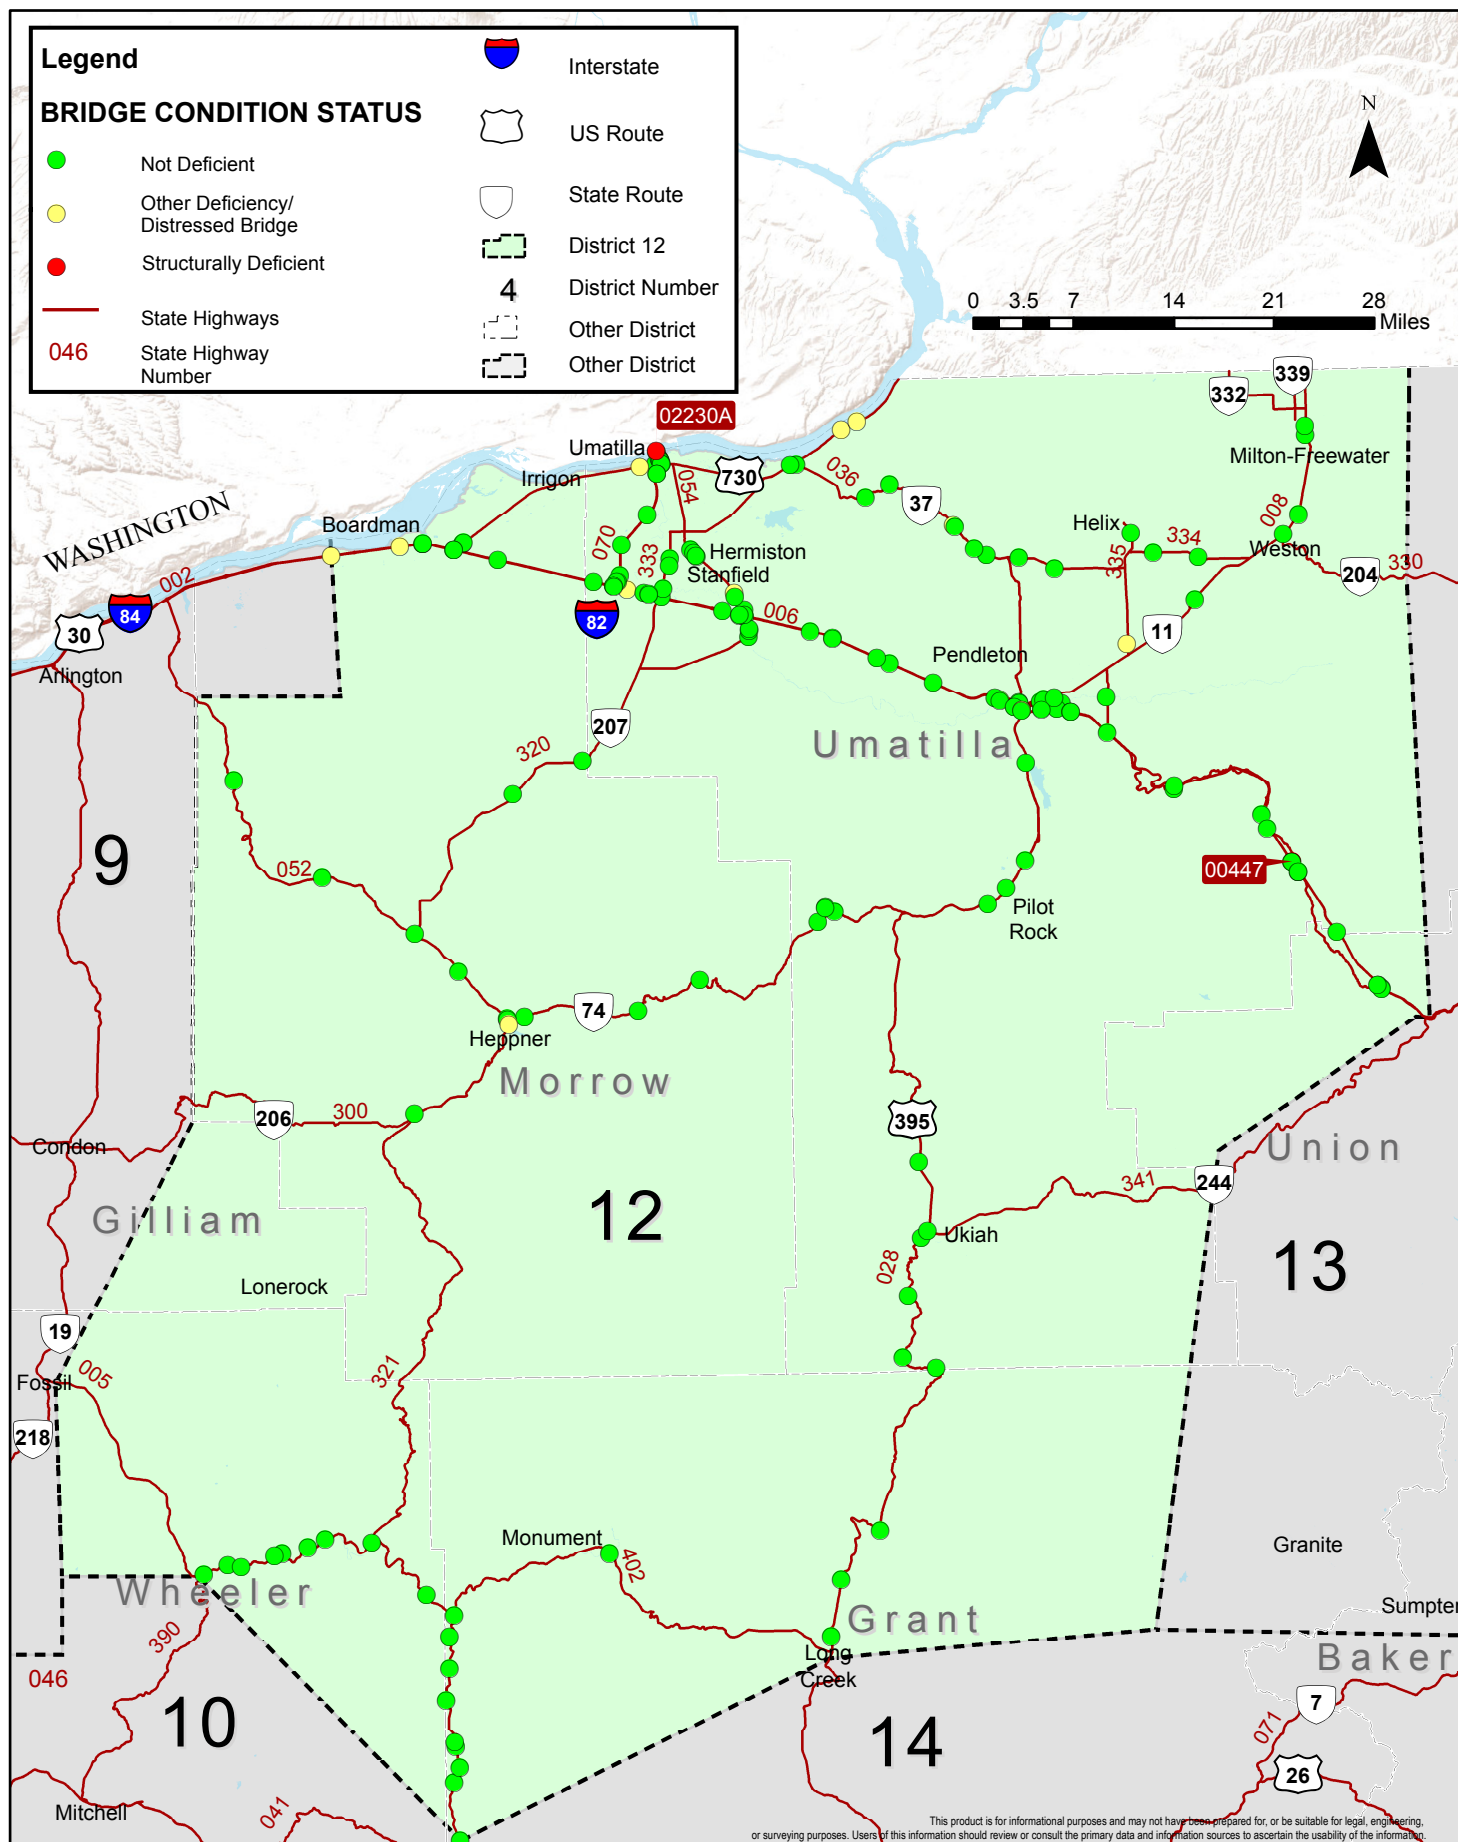

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	070	0.39	02230A	Columbia River, Hwy 70 EB (Umatilla)	1955	Steel continuous	102,076	4/5/7	PR	SD	SD LSL	PV	
5	070	0.40	16424	Columbia River, Hwy 70 WB (Umatilla)	1988	Prestressed concrete continuous	171,650	7/6/7	GD	ND		NV	
5	006	212.06	09524	Goad Rd over Hwy 6	1969	Steel continuous	9,257	7/7/7	VG	ND		NV	
5	006	213.04	09525	Hwy 6 WB over Hwy 67 (E Pendleton Intchg)	1969	Concrete continuous	8,603	7/6/8	GD	ND		NV	
5	006	213.06	09525A	Hwy 6 EB over Hwy 67 (E Pendleton Intchg)	1969	Concrete continuous	9,801	7/6/8	GD	ND		NV	
5	006	209.54	09522	Hwy 6 WB over Hwy 28 (Emigrant Ave Intchg)	1969	Concrete continuous	9,373	6/6/8	GD	ND		NV	
5	006	209.54	09522A	Hwy 6 EB over Hwy 28 (Emigrant Ave Intchg)	1969	Concrete continuous	8,605	6/6/8	GD	OD	VC	NV	
5	006AU	198.54	09579	Hwy 6 Conn over Hwy 6 (Rew Intchg)	1968	Steel continuous	10,427	7/7/7	VG	ND		NV	
5	008	30.75	06677A	Little Walla Walla River, Hwy 8	1948	Concrete continuous	2,112	5/5/5	PR	ND		NV	
5	006	208.96	09521	Umatilla River, Hwy 6 WB (Pendleton)	1969	Prestressed concrete continuous	22,450	5/6/7	PR	ND		NV	
5	006	208.97	09521A	Umatilla River, Hwy 6 EB (Pendleton)	1969	Prestressed concrete continuous	28,244	5/6/7	PR	ND		NV	
5	006AZ	199.46	09568	Hwy 6 Conn over Hwy 6 (Yoakum Intchg)	1968	Steel continuous	11,936	7/7/7	VG	ND		NV	
5	006	195.16	09578	Hwy 6 WB over Nolan Road	1968	Prestressed concrete	7,047	6/7/7	GD	ND		NV	
5	006	195.16	09578A	Hwy 6 EB over Nolan Road	1968	Prestressed concrete	7,047	6/7/7	GD	ND		NV	
5	006	207.88	09520	Hwy 6 WB over Reith Hwy & UPRR	1969	Steel continuous	18,875	5/7/8	PR	OD	LSL	NV	
5	006	207.88	09520A	Hwy 6 EB over Rieth Hwy & UPRR	1969	Steel continuous	18,875	5/7/8	PR	ND		NV	
5	006BE	202.87	09584	Hwy 6 Conn over Hwy 6 (Barnhart Rd Intchg)	1968	Steel continuous	11,250	6/7/7	GD	ND		NV	
5	006	210.96	09523	Hwy 6 WB over Hwy 8 (S Pendleton Intchg)	1969	Concrete continuous	8,346	7/6/7	GD	ND		NV	
5	006	210.96	09523A	Hwy 6 EB over Hwy 8 (S Pendleton Intchg)	1969	Concrete continuous	8,346	7/6/7	GD	ND		NV	
5	070	10.21	16450	Hwy 70 WB over UPRR	1987	Prestressed concrete continuous	13,201	6/7/7	GD	ND		NV	
5	070	10.27	16451	Hwy 70 EB over UPRR	1987	Prestressed concrete continuous	14,009	6/7/7	GD	ND		NV	
5	006BP	224.71	09648	Hwy 6 Frtg Rd over Hwy 6 EB (Emigrant Hill Intchg)	1973	Prestressed concrete	5,831	7/6/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	006	224.05	09649	Hwy 6 WB over Frontage Rd (Emigrant Hill Intchg)	1973	Concrete continuous	6,764	6/6/7	GD	ND		NV	
5	006BP	235.05	08594	Hwy 6 Frtg Rd over Hwy 6 (W Emigrant Park I/C)	1962	Concrete continuous	9,148	6/6/7	GD	ND		NV	
5	006BP	236.29	08612	Hwy 6 Frtg Rd over Hwy 6 (E Emigrant Park I/C)	1962	Concrete continuous	11,175	5/6/6	PR	ND		NV	
5	006	237.95	08498E	Hwy 6 EB over Frtg Rd & UPRR (Meacham)	1961	Prestressed concrete	20,026	6/7/7	GD	ND		NV	
5	006	237.95	08498W	Hwy 6 WB over Frtg Rd & UPRR (Meacham)	1961	Prestressed concrete	20,026	6/7/7	GD	ND		NV	
5	036	17.75	04733A	Middle Fork Cold Springs Creek, Hwy 36 at MP 17.75	1955	Concrete continuous	2,684	6/6/7	GD	ND		PV	
5	036	15.66	17158	Middle Fork Cold Springs Creek, Hwy 36 at MP 15.66	1991	Prestressed concrete	2,816	8/8/7	VG	ND		NV	
5	036	18.73	18308	Middle Fork Cold Springs Creek, Hwy 36 at MP 18.73	1998	Prestressed concrete	1,401	8/8/8	VG	ND		NV	
5	036	6.45	00694A	Cold Springs Creek, Hwy 36	1985	Prestressed concrete	3,896	6/8/7	GD	ND		NV	
5	036	1.20	07368	Hwy 36 over UPRR (Cold Springs)	1951	Concrete	8,742	5/5/5	PR	ND		PV	
5	036	15.51	17157	Middle Fork Cold Springs Creek, Hwy 36 at MP 15.51	1991	Prestressed concrete	2,832	8/8/5	PR	OD	Scour	NV	
5	036	8.83	17217	South Fork Cold Springs Creek, Hwy 36 at MP 8.83	1992	Concrete continuous	-	7	VG	ND		NV	
5	008	0.18	04697A	Umatilla River, Hwy 8 (Riverside)	1986	Prestressed concrete	21,259	7/7/7	VG	ND		NV	
5	008	-0.93	09535	Hwy 8 over UPRR & Frazer Ave & Hwy 28 NB	1970	Prestressed concrete continuous	41,236	5/6/7	PR	ND		NV	
5	028	89.18	01809A	Long Creek, Hwy 28	1985	Prestressed concrete	2,202	8/7/7	VG	ND		NV	
5	028	85.06	01810A	Pass Creek, Hwy 28	1980	Steel	-	6	GD	ND		NV	
5	028	77.38	18804	Middle Fork John Day River, Hwy 28 (Ritter Jct.)	2004	Prestressed concrete continuous	20,254	7/8/8	VG	ND		NV	
5	008	12.40	01064A	Spring Hollow Creek, Hwy 8	1988	Prestressed concrete	2,800	8/8/8	VG	ND		NV	
5	008	20.30	19650	Hwy 8 over Hwy 330 & BMR (Weston Intchg)	2005	Prestressed concrete	15,754	8/8/8	VG	ND		NV	
5	008	31.39	06979A	NE 8th Ave over Hwy 8 (Eastside)	1975	Concrete continuous	7,753	6/6/8	GD	ND		NV	
5	008	22.07	08665	Dry Creek, Hwy 8	1962	Concrete continuous	-	6	GD	ND		NV	
5	028	60.93	20871	Camas Creek, Hwy 28	2011	Prestressed concrete	10,645	8/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	028	63.81	20873	N Fork John Day River, Hwy 28 (Dale)	2011	Steel	9,137	7/8/8	VG	ND		NV	
5	028	44.46	04717A	Cooper Creek, Hwy 28	1982	Steel	-	6	GD	ND		NV	
5	028	50.20	04723	Wilkins Creek, Hwy 28	1950	Steel	-	6	GD	ND		NV	
5	028	55.66	04725B	Five Mile Creek, Hwy 28	1985	Prestressed concrete	2,048	7/7/7	VG	ND		NV	
5	341	0.03	10673B	Owens Creek, Hwy 341	1992	Wood or Timber	1,931	7/8/7	VG	ND		NV	
5	070	1.77	16443	Hwy 70 WB over Umatilla R, UPRR, and Cnty Rd.	1985	Prestressed concrete	45,753	6/7/6	GD	ND		NV	
5	070	1.77	16444	Hwy 70 EB over Umatilla River, UPRR, and Cnty Rd.	1985	Prestressed concrete	44,316	6/7/6	GD	ND		NV	
5	070	1.00	16441	Hwy 70 WB over Hwy 2 (Umatilla)	1985	Concrete continuous	9,955	6/6/7	GD	ND		NV	
5	070	1.00	16442	Hwy 70 EB over Hwy 2 (Umatilla)	1985	Concrete continuous	9,955	6/6/7	GD	ND		NV	
5	C0000	9.85	16449	Westland Road over Hwy 70	1985	Prestressed concrete	10,153	7/7/7	VG	ND		NV	
5	C0000	164.16	08946	Main St. over Hwy 2 (Boardman Intchg)	1965	Concrete continuous	11,844	7/7/7	VG	OD	VC	NV	
5	002GQ	159.30	09021	Tower Road over Hwy 2 (Tower Rd. Intchg)	1964	Prestressed concrete	9,257	6/8/6	GD	OD	LSL VC	NV	
5	002	165.76	16611	Hwy 2 EB over Port of Morrow Intchg	1984	Prestressed concrete	4,709	7/8/7	VG	ND		NV	
5	002	165.76	16612	Hwy 2 WB over Port of Morrow Intchg	1984	Prestressed concrete	5,400	6/8/7	GD	ND		NV	
5	002	182.60	00624A	Umatilla River, Hwy 2 (Umatilla)	1925	Concrete	16,829	6/6/6	GD	OD	LSL LC	PV	
5	002	168.77	08884	Hwy 2 over UPRR (Clarke)	1962	Steel	7,694	5/6/5	PR	ND		NV	
5	002	168.86	08885	USRS Canal, Hwy 2 at MP 168.86	1962	Concrete continuous	4,325	5/6/6	PR	ND		NV	
5	002	183.70	01628	Hwy 2 over UPRR (Umatilla Branch)	1933	Concrete continuous	12,340	6/6/6	GD	ND		PV	
5	002	197.80	01629	Juniper Point Half Viaduct, Hwy 2	1933	Concrete continuous	6,246	5/5/5	PR	OD	LSL DG	PV	
5	002	193.46	01637A	Hwy 2 over Hwy 36 (Cold Springs Junction)	1954	Concrete	2,230	6/5/5	PR	ND		PV	
5	006	167.97	08931E	Hwy 6 EB over Hwy 2 Conn (Irrigon Jct I/C)	1962	Concrete continuous	11,132	6/6/7	GD	ND		NV	
5	006	167.97	08931W	Hwy 6 WB over Hwy 2 Conn (Irrigon Jct I/C)	1962	Concrete continuous	10,915	6/6/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	006AC	177.98	09539	Hwy 6 Conn over Hwy 6 (Ordnance Intchg)	1967	Steel continuous	10,792	6/7/7	GD	ND		NV	
5	006HP	171.15	09640	Patterson Ferry Rd over Hwy 6	1967	Steel continuous	8,480	6/7/7	GD	ND		NV	
5	006	181.59	05203A	Westland Irrigation Canal, Hwy 6	1967	Concrete continuous	5,400	7/6/6	GD	ND		NV	
5	006	181.95	05204A	Butter Creek, Hwy 6 WB	1967	Concrete continuous	3,360	7/7/6	GD	ND		NV	
5	006	181.95	05204B	Butter Creek, Hwy 6 EB	1967	Concrete continuous	3,360	7/7/7	VG	ND		NV	
5	006AI	180.40	09540	Hwy 6 Conn over Hwy 6 (Westland Intchg)	1967	Steel continuous	12,453	6/7/7	GD	OD	VC	NV	
5	006	179.42	16452	Hwy 6 EB Conn to Hwy 70 Over Hwy 6	1987	Prestressed concrete continuous	15,356	6/7/7	GD	ND		NV	
5	006 WI	179.45	16453	Hwy 6 WB over Hwy 70 EB	1987	Prestressed concrete	9,115	6/7/7	GD	ND		NV	
5	006 EB	179.45	16454	Hwy 6 EB over Hwy 70 EB	1987	Prestressed concrete	9,968	6/5/5	PR	ND		NV	
5	006	188.42	05209A	Umatilla River & UPRR & USRS Canal, Hwy 6 WB	1968	Prestressed concrete continuous	23,742	6/6/6	GD	ND		NV	
5	C0000	0.00	09422	Echo Meadows Rd over Hwy 6	1967	Steel continuous	9,248	6/7/7	GD	ND		NV	
5	006HW	193.53	09577	Hwy 6 Conn 2 over Hwy 6 (Echo Jct Intchg)	1968	Steel continuous	9,881	6/7/7	GD	ND		NV	
5	006	188.43	20080	Umatilla River & UPRR & USRS Canal, Hwy 6 EB	2008	Steel continuous	21,501	8/8/8	VG	ND		NV	
5	006BP	251.64	00449	Hwy 6 Emigrant Hill Frtg Rd over UPRR (Glover)	1921	Concrete continuous	3,013	5/6/5	PR	ND		PV	
5	006	248.94	08048	Hwy 6 over Emigrant Hill Frtg Rd (Glover Intchg)	1957	Concrete continuous	10,004	6/6/6	GD	ND		PV	
5	006	238.77	08595E	Hwy 6 EB over Hwy 6 Frtg Rd (Meacham Intchg)	1961	Prestressed concrete	7,316	6/7/7	GD	ND		NV	
5	006	238.77	08595W	Hwy 6 WB over Hwy 6 Frtg Rd (Meacham Intchg)	1961	Prestressed concrete	7,316	6/7/7	GD	ND		NV	
5	006BP	239.45	00447	Meacham Creek & UPRR, Hwy 6 Emigrant Hill Frtg Rd	1925	Concrete continuous	7,423	4/5/5	PR	SD	SD	PV	
5	006	248.55	00449A	Hwy 6 over Emigrant Hill Frtg Rd & UPRR (Glover)	1957	Concrete continuous	20,957	5/6/6	PR	ND		PV	
5	006CX	243.82	08044	Mt Emily Road Conn over Hwy 6 (Kamela Intchg)	1957	Steel	6,727	6/5/5	PR	ND		PV	
4	005	89.19	02199A	Snabel Creek, Hwy 5	1978	Prestressed concrete	1,348	8/8/8	VG	ND		NV	
4	005	85.17	02233A	Harper Creek, Hwy 5	1958	Concrete	2,110	7/6/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
4	005	79.03	02235	Mule Shoe Creek, Hwy 5	1939	Concrete continuous	1,728	6/6/7	GD	ND		PV	
5	005	80.92	02236A	Alder Creek, Hwy 5	1958	Concrete	3,065	7/6/6	GD	ND		PV	
4	005	81.85	04979A	Juniper Creek, Hwy 5	1958	Concrete	2,818	7/6/6	GD	ND		PV	
4	005	84.53	04981A	Mathias Creek, Hwy 5	1958	Concrete	2,110	7/6/7	GD	ND		PV	
5	402	13.96	20475	North Fork John Day River, Hwy 402 (Monument)	2008	Prestressed concrete	17,600	8/7/8	VG	ND		NV	
5	005	112.54	00240C	Branson Creek, Hwy 5	1979	Prestressed concrete	672	7/7/6	GD	ND		NV	
5	005	110.04	00241B	Bone Creek, Hwy 5	1978	Prestressed concrete	1,760	8/7/7	VG	ND		NV	
5	005	118.21	00241C	Dick Creek, Hwy 5	1993	Prestressed concrete	1,080	8/8/8	VG	ND		NV	
5	005	107.63	00242B	Holmes Creek, Hwy 5	1992	Steel	-	8	VG	ND		NV	
4	005	95.36	00290A	Haystack Creek, Hwy 5	1977	Prestressed concrete	972	8/8/6	GD	ND		NV	
5	005	124.12	02734A	Rock Creek, Hwy 5 (Picture Gorge)	1941	Concrete continuous	2,320	7/6/6	GD	ND		PV	
5	005	116.25	03495A	Dry Gulch, Hwy 5 at MP 116.25	1985	Prestressed concrete	735	8/8/8	VG	ND		NV	
4	005	103.05	04988A	Bologna Creek, Hwy 5	1978	Prestressed concrete	5,802	8/7/7	VG	ND		NV	
5	005	116.62	16720	Johnny Creek, Hwy 5	1985	Prestressed concrete	905	8/8/8	VG	ND		NV	
4	005	90.68	18083	Kahler Creek, Hwy 5	1999	Prestressed concrete	2,820	8/8/8	VG	ND		NV	
5	005	119.45	20872	John Day River, Hwy 5 (Goose Rock)	2011	Prestressed concrete	12,672	8/8/8	VG	ND		NV	
5	052	36.55	00611	Blackhorse Creek, Hwy 52	1921	Concrete	1,232	7/6/6	GD	ND		NV	
5	052	15.39	00670A	Brandy Creek, Hwy 52	1984	Prestressed concrete	868	8/7/8	VG	ND		NV	
5	052	45.47	00776A	Hinton Creek, Hwy 52 (Heppner)	1921	Concrete	1,320	6/6/5	PR	ND		NV	
5	052	45.56	00777A	Willow Creek, Hwy 52 at MP 45.46 (Park)	1964	Concrete continuous	3,388	7/7/7	VG	ND		NV	
5	300	73.37	02104	Rhea Creek, Hwy 300 ((Ruggs)	1935	Concrete continuous	3,607	6/6/6	GD	ND		PV	
5	052	40.68	04478A	Campbell Creek, Hwy 52	1972	Steel	-	7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	052	28.32	17431	Reitman Canyon Creek, Hwy 52	1995	Concrete continuous	-	7	VG	ND		NV	
5	054	6.27	00474B	Maxwell Canal, Hwy 54	1986	Prestressed concrete	2,641	8/8/7	VG	ND		NV	
5	054	6.60	00475A	A Line Canal, Hwy 54	1986	Prestressed concrete	2,772	7/8/7	VG	ND		NV	
5	054	6.91	00476A	USRS Feed Canal, Hwy 54 at MP 6.91	1986	Prestressed concrete	4,872	8/8/7	VG	ND		NV	
5	054	12.10	00478B	USRS Feed Canal, Hwy 54 at MP 12.09	1989	Prestressed concrete	3,528	8/7/5	PR	ND		NV	
5	054	10.60	00479B	USRS Feed Canal, Hwy 54 at MP 10.60	1989	Prestressed concrete	4,704	8/8/5	PR	OD	LSL	NV	
5	054	10.87	00754B	Stage Gulch, Hwy 54	1989	Prestressed concrete	5,896	8/7/7	VG	ND		NV	
5	054	12.41	02439B	Furnish Canal, Hwy 54	1969	Prestressed concrete	5,396	7/6/7	GD	ND		NV	
5	054	6.84	07367A	Hwy 54 over UPRR (Hermiston)	1951	Prestressed concrete	11,502	7/7/7	VG	ND		PV	
5	028	17.44	00844A	West Fork Birch Creek, Hwy 28	1922	Concrete	1,599	7/6/7	GD	ND		NV	
5	028	15.27	02561	East Fork Birch Creek, Hwy 28 (Pilot Rock)	1940	Concrete continuous	3,537	7/7/6	GD	ND		PV	
5	028	1.74	09522B	Tutuilla Creek, Hwy 28	1969	Prestressed concrete	6,528	N	GD	ND		NV	
5	028	12.93	19270	Stewart Creek, Hwy 28 Frtg Rd	2003	Prestressed concrete	812	8/8/8	VG	ND		NV	
5	028	5.77	20869	McKay Creek, Hwy 28	2010	Prestressed concrete	7,080	8/8/8	VG	ND		NV	
5	067	5.33	07751	Hwy 67 over Mission Road EB Conn	1955	Concrete continuous	8,422	6/6/6	GD	ND		PV	
5	067	0.41	09636	Hwy 67 over Hwy 6 (W Pendleton Intchg)	1969	Concrete continuous	16,500	6/6/7	GD	ND		NV	
5	067	4.06	18661	Hwy 8 & Hwy 67 over UPRR (Eastgate Viaduct)	2002	Prestressed concrete continuous	48,413	7/8/8	VG	ND		NV	
5	067	2.16	19092	Umatilla River, Hwy 67 (Westgate)	2005	Prestressed concrete	37,573	7/8/8	VG	ND		NV	
5	067	2.17	19093	SW Court Place (Hwy 67 Conn to Hwy 36) over UPRR	2005	Prestressed concrete	7,129	8/8/8	VG	ND		NV	
5	052	45.99	00778A	Willow Creek, Hwy 52 at MP 45.46 (Courthouse)	1921	Concrete continuous	3,503	6/6/5	PR	OD	Scour	PV	
5	052	55.67	04485	Lounsberry Creek, Hwy 52	1966	Prestressed concrete	1,047	8/8/7	VG	ND		NV	
5	052	47.35	17937	Hinton Creek (East), Hwy 52	1996	Concrete continuous	784	7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 12


Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	052	62.04	18100	Little Butter Creek, Hwy 52	1997	Prestressed concrete	864	8/8/7	VG	ND		NV	
5	052	76.68	04745	Vinson Creek, Hwy 52 at MP 76.68	1953	Concrete continuous	1,080	6	GD	ND		NV	
5	052	77.45	04746	Vinson Creek, Hwy 52 at MP 77.45	1953	Concrete continuous	-	8	VG	ND		NV	
5	052	75.35	18098	Hog Hollow, Hwy 52	1997	Concrete continuous	1,134	7	VG	ND		NV	
5	052	76.63	19123	Butter Creek, Hwy 52 (Vinson)	2004	Prestressed concrete	4,229	8/7/8	VG	ND		NV	
5	054	12.56	09314	Hwy 54 over Hwy 6 (Stanfield Jct Intchg)	1968	Concrete continuous	24,780	6/5/7	PR	ND		NV	
5	005	105.60	02398	North Fork John Day River, Hwy 5 (Kimberly)	1938	Steel continuous	11,484	7/7/5	PR	ND		PV	
5	334	0.90	04775A	Middle Fork Cold Springs Creek, Hwy 334 at MP 0.90	1986	Prestressed concrete	1,312	8/8/7	VG	ND		NV	
5	334	3.55	04780A	Middle Fork Cold Springs Creek, Hwy 334 at MP 3.55	1985	Prestressed concrete	1,184	8/8/8	VG	ND		NV	
5	334	11.33	04784A	Greasewood Creek, Hwy 334	1971	Prestressed concrete	1,800	7/7/6	GD	ND		NV	
5	334	14.60	04788	Gerking Creek, Hwy 334	1966	Prestressed concrete	1,278	6/6/6	GD	ND		NV	
5	335	8.97	08031	Wild Horse Creek, Hwy 335	1956	Concrete continuous	3,111	7/6/5	PR	OD	Scour	PV	
5	331	2.02	08598	Umatilla River, Hwy 331 (Mission)	1960	Concrete continuous	9,055	6/6/6	GD	ND		NV	
5	331	4.52	09567	Hwy 331 over Hwy 6 (Mission Road Intchg)	1971	Prestressed concrete continuous	17,680	6/6/7	GD	ND		NV	
5	335	0.93	20518	Greasewood Creek, Hwy335	2007	Concrete	1,000	8	VG	ND		NV	
5	320	19.48	02432A	Butter Creek, Hwy 320	1983	Prestressed concrete	1,824	8/8/8	VG	ND		NV	
5	320	13.57	04504A	Sand Hollow Creek, Hwy 320	1983	Prestressed concrete	1,056	8/8/7	VG	ND		NV	
5	320	35.36	18478	Umatilla River, Hwy 320 (Echo)	2000	Prestressed concrete continuous	9,286	7/8/8	VG	ND		NV	
5	320	36.19	19254	USRS Feed Canal, Hwy 320 (Echo)	2003	Prestressed concrete	2,480	8/8/8	VG	ND		NV	
5	320	36.29	19255	Furnish Ditch, Hwy 320 (Echo)	2003	Prestressed concrete	1,668	8/8/8	VG	ND		NV	
5	070	0.61	16437	Hwy 70 WB over Third St (Umatilla)	1985	Prestressed concrete continuous	9,828	6/7/6	GD	ND		NV	
5	070	0.61	16438	Hwy 70 EB over Third St (Umatilla)	1985	Prestressed concrete continuous	9,828	6/8/6	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 12

Region	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/O D	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	070	0.76	16439	Hwy 70 WB over UPRR (Umatilla)	1985	Prestressed concrete	9,759	7/8/7	VG	ND		NV	
5	070	0.76	16440	Hwy 70 EB over UPRR (Umatilla)	1985	Prestressed concrete	10,753	7/8/7	VG	ND		NV	
5	C1225	0.00	16447	Powerline Rd over Hwy 70	1986	Prestressed concrete continuous	13,054	7/8/8	VG	ND		NV	
5	C0000	0.00	16448	Bridge Road over Hwy 70 and Westland Canal	1985	Prestressed concrete	11,138	8/8/8	VG	ND		NV	
5	006BP	251.37	00692	Dry Creek, Hwy 6 Emigrant Pass Frtg Rd (Glover)	1921	Concrete	954	6/6/5	PR	ND		NV	
5	002	199.03	01630A	Juniper Canyon Creek, Hwy 2	1951	Steel continuous	7,881	6/7/5	PR	OD	LSL	PV	
5	333	9.54	04770A	Maxwell Canal, Hwy 333	1974	Prestressed concrete	1,650	8/6/6	GD	ND		NV	
5	333	10.09	04771A	A-Line Canal, Hwy 333	1974	Prestressed concrete	1,540	8/6/6	GD	ND		NV	
5	333	12.50	09541	Hwy 333 over Hwy 6 (Hermiston I/C, Bucks Corner)	1967	Steel continuous	11,628	6/7/7	GD	ND		NV	
5	333	11.86	21716	Umatilla River, Hwy 333 (Hinkle)	2015	Steel	19,562	8/8/8	VG	ND		NV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 13

APRIL 2017

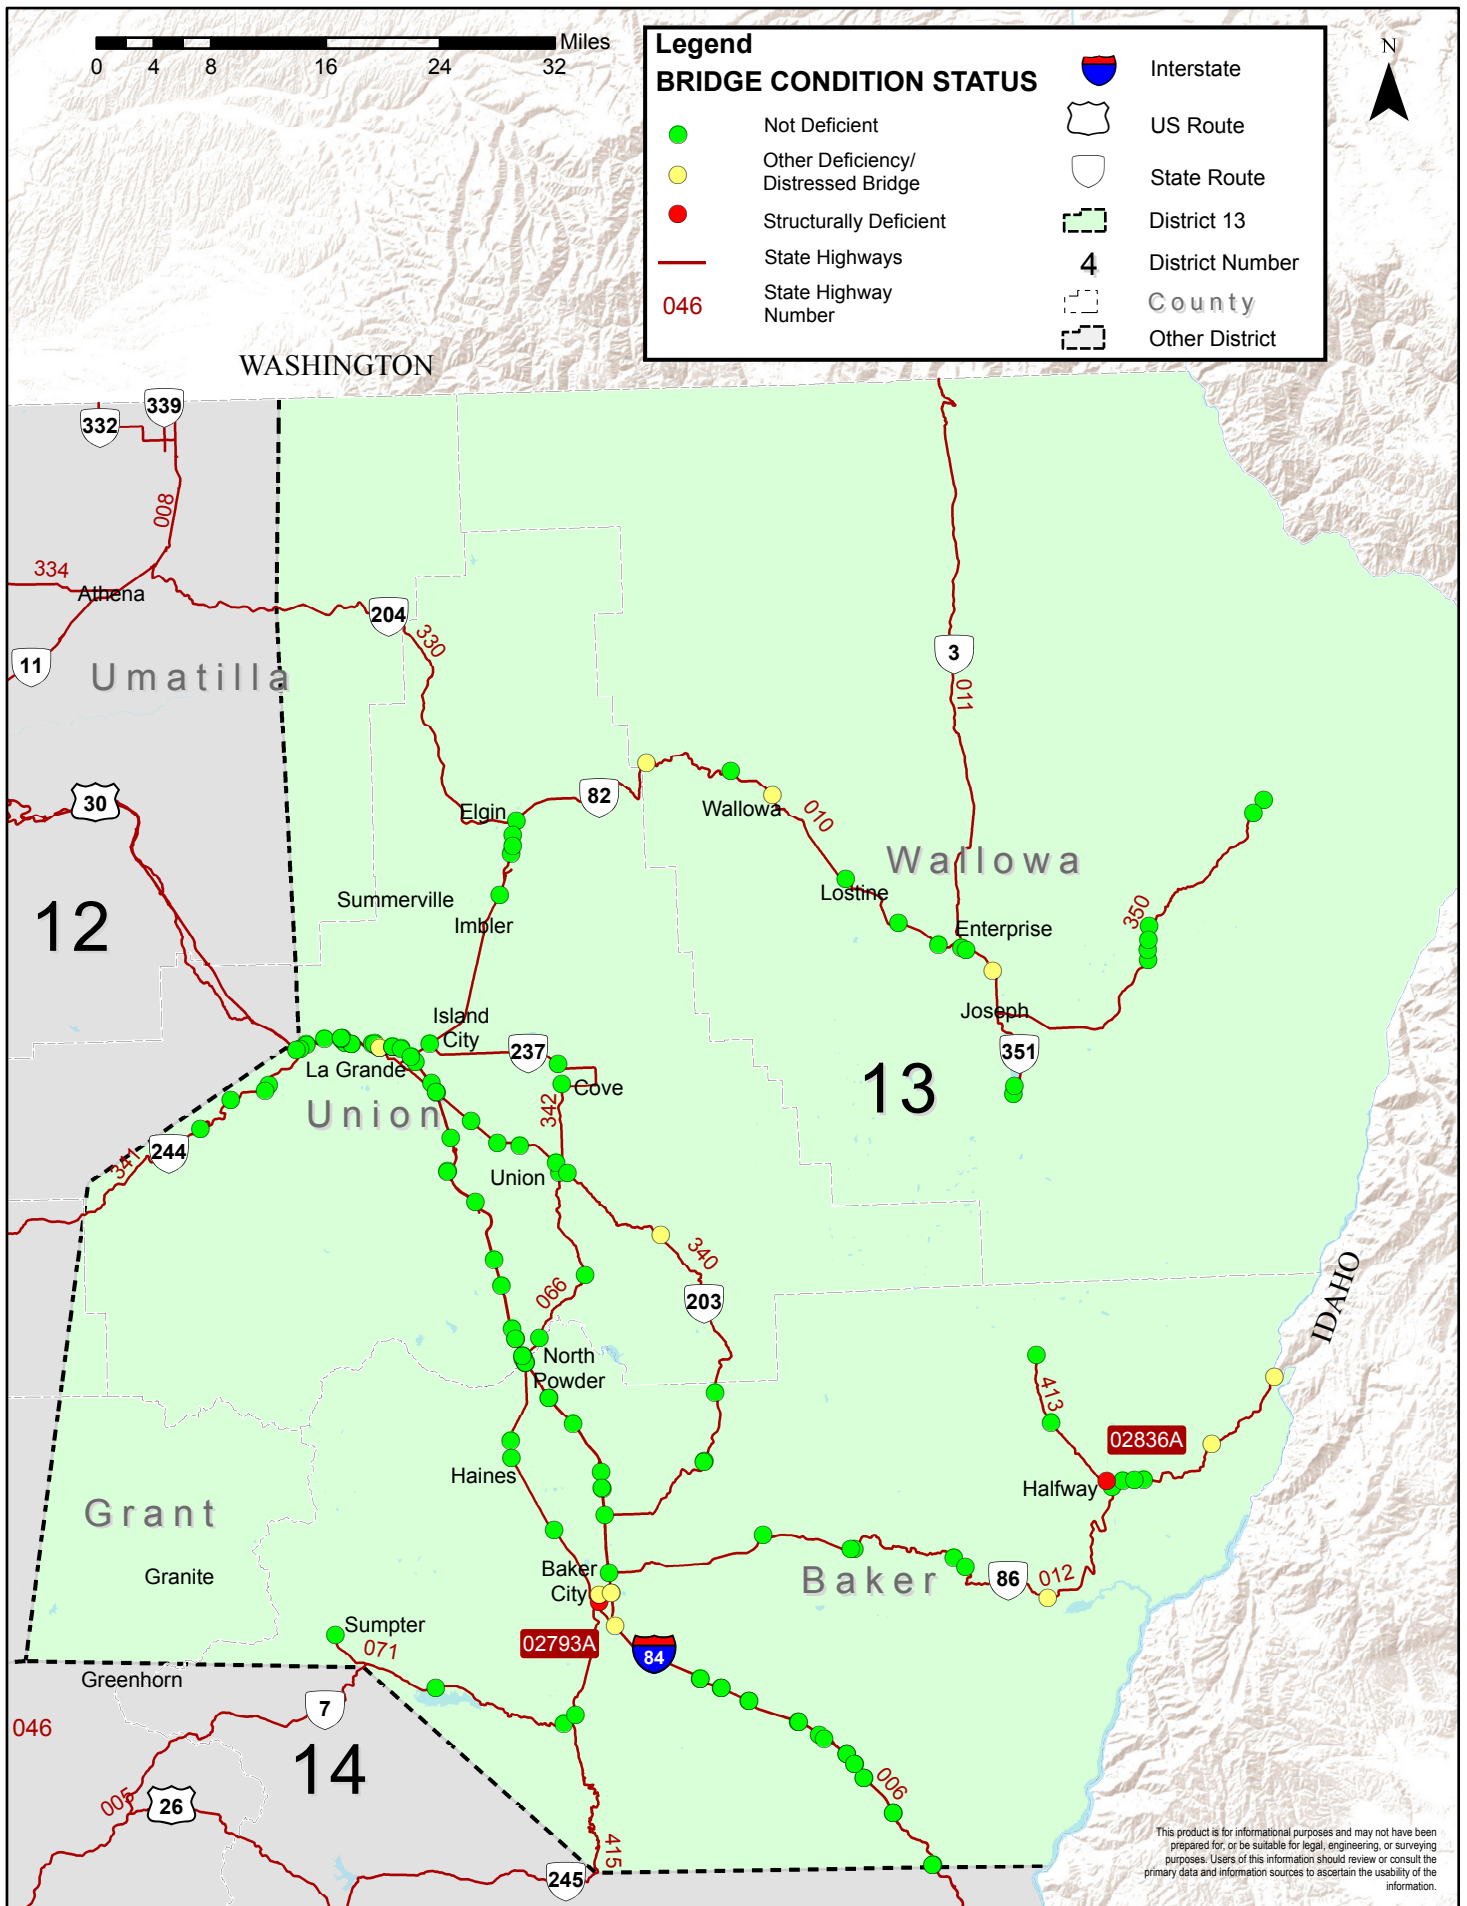

This product is for informational purposes and may not have been prepared for, or be suitable for legal, engineering, or surveying purposes. Users of this information should review or consult the primary data and information sources to ascertain the usability of the information.

2017 BRIDGE CONDITION REPORT - District 13

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	010	68.29	00725A	Prairie Creek, Hwy 10 at MP 68.29	1980	Steel	-	5	FR	OD	Scour	NV	
5	13	006	323.40	00704A	County Road over Hwy 6 (Oxman)	1966	Prestressed concrete	9,910	6/8/6	GD	ND		NV	
5	13	006	321.23	08941E	Alder Cr & Front. Rd & UPRR, Hwy 6 EB (Hill Creek)	1964	Prestressed concrete	13,082	6/8/8	GD	ND		NV	
5	13	006	321.24	08941W	Alder Cr & Front. Rd & UPRR, Hwy 6 WB (Hill Creek)	1964	Prestressed concrete	12,631	6/8/8	GD	ND		NV	
5	13	006	327.43	09044	Hwy 6 WB over Conn (Durkee Intchg)	1966	Prestressed concrete	8,022	7/7/7	VG	ND		NV	
5	13	006	327.43	09044A	Hwy 6 EB over Conn (Durkee Intchg)	1966	Prestressed concrete	7,518	7/7/7	VG	ND		NV	
5	13	006	325.31	07987	Pritchard Creek & UPRR, Hwy 6 WB	1966	Steel continuous	18,216	6/6/6	GD	ND		NV	
5	13	006	325.34	07987A	Pritchard Creek & UPRR, Hwy 6 EB	1966	Steel continuous	18,036	6/6/6	GD	ND		NV	
5	13	006	330.67	08528	Hwy 6 WB over Hwy 6 Conn (Nelson Point Intchg)	1972	Prestressed concrete	7,254	7/8/8	VG	ND		NV	
5	13	006	330.67	08528A	Hwy 6 EB over Hwy 6 Conn (Nelson Point Intchg)	1972	Prestressed concrete	7,966	7/8/8	VG	ND		NV	
5	13	006	326.24	09475	Hwy 6 WB over Hooker Ranch Rd.	1966	Prestressed concrete	6,384	7/8/8	VG	ND		NV	
5	13	006	326.24	09475A	Hwy 6 EB over Hooker Ranch Rd.	1966	Prestressed concrete	6,354	7/8/8	VG	ND		NV	
5	13	006	335.76	09332	Hwy 6 over Conn (Weatherby Intchg)	1972	Prestressed concrete	15,114	7/8/8	VG	ND		NV	
5	13	006FT	335.71	09333	Burnt River, Hwy 6 Conn #2 (Weatherby)	1972	Prestressed concrete	1,680	8/8/6	GD	ND		NV	
5	13	006	322.99	08963	Alder Creek, Hwy 6 at MP 322.99	1964	Concrete continuous	-	6	GD	ND		NV	
5	13	413	0.41	06600A	Pine Creek, Hwy 413 at MP 0.41 (Cornucopia)	1990	Steel	1,600	6/6/6	GD	ND		NV	
5	13	012	53.91	08405	Pine Creek, Hwy 12	1958	Concrete continuous	2,587	7/6/7	GD	ND		PV	
5	13	012	56.47	02842A	West Fork Dry Creek, Hwy 12	1987	Prestressed concrete	853	7/7/7	VG	ND		NV	
5	13	012	70.80	08979	Snake River, Hwy 12 (Oxbow)	1961	Steel	15,023	8/6/5	PR	OD	PAINT	NV	
5	13	012	55.86	0M364	East Pine Creek, Hwy 12	1958	Concrete continuous	-	5	FR	ND		NV	
5	13	012	55.03	17346	Clear Creek, Hwy 12	1993	Prestressed concrete	2,176	8/8/8	VG	ND		NV	
5	13	010	14.78	00836A	Willow Creek, Hwy 10	1971	Prestressed concrete	5,727	7/6/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 13

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	010	2.64	04821A	Grande Ronde R, Hwy 10 at MP 2.64 (Island City)	1976	Prestressed concrete	11,795	6/6/7	GD	ND		NV	
5	13	010	19.20	00800A	Grande Ronde R, Hwy 10 at MP 19.20 (South Elgin)	1966	Concrete continuous	12,274	5/6/7	PR	ND		NV	
5	13	010	19.97	00803A	Phillips Creek, Hwy 10 (Elgin)	1963	Prestressed concrete	1,716	8/7/7	VG	ND		NV	
5	13	010	33.65	01038A	Wallowa River, Hwy 10 (Minam)	1965	Prestressed concrete	14,689	7/6/6	GD	OD	LSL	NV	
5	13	010	20.62	01996	Grande Ronde River, Hwy 10 at MP 20.62 (NE Elgin)	1935	Concrete continuous	9,094	6/6/5	PR	ND		PV	
5	13	Hwy 10	17.88	21292	Grande Ronde River & INP RR, Hwy 10 (Indian Creek)	2012	Prestressed concrete	21,191	8/8/8	VG	ND		NV	
5	13	351	6.06	04917A	Wallowa River, Hwy 351 Frtg Rd (State Park)	1950	Concrete continuous	2,941	7/7/5	PR	ND		PV	
5	13	351	6.52	07918	East Fork Wallowa River, Hwy 351	1955	Concrete	793	7/8/6	GD	ND		NV	
5	13	341	35.17	03501A	Meadow Brook, Hwy 341	1978	Prestressed concrete	3,384	7/7/7	VG	ND		NV	
5	13	341	39.75	04847A	Grande Ronde River, Hwy 341 (Red)	1951	Concrete continuous	3,782	6/6/5	PR	ND		PV	
5	13	341	42.52	18657	Bear Creek, Hwy 341	2000	Prestressed concrete	920	8/8/5	PR	ND		NV	
5	13	341	46.75	04841A	Grande Ronde River, Hwy 341 (Hilgard)	1951	Concrete continuous	4,090	7/6/6	GD	ND		PV	
5	13	341	42.98	04845	Jordan Creek, Hwy 341	1954	Steel	918	6/6/6	GD	ND		NV	
5	13	341	47.01	20255	Hwy 341 over Hwy 6 (Hilgard Intchg)	2008	Steel	6,912	7/8/8	VG	ND		NV	
5	13	066	10.95	00445A	Hwy 66 over UPRR (Hot Lake)	1971	Concrete continuous	12,436	6/5/7	PR	ND		NV	
5	13	066	0.23	08431	Grande Ronde R & UPRR & Hwy6 EB, Hwy66 WB (Oro Dell)	1960	Concrete continuous	16,630	7/5/6	PR	OD	DG	NV	
5	13	066	0.12	08431A	Grande Ronde R & UPRR, Hwy 66 EB (Oro Dell)	1973	Prestressed concrete continuous	13,725	6/6/7	GD	OD	Rail	NV	
5	13	066	8.90	22105	Branch of Ladd Creek, Hwy 66 at MP 8.90	2014	Prestressed concrete	1,220	8/8/8	VG	ND		NV	
5	13	066	24.60	00450	Hwy 66 over UPRR (Telocaset)	1921	Concrete continuous	4,445	6/6/5	PR	ND		PV	
5	13	066	12.61	00558A	Catherine Creek, Hwy 66 at MP 12.61 (Davis Dam),	1966	Concrete continuous	3,341	7/7/5	PR	ND		NV	
5	13	066	15.65	00818A	Little Creek, Hwy 66	1922	Concrete	781	7/6/6	GD	ND		NV	
5	13	066	16.43	17334	Catherine Creek, Hwy 66 at MP 16.43 (Main St)	1994	Prestressed concrete	2,951	8/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 13

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	066	30.49	17461	Wolf Creek, Hwy 66	1995	Concrete continuous	-	8	VG	ND		NV	
5	13	066	38.59	02784B	Muddy Creek, Hwy 66	1978	Prestressed concrete	817	7/7/6	GD	ND		NV	
5	13	066	39.82	02786A	Sand Creek, Hwy 66	1962	Prestressed concrete	900	7/7/6	GD	ND		NV	
5	13	066	32.52	09500	Hwy 66 over UPRR (North Powder)	1972	Prestressed concrete	8,713	7/8/7	VG	ND		NV	
5	13	066	45.75	00493	Old Settlers Slough, Hwy 66	1920	Concrete continuous	-	6	GD	ND		NV	
5	13	066	52.13	02793A	Powder River, Hwy 66 (Bridge St)	1933	Steel	3,041	4/5/5	PR	SD	SD Scour PAINT	NV	
5	13	066	32.86	07293	North Powder River, Hwy 66	1952	Concrete continuous	4,058	7/6/6	GD	ND		PV	
5	13	340	9.57	02336	Catherine Creek, Hwy 340 (Park)	1940	Wood or Timber	2,432	6/5/5	PR	OD	TS	PV	
5	13	340	0.63	04834A	Catherine Creek, Hwy 340 (State Yard)	1966	Concrete continuous	3,370	7/7/5	PR	ND		NV	
5	13	340	28.82	02314A	Powder River, Hwy 340 (Miles)	1986	Prestressed concrete	2,816	8/8/8	VG	ND		NV	
5	13	340	23.58	02891A	Big Creek, Hwy 340	1976	Prestressed concrete	1,041	8/7/6	GD	ND		NV	
5	13	340	28.92	02897A	Basche Irrigation Ditch, Hwy 340	1972	Prestressed concrete	928	7/7/8	VG	ND		NV	
5	13	342	15.91	06998	Mill Creek, Hwy 342	1946	Concrete continuous	-	6	GD	ND		NV	
5	13	342	9.44	04855A	Catherine Creek & Old River Channel, Hwy 342	1966	Prestressed concrete	6,300	7/7/6	GD	ND		NV	
5	13	006	257.24	19229	Grande Ronde R & Hwy 6 Conn, Hwy 6 EB (L Perry I/C)	2003	Prestressed concrete continuous	17,697	7/8/8	VG	ND		NV	
5	13	006	257.22	19230	Grande Ronde R & Hwy 6 Conn, Hwy 6 WB (L Perry I/C)	2003	Prestressed concrete continuous	17,697	7/7/8	VG	ND		NV	
5	13	006	270.87	21206	Ladd Creek, Hwy 6 at MP 270.87	2015	Steel	-	8	VG	ND		NV	
5	13	012	40.64	01122A	Eagle Creek, Hwy 12 (Richland),	1925	Steel	2,940	6/7/5	PR	OD	LSL LC	NV	
5	13	006	285.84	07292A	Hwy 6 WB over UPRR (North Powder)	1972	Prestressed concrete	11,289	6/8/8	GD	ND		NV	
5	13	006	285.84	07292B	Hwy 6 EB over UPRR (North Powder)	1952	Concrete continuous	10,098	5/6/6	PR	ND		PV	
5	13	006	285.68	09499	Hwy 6 WB over Hwy 66 (North Powder Intchg)	1972	Prestressed concrete	6,424	5/7/7	PR	ND		NV	
5	13	006	285.68	09499A	Hwy 6 EB over Hwy 66 (North Powder Intchg)	1972	Prestressed concrete	6,424	5/7/7	PR	ND		NV	

2017 BRIDGE CONDITION REPORT - District 13

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	006	286.20	07293A	North Powder River, Hwy 6 WB	1972	Prestressed concrete	4,261	6/8/8	GD	ND		NV	
5	13	006	286.20	07293B	North Powder River, Hwy 6 EB	1972	Prestressed concrete	4,261	6/8/8	GD	ND		NV	
5	13	340	38.59	09511	Hwy 340 over Hwy 6 (Chandler Lane Interchange)	1972	Steel continuous	12,397	6/7/7	GD	ND		NV	
5	13	012	2.67	09804	Hwy 12 over Hwy 6 (Richland Intchg)	1972	Steel continuous	16,261	6/7/7	GD	ND		NV	
5	13	006	289.17	09801	Powder River, Hwy 6 WB	1972	Prestressed concrete	5,196	6/8/8	GD	ND		NV	
5	13	006	289.17	09801A	Powder River, Hwy 6 EB	1972	Prestressed concrete	5,196	6/8/8	GD	ND		NV	
5	13	C0000	291.65	09802	County Rd 714 (Normandy Rd) over Hwy 6	1972	Prestressed concrete continuous	10,098	7/6/7	GD	ND		NV	
5	13	C0712	295.67	09803	County Rd 712 (Culley Lane) over Hwy 6	1972	Prestressed concrete continuous	10,101	7/7/7	VG	ND		NV	
5	13	006	296.78	09507	Baldock Slough, Hwy 6 WB	1972	Concrete continuous	3,823	6/6/6	GD	ND		NV	
5	13	006	296.78	09507A	Baldock Slough, Hwy 6 EB	1972	Concrete continuous	3,823	6/6/6	GD	ND		NV	
5	13	006	304.13	09515	Hwy 6 WB over Hwy 12 (Campbell St Intchg)	1972	Prestressed concrete	9,338	7/6/7	GD	OD	Rail VC	NV	
5	13	006	304.13	09515A	Hwy 6 EB over Hwy 12 (Campbell St Intchg)	1972	Prestressed concrete	9,338	7/6/7	GD	OD	Rail	NV	
5	13	006	306.53	09516	Hwy 6 over Conn (South Baker Intchg)	1972	Concrete continuous	24,908	6/6/7	GD	OD	Rail	NV	
5	13	006	313.65	08302E	Hwy 6 EB over Conn & UPRR (Encina Intchg)	1964	Steel	12,507	6/6/7	GD	ND		NV	
5	13	006	313.65	08302W	Hwy 6 WB over Conn & UPRR (Encina Intchg)	1964	Steel	12,686	5/6/7	PR	ND		NV	
5	13	006	315.29	08423E	Hwy 6 EB over Alder Creek Rd	1964	Concrete continuous	6,091	5/6/6	PR	ND		NV	
5	13	006	315.29	08423W	Hwy 6 WB over Alder Creek Rd	1964	Concrete continuous	6,091	5/6/6	PR	ND		NV	
5	13	006	317.46	19712	Alder Crk & UPRR, Hwy 6 EB (Pleasant Vly Int)	2006	Steel continuous	27,922	7/8/8	VG	ND		NV	
5	13	006	317.44	19713	Alder Crk & UPRR, Hwy 6 WB (Pleasant Vly Int)	2007	Steel continuous	28,980	7/8/8	VG	ND		NV	
5	13	006DE	256.31	00626	Grande Ronde R & UPRR, Hwy 6 Frtg Rd (Perry Arch)	1924	Concrete continuous	7,082	7/6/6	GD	ND		PV	
5	13	006 Cor	256.42	08426	Hwy 6 Conn over Hwy 6 (Upper Perry Intchg)	1960	Concrete continuous	4,752	6/5/7	PR	OD	Rail LC	NV	
5	13	006	256.17	19865	Grande Ronde River, Hwy 6 EB (Upper Perry)	2004	Steel continuous	18,104	7/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 13

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	006	256.18	19866	Grande Ronde River, Hwy 6 WB (Upper Perry)	2005	Steel continuous	22,192	7/8/8	VG	ND		NV	
5	13	006	253.42	08504	Five Point Creek, Hwy 6	1960	Concrete continuous	9,176	7/7/7	VG	ND		NV	
5	13	006	254.93	08505	Hamilton Creek, Hwy 6	1960	Concrete continuous	-	7	VG	ND		NV	
5	13	006DE	256.75	08427	Grande Ronde R., Hwy 6 Hamilton Cr Fr Rd (Perry)	1959	Concrete continuous	7,885	5/5/6	PR	ND		NV	
5	13	C0000	268.26	09622	Hwy 6 Conn over Hwy 6 (Foothill Rd Intch)	1973	Prestressed concrete continuous	11,252	7/6/7	GD	ND		NV	
5	13	006	260.93	09631	Hwy 6 WB over N Spruce St (La Grande)	1972	Concrete continuous	6,720	7/6/7	GD	ND		NV	
5	13	006	260.93	09631A	Hwy 6 EB over N Spruce St (La Grande)	1972	Concrete continuous	6,720	7/6/7	GD	ND		NV	
5	13	C0000	262.34	09633	Cove Ave (La Grande) over Hwy 6	1972	Prestressed concrete continuous	18,011	6/6/7	GD	ND		NV	
5	13	C0000	264.21	09634	McAlister Lane (La Grande) over Hwy 6	1972	Prestressed concrete continuous	26,605	6/7/7	GD	ND		NV	
5	13	006	284.38	07291C	Wolf Creek, Hwy 6 WB	1974	Concrete continuous	2,803	6/7/7	GD	ND		NV	
5	13	006	284.38	07291D	Wolf Creek, Hwy 6 EB	1974	Concrete continuous	2,716	6/7/7	GD	ND		NV	
5	13	006EC	273.91	09779	Hwy 6 Conn over Hwy 6 (Ladd Canyon Intchg)	1973	Prestressed concrete continuous	10,705	7/6/7	GD	ND		NV	
5	13	006EJ	278.64	13584	Hwy 6 Conn over Hwy 6 (Clover Creek Intchg)	1974	Prestressed concrete continuous	9,884	7/6/7	GD	ND		NV	
5	13	006	270.87	09686	Hwy 6 over Conn (Ladd Creek Intchg)	1973	Concrete continuous	16,562	5/6/8	PR	ND		NV	
5	13	C0000	280.53	09780	McCanse Rd over Hwy 6	1974	Prestressed concrete continuous	10,055	7/6/7	GD	ND		NV	
5	13	006EO	283.64	09755	Hwy 6 Conn over Hwy 6 (Wolf Creek Intchg)	1974	Steel continuous	9,660	7/7/7	VG	ND		NV	
5	13	006	264.96	09635	Hwy 6 WB over Hwy 66 (Union Jct Intchg)	1972	Steel continuous	25,673	6/7/7	GD	ND		NV	
5	13	006	264.92	09635A	Hwy 6 EB over Hwy 66 (Union Jct Intchg)	1972	Steel continuous	28,998	5/6/7	PR	ND		NV	
5	13	006	261.85	09632	Hwy 6 WB over Hwy 10 & UPRR (Wallowa Lake Intchg)	1972	Steel continuous	16,161	6/7/7	GD	ND		NV	
5	13	006	261.84	09632A	Hwy 6 EB over Hwy 10 & UPRR Wallowa Lake Intchg)	1972	Steel continuous	13,938	6/7/7	GD	ND		NV	
5	13	006DI	253.45	00718	Five Point Creek, Hwy 6 Frtg Rd Lt	1921	Steel	1,265	5/5/6	PR	OD	LSL	NV	
5	13	010	59.92	00723A	Wallowa River, Hwy 10 (Railroad)	1966	Prestressed concrete	7,644	7/8/7	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 13


Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	010	63.18	00724A	Trout Creek, Hwy 10	1988	Prestressed concrete	2,055	8/8/8	VG	ND		NV	
5	13	010	45.83	02184	Wallowa River, Hwy 10 (Bear Creek)	1937	Concrete continuous	8,120	5/6/5	PR	OD	LSL	PV	
5	13	010	54.11	07573	Lostine River, Hwy 10	1953	Concrete continuous	3,758	7/6/6	GD	ND		PV	
5	13	010	42.26	17415	Rock Creek, Hwy 10	1995	Prestressed concrete	2,196	8/8/8	VG	ND		NV	
5	13	010	65.33	18472	Prairie Creek, Hwy 10 at MP 65.33 (River St.)	1999	Prestressed concrete	2,080	8/8/8	VG	ND		NV	
5	13	012	21.15	02808	Goose Creek, Hwy 12	1947	Concrete continuous	-	6	GD	ND		NV	
5	13	012	0.33	02924A	Powder R, Hwy 12 at MP 0.33 (Campbell St, Baker)	1972	Prestressed concrete	4,413	8/7/6	GD	OD	Rail	NV	
5	13	012	30.08	16810	Powder R, Hwy 12 at MP 30.08 (Hole-in-the-Wall #1)	1987	Prestressed concrete	15,027	6/6/5	PR	ND		NV	
5	13	012	31.23	16811	Powder R, Hwy 12 at MP 31.23 (Hole-in-the-Wall #2)	1987	Prestressed concrete	13,277	6/6/5	PR	ND		NV	
5	13	012	14.32	17411	Ruckles Creek, Hwy 12	1994	Concrete continuous	1,276	8	VG	ND		NV	
5	13	012	20.75	19836	Powder River, Hwy 12 at MP 20.76 (Love)	2004	Prestressed concrete	4,579	8/7/8	VG	ND		NV	
5	13	350	15.12	01926A	Little Sheep Creek, Hwy 350 at MP 15.12	1962	Concrete continuous	2,248	7/6/8	GD	ND		NV	
5	13	350	28.10	02069A	Camp Creek, Hwy 350	1991	Prestressed concrete	1,856	8/8/8	VG	ND		NV	
5	13	350	16.05	02084	Little Sheep Creek, Hwy 350 at MP 16.05	1935	Concrete	655	5/6/5	PR	ND		NV	
5	13	010	65.81	02219A	Prairie Creek, Hwy 10 at MP 65.81 (E. Enterprise)	1985	Prestressed concrete	2,560	8/7/7	VG	ND		NV	
5	13	350	29.34	18074	Imnaha River, Hwy 350	1997	Steel	3,234	6/8/8	GD	ND		NV	
5	13	350	13.69	18881	Little Sheep Creek, Hwy 350 at MP 13.69	2001	Prestressed concrete	1,184	8/8/8	VG	ND		NV	
5	13	350	14.41	18882	Little Sheep Creek, Hwy 350 at MP 14.41	2001	Prestressed concrete	1,184	8/8/8	VG	ND		NV	
5	13	071	30.54	09385	Deer Creek, Hwy 71	1965	Prestressed concrete	2,167	6/6/5	PR	ND		NV	
5	13	410	0.30	18461	Cracker Creek, Hwy 410 (Sumpter)	1998	Prestressed concrete	2,508	8/8/8	VG	ND		NV	
5	13	071	41.19	20720	Powder River, Hwy 71 at MP 41.19 (Rancheria)	2010	Prestressed concrete	4,268	8/8/8	VG	ND		NV	
5	13	071	42.31	20721	Powder River, Hwy 71 at MP 42.31 (Salisbury)	2010	Prestressed concrete	4,953	8/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 13

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	13	006	258.89	19683	Grande Ronde River, Hwy 6 WB (Upper Quarry)	2004	Prestressed concrete continuous	16,500	7/8/7	VG	ND		NV	
5	13	006	259.13	19681	Grande Ronde River & UPRR, Hwy 6 EB (Lower Quarry)	2003	Prestressed concrete continuous	18,115	6/8/8	GD	ND		NV	
5	13	006	259.13	19682	Grande Ronde River & UPRR, Hwy 6 WB (Lower Quarry)	2004	Prestressed concrete continuous	27,119	7/8/8	VG	ND		NV	
5	13	006	258.89	19684	Grande Ronde River, Hwy 6 EB (Upper Quarry)	2003	Prestressed concrete continuous	18,735	6/8/8	GD	ND		NV	
5	13	414	0.44	02836A	Pine Creek, Hwy 414 (Halfway)	1960	Concrete continuous	2,495	6/4/6	PR	SD	SD Scour	NV	
5	13	413	5.69	06598A	Pine Creek, Hwy 413 at MP 5.69 (Carson)	1973	Prestressed concrete	2,016	8/6/7	GD	ND		NV	
5	13	012	63.65	16032	North Pine Creek, Hwy 12	1958	Concrete continuous	2,618	7/6/5	PR	OD	Scour	PV	
5	13	006	260.29	09630	Grande Ronde River, Hwy 6 WB at MP 260.29	1972	Concrete continuous	13,439	8/7/7	VG	ND		NV	
5	13	006	260.29	09630A	Grande Ronde River, Hwy 6 EB at MP 260.29	1972	Concrete continuous	13,439	8/7/7	VG	ND		NV	
5	13	2nd Str	0.00	09630B	Grande Ronde River & Hwy 6, N 2nd St (La Grande)	1972	Concrete continuous	19,440	6/5/6	PR	ND		NV	

OREGON STATE HIGHWAY SYSTEM 2017 BRIDGE CONDITION - DISTRICT 14

APRIL 2017

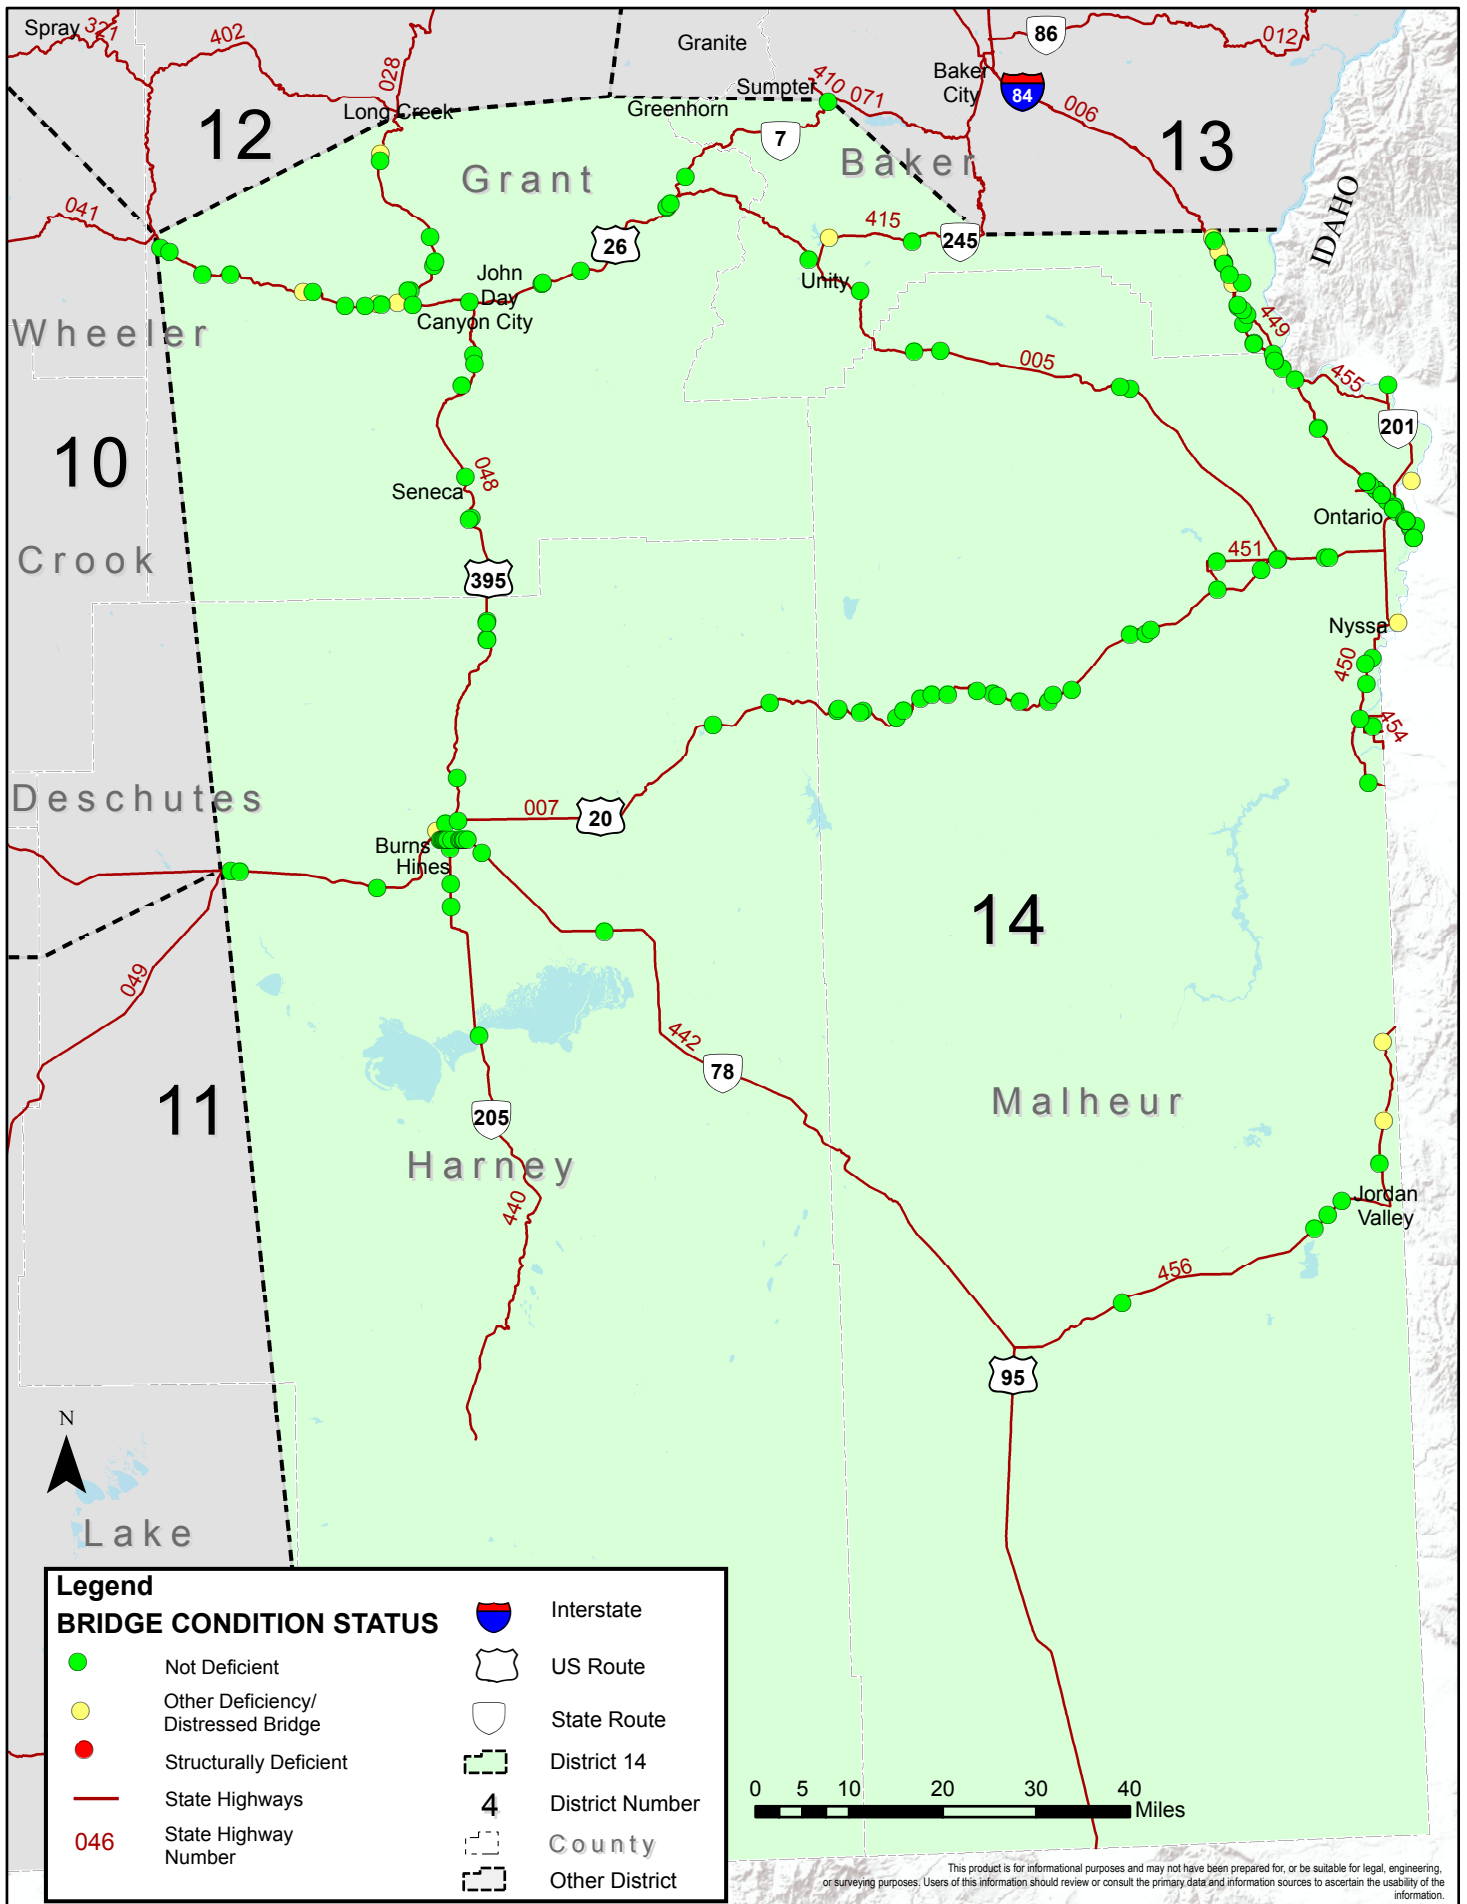

This product is for informational purposes and may not have been prepared for, or be suitable for legal, engineering, or surveying purposes. Users of this information should review or consult the primary data and information sources to ascertain the usability of the information.

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	492	21.30	04335A	Snake River, Hwy 492 (Payette)	1953	Steel continuous	21,083	5/6/5	PR	OD	LSL	PV	
5	14	006	356.17	08083A	Hwy 6 over Hwy 455 (Olds Ferry Intchg)	1973	Prestressed concrete	21,188	6/8/7	GD	ND		NV	
5	14	006	353.04	09120	Hwy 6 WB over Conn (Benson Creek Intchg)	1967	Prestressed concrete	7,392	7/8/8	VG	ND		NV	
5	14	006	353.04	09120A	Hwy 6 EB over Conn (Benson Creek Intchg)	1967	Prestressed concrete	7,392	7/8/8	VG	ND		NV	
5	14	006	362.15	09838	Hwy 6 WB over Hwy 6 Conn (Moores Hollow Intchg)	1972	Concrete continuous	6,234	5/6/7	PR	ND		NV	
5	14	006	362.15	09838A	Hwy 6 EB over Hwy 6 Conn (Moores Hollow Intchg)	1973	Concrete continuous	6,234	5/6/7	PR	ND		NV	
5	14	007	167.64	19905	Stinkingwater Creek, Hwy 7	2004	Prestressed concrete	7,757	8/8/8	VG	ND		NV	
5	14	007	174.57	19906	Middle Fork Malheur River, Hwy 7	2004	Prestressed concrete	9,096	8/8/7	VG	ND		NV	
5	14	007	185.81	19907	Chimney Cr (Kingsbury Gulch), Hwy 7 at MP 185.81	2005	Prestressed concrete	3,575	8/8/8	VG	ND		NV	
5	14	007	190.84	19908	North Fork Malheur River, Hwy 7	2005	Prestressed concrete	7,605	7/8/8	VG	ND		NV	
5	14	007	191.97	19909	Malheur River, Hwy 7 (Horseshoe Bend)	2005	Prestressed concrete continuous	11,447	8/6/7	GD	ND		NV	
5	14	007	195.13	19910	Malheur River, Hwy 7 (Gwynn)	2004	Prestressed concrete	7,400	8/8/5	PR	ND		NV	
5	14	007	205.58	19911	Malheur River, Hwy 7 (Sperry)	2005	Prestressed concrete continuous	7,400	8/7/7	VG	ND		NV	
5	14	007	205.83	19912	Sperry Creek, Hwy 7	2004	Prestressed concrete	2,724	8/8/8	VG	ND		NV	
5	14	007	208.42	19914	Gold Creek, Hwy 7	2004	Prestressed concrete	2,840	8/8/8	VG	ND		NV	
5	14	007	213.42	19915	Malheur River, Hwy 7 (Diversion)	2004	Prestressed concrete	5,304	7/8/6	GD	ND		NV	
5	14	007	214.46	19916	Malheur River, Hwy 7 (Namorf)	2004	Prestressed concrete	5,104	8/8/8	VG	ND		NV	
5	14	007	216.78	19917	Squaw Creek, Hwy 7	2004	Prestressed concrete	2,788	8/8/8	VG	ND		NV	
5	14	007	244.29	19918	Bully Creek, Hwy 7	2005	Prestressed concrete	4,903	7/8/8	VG	ND		NV	
5	14	007	246.61	19919	Malheur River, Hwy 7 WB (Vale)	2005	Prestressed concrete continuous	14,515	7/8/7	VG	ND		NV	
5	14	006	374.07	07935A	Malheur River, Hwy 6 EB	1973	Prestressed concrete	18,655	5/7/7	PR	ND		NV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	006	374.08	07935B	Malheur River, Hwy 6 WB	1973	Prestressed concrete	19,585	7/7/7	VG	ND		NV	
5	14	006	370.48	07936A	Owyhee Canal, Hwy 6 at MP 370.48	1955	Concrete continuous	-	7	VG	ND		NV	
5	14	C0000	373.08	07956	Chester Blvd over Hwy 6	1956	Concrete continuous	5,432	6/6/6	GD	ND		PV	
5	14	006HB	371.45	07970	Stanton Blvd over Hwy 6	1956	Concrete continuous	6,188	7/6/7	GD	ND		PV	
5	14	006	372.18	07971A	Hwy 6 WB over Doman Road	1972	Prestressed concrete	6,507	6/8/8	GD	ND		NV	
5	14	006	369.99	07979A	Hwy 6 EB Over S. Fork Jacobsen Gulch Rd.	1973	Prestressed concrete	5,255	7/6/7	GD	ND		NV	
5	14	006	369.99	07979B	Hwy 6 WB Over S. Fork Jacobsen Gulch Rd.	1972	Prestressed concrete	5,244	7/6/7	GD	ND		NV	
5	14	006	375.80	08397E	Hwy 6 EB over UPRR (Ore-Ida)	1960	Concrete continuous	8,359	7/6/6	GD	ND		NV	
5	14	006	375.80	08397W	Hwy 6 WB over UPRR (Ore-Ida)	1960	Concrete continuous	8,359	7/6/6	GD	ND		NV	
5	14	006	376.00	08398E	Hwy 6 EB over Grigg Road	1960	Concrete continuous	5,385	6/6/6	GD	ND		NV	
5	14	006	376.00	08398W	Hwy 6 WB over Grigg Road	1960	Concrete continuous	5,385	6/6/6	GD	ND		NV	
5	14	457	0.59	17192	Owyhee Canal, Hwy 457 (Stanton Blvd)	1991	Prestressed concrete	2,016	7/7/7	VG	ND		NV	
5	14	006	372.18	20378	Hwy 6 EB over Doman Road	2007	Prestressed concrete	5,141	8/8/8	VG	ND		NV	
5	14	007	266.81	01463A	Snake River, Hwy 7 (Nyssa)	1957	Steel continuous	36,523	7/6/5	PR	OD	LSL	PV	
5	14	006	378.01	08107E	Snake River, Hwy 6 EB	1960	Steel	33,134	5/6/6	PR	ND		NV	
5	14	006	378.01	08107W	Snake River, Hwy 6 WB	1960	Steel	33,134	6/6/6	GD	ND		NV	
5	14	C0000	376.98	08400	SE 5th Ave (River Rd) over Hwy 6	1960	Concrete continuous	9,956	6/6/6	GD	ND		NV	
5	14	006	350.20	09121	Hwy 6 WB over Benson Creek Rd	1967	Concrete continuous	5,082	6/6/7	GD	ND		NV	
5	14	006	350.20	09121A	Hwy 6 EB over Benson Creek Rd	1967	Concrete continuous	5,082	6/6/7	GD	ND		NV	
5	14	C0000	0.00	09125	Durbin Creek Rd over Hwy 6	1967	Steel continuous	11,856	7/7/8	VG	ND		NV	
5	14	006	337.27	01781A	Burnt River & Private Rd, Hwy 6 MP 337.27	1971	Prestressed concrete	23,575	7/7/7	VG	OD	LSL	NV	
5	14	006	338.99	01783A	Burnt River, Hwy 6 at MP 338.99 (Chimney Creek)	1971	Prestressed concrete	19,684	7/7/7	VG	OD	LSL	NV	
5	14	006	337.63	02203A	Burnt River, Hwy 6 at MP 337.63 (Jordan Creek)	1971	Prestressed concrete continuous	20,860	7/6/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	006	338.11	09375	Hwy 6 over Jordan Cr Conn (Lookout Mtn Intchg)	1971	Concrete continuous	9,276	8/8/8	VG	ND		NV	
5	14	006	340.58	01786A	Burnt River, Hwy 6 at MP 340.58 (Dixie Creek)	1971	Prestressed concrete continuous	16,878	8/7/8	VG	ND		NV	
5	14	006	341.86	01787A	Burnt River, Hwy 6 at MP 341.86 (Jett Creek)	1971	Prestressed concrete continuous	16,516	8/7/7	VG	ND		NV	
5	14	006	342.91	20482	Hwy 6 over Hwy 449 Conn & UPRR (Lime Interchange)	2009	Prestressed concrete continuous	42,735	7/8/8	VG	ND		NV	
5	14	006	345.83	09123	Hwy 6 over Hwy 6 Conn (North Huntington Intchg)	1967	Prestressed concrete	15,496	5/8/7	PR	ND		NV	
5	14	006GG	340.42	09394	Hwy 6 Conn #2 over Hwy 6 (Dixie Interchange)	1971	Concrete continuous	7,211	7/6/7	GD	ND		NV	
5	14	006GG	340.36	09820	Hwy 6 Conn #2 over UPRR (Dixie Interchange)	1971	Prestressed concrete	4,845	7/7/7	VG	ND		NV	
5	14	006GH	340.59	20484	Burnt River, Hwy 6 Conn #3 (Dixie)	2008	Prestressed concrete	3,362	8/8/8	VG	ND		NV	
5	14	005	131.24	00889A	South Fork John Day River, Hwy 5 (Dayville)	1967	Prestressed concrete	12,635	6/8/7	GD	ND		NV	
5	14	005	125.72	16319	Rattlesnake Creek, Hwy 5	1979	Prestressed concrete	2,560	7/7/7	VG	ND		NV	
5	14	005	126.84	17407	Cottonwood Creek, Hwy 5	1998	Prestressed concrete	1,800	8/8/8	VG	ND		NV	
5	14	005	134.36	00888A	John Day River, Hwy 5 (Stewarts)	1966	Prestressed concrete continuous	14,136	7/6/7	GD	ND		NV	
5	14	005	143.18	00989A	John Day River, Hwy 5 (Moores Crossing)	1964	Prestressed concrete	5,349	7/8/8	VG	OD	LSL	NV	
5	14	005	151.89	01042	Riley Creek, Hwy 5	1965	Prestressed concrete	900	7/6/5	PR	OD	TS	NV	
5	14	005	150.54	01043A	McClellan Creek, Hwy 5	1979	Prestressed concrete	886	8/8/6	GD	ND		NV	
5	14	005	148.25	01044	Moon Creek, Hwy 5	1953	Concrete	2,941	5/6/6	PR	ND		PV	
5	14	005	144.30	01046A	Fields Creek, Hwy 5	1979	Prestressed concrete	736	8/7/7	VG	ND		NV	
5	14	005	152.33	00988A	John Day River, Hwy 5 (Mt Vernon)	1967	Prestressed concrete	11,845	7/7/7	VG	ND		NV	
5	14	005	154.07	01041	Beech Creek, Hwy 5 (Mt Vernon)	1956	Concrete	2,964	6/5/5	PR	OD	Scour	PV	
5	14	005	170.49	02463	Indian Creek, Hwy 5	1939	Concrete continuous	1,699	7/6/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	005	170.62	02464	John Day River, Hwy 5 (Prairie City)	1939	Concrete continuous	3,985	6/6/6	GD	ND		PV	
5	14	005	174.96	02466	Dixie Creek, Hwy 5 (Prairie City)	1939	Concrete continuous	2,748	7/6/6	GD	ND		PV	
5	14	005	162.08	18947	Canyon Creek, Hwy 5 (John Day)	2002	Prestressed concrete	3,808	8/8/8	VG	ND		NV	
5	14	005	155.75	20870	John Day River, Hwy 5 (Coles)	2010	Prestressed concrete	8,330	8/8/8	VG	ND		NV	
5	14	005	209.17	02773A	South Fork Burnt River, Hwy 5	1986	Prestressed concrete	1,344	8/7/7	VG	ND		NV	
5	14	005	188.62	20046	Bridge Creek, Hwy 5 at MP 188.62	2007	Prestressed concrete	1,800	8/8/8	VG	ND		NV	
5	14	005	188.77	20047	Bridge Creek, Hwy 5 at MP 188.77	2007	Prestressed concrete	1,560	8/8/8	VG	ND		NV	
5	14	005	189.36	20048	Bridge Creek, Hwy 5 at MP 189.36	2006	Prestressed concrete	1,280	8/8/8	VG	ND		NV	
5	14	005	252.97	00546A	Pole Creek, Hwy 5	1979	Prestressed concrete	2,005	8/8/7	VG	ND		NV	
5	14	005	251.88	00589A	Canyon Creek, Hwy 5 at MP 251.88	1979	Prestressed concrete	2,365	8/7/7	VG	ND		NV	
5	14	005	216.74	02778A	West Camp Creek, Hwy 5	1979	Prestressed concrete	896	7/6/7	GD	ND		NV	
5	14	005	228.21	04307A	Middle Fork Willow Creek, Hwy 5	1986	Prestressed concrete	864	8/8/8	VG	ND		NV	
5	14	005	230.98	04311A	South Fork Willow Creek (Rose Creek), Hwy 5	1993	Prestressed concrete	1,472	8/8/8	VG	ND		NV	
5	14	007	196.71	01717A	Calf Creek, Hwy 7	1949	Concrete continuous	-	7	VG	ND		NV	
5	14	007	199.32	01719A	Pole Creek, Hwy 7	1949	Concrete continuous	-	7	VG	ND		NV	
5	14	007	203.28	04347A	Black Canyon Creek, Hwy 7	1959	Concrete continuous	2,436	6/6/7	GD	ND		NV	
5	14	007	246.55	00599B	Malheur River, Hwy 7 EB (Vale)	1988	Prestressed concrete	11,610	6/8/7	GD	ND		NV	
5	14	007	238.66	01407A	Malheur River, Hwy 7 (Hope)	1966	Prestressed concrete	14,126	7/5/5	PR	ND		NV	
5	14	451	4.68	01624A	Bully Creek, Hwy 451	1969	Prestressed concrete	1,600	7/6/6	GD	ND		NV	
5	14	007	227.74	04373A	Buckaroo Cabin Creek, Hwy 7	1962	Concrete continuous	3,418	8/7/7	VG	ND		NV	
5	14	007	228.40	04374A	Little Sandy Creek, Hwy 7	1962	Concrete continuous	2,149	7/7/7	VG	ND		NV	
5	14	007	225.53	17944	Cottonwood Creek, Hwy 7	1996	Prestressed concrete	3,040	8/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	028	113.62	03556A	Beech Creek, Hwy 28 at MP 113.62	1972	Prestressed concrete	4,450	7/7/7	VG	ND		NV	
5	14	028	118.28	09659	Beech Creek, Hwy 28 at MP 118.29	1967	Concrete continuous	4,140	7/7/7	VG	ND		NV	
5	14	028	118.55	09660	Beech Creek, Hwy 28 at MP 118.55	1967	Concrete continuous	4,629	7/7/7	VG	ND		NV	
5	14	028AE	113.07	M3556	Beech Creek, Hwy 28 Frontage Rd Rt at MP F113.09	1993	Prestressed concrete	651	7/6/6	GD	ND		NV	
5	14	028	110.20	03553A	Beech Creek, Hwy 28 at MP 110.20	1958	Concrete continuous	3,878	6/7/6	GD	ND		PV	
5	14	028	98.31	06204	Smith Creek, Hwy 28	1941	Concrete	609	7/6/6	GD	OD	Rail	NV	
5	14	028	99.13	06205	Fox Creek, Hwy 28	1941	Concrete	756	6/6/7	GD	ND		NV	
5	14	048	7.25	03558A	Canyon Creek, Hwy 48	1962	Concrete continuous	1,950	7/7/8	VG	ND		NV	
5	14	048	24.29	03564A	Bear Creek, Hwy 48	1984	Prestressed concrete	1,562	8/8/8	VG	ND		NV	
5	14	048	62.54	03603A	Poison Creek, Hwy 48	1971	Prestressed concrete	1,282	8/8/6	GD	ND		NV	
5	14	048	45.02	07053	Trout Creek, Hwy 48 at MP 45.02	1947	Concrete continuous	-	6	GD	ND		NV	
5	14	048	45.12	07054A	Trout Creek, Hwy 48 at MP 45.12	1947	Concrete continuous	-	6	GD	ND		NV	
5	14	048	43.17	0P489	Trout Creek, Hwy 48 at MP 43.17	1988	Steel	-	5	FR	ND		NV	
5	14	048	30.10	17987	Silvies River, Hwy 48 at MP 30.10	1996	Prestressed concrete	3,240	7/7/8	VG	ND		NV	
5	14	048	30.45	17988	Silvies River, Hwy 48 at MP 30.45	1996	Prestressed concrete	2,509	7/7/8	VG	ND		NV	
5	14	048	42.95	20867	Trout Creek Overflow, Hwy 48 at MP 42.95	2010	Prestressed concrete	960	8/8/6	GD	ND		NV	
5	14	491	13.66	13811	Snake River, Hwy 491 (Weiser)	2010	Prestressed concrete continuous	40,559	7/8/8	VG	ND		NV	
5	14	071	2.74	0P447	Middle Fork John Day River, Hwy 71 (Austin)	1972	Steel	-	6	GD	ND		NV	
5	14	456	25.77	01948A	Jordan Creek, Hwy 456	1985	Prestressed concrete	5,069	8/8/8	VG	ND		NV	
5	14	456	2.16	02118A	Succor Creek, Hwy 456	1975	Prestressed concrete	5,317	7/6/6	GD	OD	LSL	NV	
5	14	456	10.98	05225A	Cow Creek, Hwy 456	1944	Concrete continuous	2,494	6/6/6	GD	OD	LSL	PV	
5	14	456	15.67	17336	Hooker Creek, Hwy 456	1993	Steel	-	8	VG	ND		NV	
5	14	456	52.97	01945A	Owyhee River, Hwy 456 (Rome)	1936	Steel	11,457	7/6/6	GD	ND		PV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	456	29.92	01946A	Antelope Canal, Hwy 456 at MP 29.92	1985	Prestressed concrete	1,724	8/8/8	VG	ND		NV	
5	14	456	27.91	01947A	Antelope Canal , Hwy 456 at MP 27.91	1985	Prestressed concrete	1,850	8/8/8	VG	ND		NV	
5	14	440	7.23	03617B	West Fork Silvies River, Hwy 440	1985	Prestressed concrete	2,192	8/8/8	VG	ND		NV	
5	14	440	0.61	17455	Newman Slough (Silvies Overflow), Hwy 440	1997	Prestressed concrete	1,594	8/8/8	VG	ND		NV	
5	14	440	0.98	17456	Silvies River, Hwy 440	1997	Prestressed concrete	1,290	8/8/8	VG	ND		NV	
5	14	440	4.81	18181	Chapman Slough, Hwy 440	1997	Prestressed concrete	1,146	8/8/8	VG	ND		NV	
5	14	415	3.42	02861	Burnt River, Hwy 415 (Unity Dam)	1937	Steel	2,997	5/6/6	PR	OD	PAINT	PV	
5	14	415	12.53	02869	Big Creek, Hwy 415	1965	Prestressed concrete	961	6/7/5	PR	ND		NV	
5	14	450	8.73	01747B	Owyhee River, Hwy 450	1985	Prestressed concrete	13,568	7/7/7	VG	ND		NV	
5	14	450	5.26	04393A	Owyhee Irrigation Ditch, Hwy 450 at MP 5.26	1967	Prestressed concrete	1,640	7/7/7	VG	ND		NV	
5	14	450	6.53	04394A	Owyhee Irrigation Ditch, Hwy 450 at MP 6.53	1967	Prestressed concrete	1,640	7/7/6	GD	ND		NV	
5	14	006	354.23	08364	Birch Creek, Hwy 6	1958	Concrete continuous	-	6	GD	ND		NV	
5	14	489	12.72	04412A	Snake River, Hwy 489 (Adrian)	1973	Prestressed concrete continuous	31,302	7/6/6	GD	ND		NV	
5	14	490	20.48	07071	Irrigation Canal, Hwy 490	1947	Concrete continuous	-	7	VG	ND		NV	
5	14	453	1.59	18519	Riverside Canal, Hwy 453	1999	Concrete	-	8	VG	ND		NV	
5	14	007	251.77	07845	Nevada Ditch Canal, Hwy 7 at MP 251.77	1955	Concrete continuous	-	7	VG	ND		NV	
5	14	007	252.18	07846	Nevada Ditch, Hwy 7 at MP 252.18	1955	Concrete continuous	-	7	VG	ND		NV	
5	14	048	6.23	22448	Sheep Gulch, Hwy 48	2015	Concrete	-	7	VG	ND		NV	
5	14	048	11.15	22449	Vance Creek, Hwy 48	2015	Steel	-	8	VG	ND		NV	
5	14	007	135.23	02308A	Poison Creek, Hwy 7 (Susan's)	1966	Prestressed concrete	1,809	8/8/8	VG	ND		NV	
5	14	007	121.59	17347	Willow Creek, Hwy 7	1993	Prestressed concrete	2,160	8/8/8	VG	ND		NV	
5	14	007	132.51	18464	Silvies River, Hwy 7	1999	Prestressed concrete	2,960	8/7/5	PR	OD	LSL	NV	
5	14	007	133.75	18468	Foley Slough, Hwy 7	1999	Prestressed concrete	2,766	8/8/8	VG	ND		NV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	007	105.62	19903	Miller Creek, Hwy 7	2004	Prestressed concrete	3,968	8/8/8	VG	ND		NV	
5	14	007	106.62	19904	Dry Creek, Hwy 7	2005	Prestressed concrete	1,296	8/8/8	VG	ND		NV	
5	14	007	182.75	01851A	Chimney Cr (Kingsbury Gulch), Hwy 7 at MP 182.75	1966	Concrete	1,789	6/6/5	PR	ND		NV	
5	14	007	183.05	01852A	Chimney Cr (Kingsbury Gulch), Hwy 7 at MP 183.05	1966	Concrete	1,789	7/6/5	PR	ND		NV	
5	14	007	185.62	02180A	Chimney Cr (Kingsbury Gulch), Hwy 7 at MP 185.62	1936	Concrete	845	6/6/6	GD	ND		NV	
5	14	071	24.69	16066	Powder River, Hwy 71 at MP 24.79 (Huckleberry)	1973	Prestressed concrete	1,898	8/7/7	VG	ND		NV	
5	14	455	24.60	00731B	Malheur River, Hwy 455	1976	Prestressed concrete continuous	16,661	6/6/6	GD	ND		NV	
5	14	449	10.03	01648A	Benson Creek, Hwy 449	1957	Concrete continuous	2,389	7/6/8	GD	ND		PV	
5	14	449	0.46	01788	Burnt River, Hwy 449 at MP 0.46 (Lime)	1934	Steel	3,198	5/5/5	PR	OD	PAINT TS LC	PV	
5	14	449	4.56	17444	Burnt River), Hwy 449 at MP 4.56 (Durbin)	1995	Prestressed concrete	3,907	7/6/7	GD	ND		NV	
5	14	449	3.90	20485	Burnt River, Hwy 449 at MP 3.90	2009	Prestressed concrete	4,416	8/8/8	VG	ND		NV	
5	14	449	2.75	21252	Burnt River & UPRR, Hwy 449 at MP 2.75	2012	Prestressed concrete	4,907	8/8/8	VG	ND		NV	
5	14	442	2.74	03589A	Silvies Slough, Hwy 442 at MP 2.74	1971	Prestressed concrete	1,476	8/7/7	VG	ND		NV	
5	14	442	2.90	03590A	Silvies Slough, Hwy 442 at MP 2.90	1971	Prestressed concrete	1,116	8/8/7	VG	ND		NV	
5	14	442	3.11	03591A	Foley Slough, Hwy 442 at MP 3.11	1971	Prestressed concrete	2,340	8/8/6	GD	ND		NV	
5	14	442	3.23	03592A	Silvies Slough, Hwy 442 at MP 3.23	1971	Prestressed concrete	1,260	8/7/8	VG	ND		NV	
5	14	442	3.61	03593A	Silvies Slough, Hwy 442 at MP 3.61	1971	Prestressed concrete	1,116	8/8/8	VG	ND		NV	
5	14	442	22.34	03595B	Malheur Slough, Hwy 442 (Nine Mile)	1984	Prestressed concrete	2,208	8/8/8	VG	ND		NV	
5	14	440	22.19	06751A	The Narrows, Hwy 440	1984	Prestressed concrete	3,008	7/7/5	PR	ND		NV	
5	14	442	5.70	06834A	Silvies Slough, Hwy 442 at MP 5.70	1971	Prestressed concrete	1,116	8/8/6	GD	ND		NV	
5	14	442	0.86	03523A	Silvies River, Hwy 442 at MP 0.86	1971	Prestressed concrete	2,905	8/8/6	GD	ND		NV	
5	14	442	1.01	03582A	Silvies Slough, Hwy 442 at MP 1.01	1971	Prestressed concrete	1,836	8/6/7	GD	ND		NV	

2017 BRIDGE CONDITION REPORT - District 14

Region	District	Hwy	MP	BR	Structure Name	Year	Material	Deck Area (ft ²)	NBI Rate	Struc Cond	SD/ OD	Other Deficiencies	Seismic Vulnerability	Seismic Phase
5	14	442	1.14	03583A	Silvies Slough, Hwy 442 at MP 1.14	1971	Prestressed concrete	1,836	8/7/8	VG	ND		NV	
5	14	442	1.29	03584A	Silvies Slough, Hwy 442 at MP 1.29	1971	Prestressed concrete	1,836	8/7/8	VG	ND		NV	
5	14	442	1.41	03585A	Silvies Slough, Hwy 442 at MP 1.41	1971	Prestressed concrete	1,836	8/8/8	VG	ND		NV	
5	14	442	1.90	03587A	Silvies Slough, Hwy 442 at MP 1.90	1971	Prestressed concrete	1,836	8/7/8	VG	ND		NV	
5	14	442	0.69	20868	Silvies Slough, Hwy 442 at MP 0.69	2010	Prestressed concrete	1,580	8/8/8	VG	ND		NV	
5	14	493	28.39	01000B	Snake River, Hwy 493 (Ontario)	1967	Prestressed concrete continuous	68,565	7/5/5	PR	ND		NV	
5	14	455	25.20	20398	Hwy 455 over Hwy 6 (North Ontario Intchg)	2008	Prestressed concrete continuous	17,997	8/8/8	VG	ND		NV	
5	14	493	27.73	18097	Hwy 493 over Hwy 6 (Idaho Ave. Interchange)	1998	Prestressed concrete continuous	31,076	7/8/8	VG	ND		NV	