Welex

COMPENSATED ACOUSTIC VELOCITY LOG

RECEIVED PTL
FEB 24 1982
DEPT OF GEOLOGY

COMPANY AMERICAN QUASAR PETROLEUM CO.

WELL BENSON TIMBER 8-14

FIELD MIST

COUNTY COLUMBIA STATE OREGON

Location 1045.58' FWL & 299.74' FSL
SW¼ SW¼

Sec. 8 Twp 6N Rge 4W

Other Services:
DIGL
CDNL
4ARM DIPMETER

COMPANY
WELL
FIELD
County
State

Permanent Datum G.L. Elev. 996.5'
Log Measured From K.B. OR 10.4' Ft. Above Perm. Datum
Drilling Measured From K.B.

Elev.: K.B. 1006.9'
D.F.
G.L. 996.5'

Date	11-26-81			
Run No.	ONE			
Depth—Driller	2196			
Depth—Welex	2184			
Btm. Log Inter.	2178			
Top Log Inter.	469			
Casing—Driller	7" @ 466'	@	@	@
Casing—Welex	469			
Bit Size	6¼"			
Type Fluid in Hole	GEL/LIGNITE/ LIGNOSULFATE			
Dens. | Visc.	9.0 | 50	|	|	|
pH | Fluid Loss	9.0 | 6.8 ml	| ml	| ml	| ml
Source of Sample	CIRCULATED			
R_m @ Meas. Temp.	2.4 @ 55 °F	@ °F	@ °F	@ °F
R_{mf} @ Meas. Temp.	2.9 @ 60 °F	@ °F	@ °F	@ °F
R_{mc} @ Meas. Temp.	1.91 @ 63 °F	@ °F	@ °F	@ °F
Source R_{mf} R_{mc}	M | M	|	|	|
R_m @ BHT	1.39 @ 95 °F	@ °F	@ °F	@ °F
Time Since Circ.	1 HOUR			
Max. Rec. Temp.	95°F @ 2190	°F @	°F @	°F @
Equip. | Location	2890 | WOLD	|	|	|
Recorded By	J. PARMELEE			
Witnessed By	Mr. MANN			

Fold Here

Service Ticket No. 057073 Remarks:

SCALE CHANGES

Type Log	Depth	Scale Up Hole	Scale Down Hole

Change in Mud Type or Additional Samples

Date | Sample No.	|	|
Depth—Driller		
Type Fluid in Hole		
Dens. | Visc.	|	|
pH | Fluid Loss	|	| ml
Source of Sample		
R_m @ Meas. Temp.	@ °F	@ °F
R_{mf} @ Meas. Temp.	@ °F	@ °F
R_{mc} @ Meas. Temp.	@ °F	@ °F
Source: R_{mf} | R_{mc}	|	|
R_m @ BHT	@ °F	1.39 @ 95 °F
R_{mf} BHT	@ °F	1.83 @ 95 °F
R_{mc} BHT	@ °F	1.27 @ 95 °F

EQUIPMENT DATA

Run No.	Tool Type and No.	Pad Type	Tool Position	Other
ONE	CALIPER 64	297		
	TRANSMITTER	18923		

Welex does not guarantee the accuracy of any interpretation of log data, conversion of log data to physical rock parameters, or recommendation which may be given by Welex personnel or which may appear on the log or in any other form. Any user of such data, interpretations, conversions, or recommendations agrees that Welex is not responsible, except where due to gross negligence or willful misconduct, for any loss, damages, or expenses resulting from the use thereof.

WELEX DLS™ DIGITIZER TAPE PLAYBACK

LOG TAPE ID 92660001

DATE 11/26/81

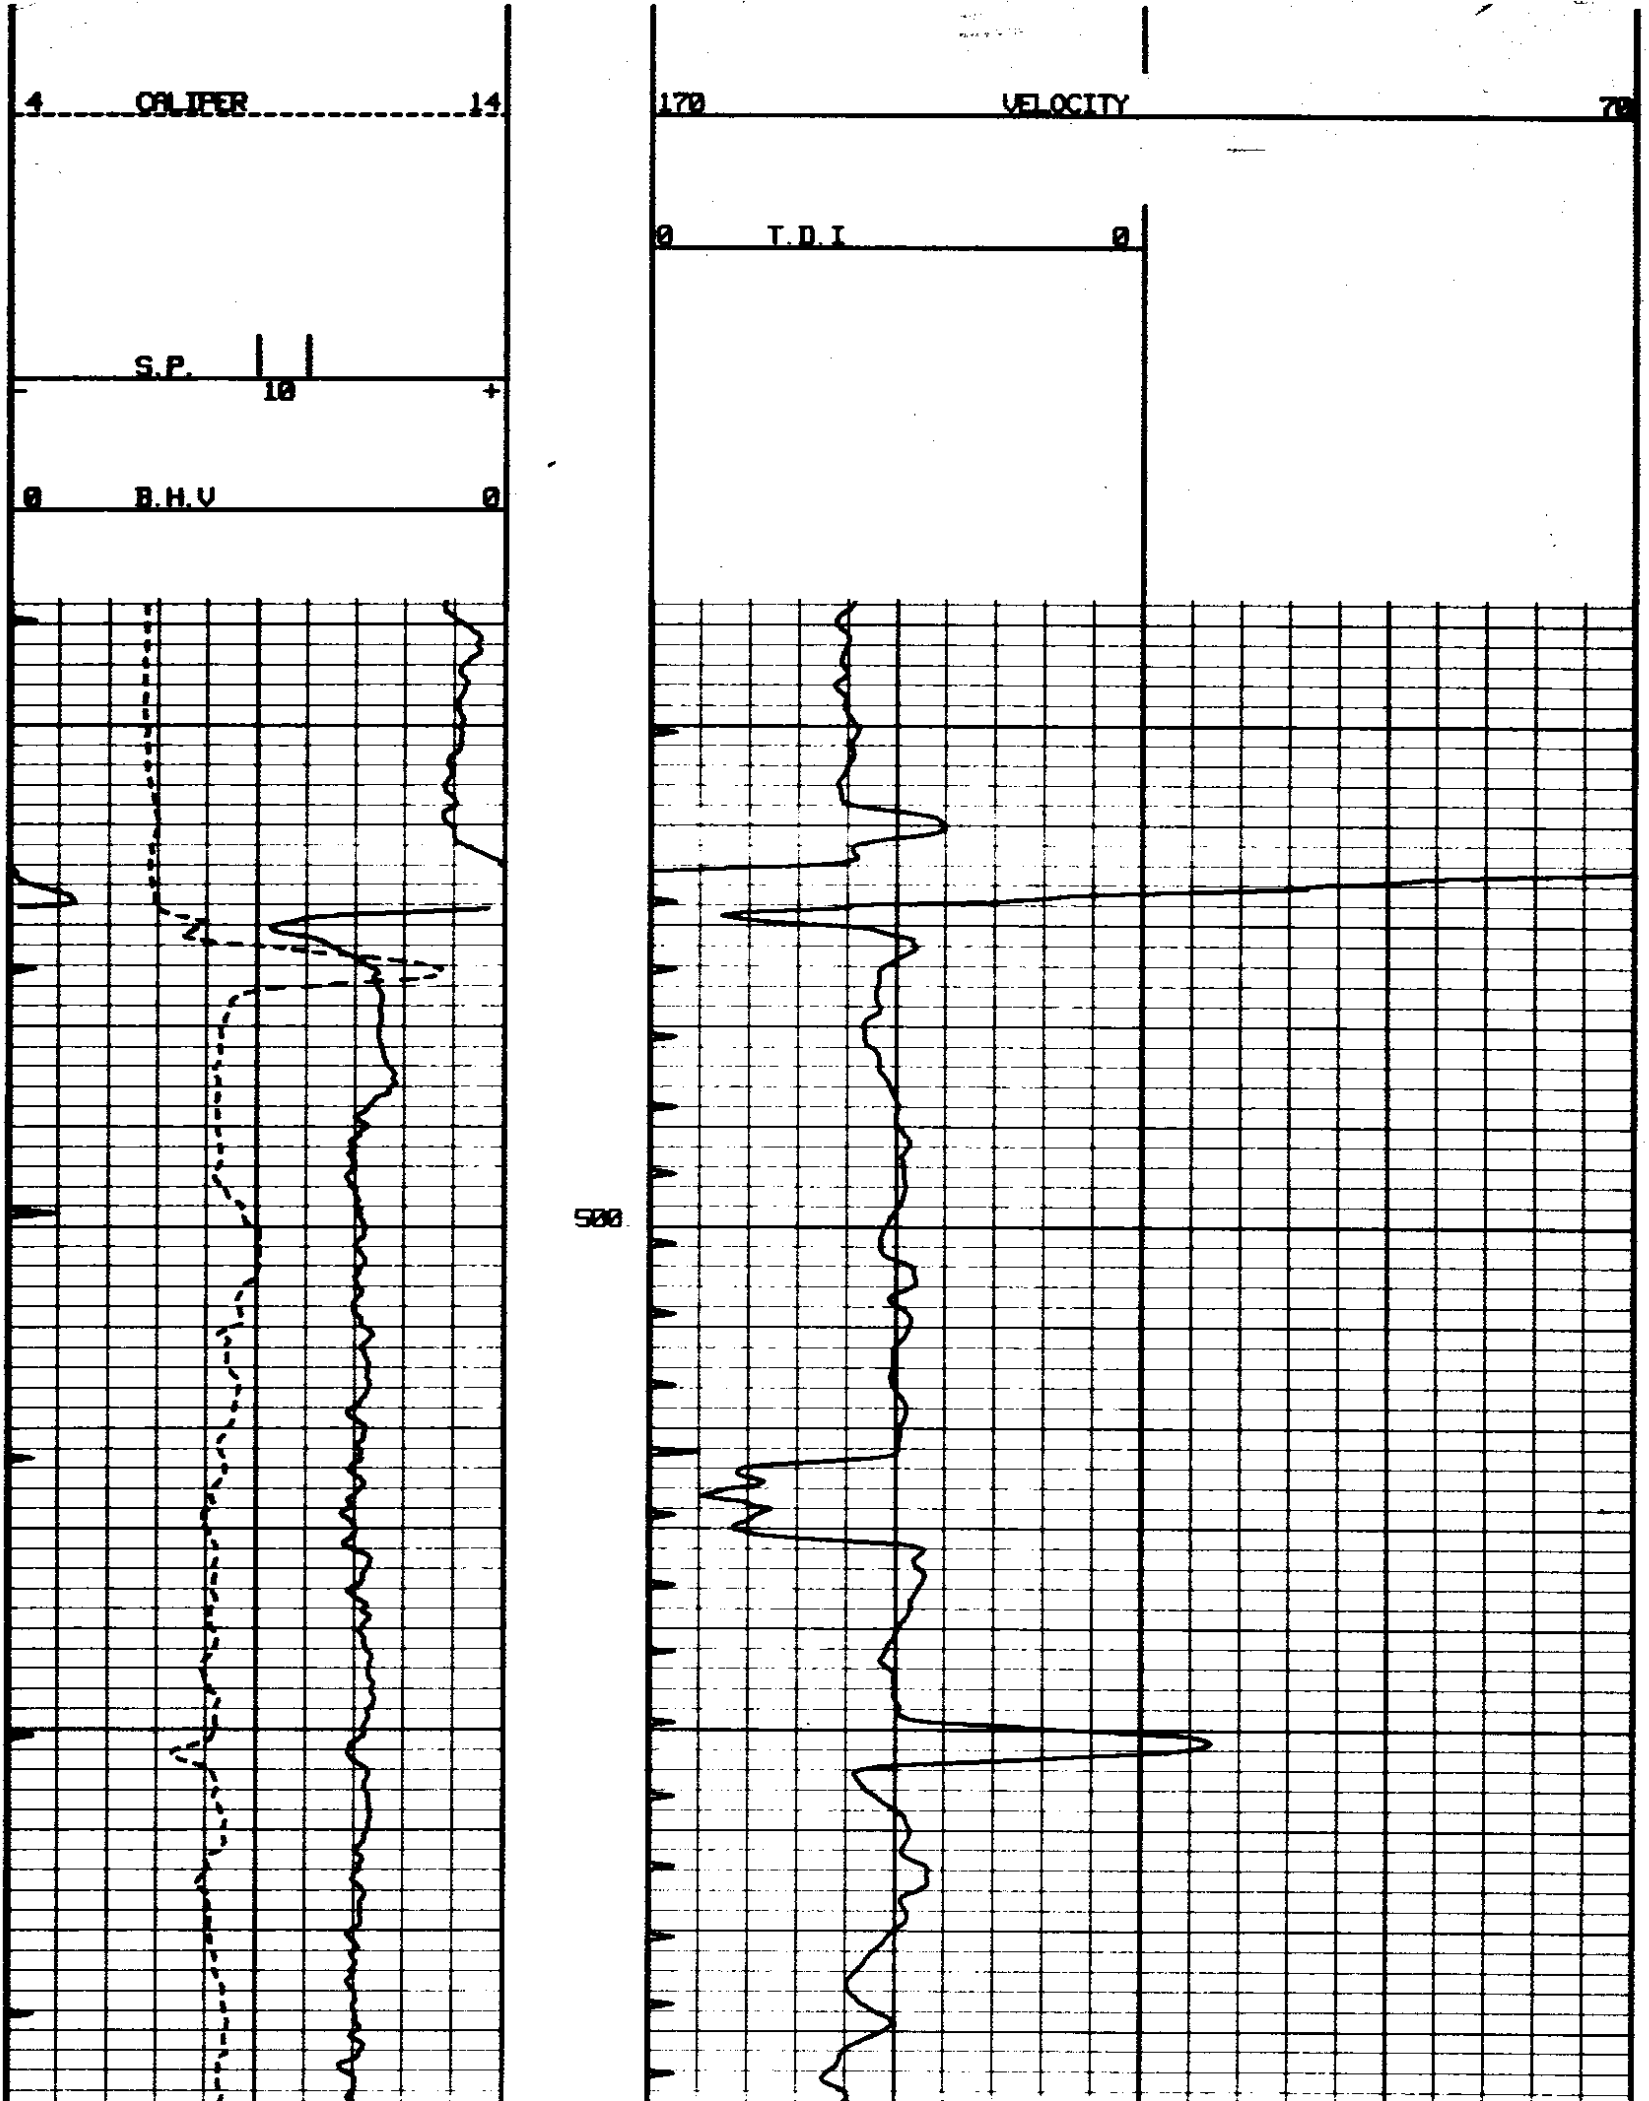

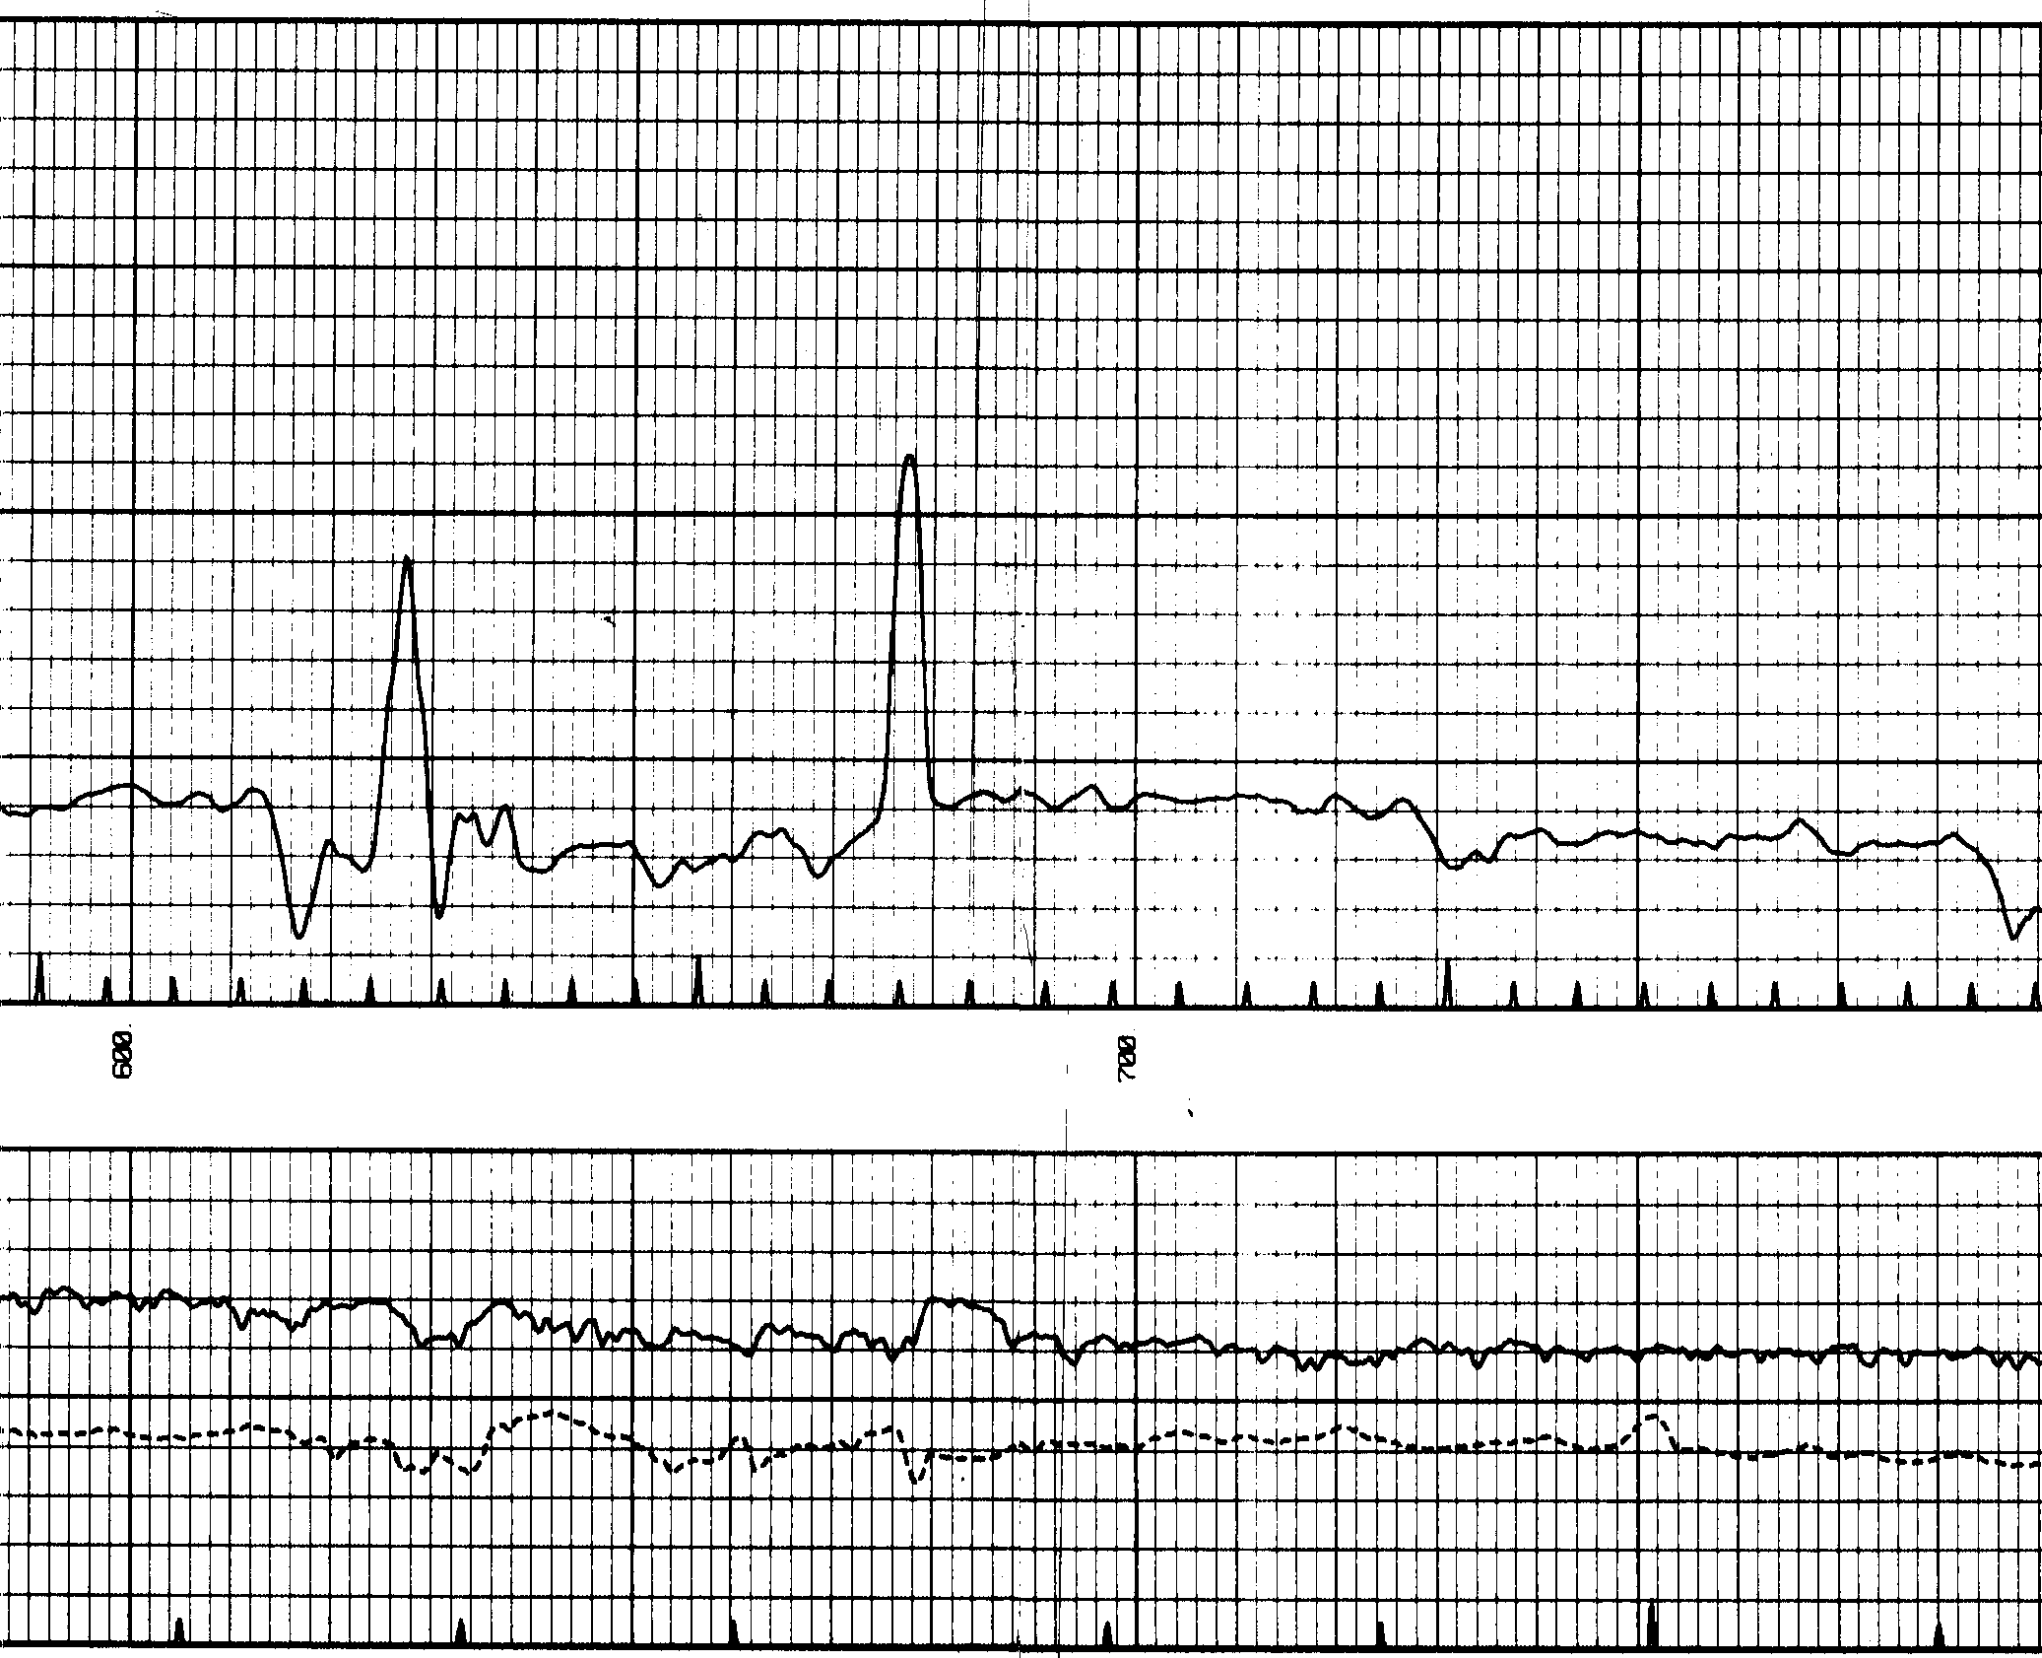

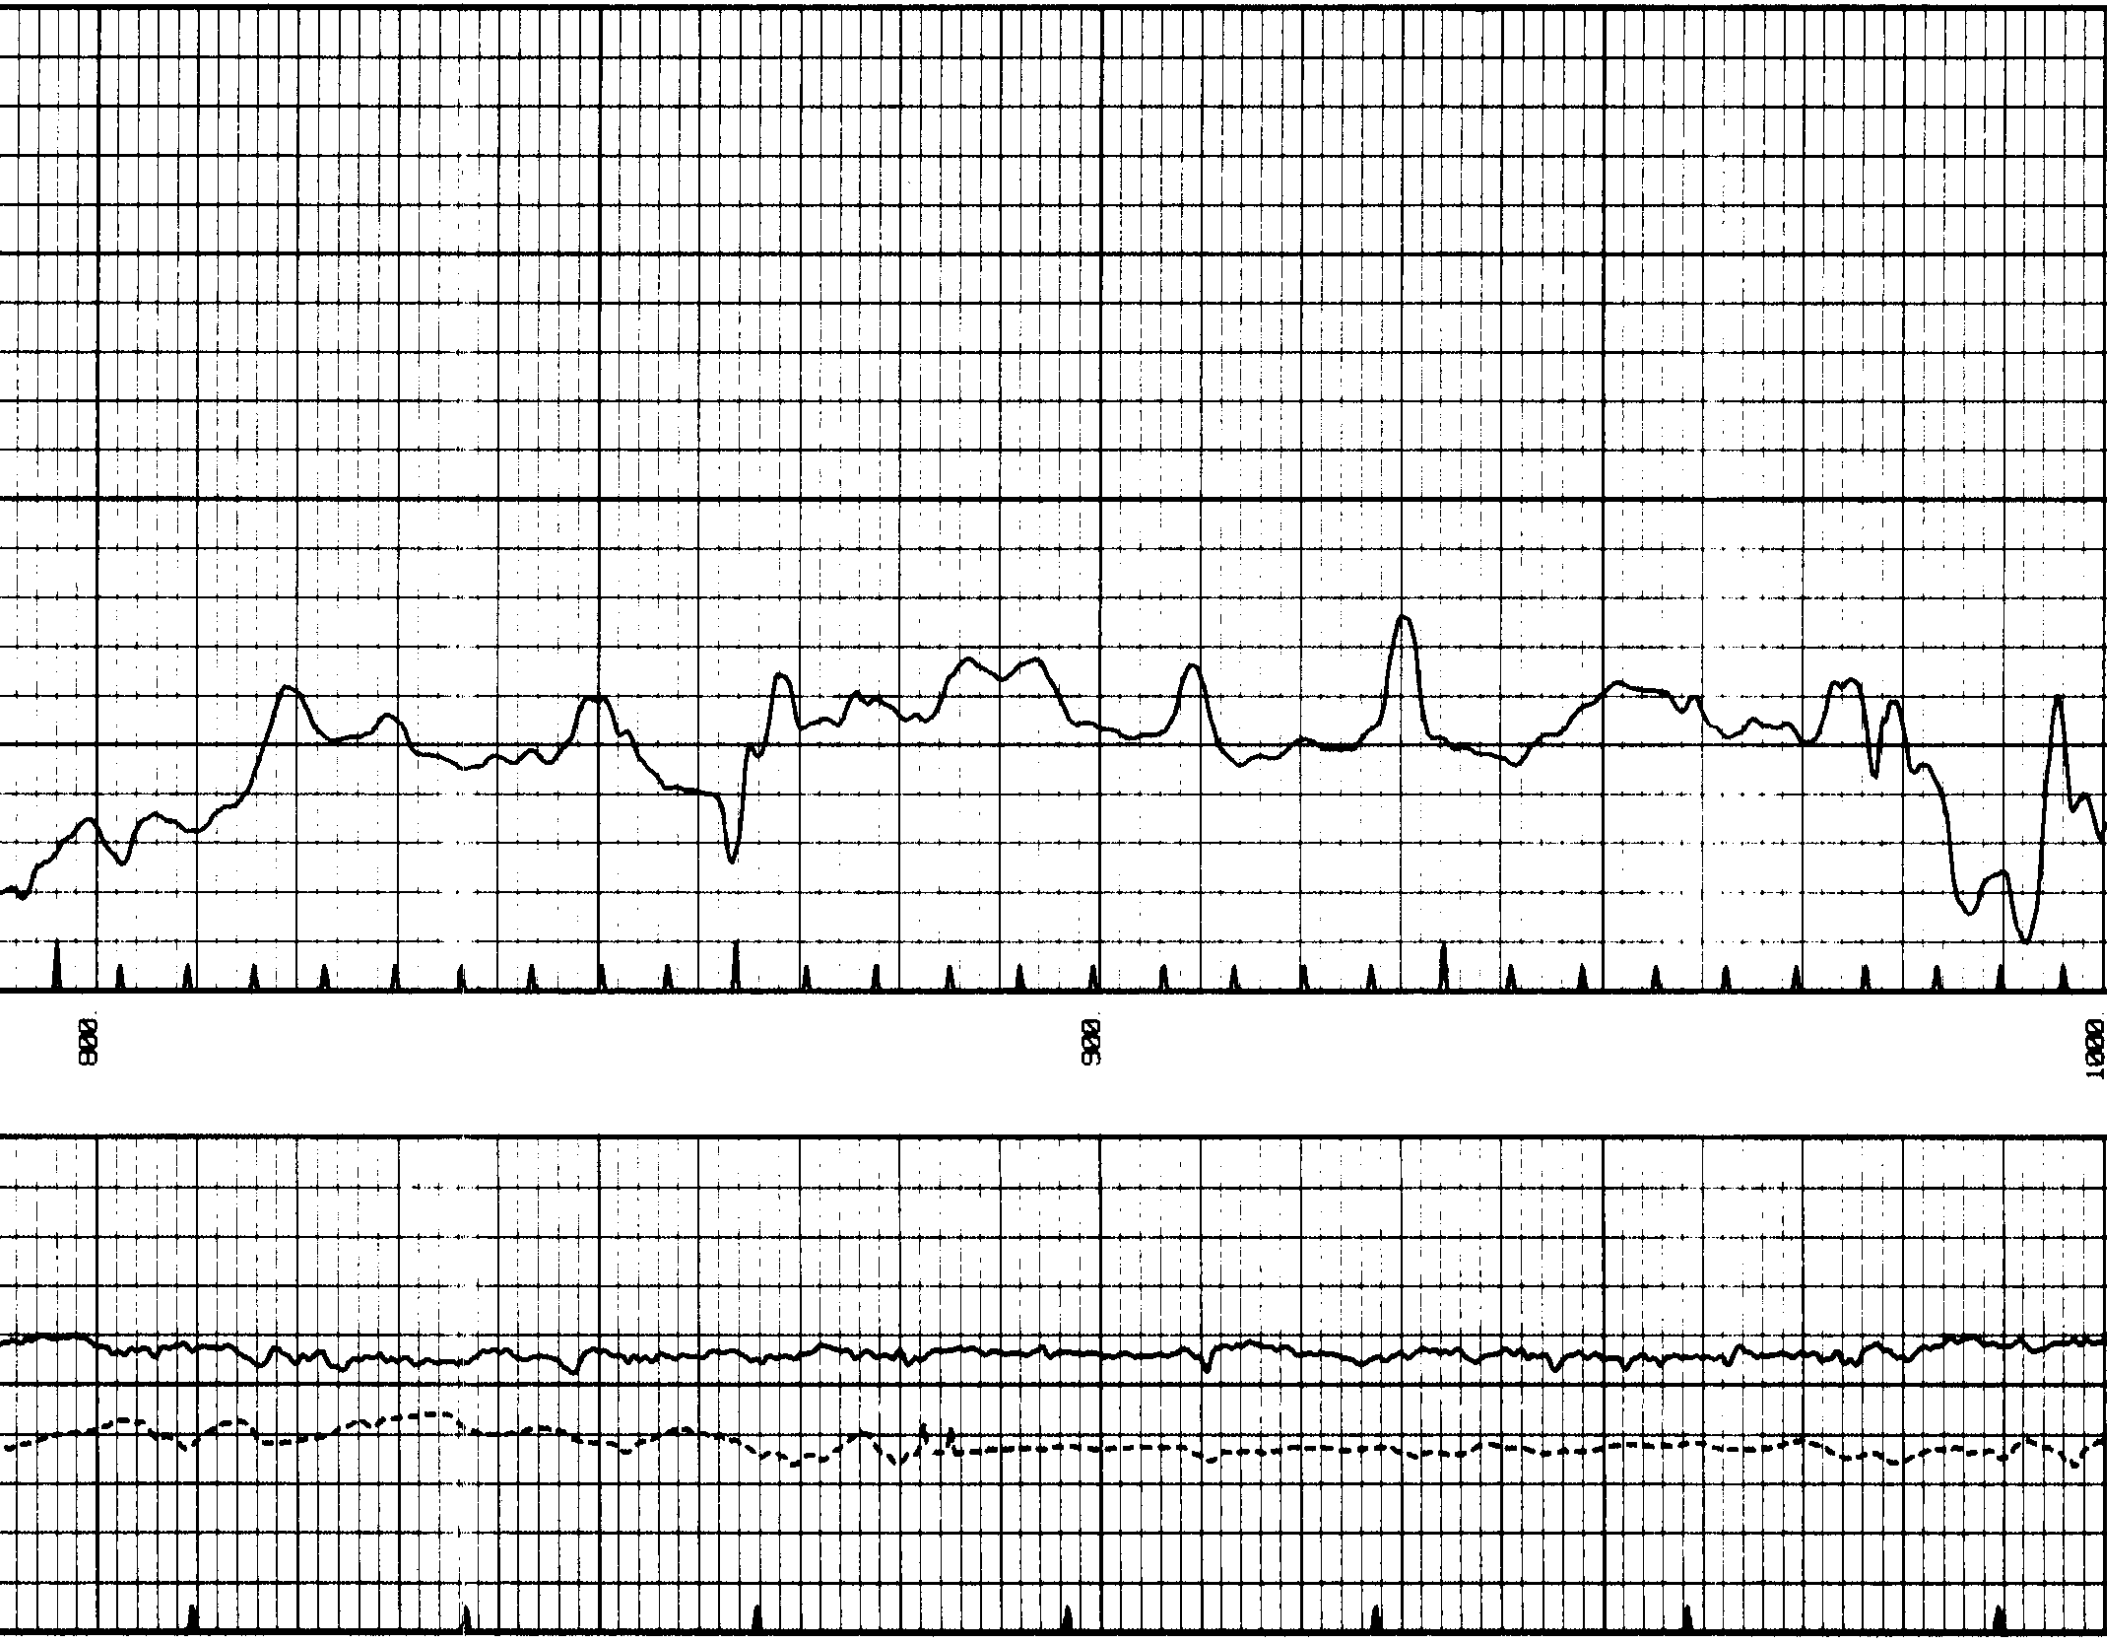

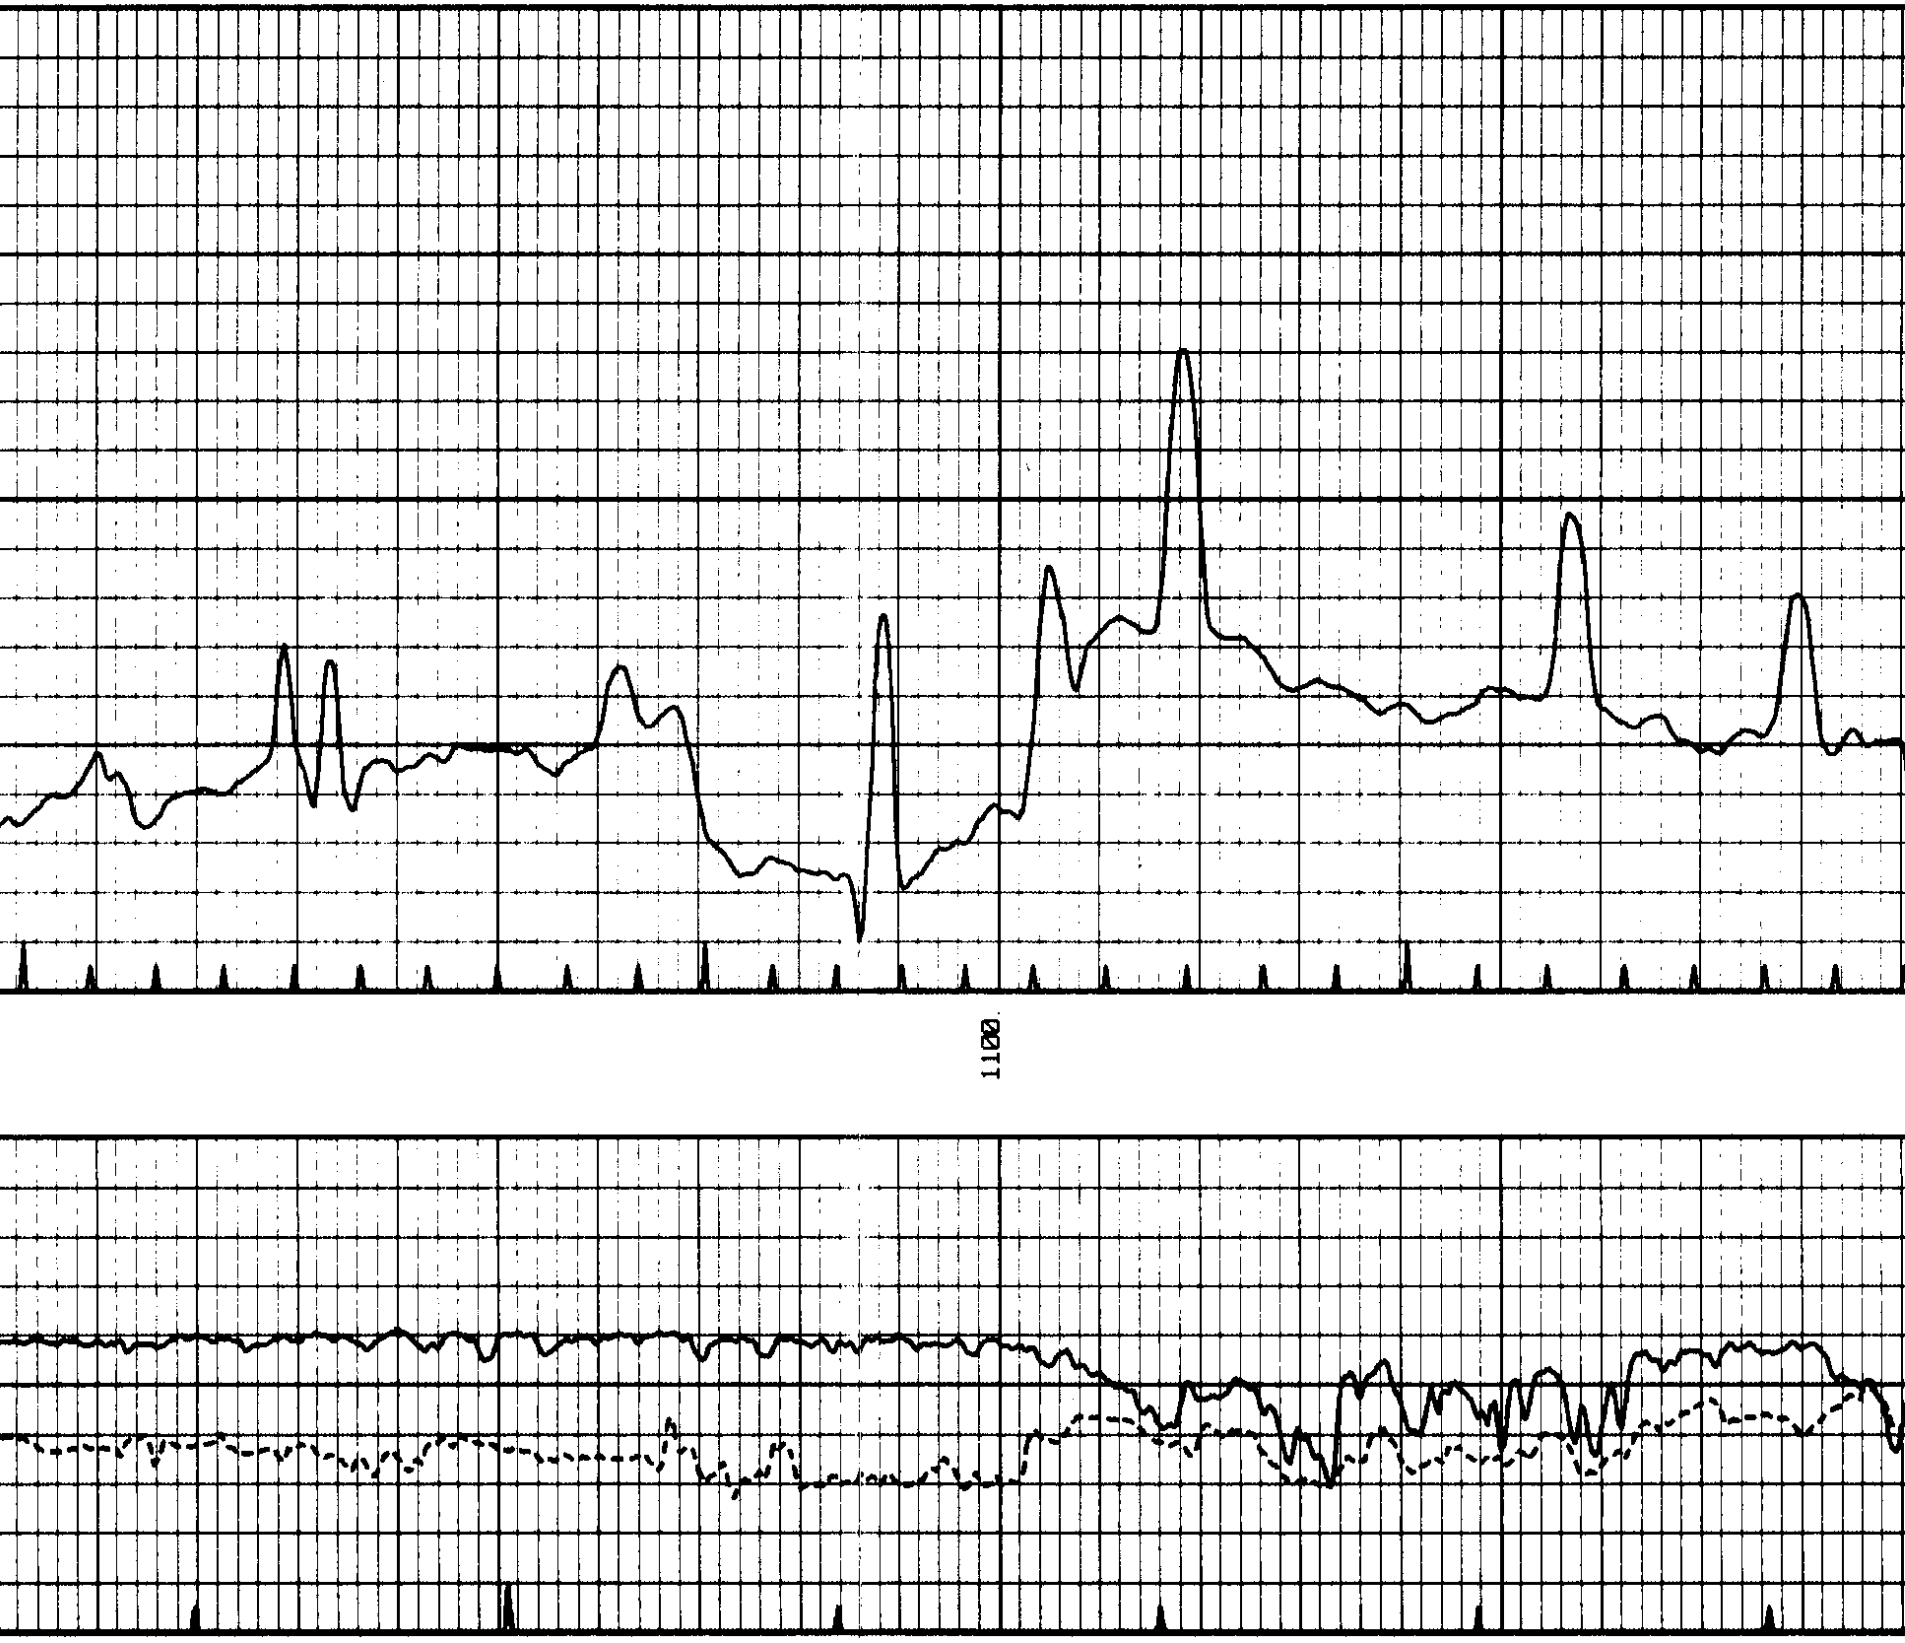

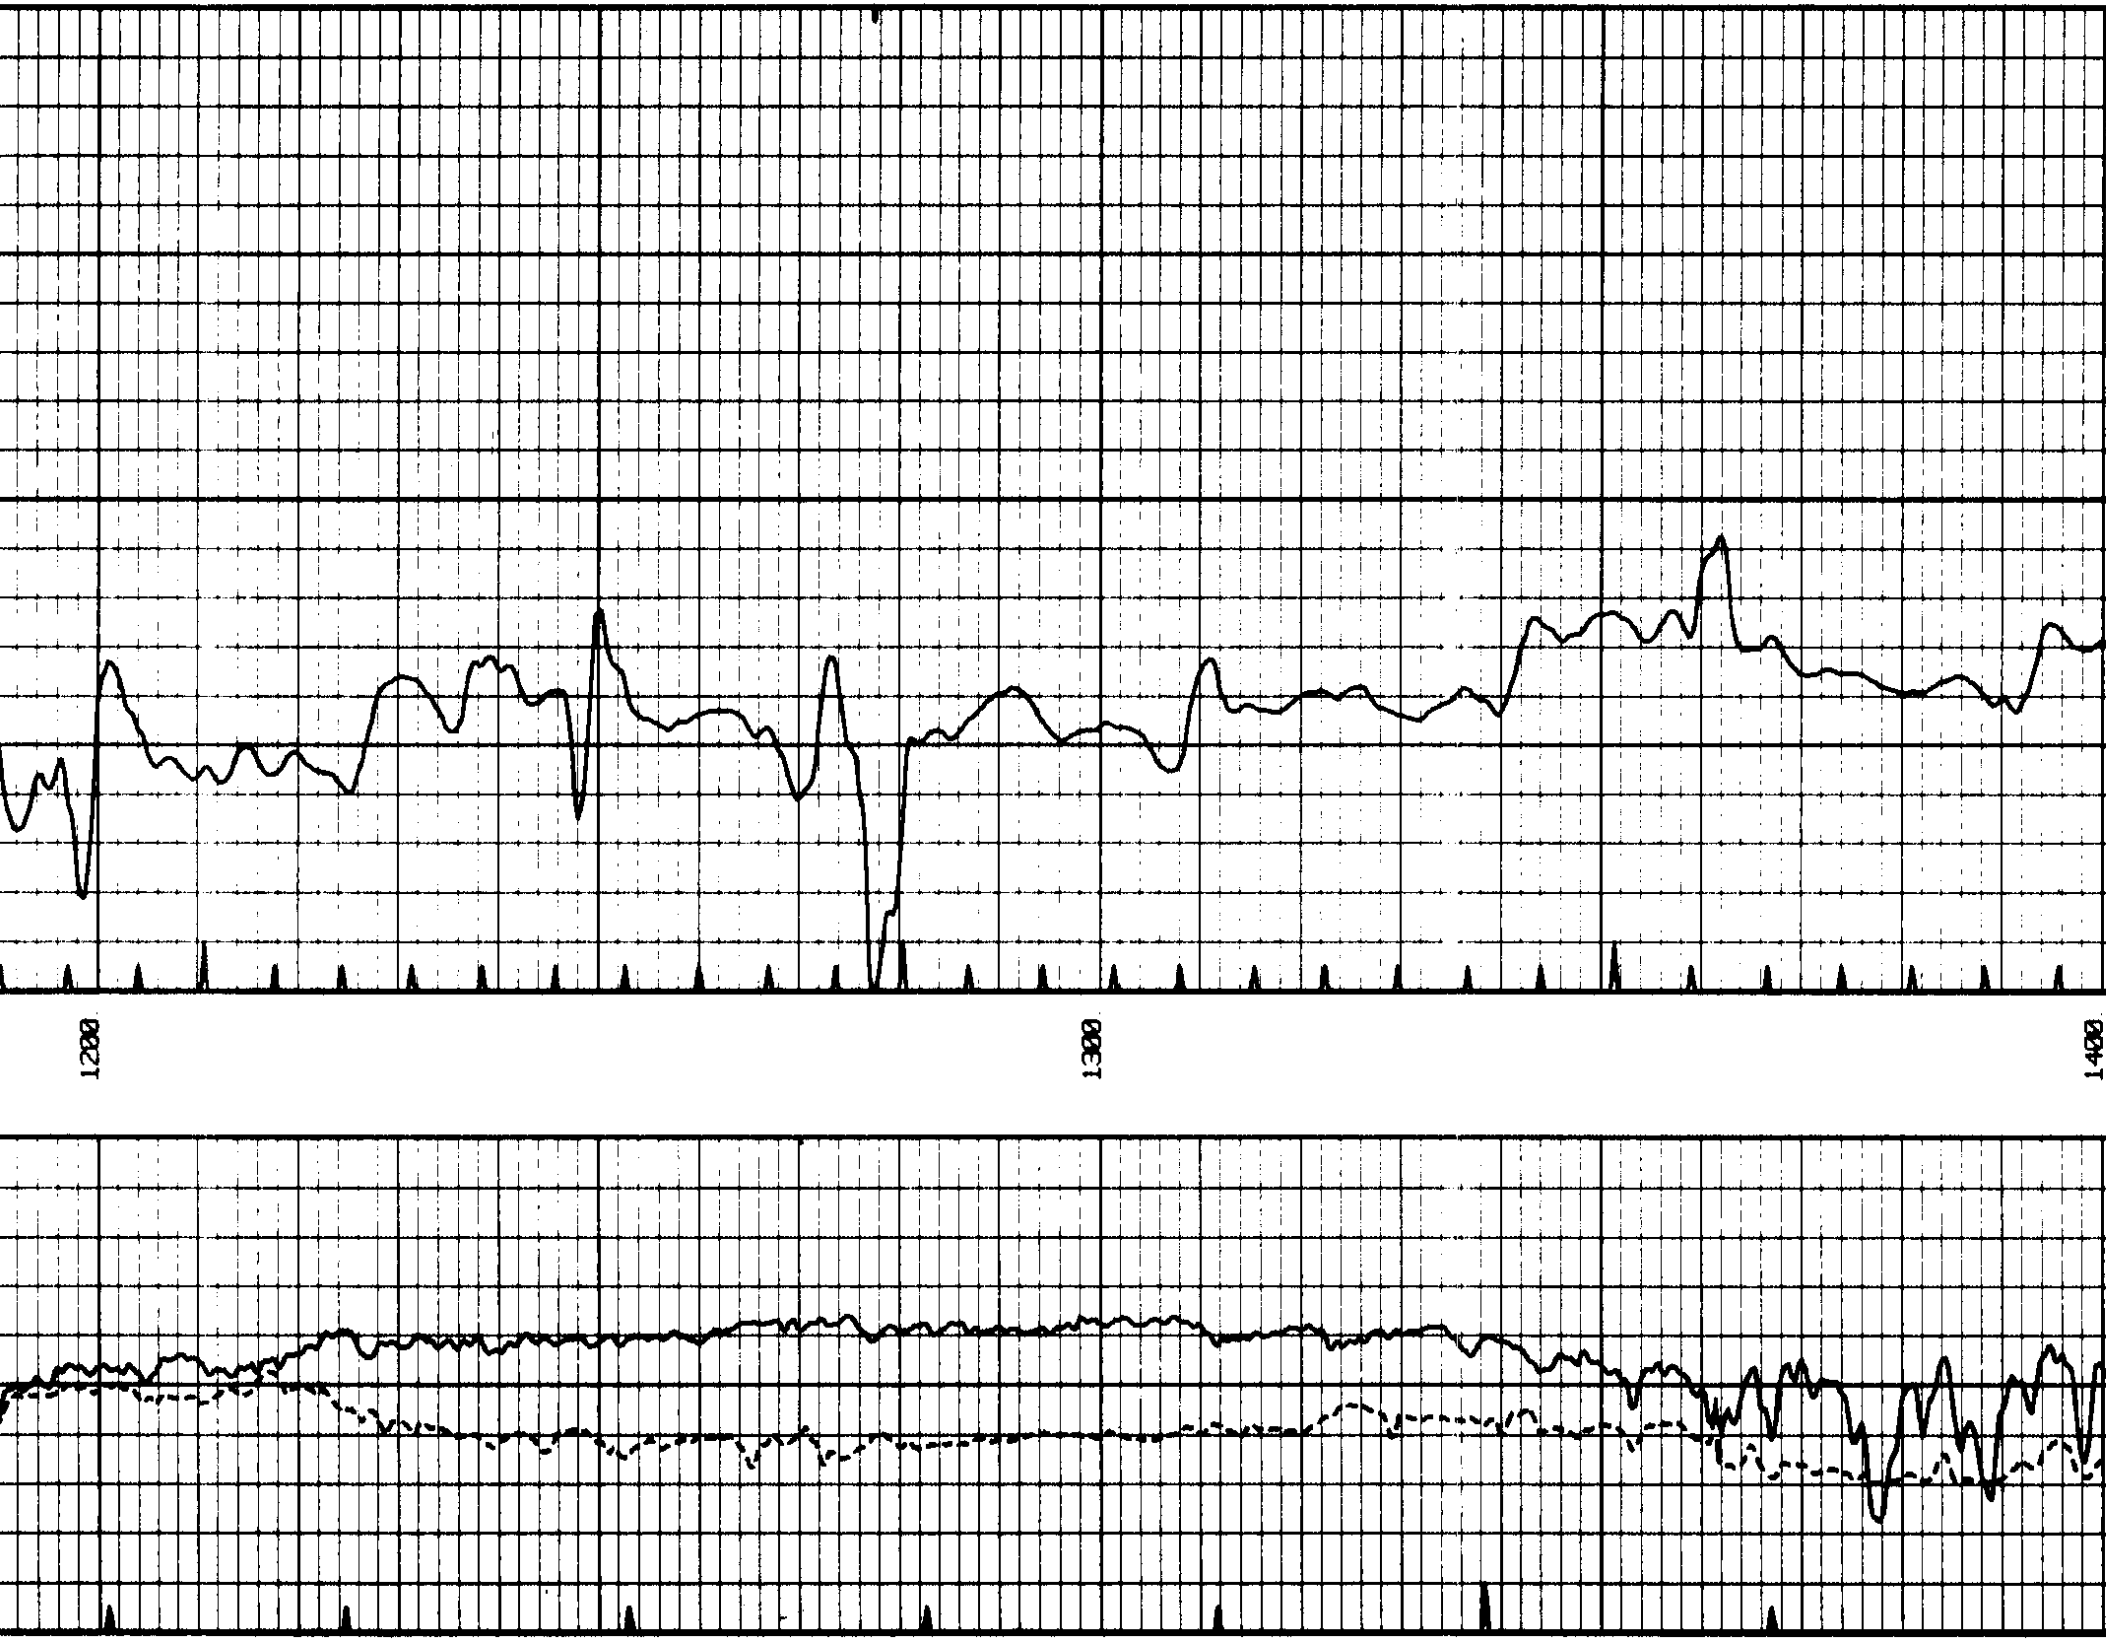

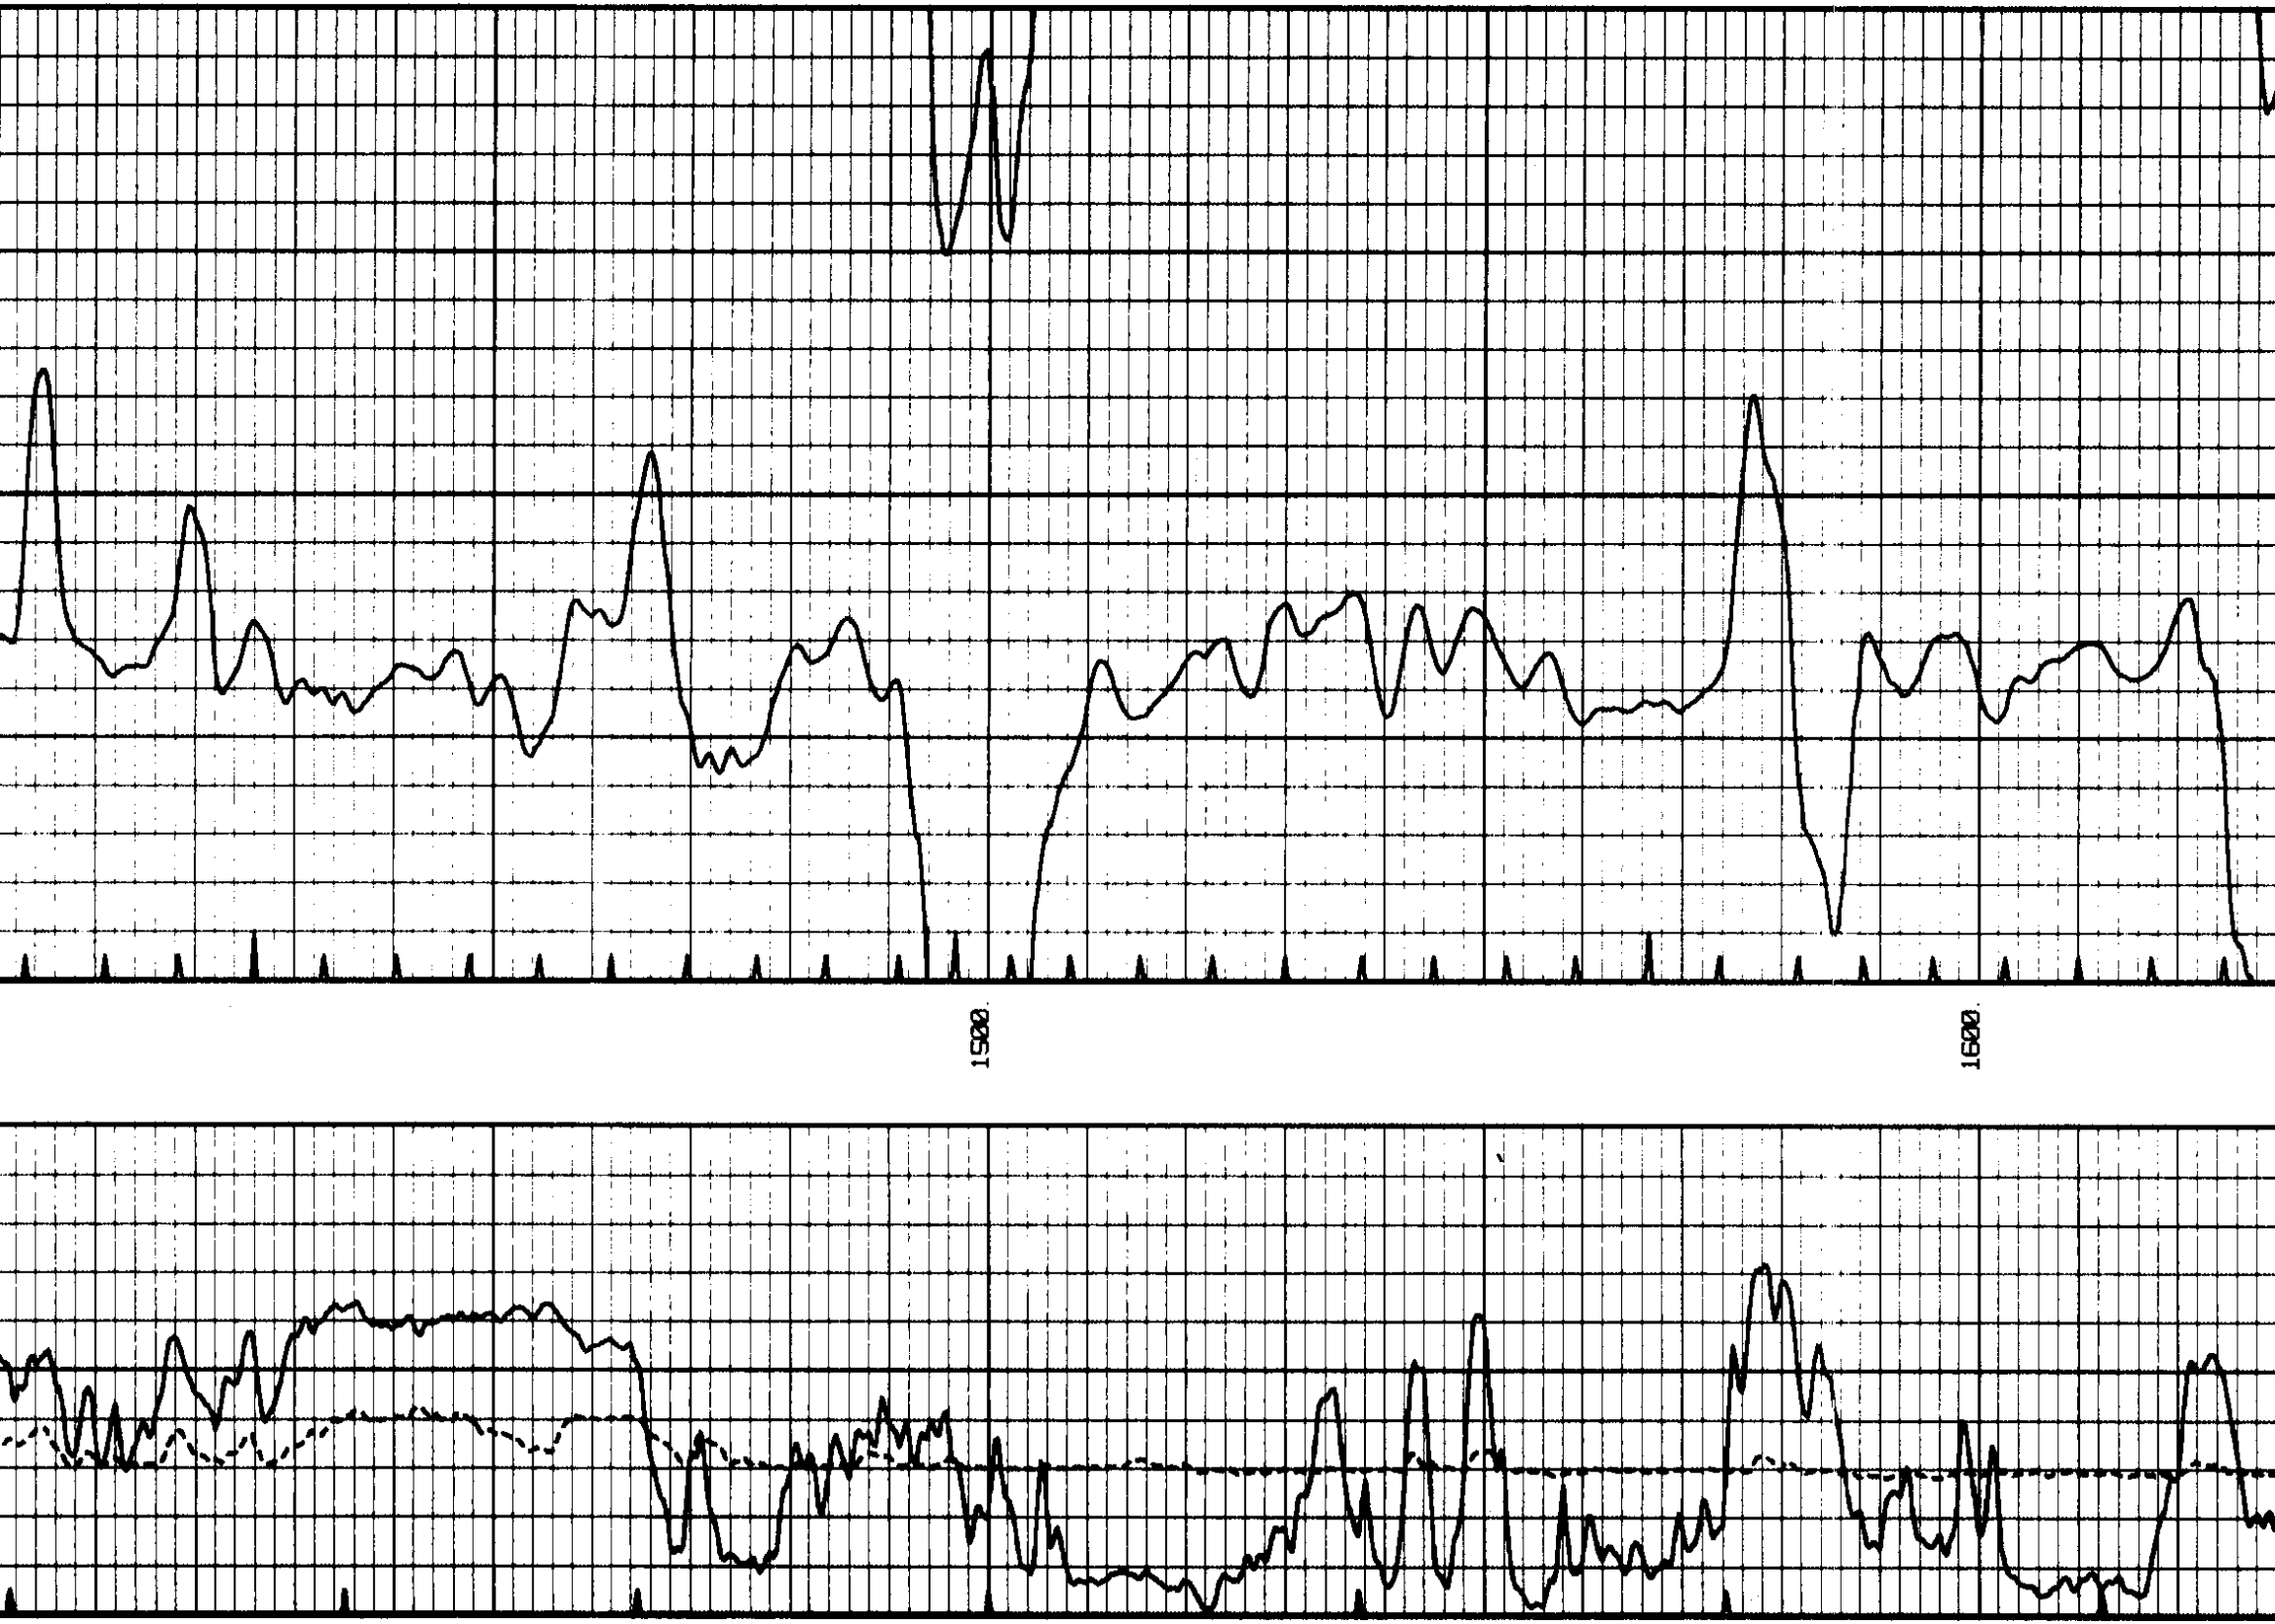

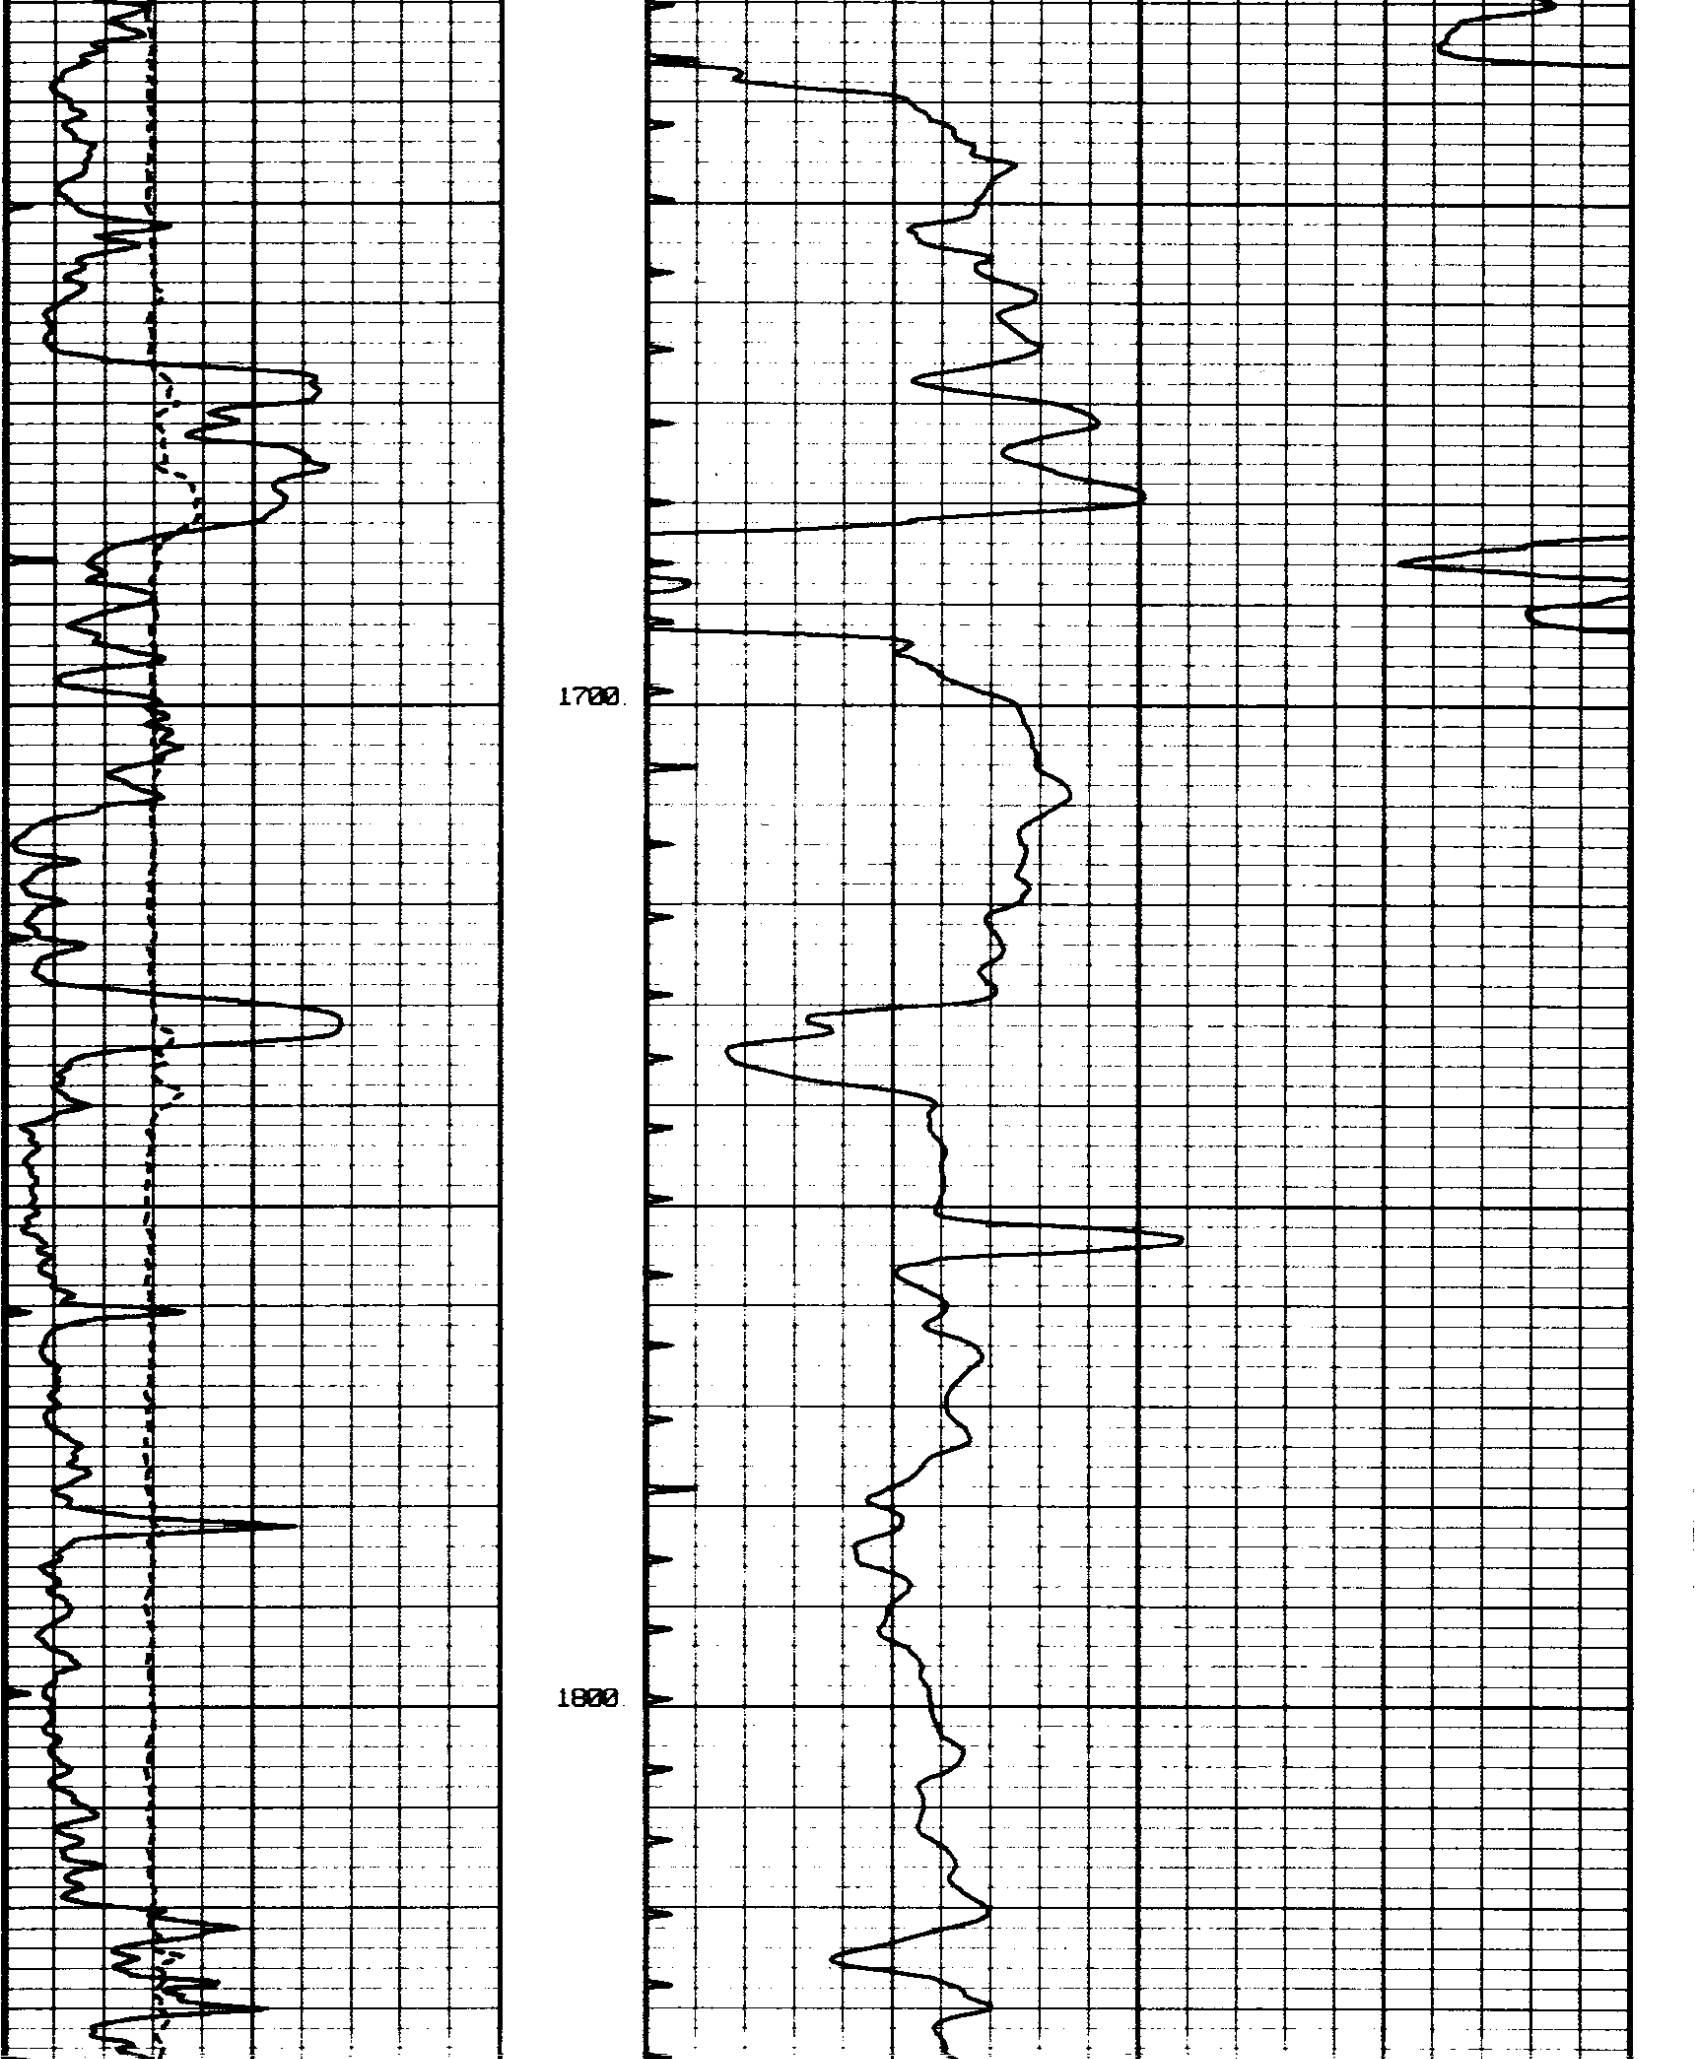

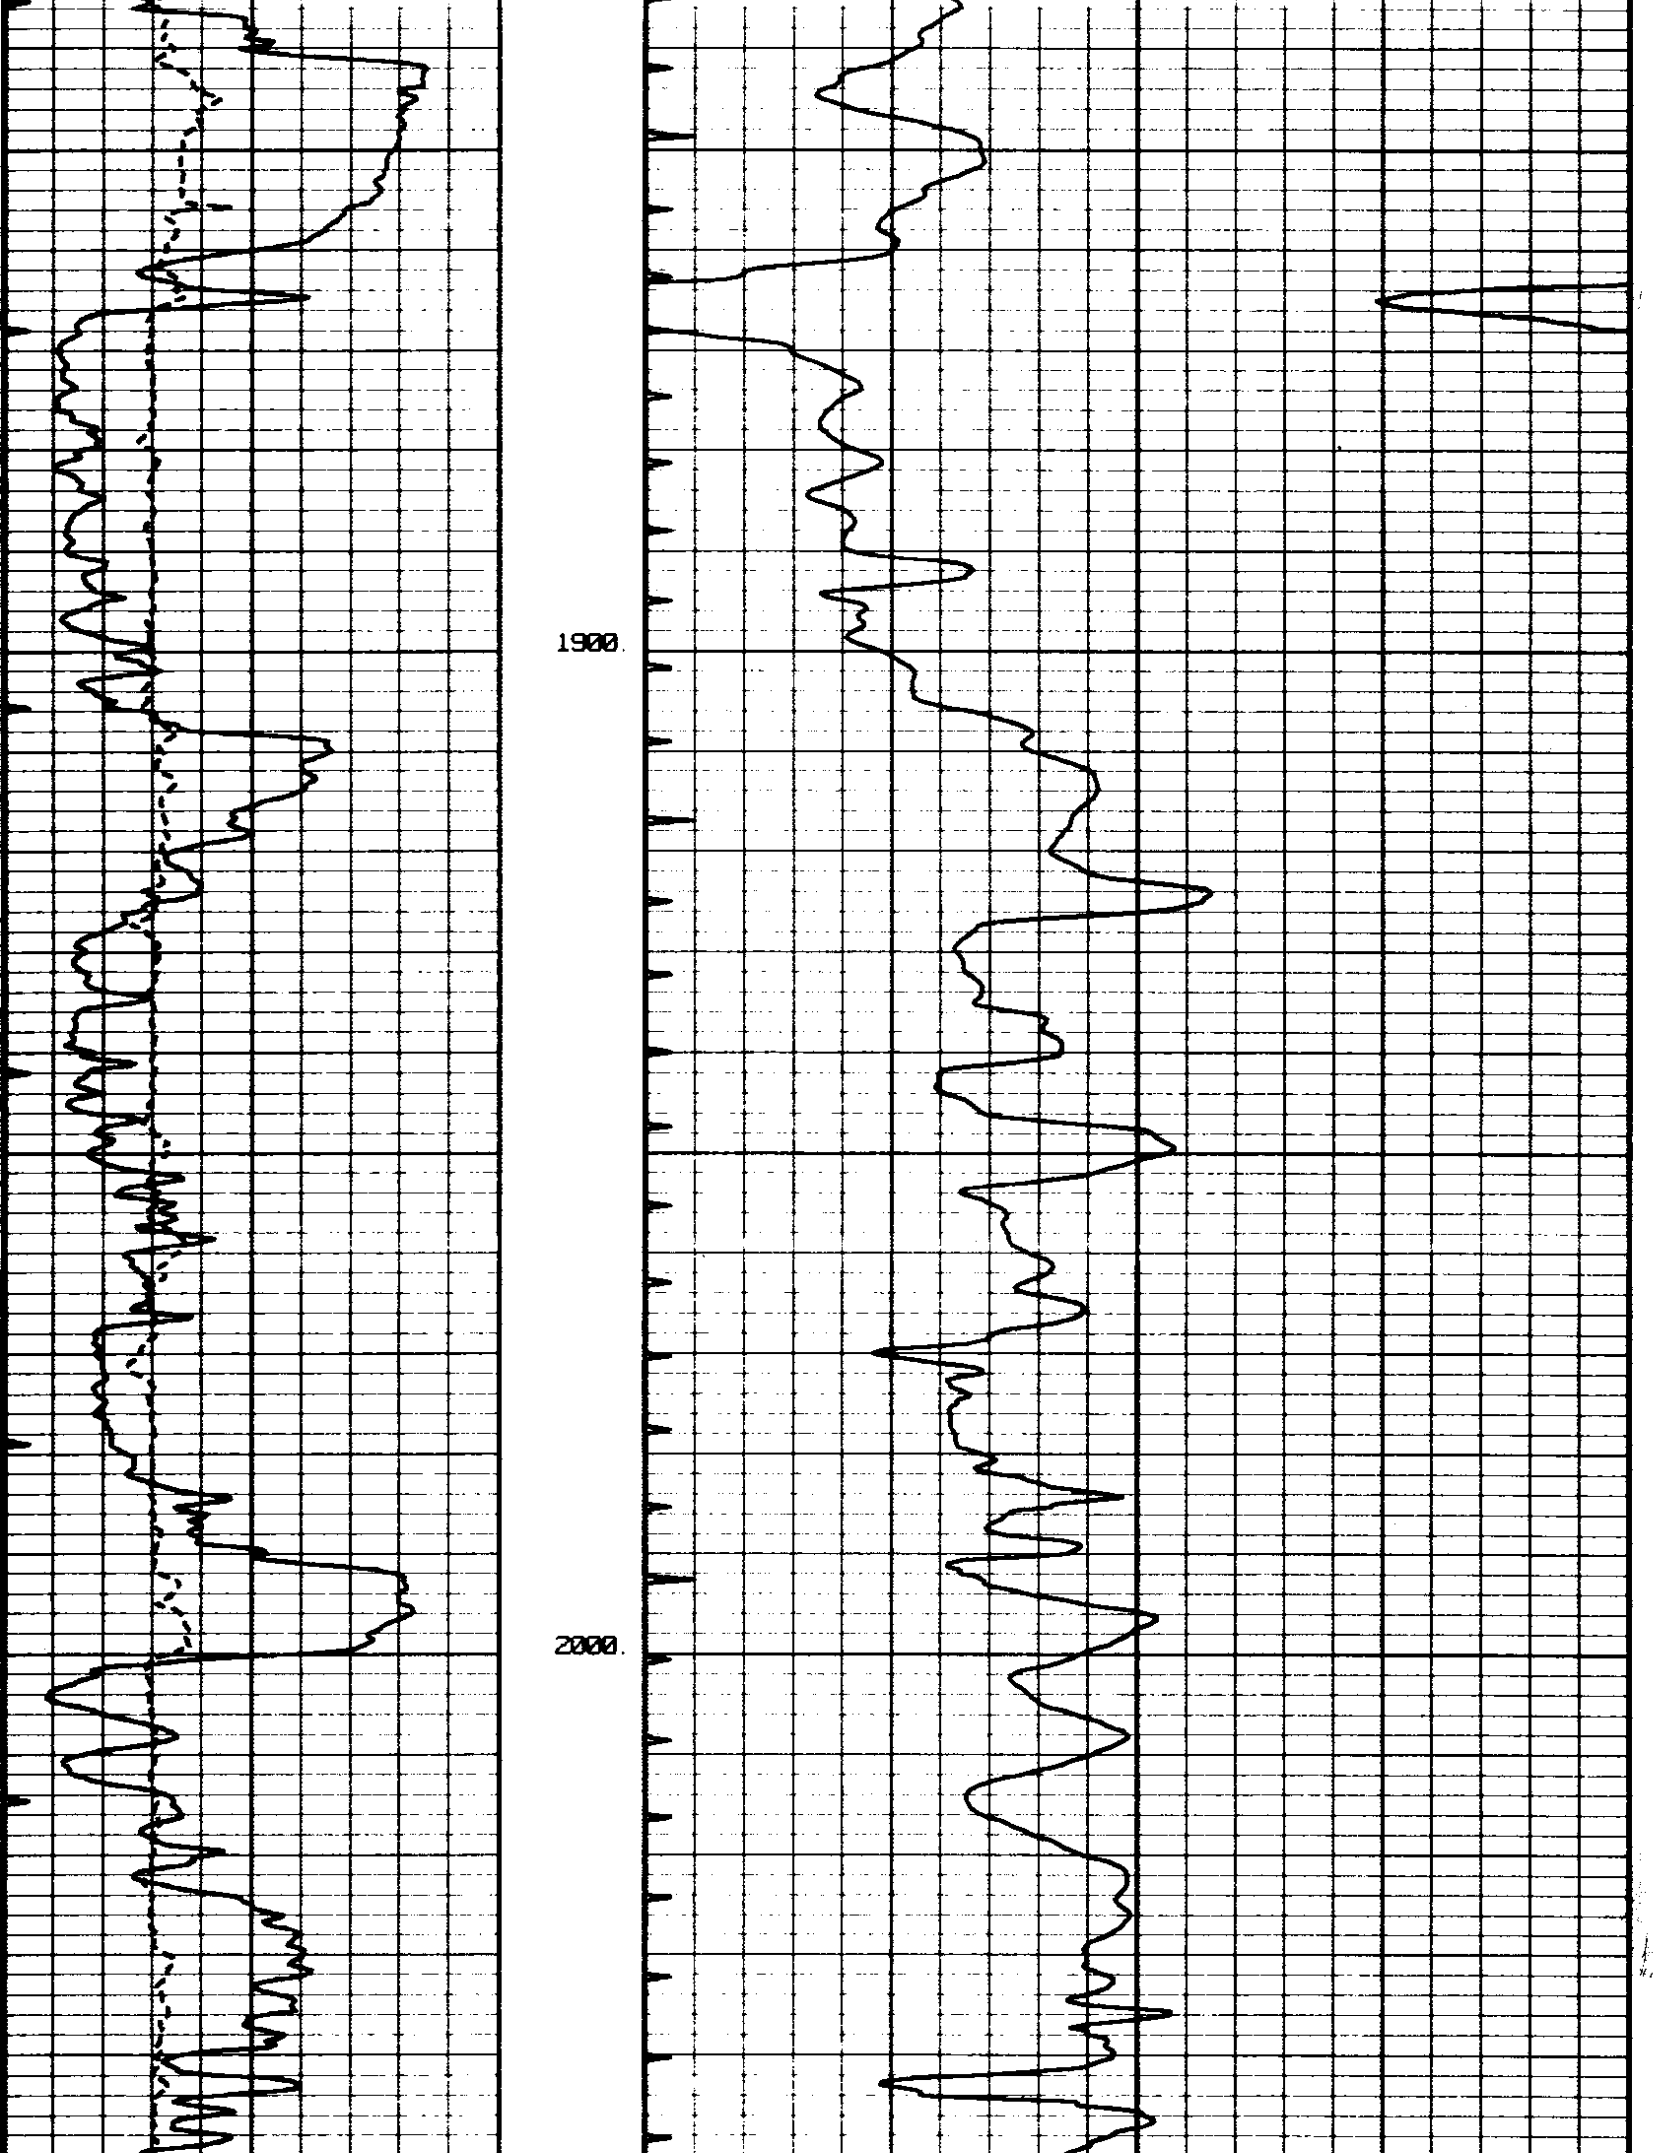

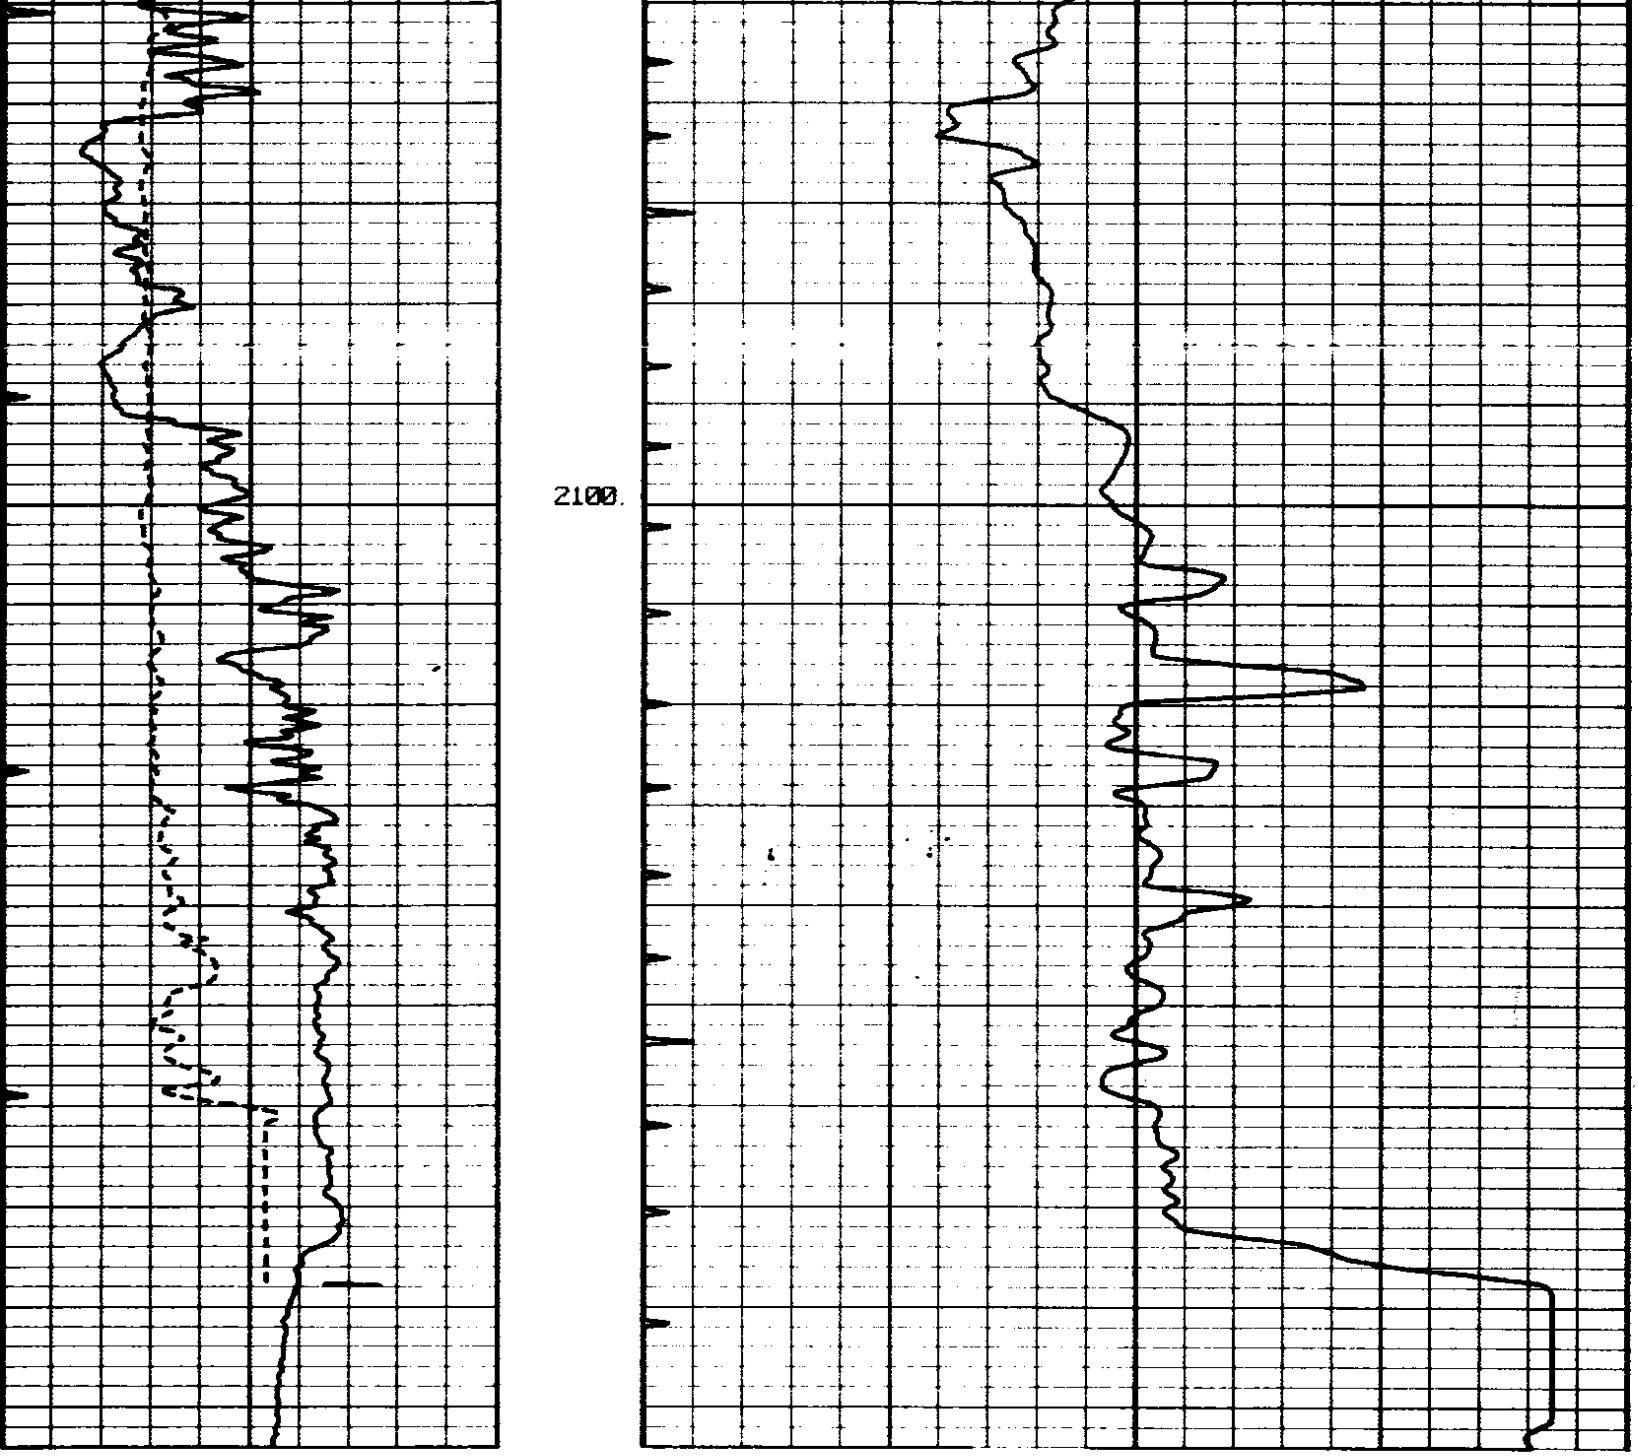

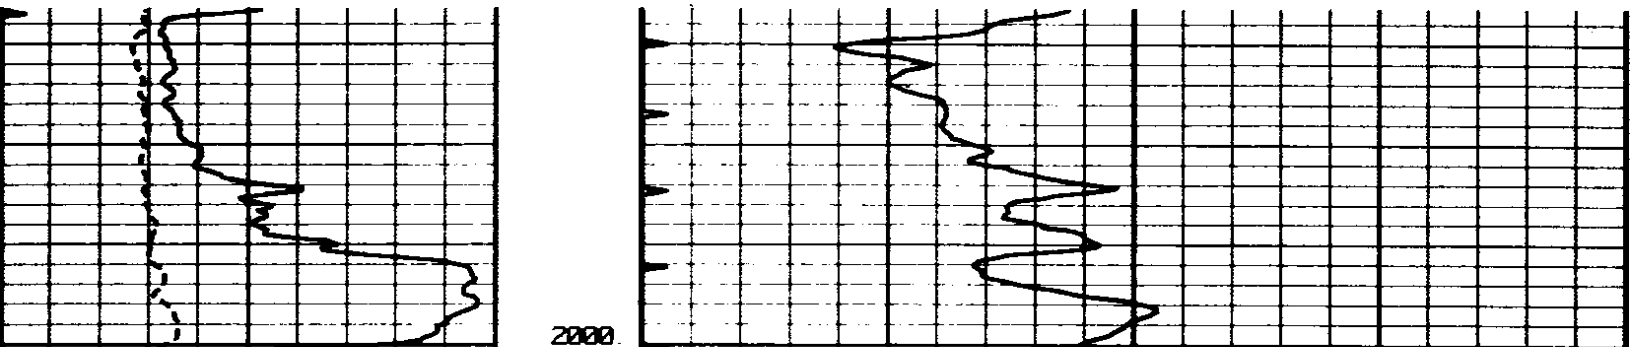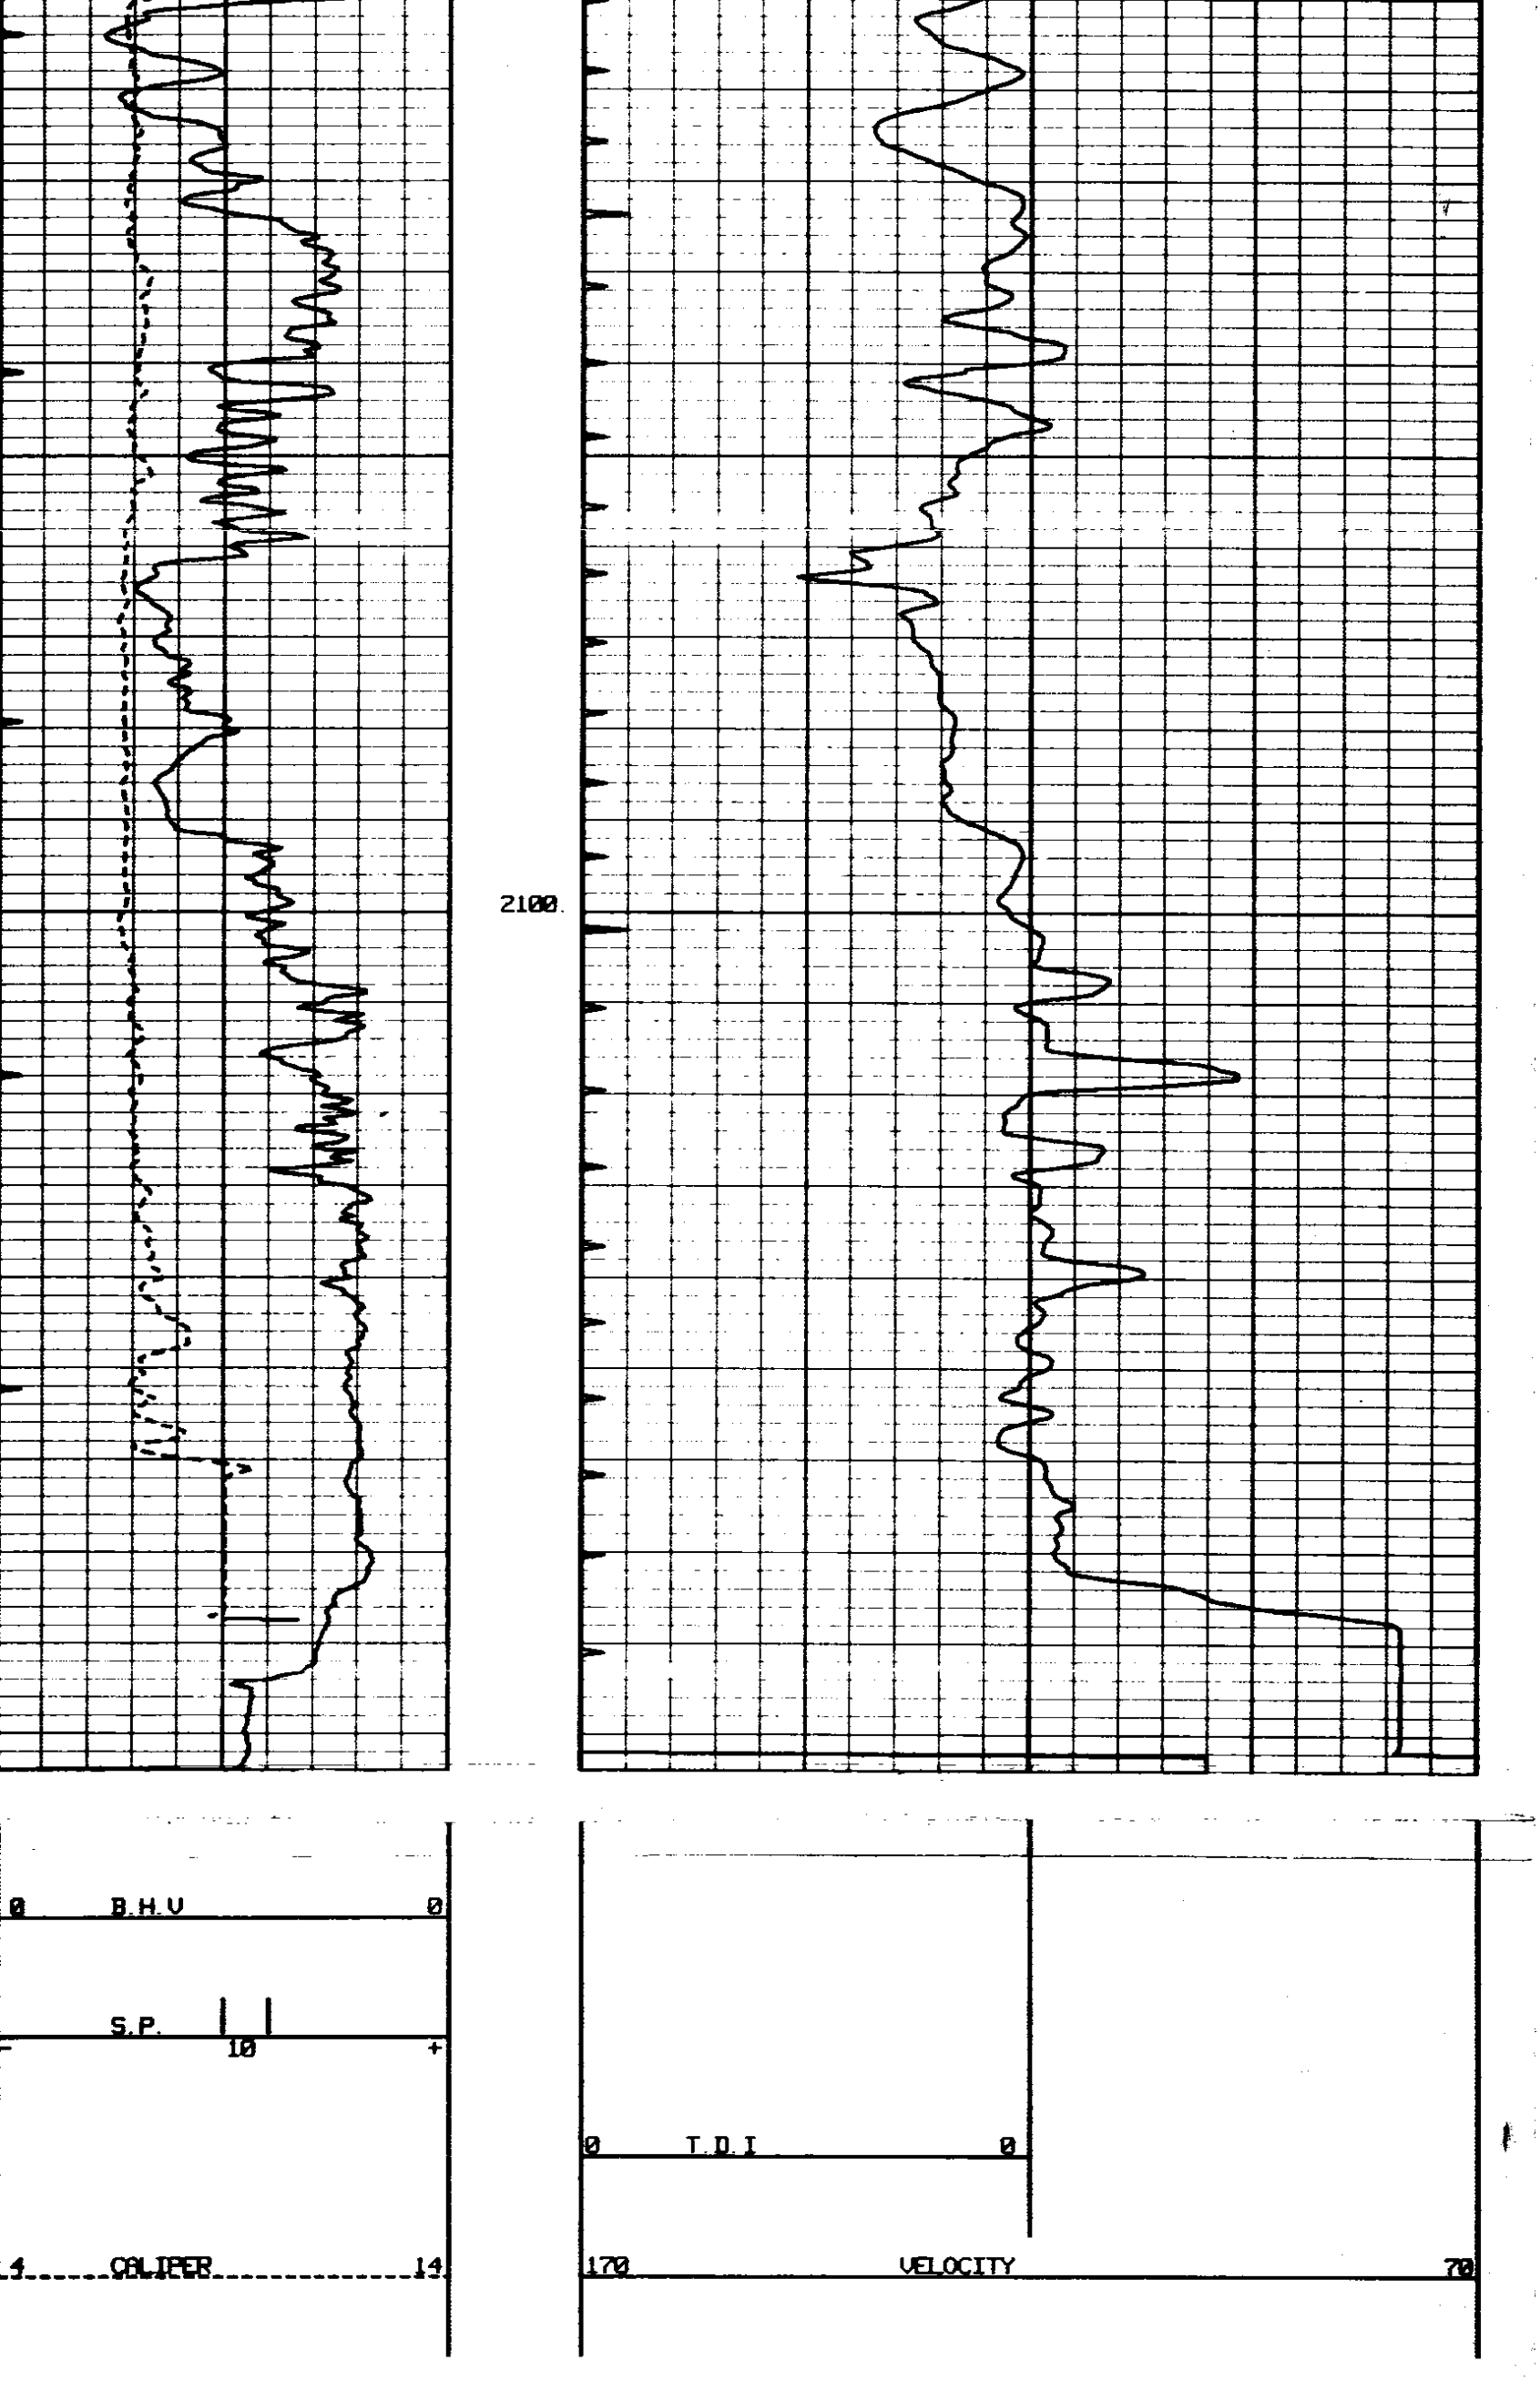REPEAT SECTION