


PLSP TO REMOVE FISH,  
REPLACE 8 5/8" CASING  
AND/OR SIDETRACK WALL

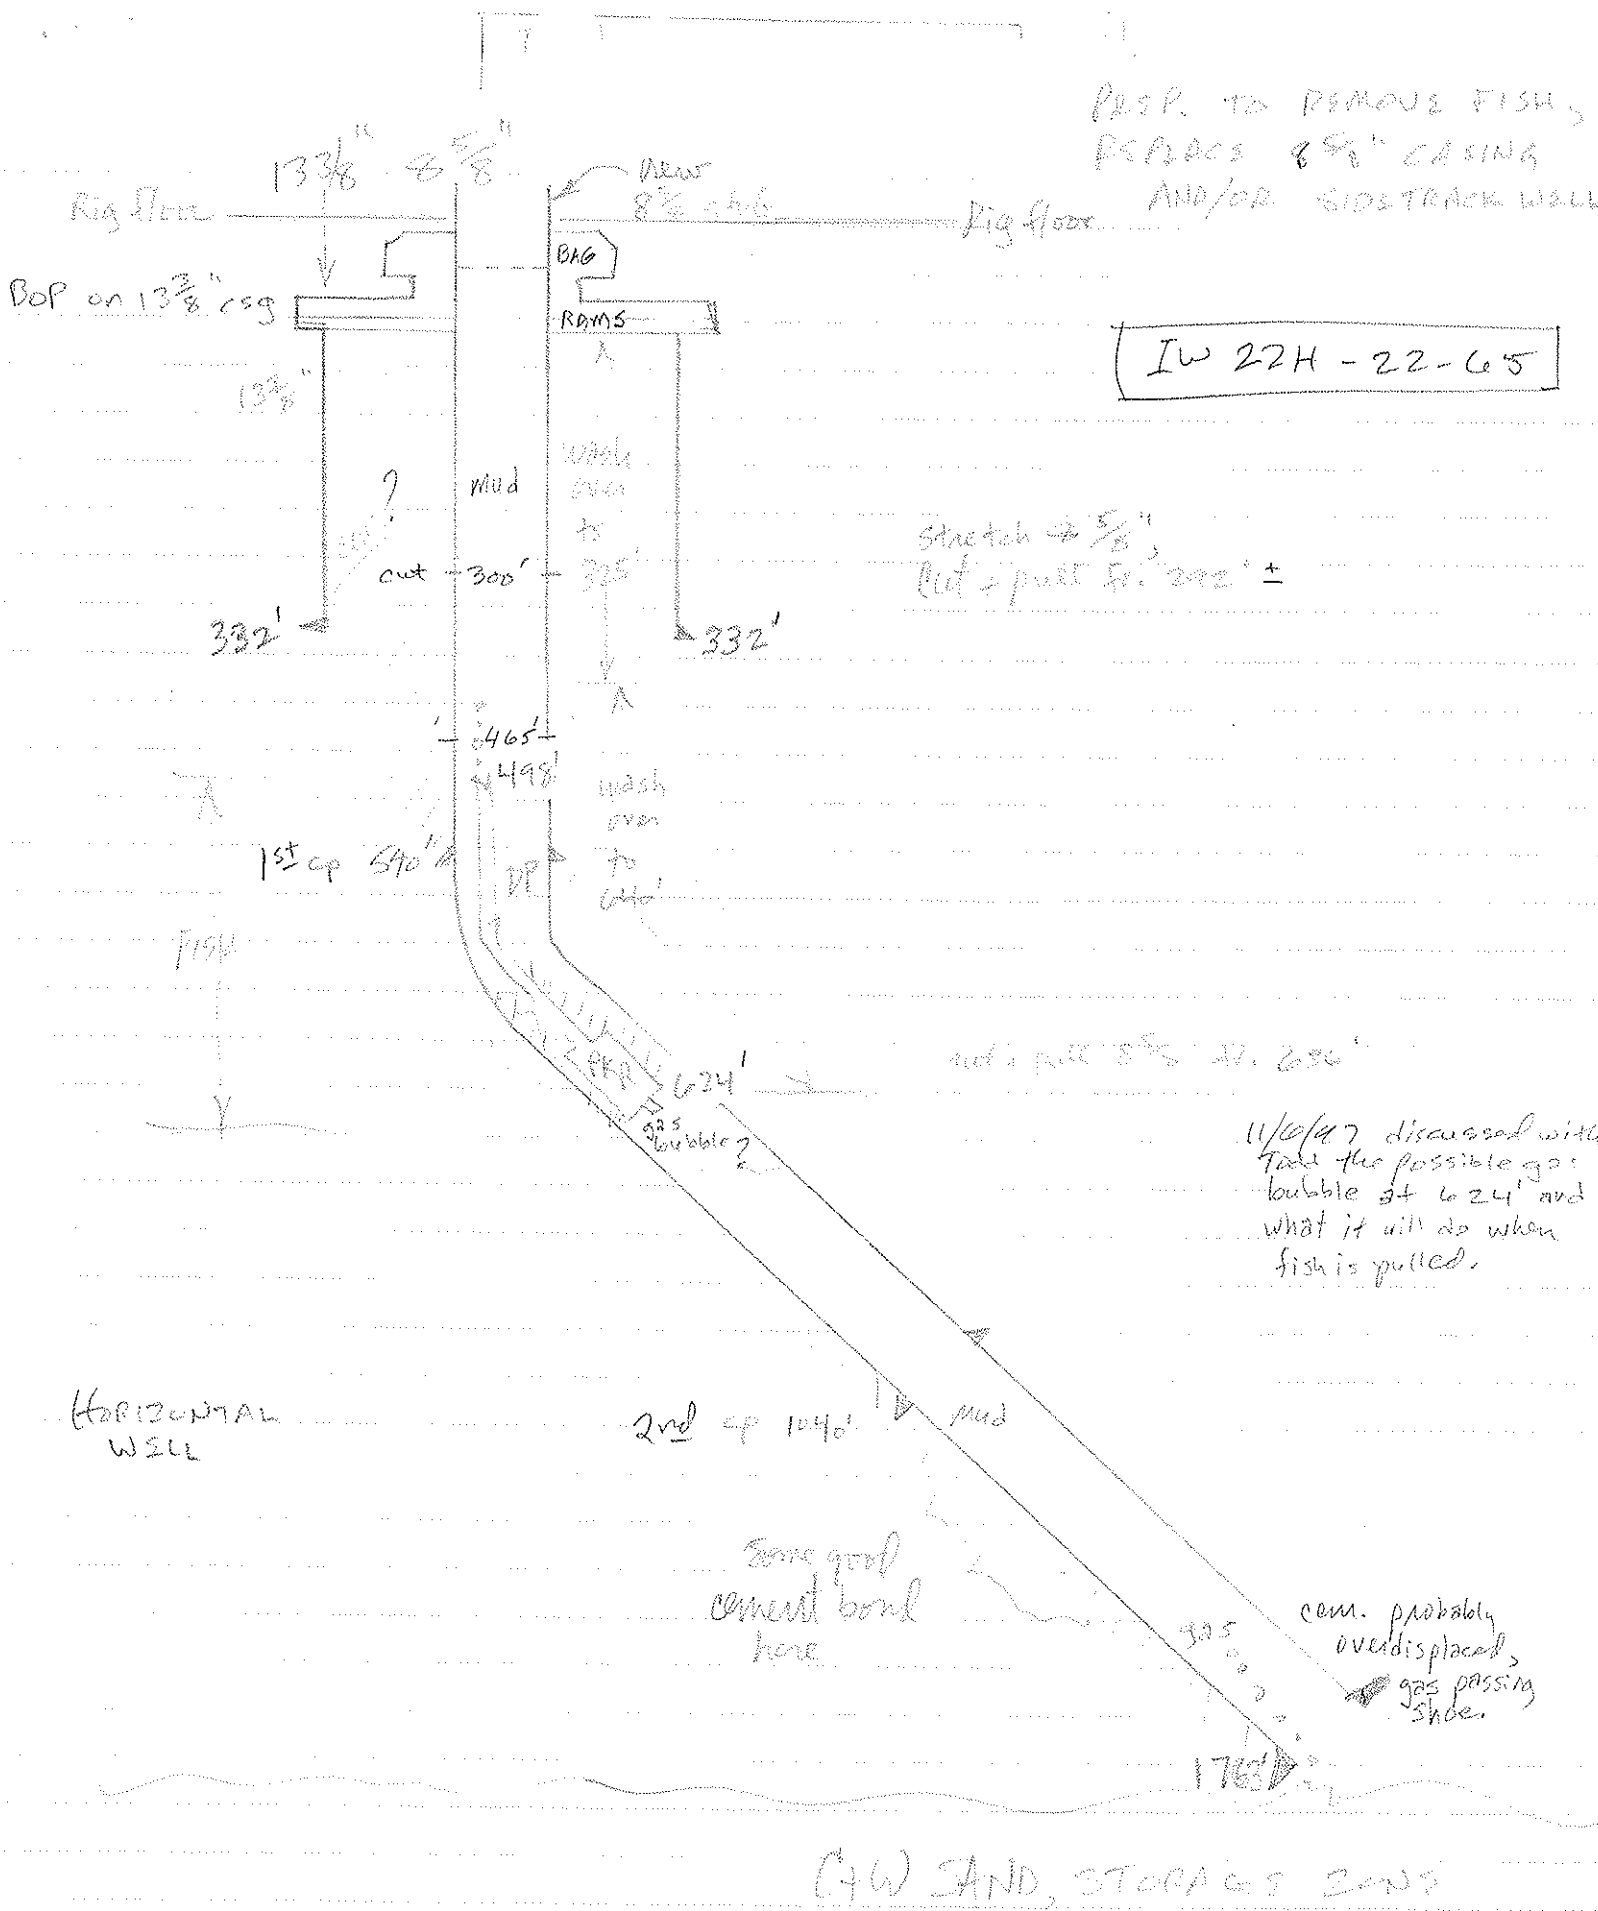

IW 22H - 22 - 65

Stretch 8 5/8"  
(cut = pull fr. 292' ±)

not a full 8 5/8" at 624'

11/6/07 discussed with Tom the possible gas bubble at 624' and what it will do when fish is pulled.

HORIZONTAL WELL

2nd cp 1040' mud

Some good cement bond here

cem. probably overdisplaced, gas passing shoes

(4W) SAND, STORAGE ZONE

HISTORY:

Run 8 5/8" + cemented

Returns after 36 bbl cement; should  
have taken 40 bbl.

WOC, check cup samples on surface.

Perf. @ 540'

332' A

WOC

Pressure up perfor to see if OK.

If OK; move BOP to 8 5/8" csg.

13 3/8" 5 1/8"

540' perf squeeze

poor bond  
to surface

fair cem. bond (1190')

good cem. bond (1210'  
1230')

(horizontal)  
hole

1763' A