

# **2022 ODA Pavement Evaluation Program Bend Municipal Airport**

Bend, Oregon

**December 30, 2022  
(REVISED: 01/24/2023)**

**Prepared for**  
State of Oregon Department of Aviation  
3040 25th Street SE  
Salem, OR 97303-1125

**Prepared by**



16520 SW Upper Boones Ferry Road, Suite 100  
Tigard, OR 97224-7661  
(503) 641-3478 | [www.gri.com](http://www.gri.com)

## TABLE OF CONTENTS

|          |                                                                     |           |
|----------|---------------------------------------------------------------------|-----------|
| <b>1</b> | <b>OVERVIEW .....</b>                                               | <b>1</b>  |
| <b>2</b> | <b>PAVEMENT INVENTORY .....</b>                                     | <b>1</b>  |
| <b>3</b> | <b>PAVEMENT CONDITION INSPECTION RESULTS .....</b>                  | <b>4</b>  |
|          | 3.1 Introduction.....                                               | 4         |
|          | 3.2 Pavement Condition Index Survey Results.....                    | 4         |
| <b>4</b> | <b>FUTURE PAVEMENT CONDITION ANALYSIS.....</b>                      | <b>5</b>  |
|          | 4.1 Introduction.....                                               | 5         |
|          | 4.2 Future Condition Analysis .....                                 | 5         |
|          | 4.3 Functional Remaining Life .....                                 | 7         |
| <b>5</b> | <b>MAINTENANCE AND REHABILITATION PROJECT RECOMMENDATIONS .....</b> | <b>7</b>  |
|          | 5.1 Introduction.....                                               | 7         |
|          | 5.2 Recommended Localized Maintenance.....                          | 8         |
|          | 5.3 Global Maintenance and Rehabilitation Plan .....                | 8         |
| <b>6</b> | <b>LIMITATIONS .....</b>                                            | <b>10</b> |

### TABLES

|            |                                                  |
|------------|--------------------------------------------------|
| Table 3-1: | ASTM PCI Rating Scale                            |
| Table 5-1: | Localized Maintenance Quantities                 |
| Table 5-2: | Global Maintenance and Rehabilitation Quantities |

### FIGURES

|             |                                                                                |
|-------------|--------------------------------------------------------------------------------|
| Figure 2.1: | Bend Airport Location Map                                                      |
| Figure 2.2: | Bend Airport Pavement Area by Surface Type                                     |
| Figure 2.3: | Bend Airport Pavement Area by Branch Use                                       |
| Figure 2.4: | Bend Airport Pavement Inventory - Aprons                                       |
| Figure 2.5: | Bend Airport Pavement Inventory - Secondary Taxiways and Taxilanes             |
| Figure 2.6: | Bend Airport Pavement Inventory - Primary Taxiways and Runway                  |
| Figure 3.1: | 2022 PCI Survey Results                                                        |
| Figure 3.2: | Bend Airport Pavement Condition Rating by Percent of Pavement Area             |
| Figure 4.1  | Future Pavement Condition                                                      |
| Figure 5.1: | Bend Airport Pavement Network General Treatment Type Distribution Based on PCI |
| Figure 5.2: | 5-Year Pavement Management Plan                                                |

### APPENDICES

|             |                                         |
|-------------|-----------------------------------------|
| Appendix A: | Pavement Inventory Report and Maps      |
| Appendix B: | Pavement Condition Index Survey Results |
| Appendix C: | Future Pavement Condition Analysis      |

## **APPENDICES (continued)**

Appendix D: Unit Cost Data and Maintenance and Rehabilitation Plan

Appendix E: Re-Inspection Report

Appendix F: Work History Report

## 1 OVERVIEW

GRI assisted with updating the Oregon Department of Aviation (ODA) airport pavement management system and developing a five-year plan for global maintenance and rehabilitation (M&R) and preservation work for the Bend Municipal Airport in Bend, Oregon. This project was implemented as a part of the ODA and Federal Aviation Administration (FAA) *Oregon Continuous Aviation System Plan*. The information provided in this report ensures compliance with FAA Grant Assurance Number 11, which outlines that an airport shall have an effective airport pavement maintenance-management program in place to receive federal financial assistance for the construction, reconstruction, or repair of airport pavements.

GRI conducted surveys of the airside pavement at Bend Airport in 2022 in accordance with the procedures of Advisory Circular 150/5380-7B and ASTM International (ASTM) D5340. We uploaded the survey data into the PAVER database and used the software to provide a rapid calculation of the pavement condition index (PCI) rating. The PCI is a numerical indicator that defines the functional condition of the pavement based on visual inspection. The scale ranges from zero to 100, where zero represents a pavement in the worst possible condition with no remaining functional life and 100 represents a pavement in the best possible condition with no defects.


## 2 PAVEMENT INVENTORY

Bend Airport is located in Bend, Oregon, and is owned and operated by the City of Bend. The airport consists of one runway that serves a variety of general aviation aircraft as well as limited commercial aircraft and helicopters. The general location of the airport is shown on the Bend Airport Location Map, Figure 2.1.




Figure 2.1 – BEND AIRPORT LOCATION MAP


Bend Airport contains one runway, two primary parallel taxiways, and multiple connector taxiways, taxilanes, aprons, and helipads. The types of airside pavements include asphalt concrete (AC), AC overlaid with AC (AAC), and portland cement concrete (PCC). The airport pavements, delineated by surface type and branch use, are shown on the Bend Airport Percent of Pavement Area by Surface Type, Figure 2.2 and the Bend Airport Percent of Pavement Area by Branch Use, Figure 2.3. The pavement inventory, including work history for each pavement section, is displayed spatially on the Bend Airport Pavement Inventory (Aprons), Figure 2.4 for aprons, the Bend Airport Pavement Inventory (Secondary Taxiways), Figure 2.5 for secondary taxiways and taxilanes, and the Bend Airport Pavement Inventory (Primary Taxiways and Runway), Figure 2.6 for the runway and primary taxiways. The pavement facilities summarized by branch and section are listed in Tables 1A and 2A, respectively, in Appendix A. The sample unit layout for each section is shown on Figure 1A in Appendix A. We used sampling rates outlined in Table 3A of Appendix A in our survey. The pavement inventory, including work history for individual airport pavement sections, is provided in the Work History Report, Table 1F.

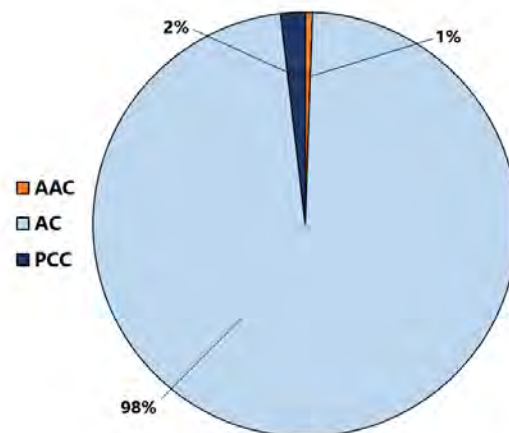


**Figure 2.2 – BEND AIRPORT PERCENT OF PAVEMENT AREA BY SURFACE TYPE**

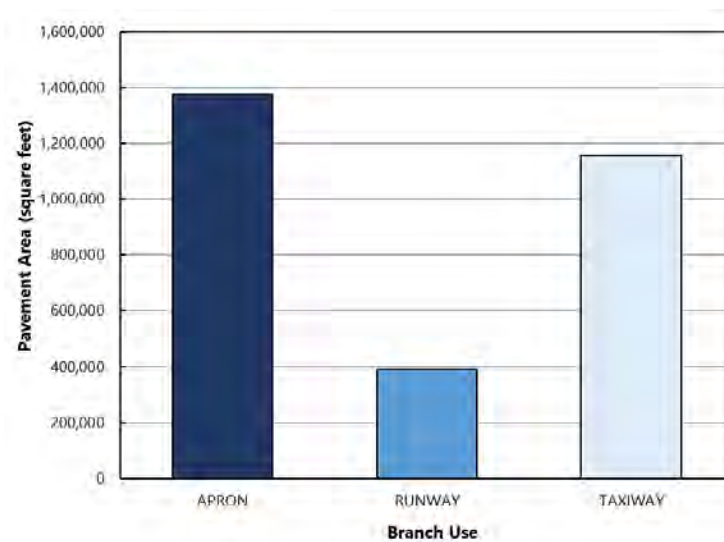


**Figure 2.3 – BEND AIRPORT PAVEMENT AREA BY BRANCH USE**

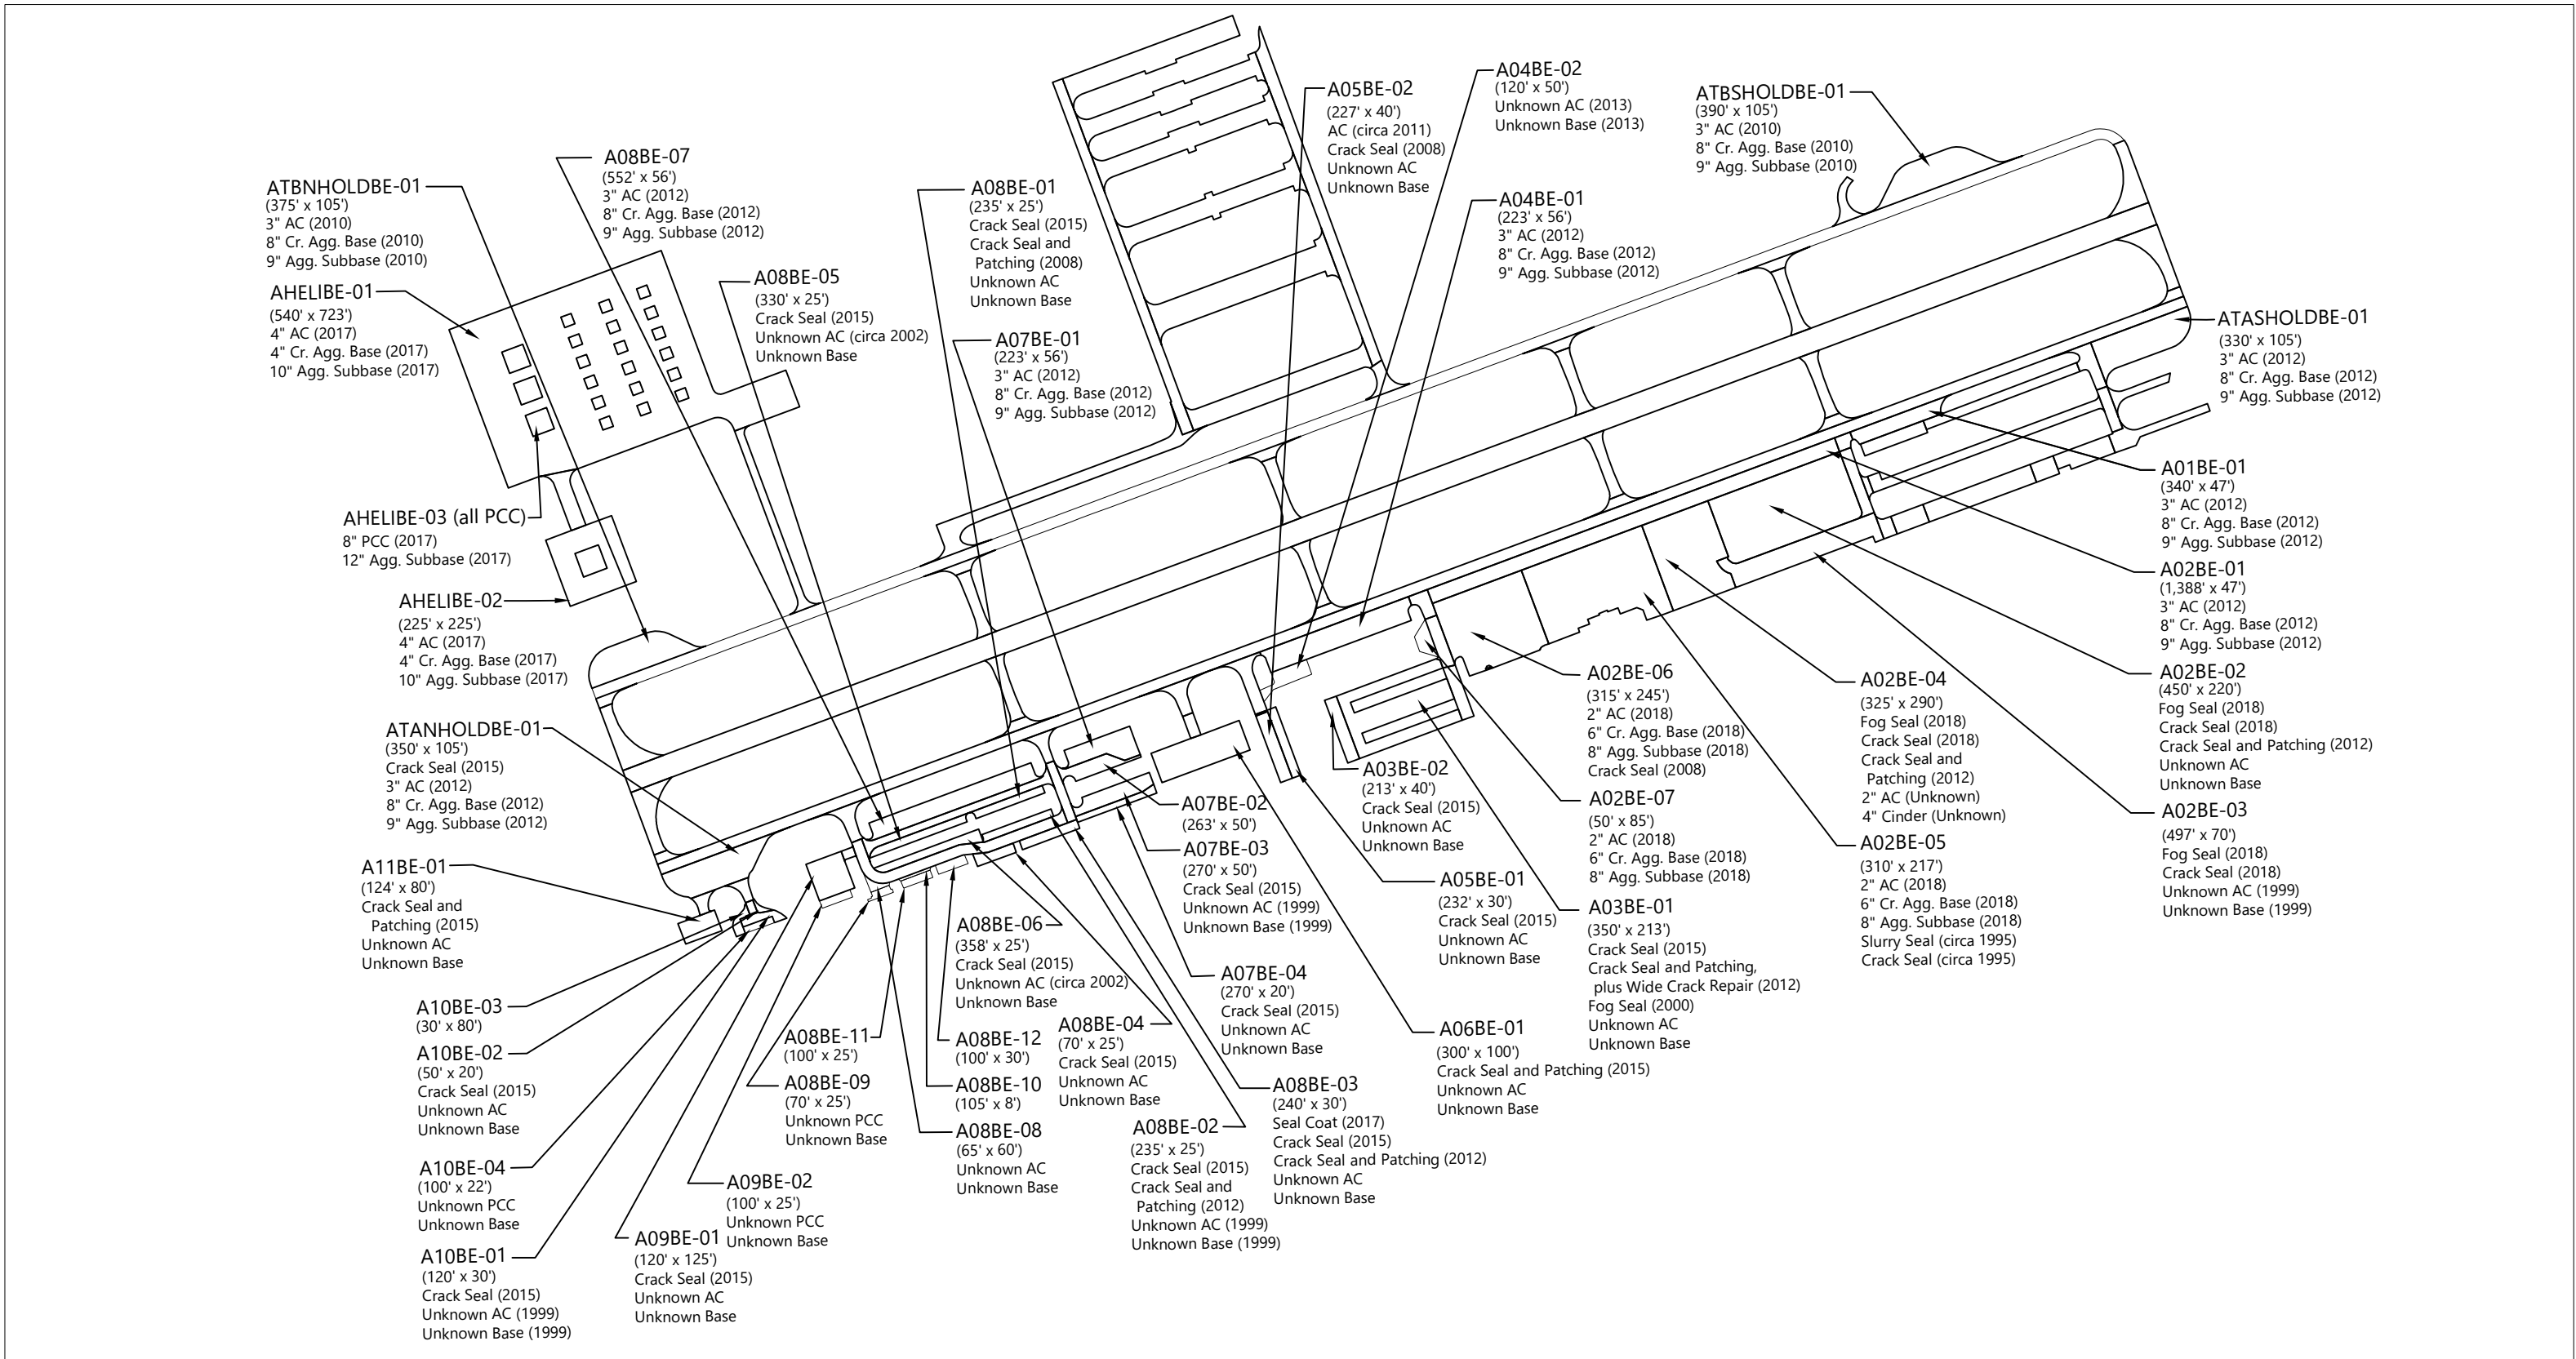



Abbreviations: AC = Asphalt Concrete; PCC = Portland Cement Concrete; Cr. = Crushed; Agg. = Aggregate

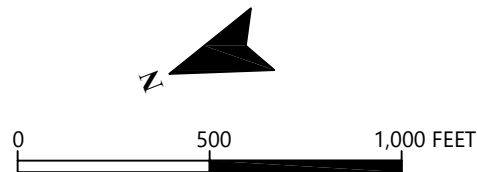

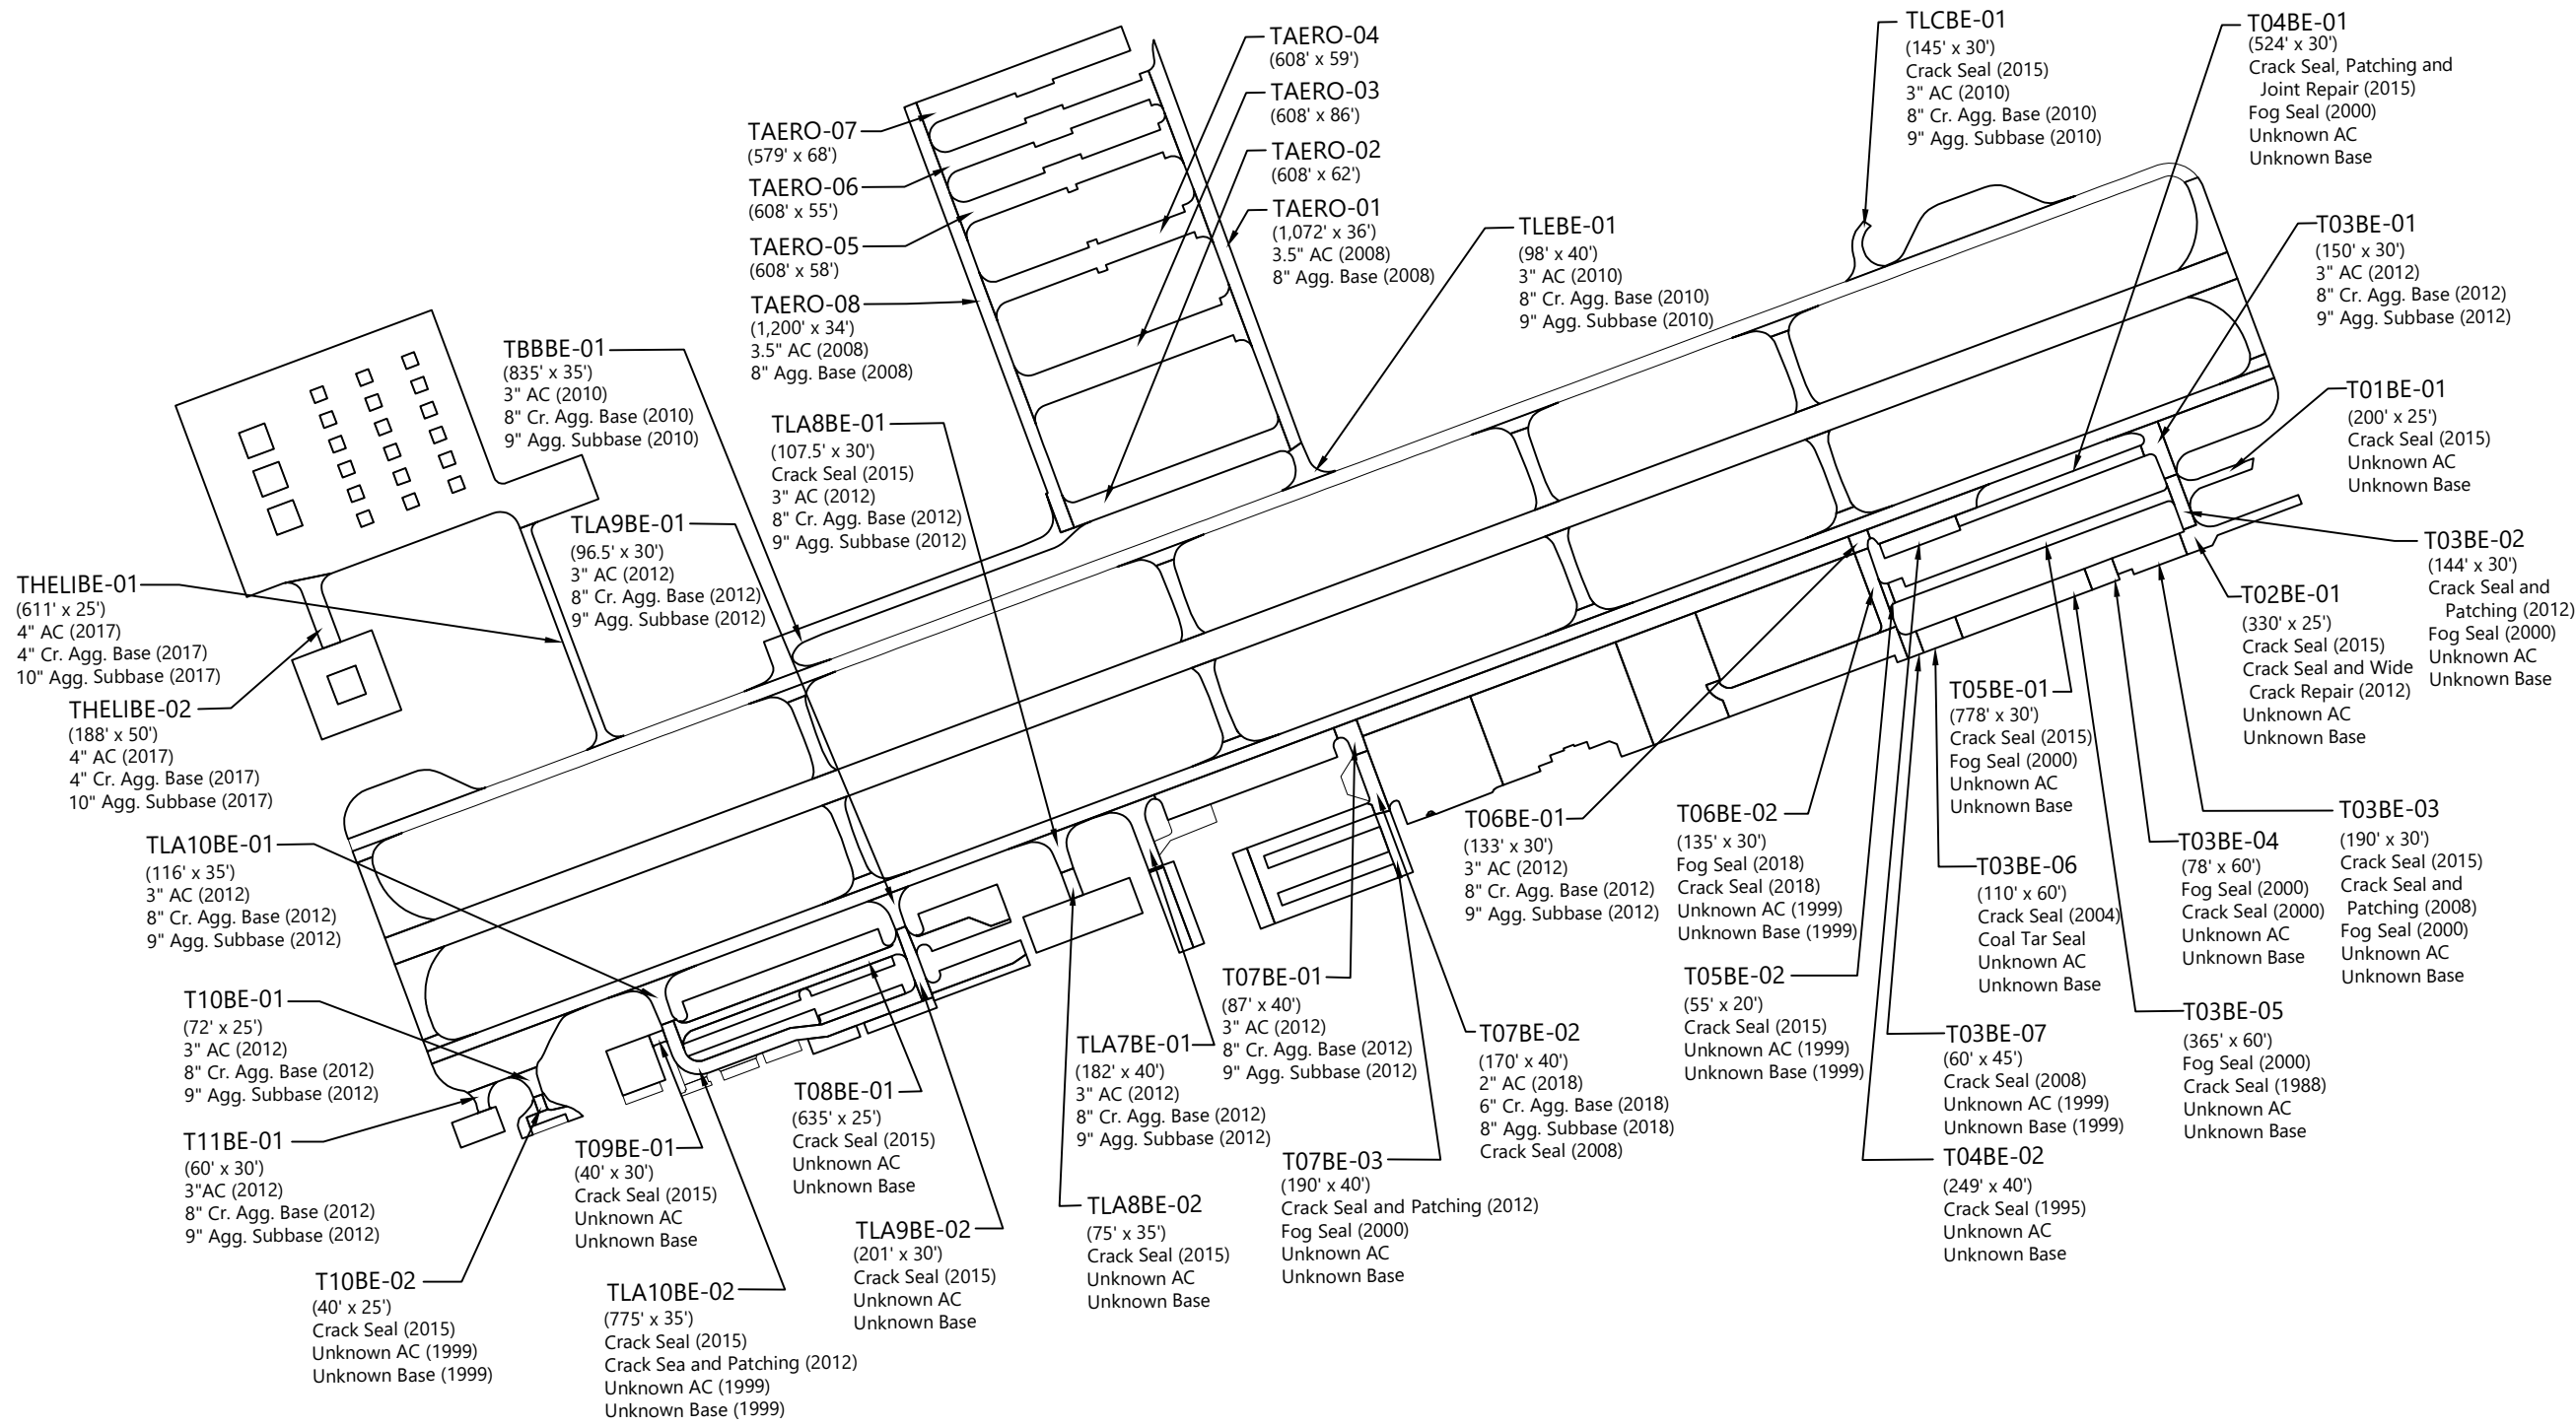


Abbreviations: AC = Asphalt Concrete; Cr. = Crushed; Agg. = Aggregate

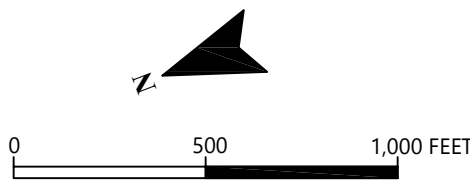

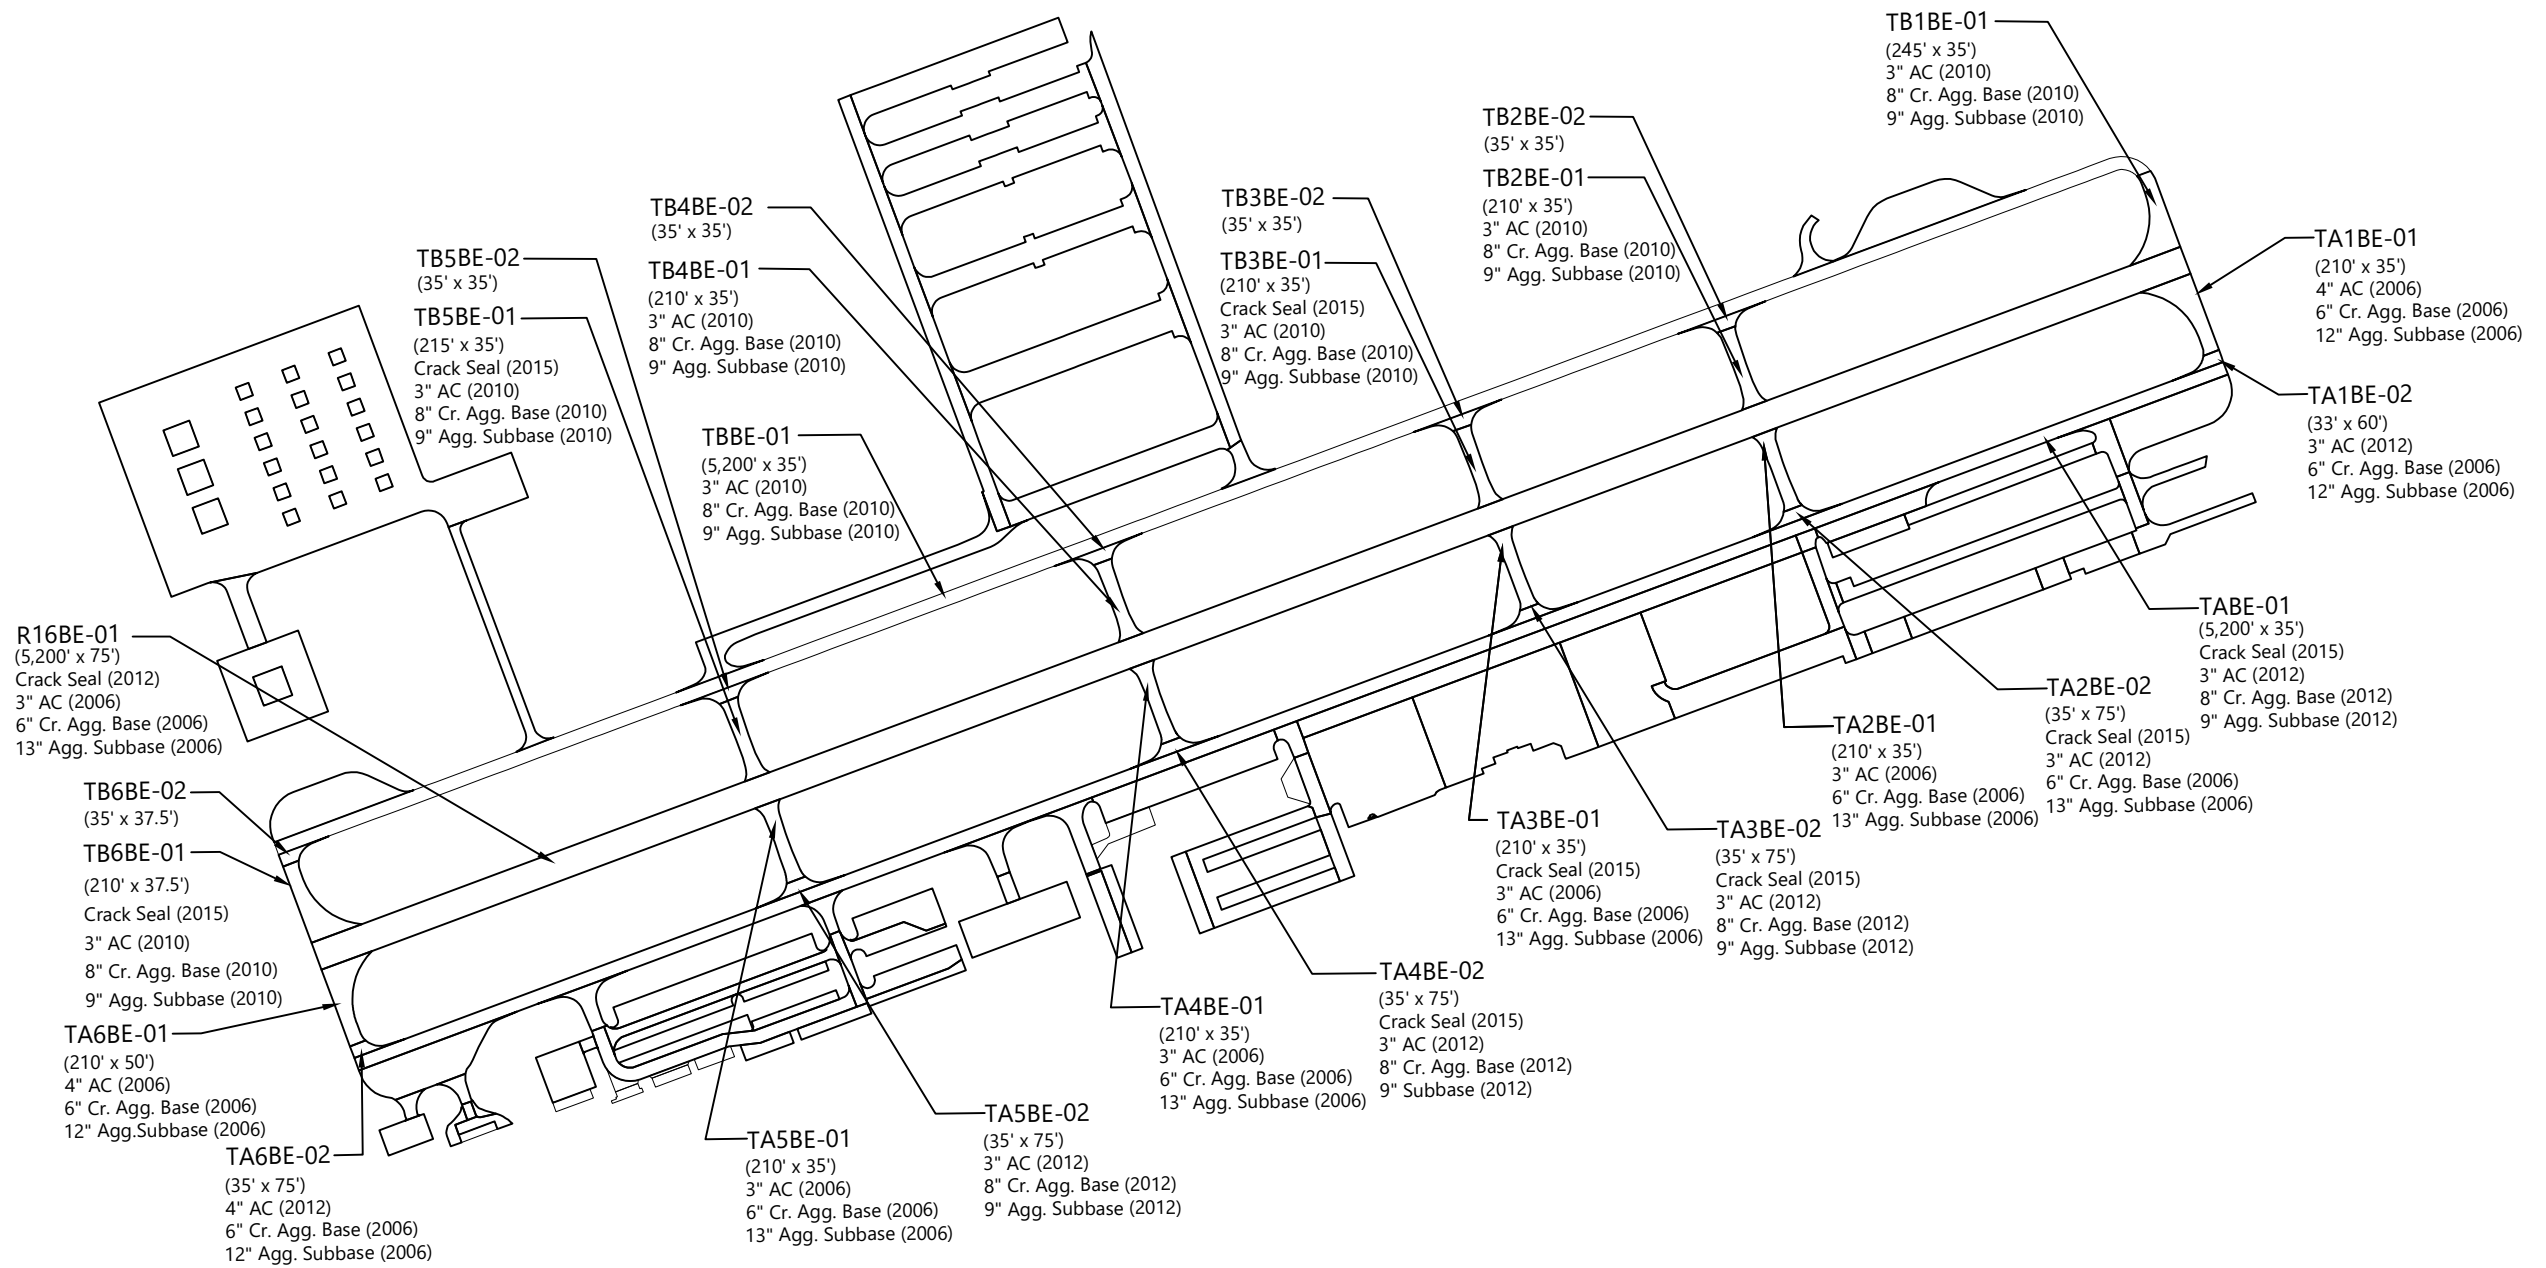

Abbreviations: AC = Asphalt Concrete; Cr. = Crushed; Agg. = Aggregate

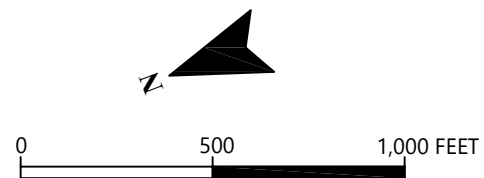

## 3 PAVEMENT CONDITION INSPECTION RESULTS

### 3.1 Introduction

GRI conducted a visual PCI survey of the airside pavements at Bend Airport in March 2022. The 2022 survey work was performed on sections last inspected in 2017 in order to update the Bend Airport inspection data. GRI performed the 2022 PCI survey in accordance with the methods described in FAA Advisory Circular 150/5380-6C and ASTM D5340, and further discussed in Appendix B of this report.


The PCI is based on the type, severity, and quantity of each distress found in an inspected sample unit. Further discussion of distress types for flexible and rigid pavement is provided in Appendix B and summarized in Table 1B in Appendix B. The results of the PCI survey are displayed using a seven-category rating scale in accordance with ASTM D5340. Details of the ASTM PCI rating scale are provided in Table 3-1 below.

**Table 3-1: ASTM PCI RATING SCALE**

| PCI Color Legend | PCI Range | PCI Rating and Definition                                                                                                                                         |
|------------------|-----------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|
|                  | 86 – 100  | GOOD: Pavement has minor or no distresses and should require only routine maintenance.                                                                            |
|                  | 71 – 85   | SATISFACTORY: Pavement has scattered low-severity distresses that should require only routine maintenance.                                                        |
|                  | 56 – 70   | FAIR: Pavement has a combination of generally low- and medium-severity distresses. Maintenance and repair needs may range from routine to major.                  |
|                  | 41 – 55   | POOR: Pavement has low-, medium-, and high-severity distresses that probably cause some operational problems. M&R needs will be major.                            |
|                  | 26 – 40   | VERY POOR: Pavement has predominantly medium- and high-severity distresses that cause considerable maintenance and operational problems. M&R needs will be major. |
|                  | 11 – 25   | SERIOUS: Pavement has mainly high-severity distresses that may affect operational safety; immediate repairs are needed.                                           |
|                  | 0 – 10    | FAILED: Pavement deterioration has progressed to the point that safe aircraft operations are no longer possible; complete reconstruction is required.             |


### 3.2 Pavement Condition Index Survey Results

The area-weighted average PCI for all airport pavements at Bend Airport is approximately 76. The section PCIs ranged from a low of 7 to a high of 100. The primary distresses observed during the inspection were weathering, longitudinal and transverse cracking, fatigue (alligator) cracking, and patching on AC-surfaced pavements, and linear cracking and shattered slabs on PCC pavements. Section PCIs following our pavement survey are displayed below spatially on the 2022 PCI Survey Results, Figure 3.1.

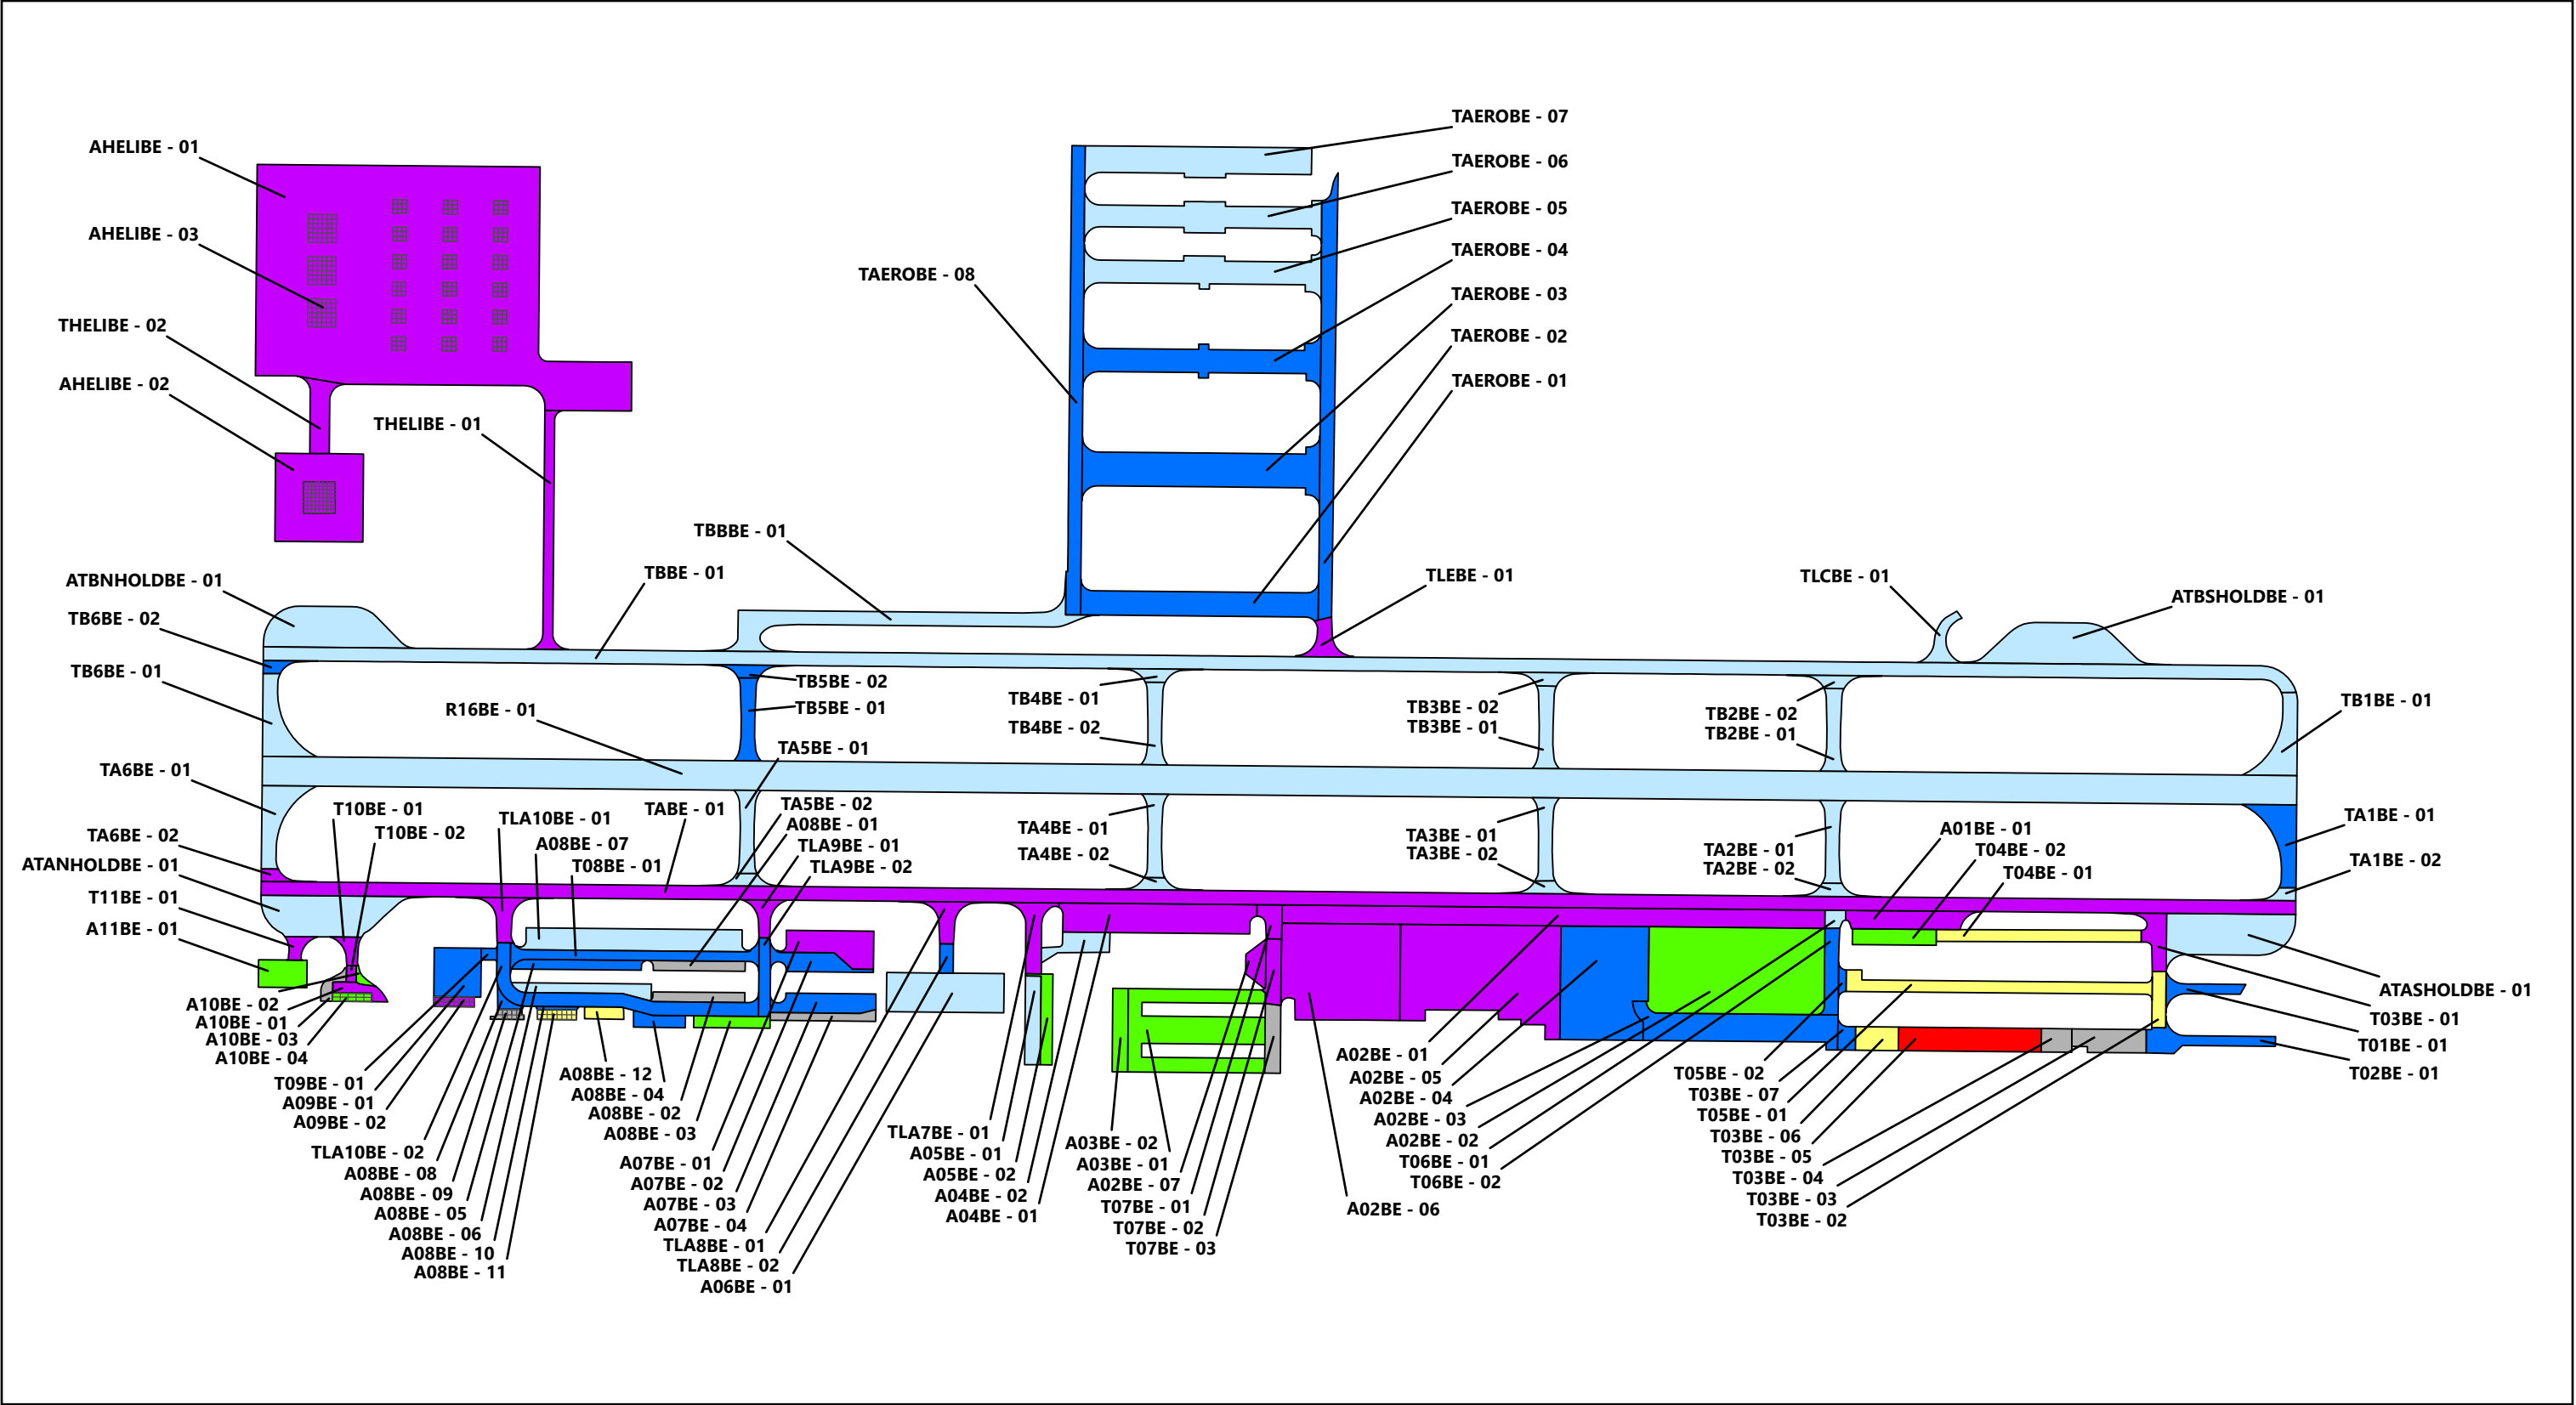


2022 SECTION PCI

- (86 - 100) GOOD
- (71 - 85) SATISFACTORY
- (56 - 70) FAIR
- (41 - 55) POOR
- (26 - 40) VERY POOR
- (11 - 25) SERIOUS
- (0 - 10) FAILED

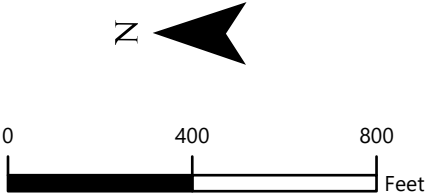

2022 PCI SURVEY RESULTS  
BEND AIRPORT

The condition distribution of the network by the percent of total pavement area is provided on the Bend Airport Pavement Condition Rating by Percent of Pavement Area, Figure 3.2. A summary of the pavement condition results by branch and section are included in Tables 2B and 3B of Appendix B, respectively. A comparison between the previous inspection and the 2022 inspection is provided in Table 4B in Appendix B. The re-inspection report that includes inspection details for individual sample units is provided in Table 1E in Appendix E.

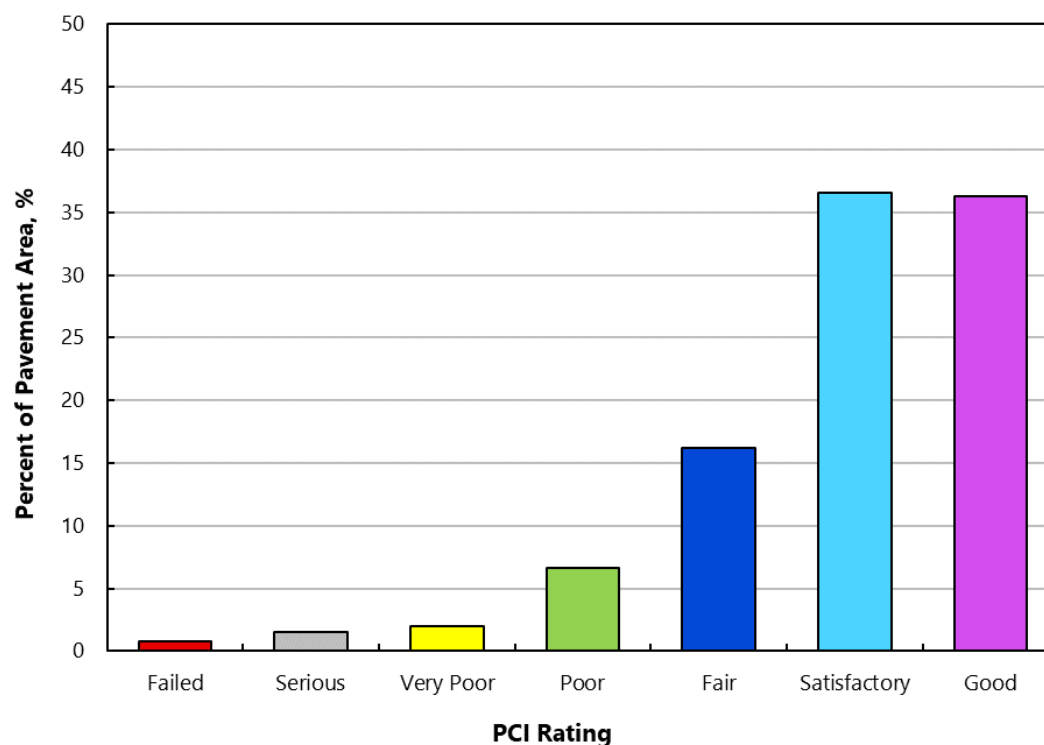

**Figure 3.2 – BEND AIRPORT PAVEMENT CONDITION RATING BY PERCENT OF PAVEMENT AREA**

## **4 FUTURE PAVEMENT CONDITION ANALYSIS**

### **4.1 Introduction**


In addition to assessing the current condition of a pavement, it is very important from a planning standpoint to be able to predict with reasonable accuracy the future condition. Additional details regarding our future pavement condition analysis, including pavement condition prediction models, are provided in Appendix C. PCI performance curves developed for Bend Airport are displayed on Figures 1C through 5C in Appendix C.

### **4.2 Future Condition Analysis**


Using the condition prediction models discussed above, the projected condition of each pavement section was determined for 5- and 10-year periods. Based on this analysis, we project the PCI to decrease from a current value of 76 to a value of 64 in the year 2027

and 53 in the year 2032 if no maintenance or rehabilitation work is performed. The projected pavement condition in 5 years and 10 years for each pavement section at Bend Airport is displayed spatially on the Future Pavement Condition, Figure 4.1 and listed in Table 1C in Appendix C, along with the past and present PCI values for the pavement network.



PREDICTED CONDITION IN 2027

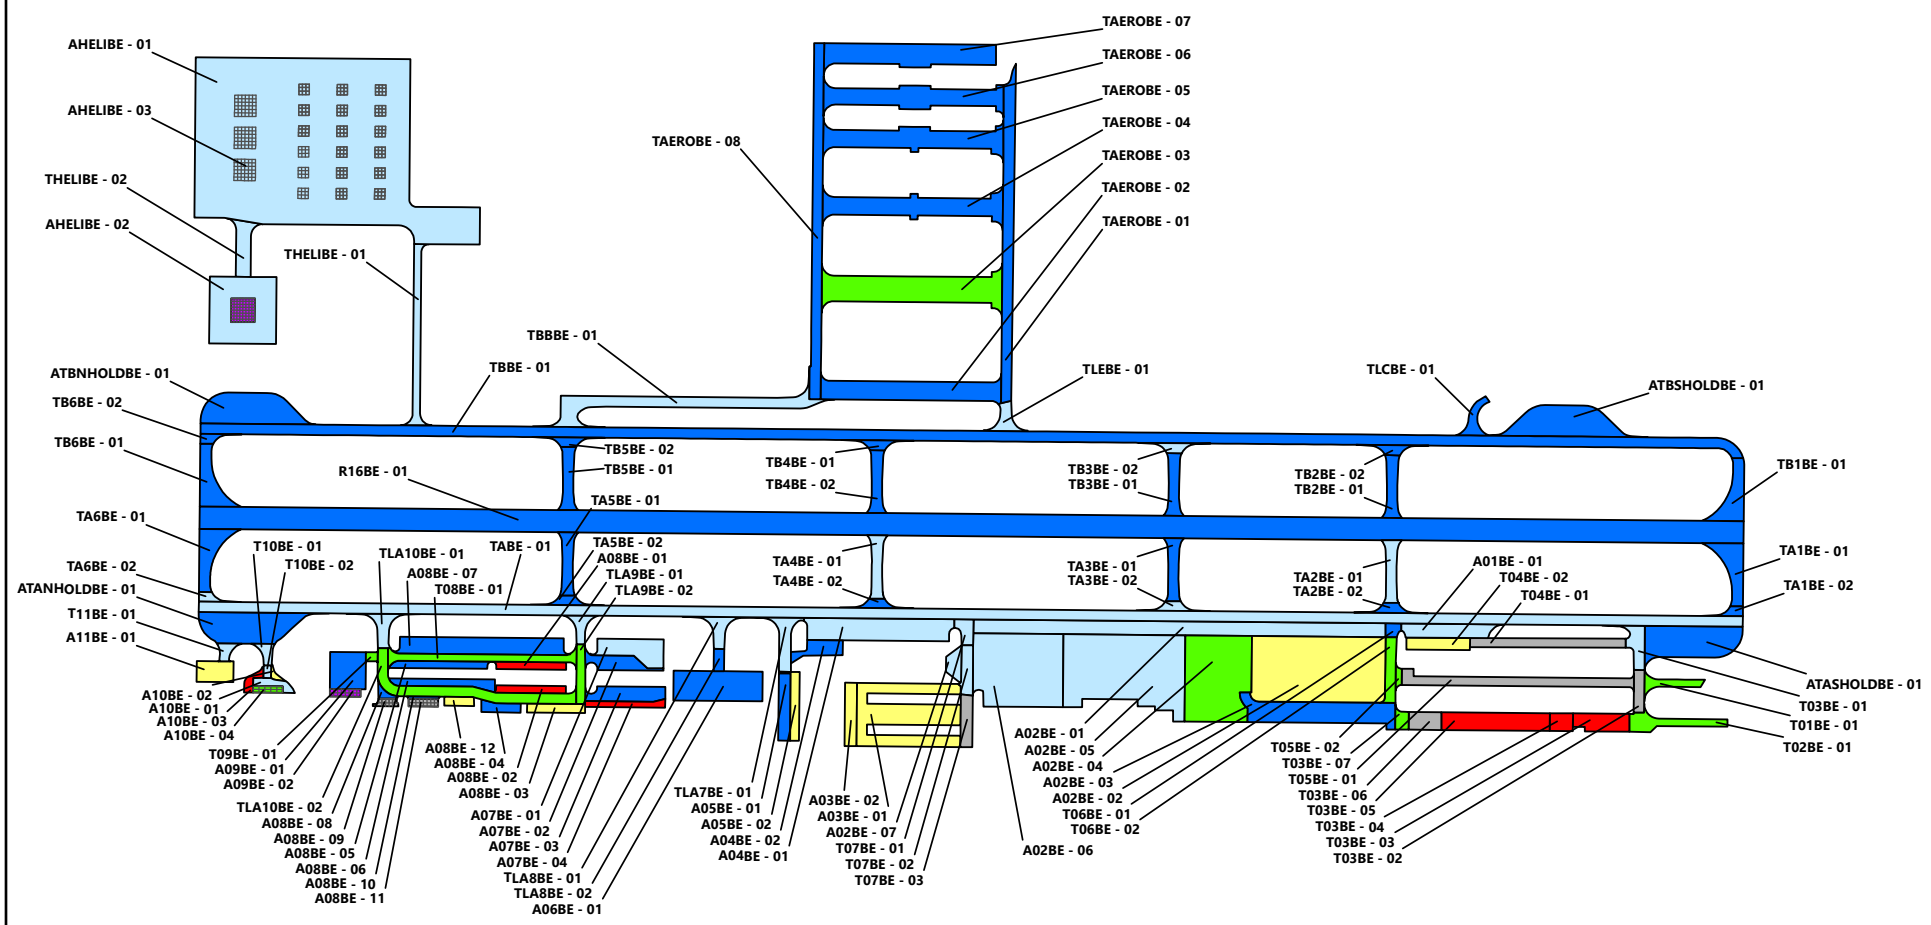

PREDICTED CONDITION IN 2032

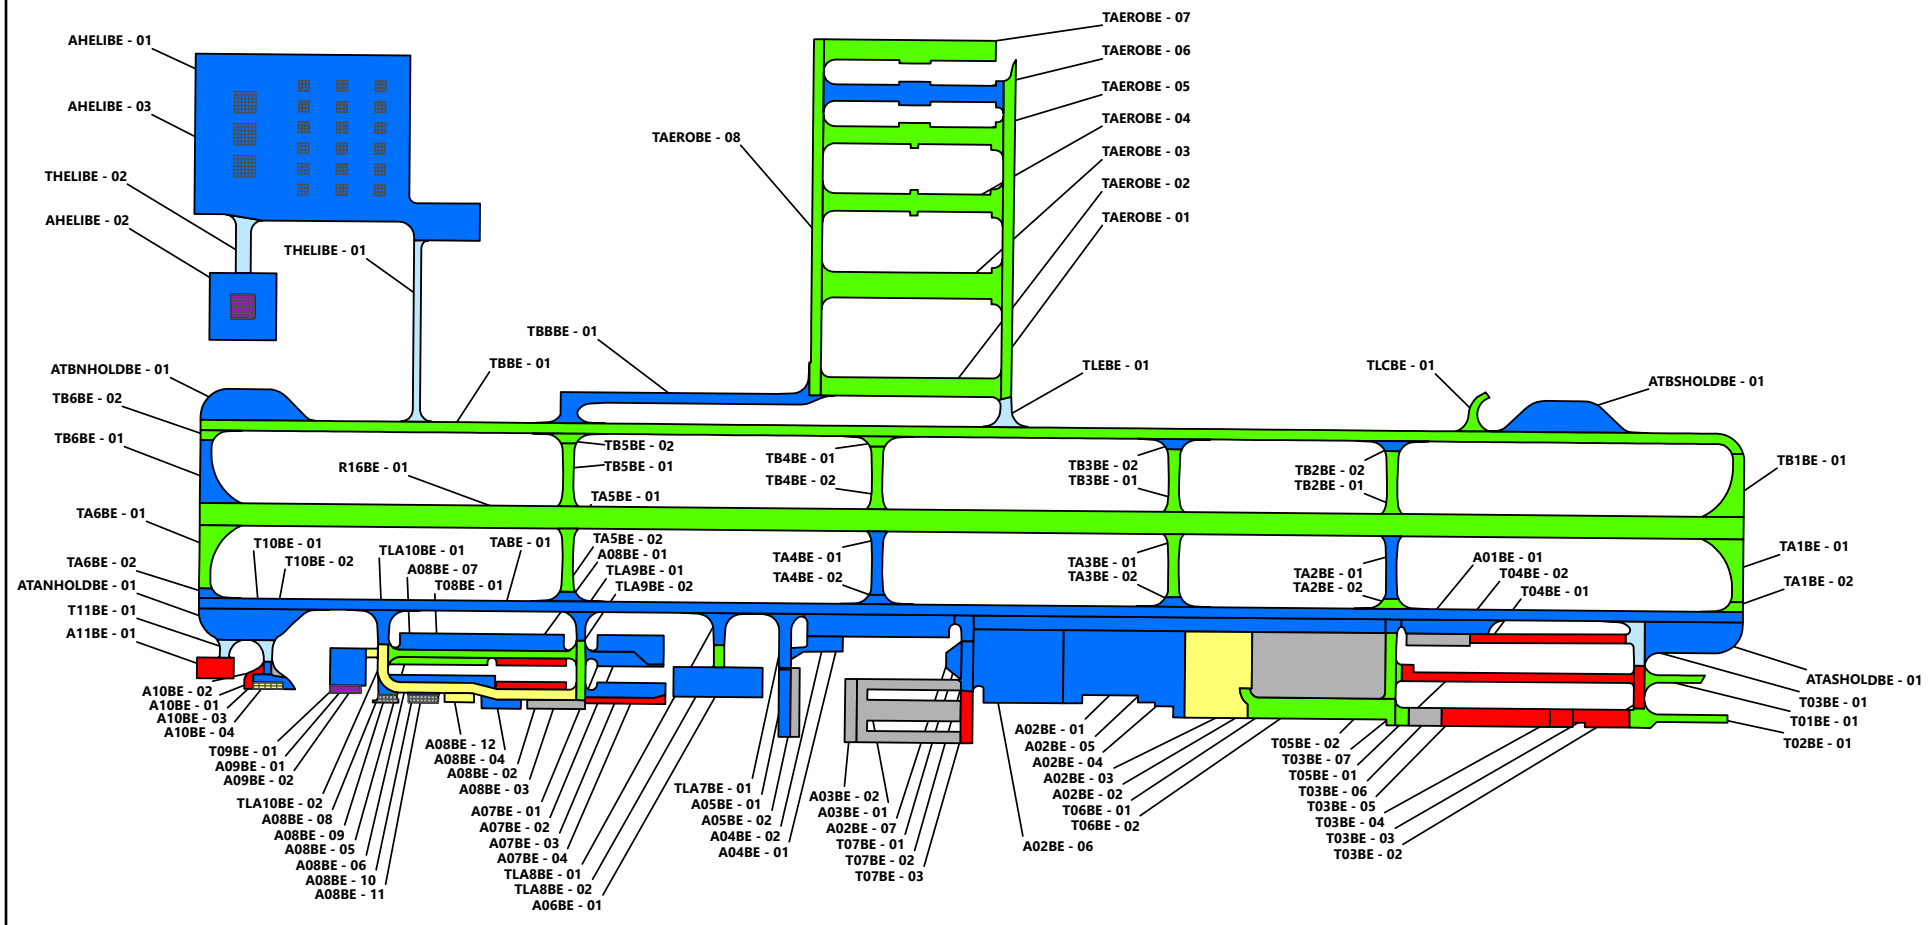

SECTION PCI

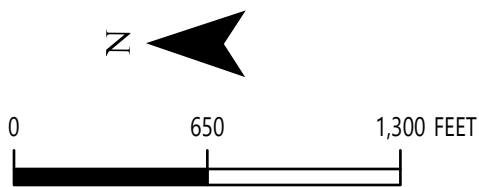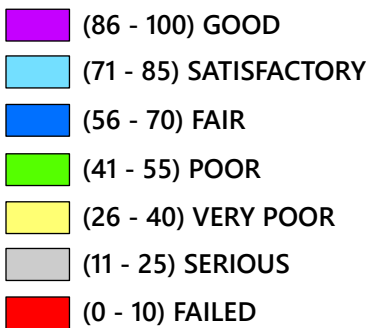

### 4.3 Functional Remaining Life

The functional remaining life is the practical amount of time a pavement is in service before requiring rehabilitation, as estimated based solely on visual condition. This is not to be confused with structural remaining life, which requires analysis of the structural capacity of a pavement and typically a field exploration and testing program that includes core explorations and falling weight deflectometer (FWD) deflection tests.

We calculated two forms of functional remaining life based on the current visual condition surveys of the pavement at Bend Airport. The first type of functional remaining life is the time until rehabilitation such as an overlay is needed. The critical PCI, further discussed in Section C.3 of Appendix C, is the threshold used for this type of functional remaining life analysis. The second type of functional remaining life is the time until the pavement is no longer operational due to high foreign object debris (FOD) potential and increased safety concerns for trafficking aircraft. A PCI of 40 was set as the trigger point for the end of the pavement's functional service life with regard to FOD potential.

The two types of functional remaining life for each section at Bend Airport are summarized in Table 2C in Appendix C.

## 5 MAINTENANCE AND REHABILITATION PROJECT RECOMMENDATIONS

### 5.1 Introduction

We evaluated M&R needs, as determined from the PAVER analysis results, in order to develop localized maintenance, global maintenance, and rehabilitation needs. Details of our M&R work priority and unit costs for work activities are provided in Tables 1D and 2D, respectively, in Appendix D.

Based on the 2022 PCI-survey results, the Bend Airport Pavement Network General Treatment Type Distribution Based on PCI, Figure 5.1 displays a breakdown of the Bend Airport network pavement condition by percent of pavement area and general M&R treatment categories. Approximately 73%, 23%, and 4% of the area require preservation treatments, rehabilitation, and reconstruction, respectively.

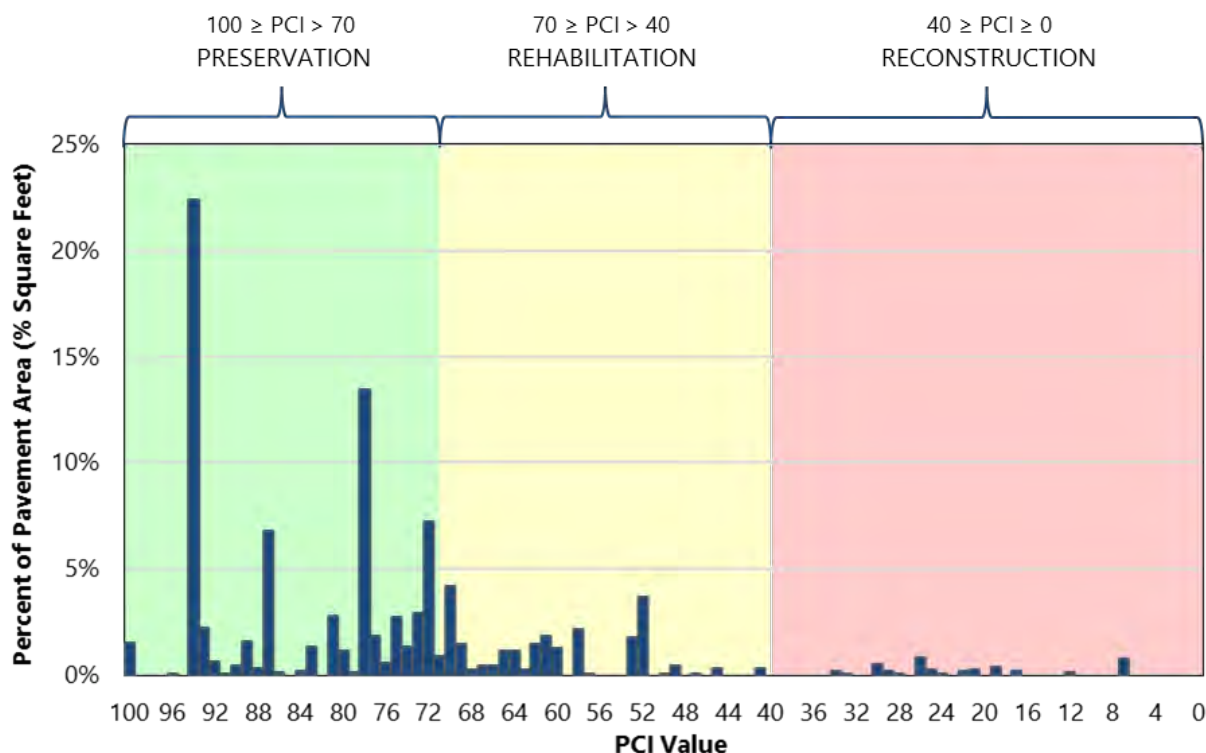


Figure 5.1 – BEND AIRPORT PAVEMENT NETWORK GENERAL TREATMENT TYPE DISTRIBUTION BASED ON PCI

## 5.2 Recommended Localized Maintenance

Localized maintenance refers to activities such as crack sealing and patching, which should be performed annually in order to properly maintain aging pavements. Using the PAVER Localized Distress Maintenance Analysis tool, we developed a list of recommended localized maintenance. This list is shown in Table 3D in Appendix D and is independent of the global maintenance and rehabilitation projects associated with the five-year global maintenance and rehabilitation work plan. A summary of the approximate total localized maintenance quantities is provided in Table 5-1 below.

Table 5-1: LOCALIZED MAINTENANCE QUANTITIES

| Localized Maintenance Operation              | Approximate Quantity |
|----------------------------------------------|----------------------|
| Asphalt Concrete Crack Sealing               | 97,955 linear feet   |
| Asphalt Concrete Wide Crack Sealing          | 290 linear feet      |
| Portland Cement Concrete Crack Sealing       | 480 linear feet      |
| Asphalt Concrete Full-Depth Patching         | 27,646 square feet   |
| Portland Cement Concrete Full Depth Patching | 144 square feet      |


## 5.3 Global Maintenance and Rehabilitation Plan

To develop the five-year work plan, we first ran the eliminate backlog scenario with the PAVER M&R Work Planning Module in order to generate a list, organized by year, of global

M&R projects. We then reviewed the project list and refined it into practical construction projects for each year. A summary of global M&R quantities is provided in Table 5-2 below, and maps of the project locations by year are shown on the 5-Year Pavement Management Plan Bend Airport, Figure 5.2. The complete list of recommended global M&R projects is presented in Table 4D in Appendix D.

**Table 5-2: GLOBAL MAINTENANCE AND REHABILITATION QUANTITIES**

| Global Maintenance or Rehabilitation Operation | Quantity, square feet |
|------------------------------------------------|-----------------------|
| Reconstruction                                 | 165,000               |
| Overlay                                        | 268,413               |
| Fog Seal                                       | 1,114,771             |
| Slurry Seal                                    | 1,323,152             |

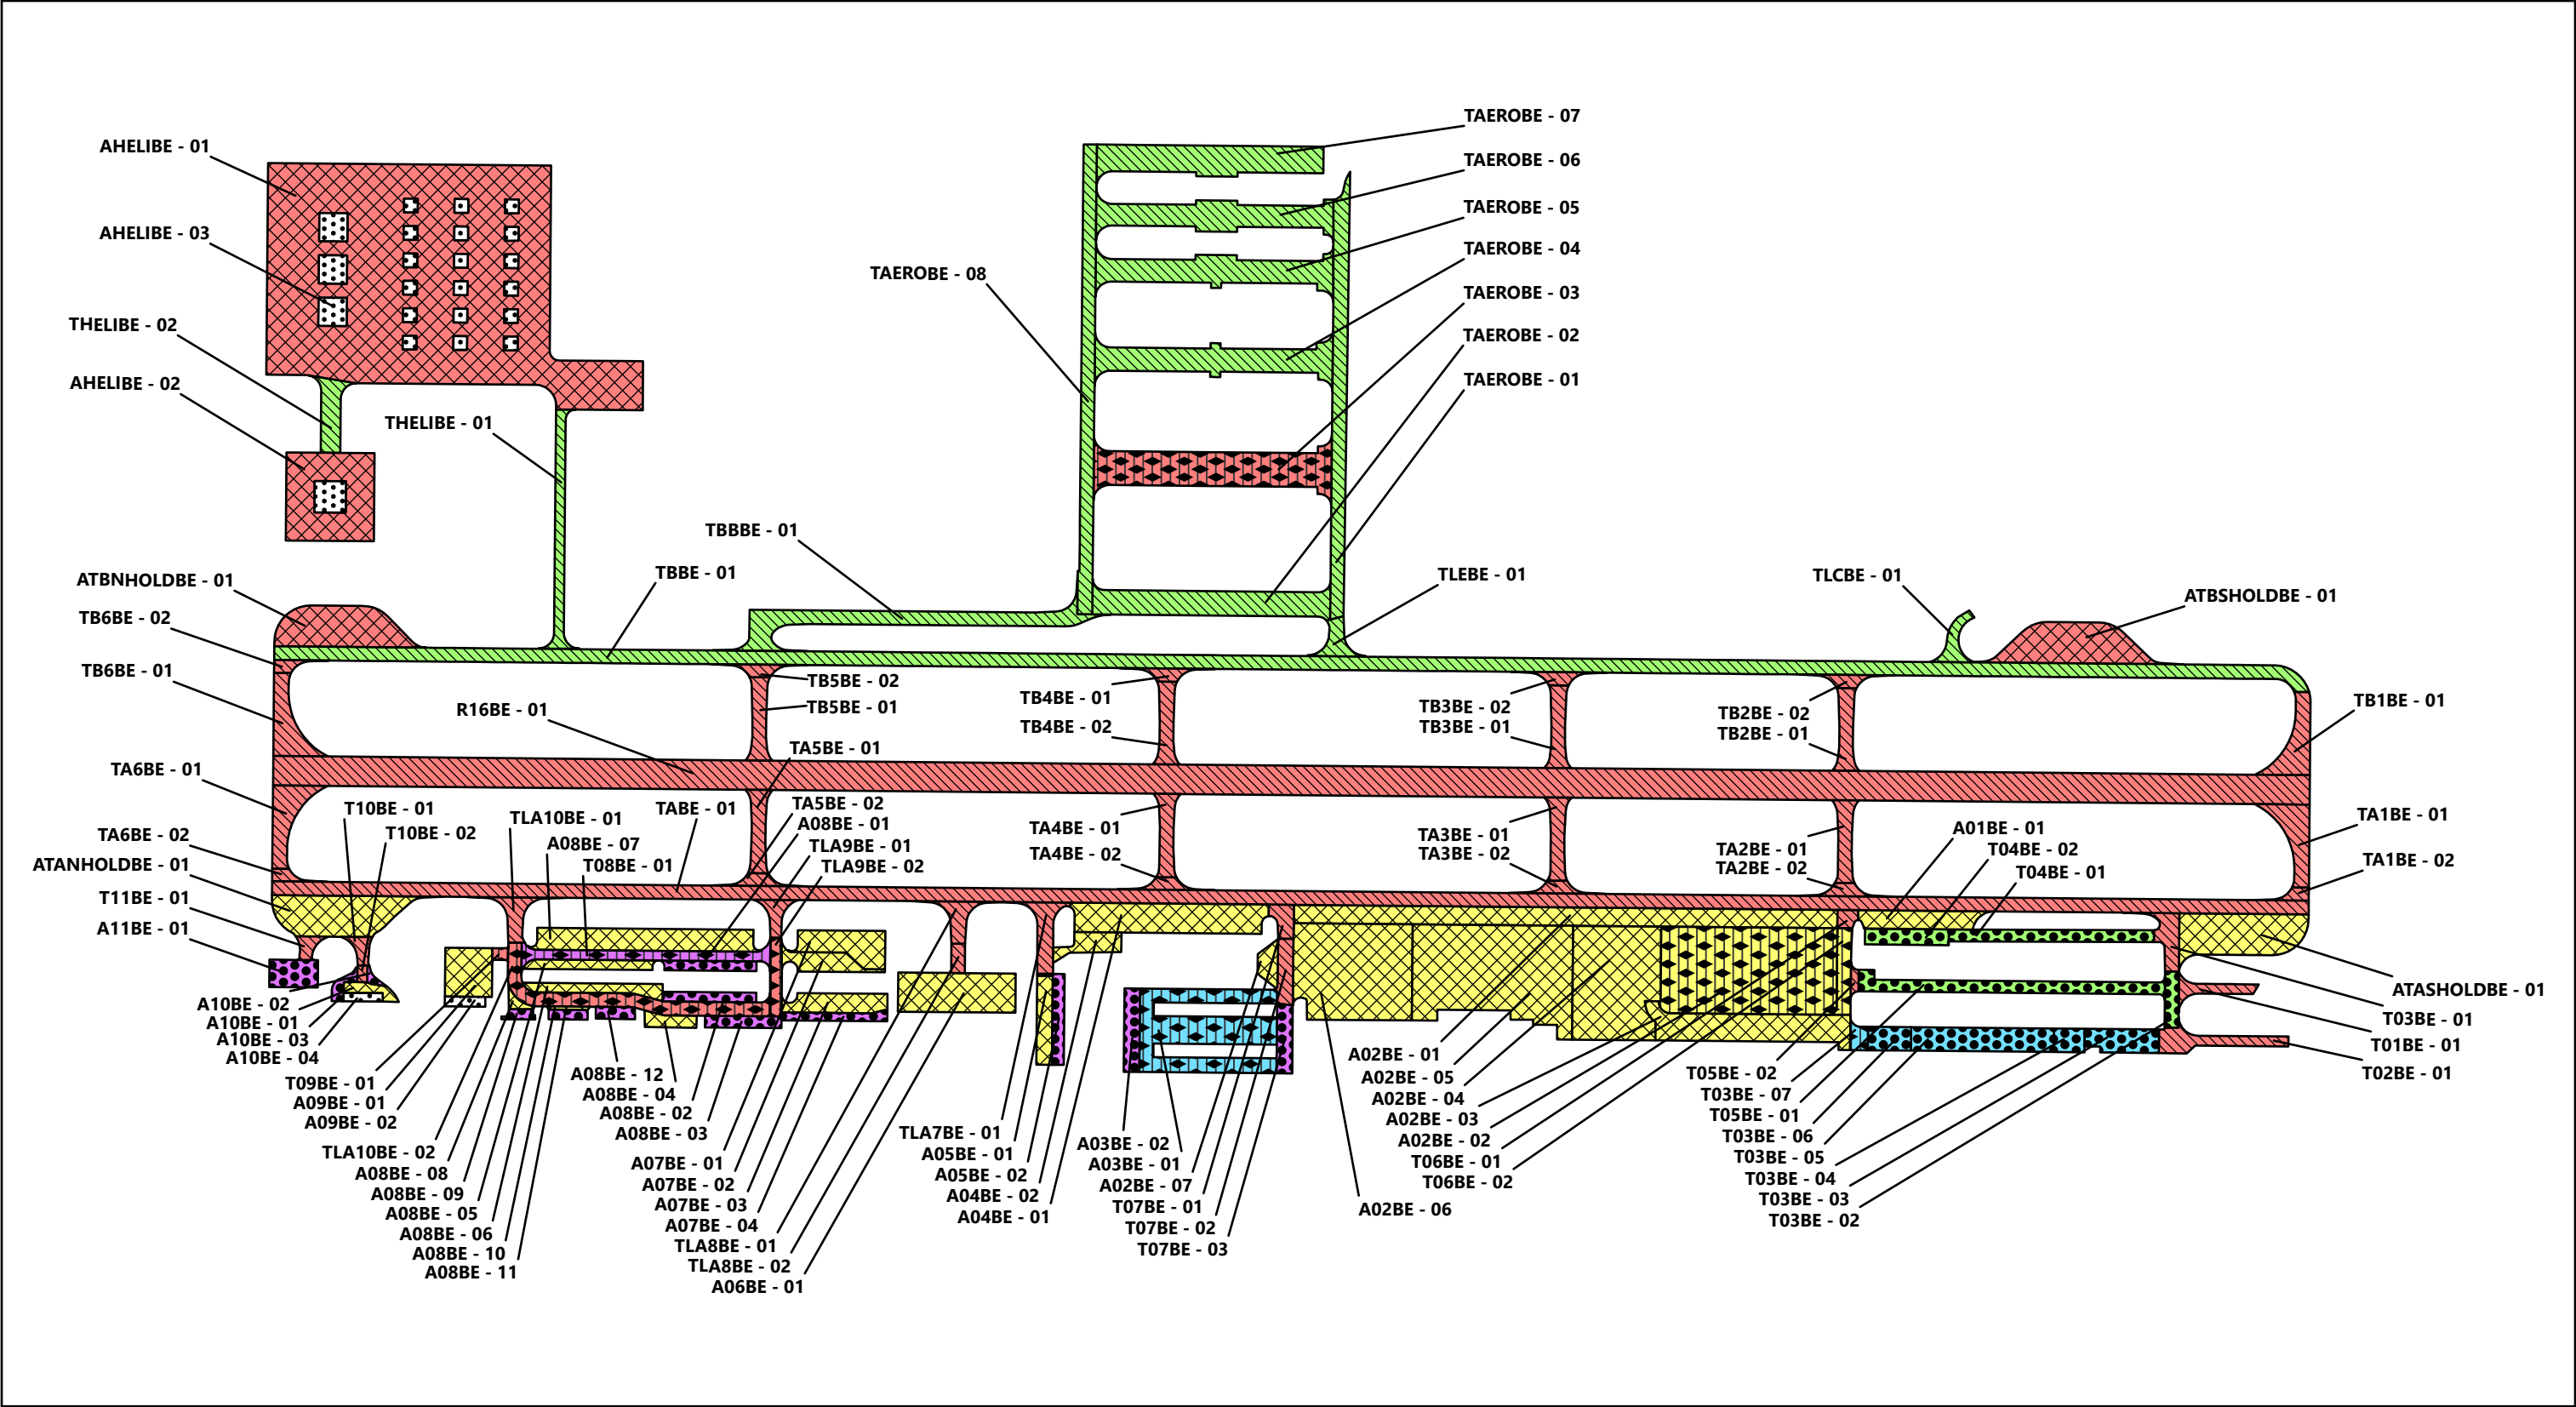


**ACTION TIMING**

- 2023
- 2024
- 2025
- 2026
- 2027

**ACTION**

- FOG SEAL
- SLURRY SEAL
- OVERLAY
- RECONSTRUCTION
- ROUTINE MAINTENANCE



OREGON DEPARTMENT OF AVIATION  
STATEWIDE PAVEMENT EVALUATION PROGRAM

**5-YEAR PAVEMENT MANAGEMENT PLAN  
BEND AIRPORT**

## 6 LIMITATIONS

This report has been prepared to assist the Oregon Department of Aviation (ODA) with pavement-related project planning for the Bend Airport. The scope is limited to the specific pavement areas described within this report. The conclusions and recommendations provided in this report are based on information provided by ODA, estimated costs, and an understanding of the pavement conditions based solely on visual assessment. The global maintenance and rehabilitation recommendations and project selections provided in this report, as well as their corresponding cost estimates, are based on a practical grouping of projects and an estimate of the structural requirements. It is possible that recommendations based on a structural evaluation would differ materially from the recommendations given herein. Therefore, the information included in this report should be used solely for project planning purposes, and it should be understood that rehabilitation costs may vary from the cost estimates given within this report.

Because the condition of the airport pavement network is dynamic, an effective maintenance and rehabilitation program should be reviewed and updated on a regular basis. In addition to regularly surveying and updating the pavement condition, completed construction activities should be tracked in the PAVER database. If Bend Airport would like to know more about the results presented in this report, please contact the undersigned.

Submitted for GRI,



RENEWS: 06/2023

Lindsy A. Hammond, PE  
Principal

Matthew A. Haynes, PE  
Project Engineer

This document has been submitted electronically.

---

## **APPENDIX A**

### *Pavement Inventory Report and Maps*

## APPENDIX A

### PAVEMENT INVENTORY REPORTS AND MAPS

#### A.1 PAVEMENT NETWORK

Bend Municipal Airport is located in Bend, Oregon, and is owned and operated by the City of Bend. The pavement network/facilities at Bend Airport serve a variety of general aviation aircraft and limited commercial aircraft. Bend Airport consists of one runway, two primary parallel taxiways, multiple connector taxiways, taxilanes, and several aprons and helipads. The types of airside pavements include asphalt concrete (AC), AC overlaid with AC (AAC), and portland cement concrete (PCC).

The current airport pavement management system (APMS) network at Bend Airport has an approximate area of 2.9 million square feet of paved airside facilities. The pavement network has previously been divided (by others) into a hierarchical order of branches, sections, and sample units that facilitate inspection and maintenance planning. The pavement facilities summarized by branch and section are listed in Tables 1A and 2A, respectively. Pavement sections and the sample unit layout for each section are shown on Figure 1A in this appendix.

#### A.2 BRANCHES

A branch, as defined in the PAVER system, is a facility that is a readily identifiable part of a pavement system and has a distinct function. For airports, branches typically consist of individual runways, taxiways, and aprons. The current pavement network for Bend Airport contains 51 branches, tabulated in Table 1A and shown on Figure 1A.

#### A.3 SECTIONS AND SAMPLE UNITS

A pavement section is the smallest management unit used when considering the application and selection of maintenance and rehabilitation (M&R) repairs and treatments and is defined by Section 2.1.8 of ASTM International (ASTM) D5340 as *"a contiguous pavement area having uniform construction, maintenance, usage history, and condition."* All sections should also have the same traffic volume and load intensity. The current pavement network included in the PAVER database for Bend Airport contains 114 sections that are managed by the City of Bend, which are tabulated in Table 2A and shown spatially on Figure 1A.

PAVER assigns a rank, which designates that pavement's prioritization in receiving maintenance and repair. The highest use or priority pavements, such as runways, taxiways, and terminal aprons, are ranked *Primary*, while the surrounding aprons and shoulders are

ranked *Secondary* and low-use areas are ranked *Tertiary*. The ranks for all sections are shown on Table 2A.

To facilitate the visual survey of the airport pavement, each section is further subdivided into smaller areas called sample units. Similar sizing of these units is critical, and studies have found that maintaining the size of the sample units to within 40% of the established normal distribution reduces the standard error of the average pavement condition index (PCI) values. To meet this criterion, the ASTM method recommends sample units for flexible pavements be  $5,000 \pm 2,000$  square feet and  $20 \text{ slabs} \pm 8 \text{ slabs}$  for rigid pavements. The delineation of sample units for each section is displayed on Figure 1A.

#### A.4 SAMPLE UNIT DELINEATION

For an APMS survey, a PCI confidence level of 92% and an allowable error (e) of eight PCI points are used for all airport pavements. To determine the number of sample units that need to be inspected to achieve the required confidence level and allowable error, the following equation is used:

$$n = \frac{N \times s^2}{\left(\frac{e^2}{4}\right)(N-1) + s^2} \quad (\text{Equation 1})$$

where:

- n = number of sample units to be inspected
- N = total number of samples in the pavement sections
- e = allowable error
- s = section standard deviation

For the 2022 Bend Airport PCI survey, Table 3A was used as a guideline in developing sampling rates for flexible and rigid pavement that reflect similar rates used for other large airport pavement networks. In general, this sampling rate distribution provides a 92% confidence level with a standard error of eight PCI points.

Sample unit locations at Bend Airport were selected using a systematic random sampling model method. This technique is implemented by first determining the number of sample units needed based on the confidence interval calculated using Equation 1. The first sample unit is randomly placed in the section and then the remaining sample units are systematically spaced throughout the section at an equal distance apart.

**Table 1A – BEND AIRPORT PAVEMENT BRANCHES**

| Facility Designation<br>(Branch ID) | Branch Name                  | Number of Sections | Approximate Area,<br>square feet |
|-------------------------------------|------------------------------|--------------------|----------------------------------|
| A01BE                               | Apron 01 Bend                | 1                  | 14,132                           |
| A02BE                               | Apron 02 Bend                | 7                  | 438,252                          |
| A03BE                               | Apron 03 Bend                | 2                  | 60,980                           |
| A04BE                               | Apron 04 Bend                | 2                  | 44,150                           |
| A05BE                               | Apron 05 Bend                | 2                  | 16,240                           |
| A06BE                               | Apron 06 Bend                | 1                  | 30,000                           |
| A07BE                               | Apron 07 Bend                | 4                  | 43,115                           |
| A08BE                               | Apron 08 Bend                | 12                 | 80,434                           |
| A09BE                               | Apron 09 Bend                | 2                  | 17,585                           |
| A10BE                               | Apron 10 Bend                | 4                  | 9,087                            |
| A11BE                               | Apron 11 Bend                | 1                  | 9,920                            |
| AHELIBE                             | Helicopter Apron Bend        | 3                  | 482,878                          |
| ATANHOLDBE                          | TW A North Run-Up Apron Bend | 1                  | 31,349                           |
| ATASHOLDBE                          | TW A South Run-Up Apron Bend | 1                  | 33,318                           |
| ATBNHOLDBE                          | TW B North Run-Up Apron Bend | 1                  | 31,198                           |
| ATBSHOLDBE                          | TW B South Run-Up Apron Bend | 1                  | 33,049                           |
| R16BE                               | Runway 16/34 Bend            | 1                  | 390,000                          |
| T01BE                               | Taxiway 01 Bend              | 1                  | 5,840                            |
| T02BE                               | Taxiway 02 Bend              | 1                  | 11,370                           |
| T03BE                               | Taxiway 03 Bend              | 7                  | 59,271                           |
| T04BE                               | Taxiway 04 Bend              | 2                  | 24,425                           |
| T05BE                               | Taxiway 05 Bend              | 2                  | 25,707                           |
| T06BE                               | Taxiway 06 Bend              | 2                  | 10,290                           |
| T07BE                               | Taxiway 07 Bend              | 3                  | 18,058                           |
| T08BE                               | Taxiway 08 Bend              | 1                  | 17,039                           |
| T09BE                               | Taxiway 09 Bend              | 1                  | 1,216                            |
| T10BE                               | Taxiway 10 Bend              | 2                  | 3,909                            |
| T11BE                               | Taxiway 11 Bend              | 1                  | 2,611                            |
| TA1BE                               | Taxiway A1 Bend              | 2                  | 14,715                           |
| TA2BE                               | Taxiway A2 Bend              | 2                  | 11,220                           |
| TA3BE                               | Taxiway A3 Bend              | 2                  | 11,200                           |
| TA4BE                               | Taxiway A4 Bend              | 2                  | 11,260                           |
| TA5BE                               | Taxiway A5 Bend              | 2                  | 11,370                           |
| TA6BE                               | Taxiway A6 Bend              | 2                  | 14,716                           |
| TABE                                | Taxiway A Bend               | 1                  | 182,005                          |
| TAEROBE                             | Aero Taxiway Bend            | 8                  | 331,001                          |
| TB1BE                               | Taxiway B1 Bend              | 1                  | 12,660                           |
| TB2BE                               | Taxiway B2 Bend              | 2                  | 11,307                           |
| TB3BE                               | Taxiway B3 Bend              | 2                  | 11,307                           |

**Table 1A – BEND AIRPORT PAVEMENT BRANCHES**

| Facility Designation<br>(Branch ID) | Branch Name             | Number of Sections | Approximate Area,<br>square feet |
|-------------------------------------|-------------------------|--------------------|----------------------------------|
| TB4BE                               | Taxiway B4 Bend         | 2                  | 11,307                           |
| TB5BE                               | Taxiway B5 Bend         | 2                  | 11,307                           |
| TB6BE                               | Taxiway B6 Bend         | 2                  | 14,755                           |
| TBBBE                               | Taxiway BB Bend         | 1                  | 36,692                           |
| TBBE                                | Taxiway B Bend          | 1                  | 181,500                          |
| THELIBE                             | Helicopter Area Taxiway | 2                  | 26,243                           |
| TLA10BE                             | Taxilane A10 Bend       | 2                  | 33,353                           |
| TLA7BE                              | Taxilane A7 Bend        | 1                  | 8,976                            |
| TLA8BE                              | Taxilane A8 Bend        | 2                  | 8,487                            |
| TLA9BE                              | Taxilane A9 Bend        | 2                  | 10,038                           |
| TLCBE                               | Taxilane C Bend         | 1                  | 5,156                            |
| TLEBE                               | Taxilane E Bend         | 1                  | 5,330                            |

**Table 2A - BEND AIRPORT CURRENT PAVEMENT INVENTORY**

| BranchID   | Branch Name                  | Branch Use | SectionID | From       | To         | Rank | Length, feet | Width, feet | Approximate Area, square feet | LCD <sup>1</sup> | Surface Type |
|------------|------------------------------|------------|-----------|------------|------------|------|--------------|-------------|-------------------------------|------------------|--------------|
| A01BE      | Apron 01 Bend                | APRON      | 01        | TABE-01    | T04BE      | S    | 340          | 47          | 14,132                        | 9/3/2012         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 01        | TABE-01    | West       | P    | 1,388        | 47          | 65,227                        | 9/3/2012         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 02        | Section 01 | South End  | P    | 450          | 220         | 98,940                        | 9/1/2005         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 03        | Section 02 | West       | P    | 497          | 70          | 36,867                        | 9/2/1999         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 04        | Section 02 | Section 05 | P    | 225          | 290         | 62,888                        | 9/2/1999         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 05        | Section 03 | Section 06 | P    | 410          | 217         | 97,120                        | 7/3/2018         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 06        | Section 04 | North End  | P    | 300          | 245         | 72,650                        | 7/3/2018         | AC           |
| A02BE      | Apron 02 Bend                | APRON      | 07        | T07BE-02   | End        | P    | 50           | 85          | 4,560                         | 7/3/2018         | AC           |
| A03BE      | Apron 03 Bend                | APRON      | 01        | Taxiway 16 | Section 02 | S    | 350          | 213         | 52,460                        | 9/2/1995         | AC           |
| A03BE      | Apron 03 Bend                | APRON      | 02        | Section 01 | -          | S    | 213          | 40          | 8,520                         | 9/1/2005         | AC           |
| A04BE      | Apron 04 Bend                | APRON      | 01        | TABE-01    | West       | S    | 478          | 75          | 36,640                        | 9/3/2012         | AC           |
| A04BE      | Apron 04 Bend                | APRON      | 02        | A04BE-01   | TLA7BE-01  | S    | 120          | 50          | 7,510                         | 7/1/2013         | AC           |
| A05BE      | Apron 05 Bend                | APRON      | 01        | Taxiway    | End        | S    | 232          | 30          | 7,160                         | 9/1/2005         | AC           |
| A05BE      | Apron 05 Bend                | APRON      | 02        | Taxiway    | End        | S    | 227          | 40          | 9,080                         | 9/1/2011         | AAC          |
| A06BE      | Apron 06 Bend                | APRON      | 01        | T27BE-01   | -          | S    | 300          | 100         | 30,000                        | 9/1/2008         | AC           |
| A07BE      | Apron 07 Bend                | APRON      | 01        | A07BE-02   | East       | S    | 223          | 56          | 15,810                        | 9/3/2012         | AC           |
| A07BE      | Apron 07 Bend                | APRON      | 02        | T15-01     | South      | S    | 263          | 50          | 9,223                         | 9/2/1999         | AC           |
| A07BE      | Apron 07 Bend                | APRON      | 03        | T15-01     | South      | S    | 270          | 50          | 12,472                        | 9/2/1999         | AC           |
| A07BE      | Apron 07 Bend                | APRON      | 04        | A07BE-03   | West       | S    | 270          | 20          | 5,610                         | 9/1/2005         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 01        | T19-01     | END        | S    | 235          | 25          | 5,923                         | 9/2/1999         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 02        | T20-01     | END        | S    | 235          | 25          | 5,912                         | 9/2/1999         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 03        | -          | -          | S    | 195          | 30          | 5,840                         | 9/1/2005         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 04        | -          | -          | S    | 130          | 35          | 4,365                         | 9/1/2005         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 05        | T19BE-01   | END        | S    | 330          | 25          | 8,050                         | 1/1/2002         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 06        | T19BE-01   | END        | S    | 358          | 25          | 9,411                         | 1/1/2002         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 07        | T16-01     | East       | S    | 552          | 56          | 31,202                        | 9/3/2012         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 08        | TLA10BE-02 | A08BE-09   | S    | 65           | 60          | 1,557                         | 1/1/1900         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 09        | A08BE-08   | End        | S    | 70           | 25          | 1,804                         | 1/1/1900         | PCC          |
| A08BE      | Apron 08 Bend                | APRON      | 10        | TLA10BE-02 | A08BE-10   | S    | 105          | 8           | 840                           | 1/1/1900         | AC           |
| A08BE      | Apron 08 Bend                | APRON      | 11        | A08BE-10   | End        | S    | 100          | 25          | 2,500                         | 1/1/1900         | PCC          |
| A08BE      | Apron 08 Bend                | APRON      | 12        | TLA10BE-02 | End        | S    | 100          | 30          | 3,030                         | 1/1/1900         | AC           |
| A09BE      | Apron 09 Bend                | APRON      | 01        | Taxiway 22 | -          | S    | 120          | 125         | 15,000                        | 9/1/2005         | AC           |
| A09BE      | Apron 09 Bend                | APRON      | 02        | A09BE-01   | End        | S    | 100          | 25          | 2,585                         | 1/1/1900         | PCC          |
| A10BE      | Apron 10 Bend                | APRON      | 01        | T21-01     | END        | S    | 120          | 30          | 3,655                         | 9/2/1999         | AC           |
| A10BE      | Apron 10 Bend                | APRON      | 02        | -          | -          | S    | 50           | 20          | 920                           | 9/1/2005         | AC           |
| A10BE      | Apron 10 Bend                | APRON      | 03        | -          | -          | S    | 30           | 80          | 2,385                         | 9/1/2005         | AC           |
| A10BE      | Apron 10 Bend                | APRON      | 04        | A10BE-01   | End        | S    | 100          | 22          | 2,127                         | 1/1/1900         | PCC          |
| A11BE      | Apron 11 Bend                | APRON      | 01        | Taxiway 23 | -          | S    | 124          | 80          | 9,920                         | 9/1/2005         | AC           |
| AHELIBE    | Helicopter Apron Bend        | APRON      | 01        | See Map    | -          | P    | 540          | 723         | 393,378                       | 7/3/2017         | AC           |
| AHELIBE    | Helicopter Apron Bend        | APRON      | 02        | See Map    | --         | P    | 225          | 225         | 44,220                        | 7/3/2017         | AC           |
| AHELIBE    | Helicopter Apron Bend        | APRON      | 03        | See Map    | --         | P    | 212          | 212         | 45,280                        | 7/2/2017         | PCC          |
| ATANHOLDBE | TW A North Run-Up Apron Bend | APRON      | 01        | TABE-01    | North End  | S    | 350          | 105         | 31,349                        | 9/3/2012         | AC           |
| ATASHOLDBE | TW A South Run-Up Apron Bend | APRON      | 01        | TABE-01    | South End  | S    | 330          | 105         | 33,318                        | 9/3/2012         | AC           |
| ATBNHOLDBE | TW B North Run-Up Apron Bend | APRON      | 01        | Taxiway B  | -          | S    | 375          | 105         | 31,198                        | 10/3/2010        | AC           |
| ATBSHOLDBE | TW B South Run-Up Apron Bend | APRON      | 01        | Taxiway B  | -          | S    | 375          | 105         | 33,049                        | 10/3/2010        | AC           |

**Table 2A - BEND AIRPORT CURRENT PAVEMENT INVENTORY**

| BranchID | Branch Name       | Branch Use | SectionID | From          | To            | Rank | Length, feet | Width, feet | Approximate Area, square feet | LCD <sup>1</sup> | Surface Type |
|----------|-------------------|------------|-----------|---------------|---------------|------|--------------|-------------|-------------------------------|------------------|--------------|
| R16BE    | Runway 16/34 Bend | RUNWAY     | 01        | Runway 16 End | Runway 34 End | P    | 5,200        | 75          | 390,000                       | 10/3/2006        | AC           |
| T01BE    | Taxiway 01 Bend   | TAXIWAY    | 01        | T03-01        | End           | S    | 200          | 25          | 5,840                         | 9/2/1998         | AC           |
| T02BE    | Taxiway 02 Bend   | TAXIWAY    | 01        | T03-01, 02    | End           | S    | 330          | 25          | 11,370                        | 9/2/1995         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 01        | TABE-01       | T03BE-02      | S    | 150          | 30          | 7,392                         | 9/3/2012         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 02        | T03BE-01      | T02-01        | S    | 144          | 30          | 5,062                         | 9/2/1994         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 03        | T02-02        | T03-04        | S    | 190          | 60          | 10,800                        | 9/2/1996         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 04        | T03-03        | T03-05        | S    | 78           | 60          | 4,683                         | 9/2/1966         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 05        | T03-04        | T03-06        | S    | 365          | 60          | 21,900                        | 9/2/1955         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 06        | T03-05        | T03-07        | S    | 110          | 60          | 6,600                         | 9/2/1988         | AC           |
| T03BE    | Taxiway 03 Bend   | TAXIWAY    | 07        | T03-06        | A01-03        | S    | 45           | 60          | 2,834                         | 9/2/1999         | AC           |
| T04BE    | Taxiway 04 Bend   | TAXIWAY    | 01        | T03-01        | T04-02        | S    | 524          | 30          | 15,759                        | 9/2/1996         | AC           |
| T04BE    | Taxiway 04 Bend   | TAXIWAY    | 02        | T04-01        | T06-01        | S    | 214          | 40          | 8,666                         | 9/2/1963         | AC           |
| T05BE    | Taxiway 05 Bend   | TAXIWAY    | 01        | T03-01        | T05-02        | S    | 778          | 30          | 24,436                        | 9/2/1993         | AC           |
| T05BE    | Taxiway 05 Bend   | TAXIWAY    | 02        | T05-01        | T06-02        | S    | 20           | 55          | 1,271                         | 9/2/1999         | AC           |
| T06BE    | Taxiway 06 Bend   | TAXIWAY    | 01        | TA-02         | T06-02        | P    | 45           | 50          | 2,250                         | 9/3/2012         | AC           |
| T06BE    | Taxiway 06 Bend   | TAXIWAY    | 02        | T06-01        | A01-01        | P    | 220          | 35          | 8,040                         | 9/2/1999         | AC           |
| T07BE    | Taxiway 07 Bend   | TAXIWAY    | 01        | TABE-01       | T12BE-02      | P    | 87           | 40          | 4,332                         | 9/3/2012         | AC           |
| T07BE    | Taxiway 07 Bend   | TAXIWAY    | 02        | T12BE-01      | T12BE-03      | P    | 170          | 40          | 6,156                         | 7/3/2018         | AC           |
| T07BE    | Taxiway 07 Bend   | TAXIWAY    | 03        | T12-02        | End           | S    | 190          | 40          | 7,570                         | 9/2/1961         | AC           |
| T08BE    | Taxiway 08 Bend   | TAXIWAY    | 01        | T17-01        | T15-01        | S    | 635          | 25          | 17,039                        | 9/2/1999         | AC           |
| T09BE    | Taxiway 09 Bend   | TAXIWAY    | 01        | A07BE         | T17BE         | S    | 40           | 30          | 1,216                         | 9/1/2005         | AC           |
| T10BE    | Taxiway 10 Bend   | TAXIWAY    | 01        | TABE-01       | T19BE-02      | S    | 72           | 25          | 2,849                         | 9/3/2012         | AC           |
| T10BE    | Taxiway 10 Bend   | TAXIWAY    | 02        | T19BE-01      | A06BE         | S    | 40           | 25          | 1,060                         | 9/2/1999         | AC           |
| T11BE    | Taxiway 11 Bend   | TAXIWAY    | 01        | TABE-03       | A08BE         | S    | 60           | 30          | 2,611                         | 9/3/2012         | AC           |
| TA1BE    | Taxiway A1 Bend   | TAXIWAY    | 01        | Runway 34 End | TA1BE-02      | P    | 210          | 35          | 12,685                        | 10/3/2006        | AC           |
| TA1BE    | Taxiway A1 Bend   | TAXIWAY    | 02        | TA1BE-01      | TABE-01       | P    | 33           | 60          | 2,030                         | 9/2/2012         | AAC          |
| TA2BE    | Taxiway A2 Bend   | TAXIWAY    | 01        | R16BE-01      | TA2BE-02      | P    | 210          | 35          | 8,275                         | 10/3/2006        | AC           |
| TA2BE    | Taxiway A2 Bend   | TAXIWAY    | 02        | TA2BE-01      | TABE-01       | P    | 35           | 75          | 2,945                         | 9/2/2012         | AAC          |
| TA3BE    | Taxiway A3 Bend   | TAXIWAY    | 01        | R16BE-01      | TA3BE-02      | P    | 210          | 35          | 8,315                         | 10/3/2006        | AC           |
| TA3BE    | Taxiway A3 Bend   | TAXIWAY    | 02        | TA3BE-01      | TABE-02       | P    | 35           | 75          | 2,885                         | 9/3/2012         | AC           |
| TA4BE    | Taxiway A4 Bend   | TAXIWAY    | 01        | R16BE-01      | TA4BE-02      | P    | 210          | 35          | 8,400                         | 10/3/2006        | AC           |
| TA4BE    | Taxiway A4 Bend   | TAXIWAY    | 02        | TA4BE-02      | TABE-01       | P    | 35           | 75          | 2,860                         | 9/3/2012         | AC           |
| TA5BE    | Taxiway A5 Bend   | TAXIWAY    | 01        | R16BE-01      | TA5BE-02      | P    | 210          | 35          | 8,480                         | 10/3/2006        | AC           |
| TA5BE    | Taxiway A5 Bend   | TAXIWAY    | 02        | TA5BE-01      | TABE-01       | P    | 35           | 75          | 2,890                         | 9/3/2012         | AC           |
| TA6BE    | Taxiway A6 Bend   | TAXIWAY    | 01        | Runway 16 End | TA6BE-02      | P    | 210          | 50          | 12,716                        | 10/3/2006        | AC           |
| TA6BE    | Taxiway A6 Bend   | TAXIWAY    | 02        | TA6BE-01      | TABE-01       | P    | 35           | 75          | 2,000                         | 9/2/2012         | AAC          |
| TABE     | Taxiway A Bend    | TAXIWAY    | 01        | TA1BE-01      | TA6BE-01      | P    | 5,200        | 35          | 182,005                       | 9/3/2012         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 01        | TLE           | TL06          | S    | 1,072        | 36          | 40,188                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 02        | TL01          | TL08          | S    | 608          | 62          | 38,299                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 03        | TL01          | TL08          | S    | 608          | 86          | 54,823                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 04        | TL01          | TL08          | S    | 608          | 59          | 39,175                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 05        | TL01          | TL08          | S    | 608          | 58          | 38,964                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 06        | TL01          | TL08          | S    | 608          | 55          | 37,723                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 07        | TL01          | TL08          | S    | 579          | 68          | 40,813                        | 9/2/2008         | AC           |
| TAEROBE  | Aero Taxiway Bend | TAXIWAY    | 08        | TBB           | TL07          | S    | 1,200        | 34          | 41,016                        | 9/2/2008         | AC           |

**Table 2A - BEND AIRPORT CURRENT PAVEMENT INVENTORY**

| BranchID | Branch Name             | Branch Use | SectionID | From          | To                 | Rank | Length, feet | Width, feet | Approximate Area, square feet | LCD <sup>1</sup> | Surface Type |
|----------|-------------------------|------------|-----------|---------------|--------------------|------|--------------|-------------|-------------------------------|------------------|--------------|
| TB1BE    | Taxiway B1 Bend         | TAXIWAY    | 01        | Taxiway B     | Runway 34 End      | P    | 210          | 35          | 12,660                        | 10/3/2010        | AC           |
| TB2BE    | Taxiway B2 Bend         | TAXIWAY    | 01        | Runway 16/34  | TB2BE-02           | P    | 210          | 35          | 8,364                         | 10/3/2010        | AC           |
| TB2BE    | Taxiway B2 Bend         | TAXIWAY    | 02        | TB2BE-01      | Taxiway B          | P    | 35           | 35          | 2,943                         | 10/3/2010        | AC           |
| TB3BE    | Taxiway B3 Bend         | TAXIWAY    | 01        | Runway 16/34  | ccc:Runway 16/34   | P    | 210          | 35          | 8,358                         | 10/3/2010        | AC           |
| TB3BE    | Taxiway B3 Bend         | TAXIWAY    | 02        | TB3BE-01      | Taxiway B          | P    | 35           | 35          | 2,949                         | 10/3/2010        | AC           |
| TB4BE    | Taxiway B4 Bend         | TAXIWAY    | 01        | Runway 16/34  | TB4BE-02           | P    | 210          | 35          | 8,361                         | 10/3/2010        | AC           |
| TB4BE    | Taxiway B4 Bend         | TAXIWAY    | 02        | TB4BE-01      | Taxiway B          | P    | 35           | 35          | 2,946                         | 10/3/2010        | AC           |
| TB5BE    | Taxiway B5 Bend         | TAXIWAY    | 01        | Runway 16/34  | TB5BE-02           | P    | 210          | 35          | 8,431                         | 10/3/2010        | AC           |
| TB5BE    | Taxiway B5 Bend         | TAXIWAY    | 02        | TB5BE-01      | Taxiway B          | P    | 35           | 35          | 2,876                         | 10/3/2010        | AC           |
| TB6BE    | Taxiway B6 Bend         | TAXIWAY    | 01        | Runway 16 End | TB6BE-02           | P    | 210          | 37          | 12,729                        | 10/3/2010        | AC           |
| TB6BE    | Taxiway B6 Bend         | TAXIWAY    | 02        | TB6BE-02      | Taxiway B          | P    | 35           | 37          | 2,026                         | 10/3/2010        | AC           |
| TBBBE    | Taxiway BB Bend         | TAXIWAY    | 01        | TB            | T08                | S    | 835          | 35          | 36,692                        | 10/3/2010        | AC           |
| TBBE     | Taxiway B Bend          | TAXIWAY    | 01        | Taxiway B1    | Taxiway B6         | P    | 5,200        | 35          | 181,500                       | 10/3/2010        | AC           |
| THELIBE  | Helicopter Area Taxiway | TAXIWAY    | 01        | See Map       | -                  | P    | 611          | 25          | 16,126                        | 7/3/2017         | AC           |
| THELIBE  | Helicopter Area Taxiway | TAXIWAY    | 02        | See Map       | --                 | P    | 188          | 50          | 10,117                        | 7/3/2017         | AC           |
| TLA10BE  | Taxilane A10 Bend       | TAXIWAY    | 01        | TABE-01       | TLA10BE-02         | S    | 116          | 35          | 6,215                         | 9/3/2012         | AC           |
| TLA10BE  | Taxilane A10 Bend       | TAXIWAY    | 02        | TLA10BE-01    | TLA9BE-02          | S    | 775          | 35          | 27,138                        | 9/2/1999         | AC           |
| TLA7BE   | Taxilane A7 Bend        | TAXIWAY    | 01        | TABE-02       | A03-01             | S    | 182          | 40          | 8,976                         | 9/3/2012         | AC           |
| TLA8BE   | Taxilane A8 Bend        | TAXIWAY    | 01        | TABE-01       | TLA8BE-02          | S    | 108          | 35          | 5,862                         | 9/3/2012         | AC           |
| TLA8BE   | Taxilane A8 Bend        | TAXIWAY    | 02        | TABE-02       | A09BE-01           | S    | 75           | 35          | 2,625                         | 9/1/2008         | AC           |
| TLA9BE   | Taxilane A9 Bend        | TAXIWAY    | 01        | TABE-01       | TLA9BE-02          | S    | 97           | 30          | 4,115                         | 9/3/2012         | AC           |
| TLA9BE   | Taxilane A9 Bend        | TAXIWAY    | 02        | TLA9BE-01     | A05BE-03           | S    | 201          | 30          | 5,923                         | 9/2/1999         | AC           |
| TLCBE    | Taxilane C Bend         | TAXIWAY    | 01        | Taxiway B     | -                  | S    | 145          | 30          | 5,156                         | 10/3/2010        | AC           |
| TLEBE    | Taxilane E Bend         | TAXIWAY    | 01        | Taxiway B     | South Run-Up Apron | S    | 98           | 40          | 5,330                         | 10/3/2010        | AC           |

Abbreviations:

P = Primary pavement, S = Secondary pavement, AC = Asphalt Concrete, AAC = AC overlaid AC, PCC = Portland Cement Concrete


Notes:

<sup>1</sup> LCD = Last Construction Date. The date of the last major rehabilitation (e.g. overlay)


**Table 3A: EXAMPLE SAMPLE RATES FOR AC AND PCC PAVEMENTS**

| AC Sampling Rate                |                           | PCC Sampling Rate               |                           |
|---------------------------------|---------------------------|---------------------------------|---------------------------|
| Total Number of Sample Units, N | Sample Units to Survey, n | Total Number of Sample Units, N | Sample Units to Survey, n |
| 1                               | 1                         | 1                               | 1                         |
| 2-3                             | 2                         | 2                               | 2                         |
| 4-6                             | 3                         | 3-4                             | 3                         |
| 7-13                            | 4                         | 5-6                             | 4                         |
| 14-38                           | 5                         | 7-8                             | 5                         |
| 39+                             | 6                         | 9-11                            | 6                         |
|                                 |                           | 12-14                           | 7                         |
|                                 |                           | 15-19                           | 8                         |
|                                 |                           | 20-27                           | 9                         |
|                                 |                           | 28-38                           | 10                        |
|                                 |                           | 39-58                           | 11                        |
|                                 |                           | 59-104                          | 12                        |
|                                 |                           | 105-313                         | 13                        |
|                                 |                           | 314+                            | 14                        |

**Note:** AC = Asphalt Concrete  
PCC = portland cement concrete

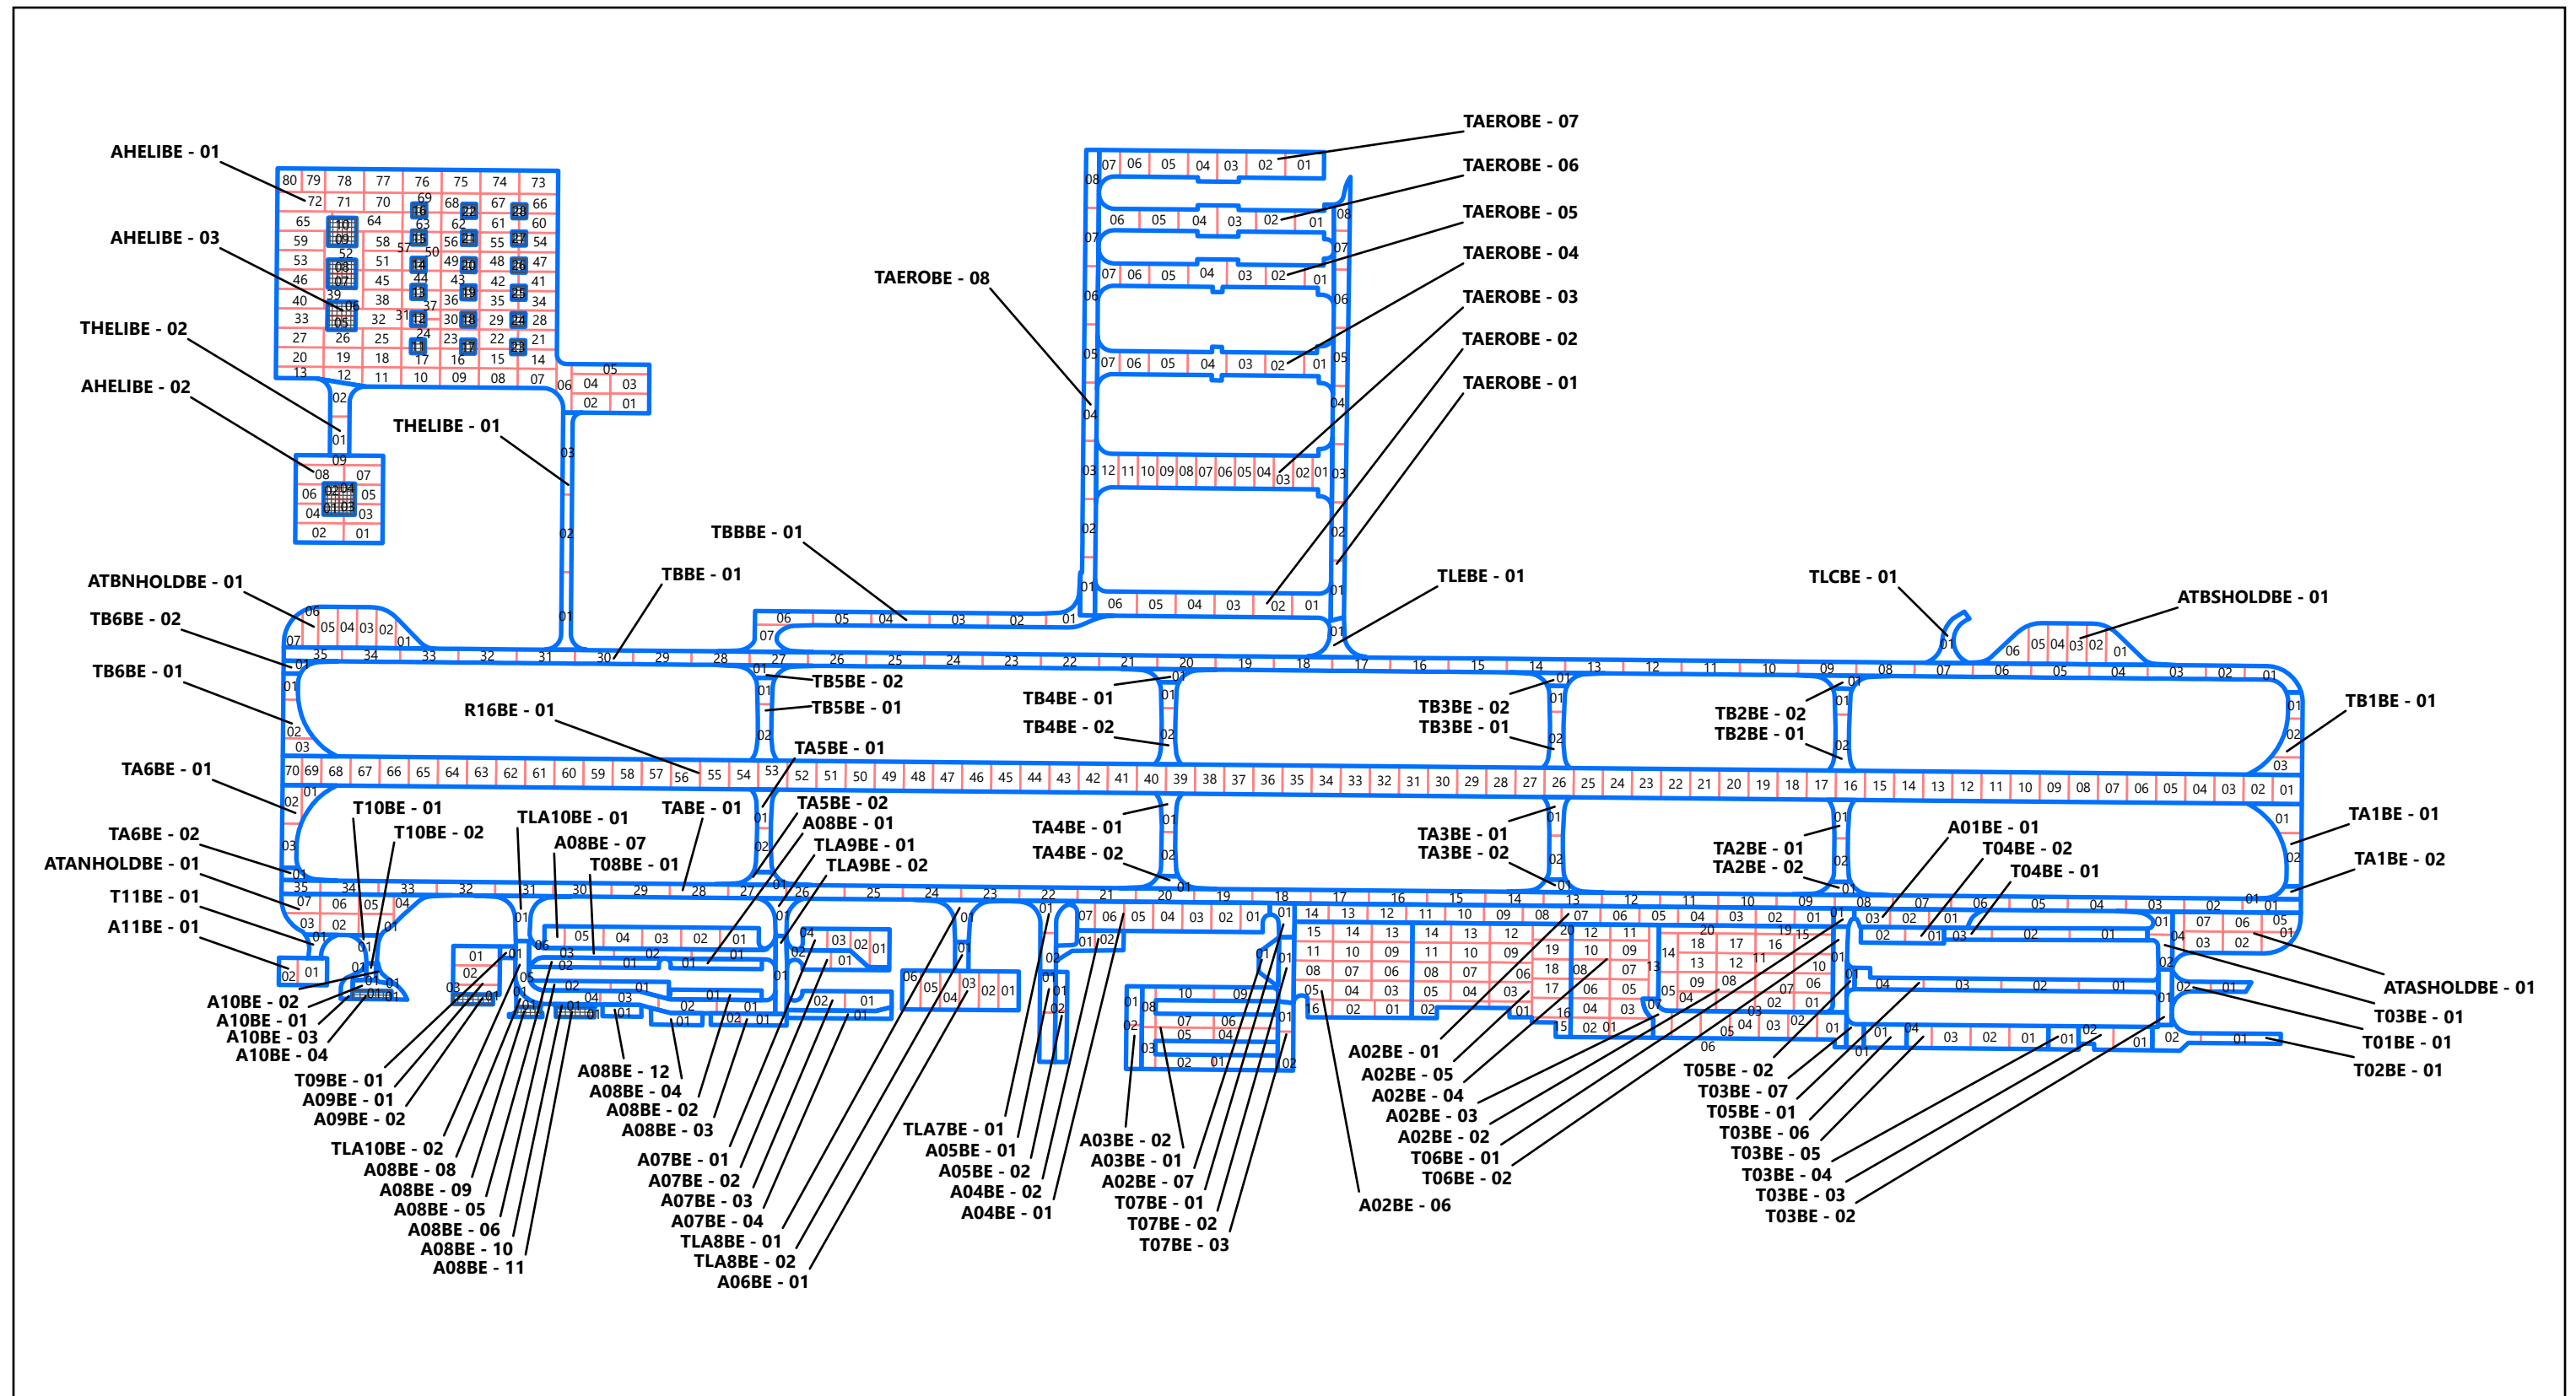

SECTION  
SAMPLE UNIT

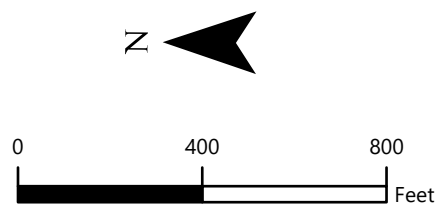

# SAMPLE UNIT LAYOUT BEND AIRPORT

DEC. 2022

JOB NO. 6593-B

FIG. 1A

## **APPENDIX B**

---

### *Pavement Condition Index Survey Results*

## APPENDIX B

## PAVEMENT CONDITION INDEX SURVEY RESULTS

## B.1 METHODOLOGY

As previously discussed, the PCI is a measure of the pavement's functional surface condition and provides a methodology for assessing the causes of distress and whether the distress is related to a load or climatic conditions. Although the PCI is not a direct measure of structural capacity, it provides a suggestion of the structural needs of the pavement.

The PCI is based on the type, severity, and quantity of each distress found in an inspected sample unit. The results are displayed using a seven-category rating scale in accordance with ASTM D5340. Flexible pavement (e.g., AC and AAC) and rigid pavement (e.g., PCC) distress types are presented in Table 1B. A summary of the pavement condition results by branch and section are included in Tables 2B and 3B of Appendix B, respectively.

Table 1B: PAVER DISTRESS CODES FOR FLEXIBLE AND RIGID PAVEMENT

| Flexible Pavement |                                       |                        | Rigid Pavement |                                                |                        |
|-------------------|---------------------------------------|------------------------|----------------|------------------------------------------------|------------------------|
| PAVER Code        | Pavement Distress                     | Related Cause          | PAVER Code     | Pavement Distress                              | Related Cause          |
| 41                | Alligator Cracking                    | Load                   | 61             | Blow-Up                                        | Load                   |
| 42                | Bleeding                              | Other                  | 62             | Corner Break                                   | Load                   |
| 43                | Block Cracking                        | Climate/<br>Durability | 63             | Longitudinal, Transverse,<br>& Diagonal Cracks | Climate/<br>Durability |
| 44                | Corrugation                           | Other                  | 64             | Durability Cracking                            | Climate/<br>Durability |
| 45                | Depression                            | Other                  | 65             | Joint Seal Damage                              | Other                  |
| 46                | Jet Blast                             | Other                  | 66             | Small Patch                                    | Other                  |
| 47                | Joint Reflection<br>Cracking          | Climate/<br>Durability | 67             | Large Patch                                    | Other                  |
| 48                | Longitudinal &<br>Transverse Cracking | Climate/<br>Durability | 68             | Pop Outs                                       | Other                  |
| 49                | Oil Spillage                          | Other                  | 69             | Pumping                                        | Other                  |
| 50                | Patching                              | Climate/<br>Durability | 70             | Scaling                                        | Other                  |
| 51                | Polished Aggregate                    | Other                  | 71             | Faulting                                       | Other                  |
| 52                | Raveling                              | Climate/<br>Durability | 72             | Shattered Slab                                 | Load                   |

| Flexible Pavement |                   |                        |
|-------------------|-------------------|------------------------|
| PAVER Code        | Pavement Distress | Related Cause          |
| 53                | Rutting           | Load                   |
| 54                | Shoving           | Other                  |
| 55                | Slippage Cracking | Other                  |
| 56                | Swelling          | Other                  |
| 57                | Weathering        | Climate/<br>Durability |

| Rigid Pavement |                                |               |
|----------------|--------------------------------|---------------|
| PAVER Code     | Pavement Distress              | Related Cause |
| 73             | Shrinkage Cracking             | Other         |
| 74             | Joint Spalls                   | Other         |
| 75             | Corner Spalls                  | Other         |
| 76             | Alkali-Silica Reactivity (ASR) | Other         |

To obtain the section PCI, we extrapolated the PCI of each selected sample unit over the entire section area. Distresses found in sample units classified as “additional”– defined as nonrepresentative instead of random- are not extrapolated over the entire section but merely added to the extrapolated quantity. The PCI rating scale presented previously in Table 3-1 of Section 3.1 and are based on ASTM D5340.

Section 4.1 of ASTM D5340 governing PCI surveys offers this caution:

*“The PCI is a numerical indicator that rates the surface condition of the pavement. The PCI provides a measure of the **present condition** of the pavement based on the distress observed on the surface of the pavement, which also indicates the structural integrity and surface operational condition (localized roughness and safety). The PCI **cannot** measure the structural capacity; neither does it provide a direct measurement of skid resistance or roughness. It provides an objective and rational basis for determining maintenance and repair needs and priorities. Continuous monitoring of the PCI is used to establish the rate of pavement deterioration, which permits early identification of major rehabilitation needs. The PCI provides feedback on pavement performance for validation or improvement of current pavement design and maintenance procedures.”*

Based on the limitations of the PCI method, it is imperative that engineers and planners treat the PCI as a tool that will assist them during the M&R planning process. Any major project should always be preceded by an up-to-date, detailed, 100% project-level inspection of the pavement in order to reevaluate maintenance needs prior to the project design process.

## B.2 DISTRESS TYPES

Distress tends to fall into one of the following four cause categories:

- **Load-related:** Flexible pavement distresses include alligator/fatigue cracking, corrugation, depression, polished aggregate, rutting, and slippage cracking. Rigid

pavement distresses include corner breaks, longitudinal cracking, divided slabs, polished aggregate, pumping, and joint spalling.

- **Climate- and durability-related:** Flexible pavement distresses include bleeding, block cracking, joint reflection cracking, longitudinal and transverse (L&T) cracking, swelling, and raveling/weathering. Rigid pavement distresses include blow-ups, durability cracking, longitudinal cracking, pop-outs, pumping, scaling, shrinkage cracks, and joint and corner spalling.
- **Moisture- and drainage-related:** Flexible pavement distresses include alligator/fatigue cracking, depressions, potholes, and swelling. Rigid pavement distresses include corner breaks, divided slabs, and pumping.
- **Other factors:** Oil spillage, jet blast erosion, bleeding, patching, and concrete slab joint faulting.

As described above, a distress may be the result of more than one cause. For example, depressions may be caused by incorrect compaction during construction or by subgrade softening due to environmental factors. In addition, a distress may be initiated by one cause but may progress to a distress of higher severity by another cause. Therefore, engineering judgment is critical in analyzing the actual cause or causes of the distress.

### B.3 PAVEMENT CONDITION INDEX SURVEY RESULTS

The evaluated Bend Airport pavement network consists of 51 branches and 114 sections. A total of 265 sample units were visually inspected in the field. Data from the inspected sample units were input into the PAVER database, and a resultant PCI for each section was computed. Additional details regarding the PCI and distress types observed for each surveyed sample unit are provided in the re-inspection report, Table 1E, in Appendix E. Based on the 2022 PCI survey, the area-weighted average PCI for the entire pavement network at Bend Airport is approximately 76, which corresponds to a PCI rating of Satisfactory.

To investigate the rate of deterioration of each pavement section we compared the PCI results from the 2022 survey to the PCI results from the previous inspection. The variation in PCI between inspections for Bend Airport pavement sections is outlined in Table 4B in this appendix.

**Table 2B - BEND AIRPORT CURRENT BRANCH CONDITION REPORT**

| Branch ID  | Number of Sections | Approximate Area, square feet | Use     | Area Weighted Average Branch PCI | PCI Category |
|------------|--------------------|-------------------------------|---------|----------------------------------|--------------|
| A01BE      | 1                  | 14,132                        | APRON   | 92                               | Good         |
| A02BE      | 7                  | 438,252                       | APRON   | 76                               | Satisfactory |
| A03BE      | 2                  | 60,980                        | APRON   | 53                               | Poor         |
| A04BE      | 2                  | 44,150                        | APRON   | 87                               | Good         |
| A05BE      | 2                  | 16,240                        | APRON   | 64                               | Fair         |
| A06BE      | 1                  | 30,000                        | APRON   | 72                               | Satisfactory |
| A07BE      | 4                  | 43,115                        | APRON   | 68                               | Fair         |
| A08BE      | 12                 | 80,434                        | APRON   | 61                               | Fair         |
| A09BE      | 2                  | 17,585                        | APRON   | 70                               | Fair         |
| A10BE      | 4                  | 9,087                         | APRON   | 60                               | Fair         |
| A11BE      | 1                  | 9,920                         | APRON   | 45                               | Poor         |
| AHELIBE    | 3                  | 482,878                       | APRON   | 95                               | Good         |
| ATANHOLDBE | 1                  | 31,349                        | APRON   | 73                               | Satisfactory |
| ATASHOLDBE | 1                  | 33,318                        | APRON   | 81                               | Satisfactory |
| ATBNHOLDBE | 1                  | 31,198                        | APRON   | 80                               | Satisfactory |
| ATBSHOLDBE | 1                  | 33,049                        | APRON   | 75                               | Satisfactory |
| R16BE      | 1                  | 390,000                       | RUNWAY  | 78                               | Satisfactory |
| T01BE      | 1                  | 5,840                         | TAXIWAY | 65                               | Fair         |
| T02BE      | 1                  | 11,370                        | TAXIWAY | 65                               | Fair         |
| T03BE      | 7                  | 59,271                        | TAXIWAY | 28                               | Very Poor    |
| T04BE      | 2                  | 24,425                        | TAXIWAY | 34                               | Very Poor    |
| T05BE      | 2                  | 25,707                        | TAXIWAY | 28                               | Very Poor    |
| T06BE      | 2                  | 10,290                        | TAXIWAY | 66                               | Fair         |
| T07BE      | 3                  | 18,058                        | TAXIWAY | 60                               | Fair         |
| T08BE      | 1                  | 17,039                        | TAXIWAY | 64                               | Fair         |
| T09BE      | 1                  | 1,216                         | TAXIWAY | 57                               | Fair         |
| T10BE      | 2                  | 3,909                         | TAXIWAY | 91                               | Good         |
| T11BE      | 1                  | 2,611                         | TAXIWAY | 94                               | Good         |
| TA1BE      | 2                  | 14,715                        | TAXIWAY | 69                               | Fair         |
| TA2BE      | 2                  | 11,220                        | TAXIWAY | 82                               | Satisfactory |
| TA3BE      | 2                  | 11,200                        | TAXIWAY | 74                               | Satisfactory |
| TA4BE      | 2                  | 11,260                        | TAXIWAY | 80                               | Satisfactory |
| TA5BE      | 2                  | 11,370                        | TAXIWAY | 76                               | Satisfactory |
| TA6BE      | 2                  | 14,716                        | TAXIWAY | 76                               | Satisfactory |
| TABE       | 1                  | 182,005                       | TAXIWAY | 87                               | Good         |
| TAEROBE    | 8                  | 331,001                       | TAXIWAY | 70                               | Fair         |
| TB1BE      | 1                  | 12,660                        | TAXIWAY | 75                               | Satisfactory |
| TB2BE      | 2                  | 11,307                        | TAXIWAY | 76                               | Satisfactory |
| TB3BE      | 2                  | 11,307                        | TAXIWAY | 74                               | Satisfactory |

**Table 2B - BEND AIRPORT CURRENT BRANCH CONDITION REPORT**

| Branch ID | Number of Sections | Approximate Area, square feet | Use     | Area Weighted Average Branch PCI | PCI Category |
|-----------|--------------------|-------------------------------|---------|----------------------------------|--------------|
| TB4BE     | 2                  | 11,307                        | TAXIWAY | 75                               | Satisfactory |
| TB5BE     | 2                  | 11,307                        | TAXIWAY | 69                               | Fair         |
| TB6BE     | 2                  | 14,755                        | TAXIWAY | 76                               | Satisfactory |
| TBBBE     | 1                  | 36,692                        | TAXIWAY | 81                               | Satisfactory |
| TBBE      | 1                  | 181,500                       | TAXIWAY | 72                               | Satisfactory |
| THELIBE   | 2                  | 26,243                        | TAXIWAY | 94                               | Good         |
| TLA10BE   | 2                  | 33,353                        | TAXIWAY | 65                               | Fair         |
| TLA7BE    | 1                  | 8,976                         | TAXIWAY | 88                               | Good         |
| TLA8BE    | 2                  | 8,487                         | TAXIWAY | 84                               | Satisfactory |
| TLA9BE    | 2                  | 10,038                        | TAXIWAY | 73                               | Satisfactory |
| TLCBE     | 1                  | 5,156                         | TAXIWAY | 75                               | Satisfactory |
| TLEBE     | 1                  | 5,330                         | TAXIWAY | 94                               | Good         |

| Use Category | Number of Sections | Total Area, square feet | Area Weighted Average PCI |
|--------------|--------------------|-------------------------|---------------------------|
| APRON        | 45                 | 1,375,687               | 81                        |
| RUNWAY       | 1                  | 390,000                 | 78                        |
| TAXIWAY      | 68                 | 1,155,641               | 71                        |
| <b>ALL</b>   | <b>114</b>         | <b>2,921,328</b>        | <b>76</b>                 |

**Table 3B - BEND AIRPORT 2022 PAVEMENT CONDITION INDEX SURVEY RESULTS**

| BranchID   | SectionID | Last Construction Date | Surface Type | Use   | Last Inspection Date | Age at Inspection | PCI | PCI Category | PCI % Climate | PCI % Load | PCI % Other |
|------------|-----------|------------------------|--------------|-------|----------------------|-------------------|-----|--------------|---------------|------------|-------------|
| A01BE      | 01        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 92  | Good         | 100           | 0          | 0           |
| A02BE      | 01        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 93  | Good         | 100           | 0          | 0           |
| A02BE      | 02        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 52  | Poor         | 72            | 28         | 0           |
| A02BE      | 03        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 62  | Fair         | 100           | 0          | 0           |
| A02BE      | 04        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 58  | Fair         | 83            | 17         | 0           |
| A02BE      | 05        | 7/3/2018               | AC           | APRON | 3/1/2022             | 4                 | 94  | Good         | 100           | 0          | 0           |
| A02BE      | 06        | 7/3/2018               | AC           | APRON | 3/1/2022             | 4                 | 94  | Good         | 100           | 0          | 0           |
| A02BE      | 07        | 7/3/2018               | AC           | APRON | 3/1/2022             | 4                 | 92  | Good         | 100           | 0          | 0           |
| A03BE      | 01        | 9/2/1995               | AC           | APRON | 3/1/2022             | 26                | 53  | Poor         | 70            | 30         | 0           |
| A03BE      | 02        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 52  | Poor         | 64            | 36         | 0           |
| A04BE      | 01        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 89  | Good         | 100           | 0          | 0           |
| A04BE      | 02        | 7/1/2013               | AC           | APRON | 3/1/2022             | 9                 | 76  | Satisfactory | 100           | 0          | 0           |
| A05BE      | 01        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 49  | Poor         | 51            | 49         | 0           |
| A05BE      | 02        | 9/1/2011               | AAC          | APRON | 3/1/2022             | 11                | 76  | Satisfactory | 100           | 0          | 0           |
| A06BE      | 01        | 9/1/2008               | AC           | APRON | 3/1/2022             | 14                | 72  | Satisfactory | 78            | 22         | 0           |
| A07BE      | 01        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 87  | Good         | 100           | 0          | 0           |
| A07BE      | 02        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 64  | Fair         | 100           | 0          | 0           |
| A07BE      | 03        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 66  | Fair         | 100           | 0          | 0           |
| A07BE      | 04        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 25  | Serious      | 35            | 65         | 0           |
| A08BE      | 01        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 17  | Serious      | 46            | 54         | 0           |
| A08BE      | 02        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 22  | Serious      | 49            | 51         | 0           |
| A08BE      | 03        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 49  | Poor         | 56            | 44         | 0           |
| A08BE      | 04        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 64  | Fair         | 100           | 0          | 0           |
| A08BE      | 05        | 1/1/2002               | AC           | APRON | 3/1/2022             | 20                | 60  | Fair         | 82            | 18         | 0           |
| A08BE      | 06        | 1/1/2002               | AC           | APRON | 3/1/2022             | 20                | 71  | Satisfactory | 100           | 0          | 0           |
| A08BE      | 07        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 83  | Satisfactory | 100           | 0          | 0           |
| A08BE      | 08        | 1/1/1900               | AC           | APRON | 3/1/2022             | 122               | 60  | Fair         | 70            | 30         | 0           |
| A08BE      | 09        | 1/1/1900               | PCC          | APRON | 3/1/2022             | 122               | 25  | Serious      | 0             | 98         | 2           |
| A08BE      | 10        | 1/1/1900               | AC           | APRON | 3/1/2022             | 122               | 69  | Fair         | 100           | 0          | 0           |
| A08BE      | 11        | 1/1/1900               | PCC          | APRON | 3/1/2022             | 122               | 28  | Very Poor    | 0             | 94         | 6           |
| A08BE      | 12        | 1/1/1900               | AC           | APRON | 3/1/2022             | 122               | 33  | Very Poor    | 39            | 61         | 0           |
| A09BE      | 01        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 65  | Fair         | 76            | 24         | 0           |
| A09BE      | 02        | 1/1/1900               | PCC          | APRON | 3/1/2022             | 122               | 96  | Good         | 0             | 0          | 100         |
| A10BE      | 01        | 9/2/1999               | AC           | APRON | 3/1/2022             | 22                | 94  | Good         | 100           | 0          | 0           |
| A10BE      | 02        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 50  | Poor         | 53            | 47         | 0           |
| A10BE      | 03        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 24  | Serious      | 32            | 68         | 0           |
| A10BE      | 04        | 1/1/1900               | PCC          | APRON | 3/1/2022             | 122               | 47  | Poor         | 0             | 94         | 6           |
| A11BE      | 01        | 9/1/2005               | AC           | APRON | 3/1/2022             | 17                | 45  | Poor         | 58            | 42         | 0           |
| AHELIBE    | 01        | 7/3/2017               | AC           | APRON | 3/1/2022             | 5                 | 94  | Good         | 100           | 0          | 0           |
| AHELIBE    | 02        | 7/3/2017               | AC           | APRON | 3/1/2022             | 5                 | 94  | Good         | 100           | 0          | 0           |
| AHELIBE    | 03        | 7/2/2017               | PCC          | APRON | 3/1/2022             | 5                 | 100 | Good         | 0             | 0          | 0           |
| ATANHOLDBE | 01        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 73  | Satisfactory | 100           | 0          | 0           |
| ATASHOLDBE | 01        | 9/3/2012               | AC           | APRON | 3/1/2022             | 9                 | 81  | Satisfactory | 100           | 0          | 0           |

**Table 3B - BEND AIRPORT 2022 PAVEMENT CONDITION INDEX SURVEY RESULTS**

| BranchID   | SectionID | Last Construction Date | Surface Type | Use     | Last Inspection Date | Age at Inspection | PCI | PCI Category | PCI % Climate | PCI % Load | PCI % Other |
|------------|-----------|------------------------|--------------|---------|----------------------|-------------------|-----|--------------|---------------|------------|-------------|
| ATBNHOLDBE | 01        | 10/3/2010              | AC           | APRON   | 3/1/2022             | 11                | 80  | Satisfactory | 100           | 0          | 0           |
| ATBSHOLDBE | 01        | 10/3/2010              | AC           | APRON   | 3/1/2022             | 11                | 75  | Satisfactory | 100           | 0          | 0           |
| R16BE      | 01        | 10/3/2006              | AC           | RUNWAY  | 3/1/2022             | 15                | 78  | Satisfactory | 100           | 0          | 0           |
| T01BE      | 01        | 9/2/1998               | AC           | TAXIWAY | 3/1/2022             | 23                | 65  | Fair         | 65            | 0          | 35          |
| T02BE      | 01        | 9/2/1995               | AC           | TAXIWAY | 3/1/2022             | 26                | 65  | Fair         | 90            | 10         | 0           |
| T03BE      | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 94  | Good         | 100           | 0          | 0           |
| T03BE      | 02        | 9/2/1994               | AC           | TAXIWAY | 3/1/2022             | 27                | 29  | Very Poor    | 62            | 32         | 6           |
| T03BE      | 03        | 9/2/1996               | AC           | TAXIWAY | 3/1/2022             | 25                | 19  | Serious      | 51            | 49         | 0           |
| T03BE      | 04        | 9/2/1966               | AC           | TAXIWAY | 3/1/2022             | 55                | 12  | Serious      | 30            | 70         | 0           |
| T03BE      | 05        | 9/2/1955               | AC           | TAXIWAY | 3/1/2022             | 66                | 7   | Failed       | 31            | 69         | 0           |
| T03BE      | 06        | 9/2/1988               | AC           | TAXIWAY | 3/1/2022             | 33                | 34  | Very Poor    | 74            | 26         | 0           |
| T03BE      | 07        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 64  | Fair         | 100           | 0          | 0           |
| T04BE      | 01        | 9/2/1996               | AC           | TAXIWAY | 3/1/2022             | 25                | 30  | Very Poor    | 36            | 64         | 0           |
| T04BE      | 02        | 9/2/1963               | AC           | TAXIWAY | 3/1/2022             | 58                | 41  | Poor         | 68            | 32         | 0           |
| T05BE      | 01        | 9/2/1993               | AC           | TAXIWAY | 3/1/2022             | 28                | 26  | Very Poor    | 58            | 42         | 0           |
| T05BE      | 02        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 65  | Fair         | 100           | 0          | 0           |
| T06BE      | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 79  | Satisfactory | 100           | 0          | 0           |
| T06BE      | 02        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 63  | Fair         | 100           | 0          | 0           |
| T07BE      | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 86  | Good         | 100           | 0          | 0           |
| T07BE      | 02        | 7/3/2018               | AC           | TAXIWAY | 3/1/2022             | 4                 | 90  | Good         | 100           | 0          | 0           |
| T07BE      | 03        | 9/2/1961               | AC           | TAXIWAY | 3/1/2022             | 60                | 21  | Serious      | 41            | 59         | 0           |
| T08BE      | 01        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 64  | Fair         | 100           | 0          | 0           |
| T09BE      | 01        | 9/1/2005               | AC           | TAXIWAY | 3/1/2022             | 17                | 57  | Fair         | 100           | 0          | 0           |
| T10BE      | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 91  | Good         | 100           | 0          | 0           |
| T10BE      | 02        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 90  | Good         | 100           | 0          | 0           |
| T11BE      | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 94  | Good         | 100           | 0          | 0           |
| TA1BE      | 01        | 10/3/2006              | AC           | TAXIWAY | 3/1/2022             | 15                | 67  | Fair         | 88            | 12         | 0           |
| TA1BE      | 02        | 9/2/2012               | AAC          | TAXIWAY | 3/1/2022             | 9                 | 79  | Satisfactory | 100           | 0          | 0           |
| TA2BE      | 01        | 10/3/2006              | AC           | TAXIWAY | 3/1/2022             | 15                | 83  | Satisfactory | 100           | 0          | 0           |
| TA2BE      | 02        | 9/2/2012               | AAC          | TAXIWAY | 3/1/2022             | 9                 | 81  | Satisfactory | 100           | 0          | 0           |
| TA3BE      | 01        | 10/3/2006              | AC           | TAXIWAY | 3/1/2022             | 15                | 71  | Satisfactory | 100           | 0          | 0           |
| TA3BE      | 02        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 84  | Satisfactory | 100           | 0          | 0           |
| TA4BE      | 01        | 10/3/2006              | AC           | TAXIWAY | 3/1/2022             | 15                | 81  | Satisfactory | 100           | 0          | 0           |
| TA4BE      | 02        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 78  | Satisfactory | 100           | 0          | 0           |
| TA5BE      | 01        | 10/3/2006              | AC           | TAXIWAY | 3/1/2022             | 15                | 75  | Satisfactory | 100           | 0          | 0           |
| TA5BE      | 02        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 77  | Satisfactory | 100           | 0          | 0           |
| TA6BE      | 01        | 10/3/2006              | AC           | TAXIWAY | 3/1/2022             | 15                | 73  | Satisfactory | 86            | 14         | 0           |
| TA6BE      | 02        | 9/2/2012               | AAC          | TAXIWAY | 3/1/2022             | 9                 | 94  | Good         | 100           | 0          | 0           |
| TABE       | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 87  | Good         | 100           | 0          | 0           |
| TAEROBE    | 01        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 69  | Fair         | 100           | 0          | 0           |
| TAEROBE    | 02        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 70  | Fair         | 100           | 0          | 0           |
| TAEROBE    | 03        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 61  | Fair         | 100           | 0          | 0           |
| TAEROBE    | 04        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 70  | Fair         | 100           | 0          | 0           |

**Table 3B - BEND AIRPORT 2022 PAVEMENT CONDITION INDEX SURVEY RESULTS**

| BranchID | SectionID | Last Construction Date | Surface Type | Use     | Last Inspection Date | Age at Inspection | PCI | PCI Category | PCI % Climate | PCI % Load | PCI % Other |
|----------|-----------|------------------------|--------------|---------|----------------------|-------------------|-----|--------------|---------------|------------|-------------|
| TAEROBE  | 05        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 74  | Satisfactory | 100           | 0          | 0           |
| TAEROBE  | 06        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 77  | Satisfactory | 100           | 0          | 0           |
| TAEROBE  | 07        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 73  | Satisfactory | 100           | 0          | 0           |
| TAEROBE  | 08        | 9/2/2008               | AC           | TAXIWAY | 3/1/2022             | 13                | 70  | Fair         | 100           | 0          | 0           |
| TB1BE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 75  | Satisfactory | 100           | 0          | 0           |
| TB2BE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 75  | Satisfactory | 100           | 0          | 0           |
| TB2BE    | 02        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 80  | Satisfactory | 100           | 0          | 0           |
| TB3BE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 71  | Satisfactory | 100           | 0          | 0           |
| TB3BE    | 02        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 84  | Satisfactory | 100           | 0          | 0           |
| TB4BE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 75  | Satisfactory | 100           | 0          | 0           |
| TB4BE    | 02        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 75  | Satisfactory | 100           | 0          | 0           |
| TB5BE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 68  | Fair         | 82            | 18         | 0           |
| TB5BE    | 02        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 70  | Fair         | 100           | 0          | 0           |
| TB6BE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 77  | Satisfactory | 100           | 0          | 0           |
| TB6BE    | 02        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 70  | Fair         | 100           | 0          | 0           |
| TBBBE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 81  | Satisfactory | 100           | 0          | 0           |
| TBBE     | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 72  | Satisfactory | 100           | 0          | 0           |
| THELIBE  | 01        | 7/3/2017               | AC           | TAXIWAY | 3/1/2022             | 5                 | 94  | Good         | 100           | 0          | 0           |
| THELIBE  | 02        | 7/3/2017               | AC           | TAXIWAY | 3/1/2022             | 5                 | 94  | Good         | 100           | 0          | 0           |
| TLA10BE  | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 89  | Good         | 100           | 0          | 0           |
| TLA10BE  | 02        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 60  | Fair         | 100           | 0          | 0           |
| TLA7BE   | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 88  | Good         | 100           | 0          | 0           |
| TLA8BE   | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 90  | Good         | 100           | 0          | 0           |
| TLA8BE   | 02        | 9/1/2008               | AC           | TAXIWAY | 3/1/2022             | 14                | 69  | Fair         | 100           | 0          | 0           |
| TLA9BE   | 01        | 9/3/2012               | AC           | TAXIWAY | 3/1/2022             | 9                 | 89  | Good         | 100           | 0          | 0           |
| TLA9BE   | 02        | 9/2/1999               | AC           | TAXIWAY | 3/1/2022             | 22                | 62  | Fair         | 100           | 0          | 0           |
| TLCBE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 75  | Satisfactory | 100           | 0          | 0           |
| TLEBE    | 01        | 10/3/2010              | AC           | TAXIWAY | 3/1/2022             | 11                | 94  | Good         | 100           | 0          | 0           |

Abbreviations:

PCI = Pavement Condition Index, AC = Asphalt Concrete, AAC = AC overlaid AC, PCC = Portland Cement Concrete

**Table 4B - BEND AIRPORT COMPARISON OF PREVIOUS INSPECTION AND 2022 RESULTS**

| Branch ID | Section ID | Surface Type <sup>1</sup> | Approximate<br>Area, square<br>feet | LCD <sup>2</sup> | 2017 Survey |              |            | 2022 Survey |              |    | Age <sup>3</sup> | $\Delta$ PCI/yr <sup>4</sup> | Rate of<br>Deterioration |
|-----------|------------|---------------------------|-------------------------------------|------------------|-------------|--------------|------------|-------------|--------------|----|------------------|------------------------------|--------------------------|
|           |            |                           |                                     |                  | PCI         | PCI Category | Insp. Date | PCI         | PCI Category |    |                  |                              |                          |
| A01BE     | 01         | AC                        | 14,132                              | 9/3/2012         | 98          | Good         | 6/18/2017  | 92          | Good         | 5  | -1.28            |                              | NORMAL                   |
| A02BE     | 01         | AC                        | 65,227                              | 9/3/2012         | 99          | Good         | 6/18/2017  | 93          | Good         | 5  | -1.28            |                              | NORMAL                   |
| A02BE     | 02         | AC                        | 98,940                              | 9/1/2005         | 66          | Fair         | 6/18/2017  | 52          | Poor         | 12 | -2.98            |                              | NORMAL                   |
| A02BE     | 03         | AC                        | 36,867                              | 9/2/1999         | 59          | Fair         | 6/18/2017  | 62          | Fair         | 18 | 0.64             |                              | NONE                     |
| A02BE     | 04         | AC                        | 62,888                              | 9/2/1999         | 72          | Satisfactory | 6/18/2017  | 58          | Fair         | 18 | -2.98            |                              | NORMAL                   |
| A02BE     | 05         | AC                        | 97,120                              | 7/3/2018         | 8           | Failed       | 6/18/2017  | 94          | Good         | -1 | 18.28            |                              | NONE                     |
| A02BE     | 06         | AC                        | 72,650                              | 7/3/2018         | 42          | Poor         | 6/18/2017  | 94          | Good         | -1 | 11.05            |                              | NONE                     |
| A02BE     | 07         | AC                        | 4,560                               | 7/3/2018         | --          | --           | --         | 92          | Good         | -- | --               |                              | N/A <sup>5</sup>         |
| A03BE     | 01         | AC                        | 52,460                              | 9/2/1995         | 64          | Fair         | 6/18/2017  | 53          | Poor         | 22 | -2.34            |                              | NORMAL                   |
| A03BE     | 02         | AC                        | 8,520                               | 9/1/2005         | 53          | Poor         | 6/18/2017  | 52          | Poor         | 12 | -0.21            |                              | NORMAL                   |
| A04BE     | 01         | AC                        | 36,640                              | 9/3/2012         | 91          | Good         | 6/18/2017  | 89          | Good         | 5  | -0.43            |                              | NORMAL                   |
| A04BE     | 02         | AC                        | 7,510                               | 7/1/2013         | --          | --           | --         | 76          | Satisfactory | -- | --               |                              | N/A                      |
| A05BE     | 01         | AC                        | 7,160                               | 9/1/2005         | 68          | Fair         | 6/18/2017  | 49          | Poor         | 12 | -4.04            |                              | HIGH                     |
| A05BE     | 02         | AAC                       | 9,080                               | 9/1/2011         | 85          | Satisfactory | 6/18/2017  | 76          | Satisfactory | 6  | -1.91            |                              | NORMAL                   |
| A06BE     | 01         | AC                        | 30,000                              | 9/1/2008         | 78          | Satisfactory | 6/18/2017  | 72          | Satisfactory | 9  | -1.28            |                              | NORMAL                   |
| A07BE     | 01         | AC                        | 15,810                              | 9/3/2012         | 100         | Good         | 6/18/2017  | 87          | Good         | 5  | -2.76            |                              | NORMAL                   |
| A07BE     | 02         | AC                        | 9,223                               | 9/2/1999         | 71          | Satisfactory | 6/18/2017  | 64          | Fair         | 18 | -1.49            |                              | NORMAL                   |
| A07BE     | 03         | AC                        | 12,472                              | 9/2/1999         | 70          | Fair         | 6/18/2017  | 66          | Fair         | 18 | -0.85            |                              | NORMAL                   |
| A07BE     | 04         | AC                        | 5,610                               | 9/1/2005         | 49          | Poor         | 6/18/2017  | 25          | Serious      | 12 | -5.10            |                              | HIGH                     |
| A08BE     | 01         | AC                        | 5,923                               | 9/2/1999         | 27          | Very Poor    | 6/18/2017  | 17          | Serious      | 18 | -2.13            |                              | NORMAL                   |
| A08BE     | 02         | AC                        | 5,912                               | 9/2/1999         | 49          | Poor         | 6/18/2017  | 22          | Serious      | 18 | -5.74            |                              | HIGH                     |
| A08BE     | 03         | AC                        | 5,840                               | 9/1/2005         | 100         | Good         | 6/18/2017  | 49          | Poor         | 12 | -10.84           |                              | HIGH                     |
| A08BE     | 04         | AC                        | 4,365                               | 9/1/2005         | 57          | Fair         | 6/18/2017  | 64          | Fair         | 12 | 1.49             |                              | NONE                     |
| A08BE     | 05         | AC                        | 8,050                               | 1/1/2002         | 62          | Fair         | 6/18/2017  | 60          | Fair         | 15 | -0.43            |                              | NORMAL                   |
| A08BE     | 06         | AC                        | 9,411                               | 1/1/2002         | 69          | Fair         | 6/18/2017  | 71          | Satisfactory | 15 | 0.43             |                              | NONE                     |
| A08BE     | 07         | AC                        | 31,202                              | 9/3/2012         | 98          | Good         | 6/18/2017  | 83          | Satisfactory | 5  | -3.19            |                              | NORMAL                   |
| A08BE     | 08         | AC                        | 1,557                               | 1/1/1900         | --          | --           | --         | 60          | Fair         | -- | --               |                              | N/A                      |
| A08BE     | 09         | PCC                       | 1,804                               | 1/1/1900         | --          | --           | --         | 25          | Serious      | -- | --               |                              | N/A                      |
| A08BE     | 10         | AC                        | 840                                 | 1/1/1900         | --          | --           | --         | 69          | Fair         | -- | --               |                              | N/A                      |
| A08BE     | 11         | PCC                       | 2,500                               | 1/1/1900         | --          | --           | --         | 28          | Very Poor    | -- | --               |                              | N/A                      |

**Table 4B - BEND AIRPORT COMPARISON OF PREVIOUS INSPECTION AND 2022 RESULTS**

| Branch ID  | Section ID | Surface Type <sup>1</sup> | Approximate<br>Area, square<br>feet | LCD <sup>2</sup> | 2017 Survey |              |            | 2022 Survey |              |    | Age <sup>3</sup> | Δ PCI/yr <sup>4</sup> | Rate of<br>Deterioration |
|------------|------------|---------------------------|-------------------------------------|------------------|-------------|--------------|------------|-------------|--------------|----|------------------|-----------------------|--------------------------|
|            |            |                           |                                     |                  | PCI         | PCI Category | Insp. Date | PCI         | PCI Category |    |                  |                       |                          |
| A08BE      | 12         | AC                        | 3,030                               | 1/1/1900         | --          | --           | --         | 33          | Very Poor    | -- | --               | --                    | N/A                      |
| A09BE      | 01         | AC                        | 15,000                              | 9/1/2005         | 74          | Satisfactory | 6/18/2017  | 65          | Fair         | 12 | -1.91            |                       | NORMAL                   |
| A09BE      | 02         | PCC                       | 2,585                               | 1/1/1900         | --          | --           | --         | 96          | Good         | -- | --               | --                    | N/A                      |
| A10BE      | 01         | AC                        | 3,655                               | 9/2/1999         | 49          | Poor         | 6/18/2017  | 94          | Good         | 18 | 9.57             |                       | NONE                     |
| A10BE      | 02         | AC                        | 920                                 | 9/1/2005         | 30          | Very Poor    | 6/18/2017  | 50          | Poor         | 12 | 4.25             |                       | NONE                     |
| A10BE      | 03         | AC                        | 2,385                               | 9/1/2005         | 80          | Satisfactory | 6/18/2017  | 24          | Serious      | 12 | -11.90           |                       | HIGH                     |
| A10BE      | 04         | PCC                       | 2,127                               | 1/1/1900         | --          | --           | --         | 47          | Poor         | -- | --               | --                    | N/A                      |
| A11BE      | 01         | AC                        | 9,920                               | 9/1/2005         | 66          | Fair         | 6/18/2017  | 45          | Poor         | 12 | -4.46            |                       | HIGH                     |
| AHELIBE    | 01         | AC                        | 393,378                             | 7/3/2017         | 100         | Good         | 7/3/2017   | 94          | Good         | 0  | -1.29            |                       | NORMAL                   |
| AHELIBE    | 02         | AC                        | 44,220                              | 7/3/2017         | 100         | Good         | 7/3/2017   | 94          | Good         | 0  | -1.29            |                       | NORMAL                   |
| AHELIBE    | 03         | PCC                       | 45,280                              | 7/2/2017         | 100         | Good         | 7/2/2017   | 100         | Good         | 0  | 0.00             |                       | NONE                     |
| ATANHOLDBE | 01         | AC                        | 31,349                              | 9/3/2012         | 80          | Satisfactory | 6/18/2017  | 73          | Satisfactory | 5  | -1.49            |                       | NORMAL                   |
| ATASHOLDBE | 01         | AC                        | 33,318                              | 9/3/2012         | 96          | Good         | 6/18/2017  | 81          | Satisfactory | 5  | -3.19            |                       | NORMAL                   |
| ATBNHOLDBE | 01         | AC                        | 31,198                              | 10/3/2010        | 83          | Satisfactory | 6/18/2017  | 80          | Satisfactory | 7  | -0.64            |                       | NORMAL                   |
| ATBSHOLDBE | 01         | AC                        | 33,049                              | 10/3/2010        | 81          | Satisfactory | 6/18/2017  | 75          | Satisfactory | 7  | -1.28            |                       | NORMAL                   |
| R16BE      | 01         | AC                        | 390,000                             | 10/3/2006        | 84          | Satisfactory | 6/18/2017  | 78          | Satisfactory | 11 | -1.28            |                       | NORMAL                   |
| T01BE      | 01         | AC                        | 5,840                               | 9/2/1998         | 77          | Satisfactory | 6/18/2017  | 65          | Fair         | 19 | -2.55            |                       | NORMAL                   |
| T02BE      | 01         | AC                        | 11,370                              | 9/2/1995         | 76          | Satisfactory | 6/18/2017  | 65          | Fair         | 22 | -2.34            |                       | NORMAL                   |
| T03BE      | 01         | AC                        | 7,392                               | 9/3/2012         | 100         | Good         | 6/18/2017  | 94          | Good         | 5  | -1.28            |                       | NORMAL                   |
| T03BE      | 02         | AC                        | 5,062                               | 9/2/1994         | 41          | Poor         | 6/18/2017  | 29          | Very Poor    | 23 | -2.55            |                       | NORMAL                   |
| T03BE      | 03         | AC                        | 10,800                              | 9/2/1996         | 45          | Poor         | 6/18/2017  | 19          | Serious      | 21 | -5.53            |                       | HIGH                     |
| T03BE      | 04         | AC                        | 4,683                               | 9/2/1966         | 6           | Failed       | 6/18/2017  | 12          | Serious      | 51 | 1.28             |                       | NONE                     |
| T03BE      | 05         | AC                        | 21,900                              | 9/2/1955         | 9           | Failed       | 6/18/2017  | 7           | Failed       | 62 | -0.43            |                       | NORMAL                   |
| T03BE      | 06         | AC                        | 6,600                               | 9/2/1988         | 39          | Very Poor    | 6/18/2017  | 34          | Very Poor    | 29 | -1.06            |                       | NORMAL                   |
| T03BE      | 07         | AC                        | 2,834                               | 9/2/1999         | 65          | Fair         | 6/18/2017  | 64          | Fair         | 18 | -0.21            |                       | NORMAL                   |
| T04BE      | 01         | AC                        | 15,759                              | 9/2/1996         | 42          | Poor         | 6/18/2017  | 30          | Very Poor    | 21 | -2.55            |                       | NORMAL                   |
| T04BE      | 02         | AC                        | 8,666                               | 9/2/1963         | 29          | Very Poor    | 6/18/2017  | 41          | Poor         | 54 | 2.55             |                       | NONE                     |
| T05BE      | 01         | AC                        | 24,436                              | 9/2/1993         | 40          | Very Poor    | 6/18/2017  | 26          | Very Poor    | 24 | -2.98            |                       | NORMAL                   |
| T05BE      | 02         | AC                        | 1,271                               | 9/2/1999         | 69          | Fair         | 6/18/2017  | 65          | Fair         | 18 | -0.85            |                       | NORMAL                   |
| T06BE      | 01         | AC                        | 2,250                               | 9/3/2012         | 100         | Good         | 6/18/2017  | 79          | Satisfactory | 5  | -4.46            |                       | HIGH                     |

**Table 4B - BEND AIRPORT COMPARISON OF PREVIOUS INSPECTION AND 2022 RESULTS**

| Branch ID | Section ID | Surface Type <sup>1</sup> | Approximate<br>Area, square<br>feet | LCD <sup>2</sup> | 2017 Survey  |              |           | 2022 Survey  |                  |                       | Rate of<br>Deterioration |        |
|-----------|------------|---------------------------|-------------------------------------|------------------|--------------|--------------|-----------|--------------|------------------|-----------------------|--------------------------|--------|
|           |            |                           | PCI                                 |                  | PCI Category | Insp. Date   | PCI       | PCI Category | Age <sup>3</sup> | Δ PCI/yr <sup>4</sup> |                          |        |
| T06BE     | 02         | AC                        | 8,040                               | 9/2/1999         | 52           | Poor         | 6/18/2017 | 63           | Fair             | 18                    | 2.34                     | NONE   |
| T07BE     | 01         | AC                        | 4,332                               | 9/3/2012         | 100          | Good         | 6/18/2017 | 86           | Good             | 5                     | -2.98                    | NORMAL |
| T07BE     | 02         | AC                        | 6,156                               | 7/3/2018         | 46           | Poor         | 6/18/2017 | 90           | Good             | -1                    | 9.35                     | NONE   |
| T07BE     | 03         | AC                        | 7,570                               | 9/2/1961         | 53           | Poor         | 6/18/2017 | 21           | Serious          | 56                    | -6.80                    | HIGH   |
| T08BE     | 01         | AC                        | 17,039                              | 9/2/1999         | 62           | Fair         | 6/18/2017 | 64           | Fair             | 18                    | 0.43                     | NONE   |
| T09BE     | 01         | AC                        | 1,216                               | 9/1/2005         | 72           | Satisfactory | 6/18/2017 | 57           | Fair             | 12                    | -3.19                    | NORMAL |
| T10BE     | 01         | AC                        | 2,849                               | 9/3/2012         | 100          | Good         | 6/18/2017 | 91           | Good             | 5                     | -1.91                    | NORMAL |
| T10BE     | 02         | AC                        | 1,060                               | 9/2/1999         | 53           | Poor         | 6/18/2017 | 90           | Good             | 18                    | 7.87                     | NONE   |
| T11BE     | 01         | AC                        | 2,611                               | 9/3/2012         | 100          | Good         | 6/18/2017 | 94           | Good             | 5                     | -1.28                    | NORMAL |
| TA1BE     | 01         | AC                        | 12,685                              | 10/3/2006        | 79           | Satisfactory | 6/18/2017 | 67           | Fair             | 11                    | -2.55                    | NORMAL |
| TA1BE     | 02         | AAC                       | 2,030                               | 9/2/2012         | 74           | Satisfactory | 6/18/2017 | 79           | Satisfactory     | 5                     | 1.06                     | NONE   |
| TA2BE     | 01         | AC                        | 8,275                               | 10/3/2006        | 79           | Satisfactory | 6/18/2017 | 83           | Satisfactory     | 11                    | 0.85                     | NONE   |
| TA2BE     | 02         | AAC                       | 2,945                               | 9/2/2012         | 81           | Satisfactory | 6/18/2017 | 81           | Satisfactory     | 5                     | 0.00                     | NONE   |
| TA3BE     | 01         | AC                        | 8,315                               | 10/3/2006        | 83           | Satisfactory | 6/18/2017 | 71           | Satisfactory     | 11                    | -2.55                    | NORMAL |
| TA3BE     | 02         | AC                        | 2,885                               | 9/3/2012         | 81           | Satisfactory | 6/18/2017 | 84           | Satisfactory     | 5                     | 0.64                     | NONE   |
| TA4BE     | 01         | AC                        | 8,400                               | 10/3/2006        | 89           | Good         | 6/18/2017 | 81           | Satisfactory     | 11                    | -1.70                    | NORMAL |
| TA4BE     | 02         | AC                        | 2,860                               | 9/3/2012         | 91           | Good         | 6/18/2017 | 78           | Satisfactory     | 5                     | -2.76                    | NORMAL |
| TA5BE     | 01         | AC                        | 8,480                               | 10/3/2006        | 89           | Good         | 6/18/2017 | 75           | Satisfactory     | 11                    | -2.98                    | NORMAL |
| TA5BE     | 02         | AC                        | 2,890                               | 9/3/2012         | 91           | Good         | 6/18/2017 | 77           | Satisfactory     | 5                     | -2.98                    | NORMAL |
| TA6BE     | 01         | AC                        | 12,716                              | 10/3/2006        | 85           | Satisfactory | 6/18/2017 | 73           | Satisfactory     | 11                    | -2.55                    | NORMAL |
| TA6BE     | 02         | AAC                       | 2,000                               | 9/2/2012         | 100          | Good         | 6/18/2017 | 94           | Good             | 5                     | -1.28                    | NORMAL |
| TABE      | 01         | AC                        | 182,005                             | 9/3/2012         | 100          | Good         | 6/18/2017 | 87           | Good             | 5                     | -2.76                    | NORMAL |
| TAEROBE   | 01         | AC                        | 40,188                              | 9/2/2008         | 70           | Fair         | 6/18/2017 | 69           | Fair             | 9                     | -0.21                    | NORMAL |
| TAEROBE   | 02         | AC                        | 38,299                              | 9/2/2008         | 72           | Satisfactory | 6/18/2017 | 70           | Fair             | 9                     | -0.43                    | NORMAL |
| TAEROBE   | 03         | AC                        | 54,823                              | 9/2/2008         | 73           | Satisfactory | 6/18/2017 | 61           | Fair             | 9                     | -2.55                    | NORMAL |
| TAEROBE   | 04         | AC                        | 39,175                              | 9/2/2008         | 80           | Satisfactory | 6/18/2017 | 70           | Fair             | 9                     | -2.13                    | NORMAL |
| TAEROBE   | 05         | AC                        | 38,964                              | 9/2/2008         | 76           | Satisfactory | 6/18/2017 | 74           | Satisfactory     | 9                     | -0.43                    | NORMAL |
| TAEROBE   | 06         | AC                        | 37,723                              | 9/2/2008         | 76           | Satisfactory | 6/18/2017 | 77           | Satisfactory     | 9                     | 0.21                     | NONE   |
| TAEROBE   | 07         | AC                        | 40,813                              | 9/2/2008         | 77           | Satisfactory | 6/18/2017 | 73           | Satisfactory     | 9                     | -0.85                    | NORMAL |
| TAEROBE   | 08         | AC                        | 41,016                              | 9/2/2008         | 71           | Satisfactory | 6/18/2017 | 70           | Fair             | 9                     | -0.21                    | NORMAL |

**Table 4B - BEND AIRPORT COMPARISON OF PREVIOUS INSPECTION AND 2022 RESULTS**

| Branch ID | Section ID | Surface Type <sup>1</sup> | Approximate<br>Area, square<br>feet | LCD <sup>2</sup> | 2017 Survey |              |            | 2022 Survey |              |    | Age <sup>3</sup> | Δ PCI/yr <sup>4</sup> | Rate of<br>Deterioration |
|-----------|------------|---------------------------|-------------------------------------|------------------|-------------|--------------|------------|-------------|--------------|----|------------------|-----------------------|--------------------------|
|           |            |                           |                                     |                  | PCI         | PCI Category | Insp. Date | PCI         | PCI Category |    |                  |                       |                          |
| TB1BE     | 01         | AC                        | 12,660                              | 10/3/2010        | 84          | Satisfactory | 6/18/2017  | 75          | Satisfactory | 7  | -1.91            |                       | NORMAL                   |
| TB2BE     | 01         | AC                        | 8,364                               | 10/3/2010        | 76          | Satisfactory | 6/18/2017  | 75          | Satisfactory | 7  | -0.21            |                       | NORMAL                   |
| TB2BE     | 02         | AC                        | 2,943                               | 10/3/2010        | --          | --           | --         | 80          | Satisfactory | -- | --               |                       | N/A                      |
| TB3BE     | 01         | AC                        | 8,358                               | 10/3/2010        | 82          | Satisfactory | 6/18/2017  | 71          | Satisfactory | 7  | -2.34            |                       | NORMAL                   |
| TB3BE     | 02         | AC                        | 2,949                               | 10/3/2010        | --          | --           | --         | 84          | Satisfactory | -- | --               |                       | N/A                      |
| TB4BE     | 01         | AC                        | 8,361                               | 10/3/2010        | 84          | Satisfactory | 6/18/2017  | 75          | Satisfactory | 7  | -1.91            |                       | NORMAL                   |
| TB4BE     | 02         | AC                        | 2,946                               | 10/3/2010        | --          | --           | --         | 75          | Satisfactory | -- | --               |                       | N/A                      |
| TB5BE     | 01         | AC                        | 8,431                               | 10/3/2010        | 83          | Satisfactory | 6/18/2017  | 68          | Fair         | 7  | -3.19            |                       | NORMAL                   |
| TB5BE     | 02         | AC                        | 2,876                               | 10/3/2010        | --          | --           | --         | 70          | Fair         | -- | --               |                       | N/A                      |
| TB6BE     | 01         | AC                        | 12,729                              | 10/3/2010        | 79          | Satisfactory | 6/18/2017  | 77          | Satisfactory | 7  | -0.43            |                       | NORMAL                   |
| TB6BE     | 02         | AC                        | 2,026                               | 10/3/2010        | --          | --           | --         | 70          | Fair         | -- | --               |                       | N/A                      |
| TBBBE     | 01         | AC                        | 36,692                              | 10/3/2010        | 82          | Satisfactory | 6/18/2017  | 81          | Satisfactory | 7  | -0.21            |                       | NORMAL                   |
| TBBE      | 01         | AC                        | 181,500                             | 10/3/2010        | 80          | Satisfactory | 6/18/2017  | 72          | Satisfactory | 7  | -1.70            |                       | NORMAL                   |
| THELIBE   | 01         | AC                        | 16,126                              | 7/3/2017         | 100         | Good         | 7/3/2017   | 94          | Good         | 0  | -1.29            |                       | NORMAL                   |
| THELIBE   | 02         | AC                        | 10,117                              | 7/3/2017         | 100         | Good         | 7/3/2017   | 94          | Good         | 0  | -1.29            |                       | NORMAL                   |
| TLA10BE   | 01         | AC                        | 6,215                               | 9/3/2012         | 87          | Good         | 6/18/2017  | 89          | Good         | 5  | 0.43             |                       | NONE                     |
| TLA10BE   | 02         | AC                        | 27,138                              | 9/2/1999         | 70          | Fair         | 6/18/2017  | 60          | Fair         | 18 | -2.13            |                       | NORMAL                   |
| TLA7BE    | 01         | AC                        | 8,976                               | 9/3/2012         | 99          | Good         | 6/18/2017  | 88          | Good         | 5  | -2.34            |                       | NORMAL                   |
| TLA8BE    | 01         | AC                        | 5,862                               | 9/3/2012         | 89          | Good         | 6/18/2017  | 90          | Good         | 5  | 0.21             |                       | NONE                     |
| TLA8BE    | 02         | AC                        | 2,625                               | 9/1/2008         | 94          | Good         | 6/18/2017  | 69          | Fair         | 9  | -5.31            |                       | HIGH                     |
| TLA9BE    | 01         | AC                        | 4,115                               | 9/3/2012         | 87          | Good         | 6/18/2017  | 89          | Good         | 5  | 0.43             |                       | NONE                     |
| TLA9BE    | 02         | AC                        | 5,923                               | 9/2/1999         | 56          | Fair         | 6/18/2017  | 62          | Fair         | 18 | 1.28             |                       | NONE                     |
| TLCBE     | 01         | AC                        | 5,156                               | 10/3/2010        | 89          | Good         | 6/18/2017  | 75          | Satisfactory | 7  | -2.98            |                       | NORMAL                   |
| TLEBE     | 01         | AC                        | 5,330                               | 10/3/2010        | 94          | Good         | 6/18/2017  | 94          | Good         | 7  | 0.00             |                       | NONE                     |

Abbreviations:

<sup>1</sup> AC = Asphalt Concrete, AAC = Asphalt Overlay AC, PCC = Portland Cement Concrete

<sup>2</sup> LCD = Last construction date. The date of the last major pavement rehabilitation (e.g. AC overlay)

<sup>3</sup> Age = Pavement age in years at the time of the PCI survey in 2017

<sup>4</sup> Δ PCI/yr = Change in PCI points per year between 2017 survey and 2022 survey

<sup>5</sup> N/A = Not applicable due to changes in sectioning



---

## **APPENDIX C**

### *Future Pavement Condition Analysis*

## APPENDIX C

### FUTURE PAVEMENT CONDITION ANALYSIS

#### C.1 METHODOLOGY


In addition to assessing the current condition of a pavement, it is very important from a planning standpoint to be able to predict with reasonable accuracy its future condition. In a pavement management plan (PMP), this is done with the aid of a prediction model. When an APMS is initially implemented, the default models are typically used to predict the future condition of a pavement. However, after PCI surveys are completed, the historical data are then used to refine the models, so they better represent the deterioration of a particular class of pavement based on local climatic conditions, loading, material sources, construction procedures, etc. The importance of accurate prediction models is part of the reason it is essential to conduct periodic, routine surveys in order to track the rate of deterioration.

In PAVER, the pavement deterioration curves are developed based on the “family” model procedure. A pavement “family” is defined as a group of pavements with similar deterioration characteristics. The procedure for developing the prediction models is:


1. Define the pavement families.
2. Review the data.
3. Conduct a data outlier analysis.
- 4) Model the data.

#### C.2 PREDICTION MODELS


We developed separate condition prediction models for each pavement “family” at Bend Airport. The delineation is based on branch use, surface type, section rank, and structural design life. We use five distinct models for the following “families” of pavements at Bend Airport. For each model, we reviewed the data in order to filter out any suspicious or inaccurate data or any data that fall outside boundary values set by PAVER. After outliers are removed and the data are checked for accuracy and reasonableness, the PAVER program calculates a best-fit curve using a fourth-order, polynomial-constrained, least-squares analysis procedure. This best-fit curve for each family is used in the analysis to predict the average behavior of all sections within each “family.” Our condition prediction models for each “family” are provided on Figures 1C through 5C below.

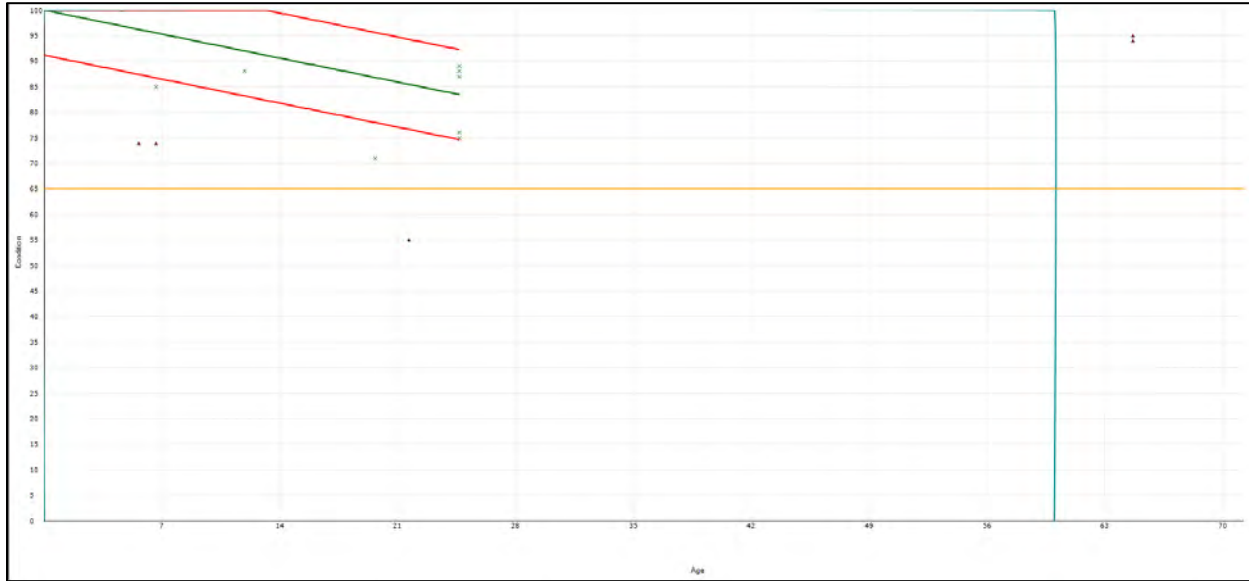


**Figure 1C – CONDITION PREDICTION MODEL FOR CENTRAL CATEGORY 1/2 PCC RUNWAYS, TAXIWAYS, AND APRONS**

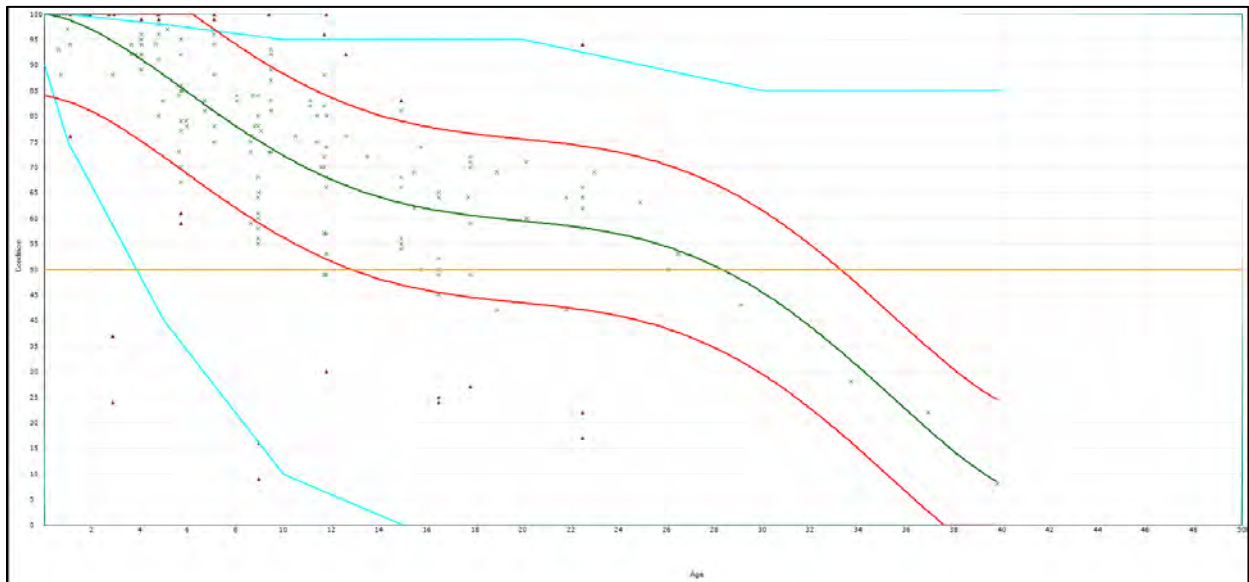


**Figure 2C – CONDITION PREDICTION MODEL FOR CENTRAL CATEGORY 1/2 AC AND AAC APRONS**

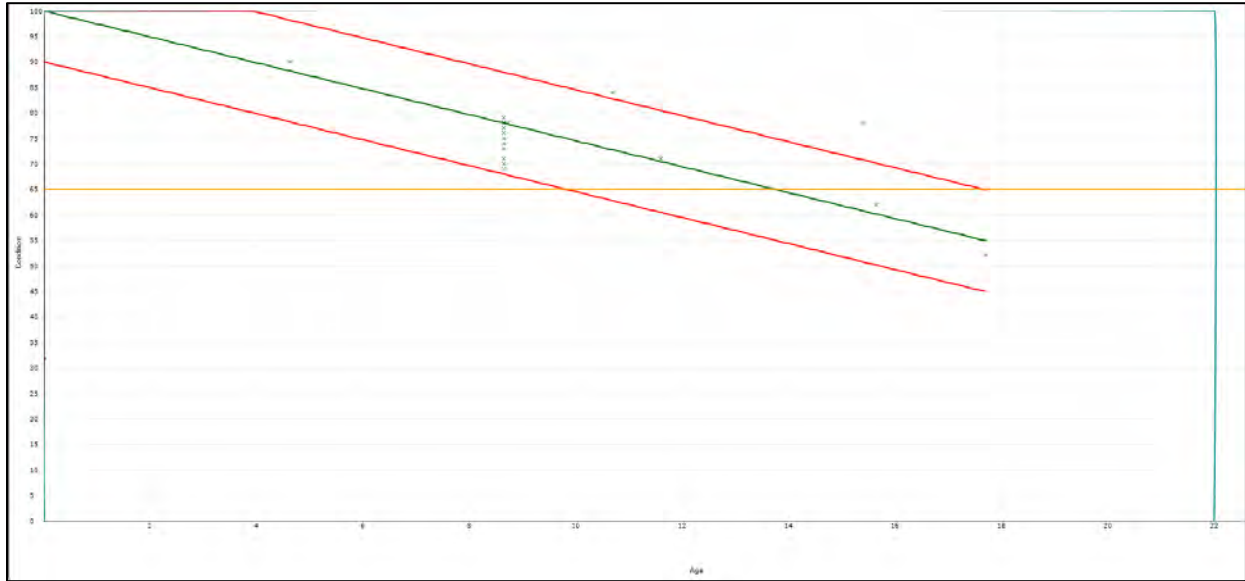

**Figure 3C - CONDITION PREDICTION MODEL FOR CENTRAL CATEGORY 1/2 AC AND AAC RUNWAYS**

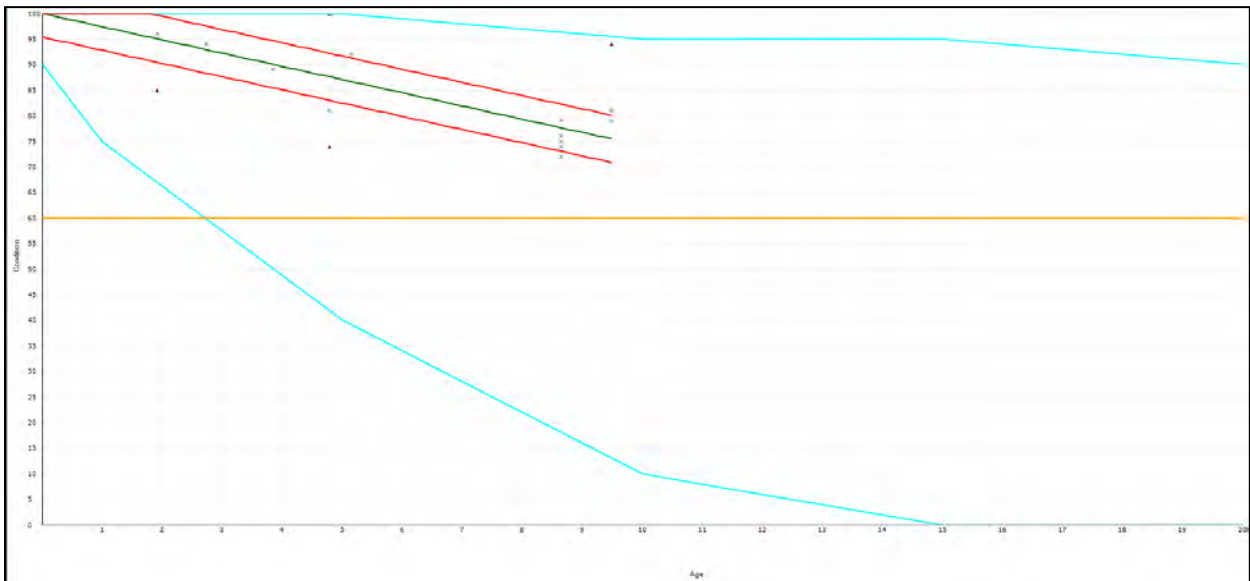

**Figure 4C - CONDITION PREDICTION MODEL FOR CENTRAL CATEGORY 1/2 AAC TAXIWAYS**

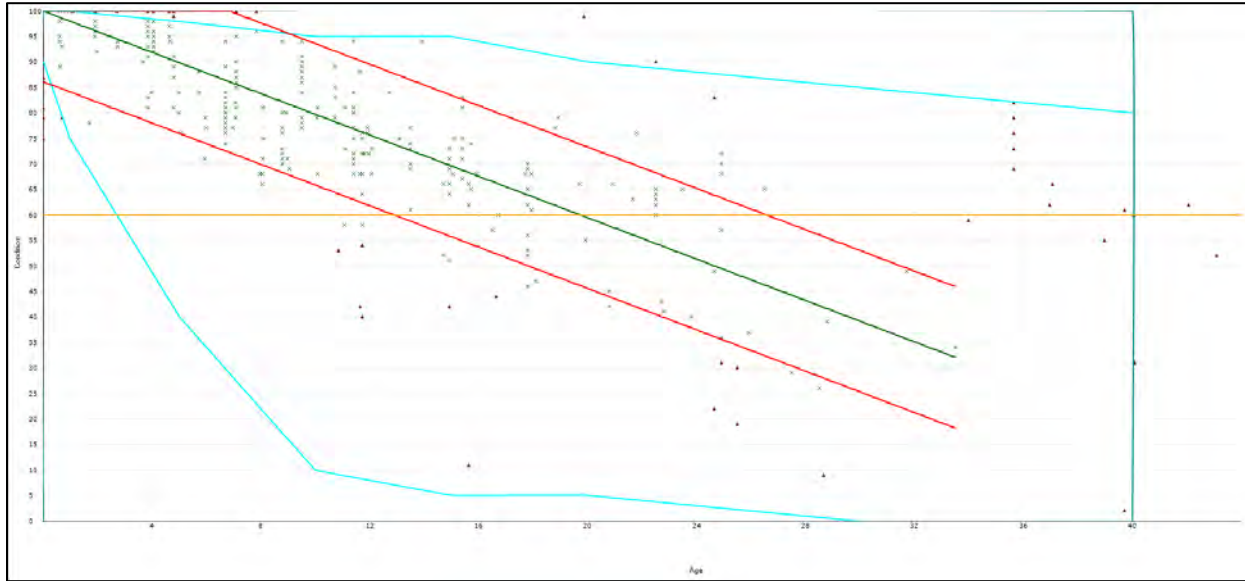

**Figure 5C - CONDITION PREDICTION MODEL FOR CENTRAL CATEGORY 1/2 AC TAXIWAYS**

### **C.3 CRITICAL PAVEMENT CONDITION INDEX**

Each of the condition-prediction models have an assigned critical PCI. The critical PCI is the point at which the pavement condition begins to deteriorate more quickly over time. As the condition deteriorates to a worse state, major M&R is triggered because the cost to apply localized M&R increases significantly. Pavement sections with PCI above the critical value are given a higher priority for funding during budget analysis in order to prevent them from deteriorating to the point where more costly rehabilitation is necessary. We used the following critical PCI values at Bend Airport:

- Runways – 65
- Taxiways/Taxilanes – 60
- Aprons – 50

### **C.4 FUTURE CONDITION ANALYSIS**

As previously discussed, the projected condition of each pavement section was determined for 5- and 10-year periods. The projected pavement conditions in 5 years and 10 years for each pavement section at Bend Airport, along with the conditions at the previous inspection, are listed in Table 1C.

### **C.5 FUNCTIONAL REMAINING LIFE**

As mentioned above, functional remaining life is the practical amount of time a pavement is in service before requiring rehabilitation, as estimated based solely on visual condition.

This is not to be confused with structural remaining life, which requires analysis of the structural capacity of a pavement.

We calculated two forms of functional remaining life based on the current visual condition surveys of the pavement at Bend Airport, the time until rehabilitation, and the time until the pavement is no longer operational due to high foreign object debris potential and increased safety concerns for trafficking aircraft (PCI less than 40). The results of the functional life analysis are provided in Table 2C.

**Table 1C - PAST, PRESENT, AND FUTURE PCI**

| BranchID   | SectionID | Past Inspection PCI | Current PCI | Predicted Future PCI |      |
|------------|-----------|---------------------|-------------|----------------------|------|
|            |           | 2016                | 2022        | 2027                 | 2032 |
| A01BE      | 01        | 98                  | 92          | 76                   | 64   |
| A02BE      | 01        | 99                  | 93          | 77                   | 65   |
| A02BE      | 02        | 66                  | 52          | 37                   | 17   |
| A02BE      | 03        | 59                  | 62          | 59                   | 55   |
| A02BE      | 04        | 72                  | 58          | 51                   | 36   |
| A02BE      | 05        | 8                   | 94          | 78                   | 66   |
| A02BE      | 06        | 42                  | 94          | 78                   | 66   |
| A02BE      | 07        | --                  | 92          | 76                   | 64   |
| A03BE      | 01        | 64                  | 53          | 39                   | 19   |
| A03BE      | 02        | 53                  | 52          | 37                   | 17   |
| A04BE      | 01        | 91                  | 89          | 73                   | 63   |
| A04BE      | 02        | --                  | 76          | 65                   | 60   |
| A05BE      | 01        | 68                  | 49          | 32                   | 12   |
| A05BE      | 02        | 85                  | 76          | 65                   | 60   |
| A06BE      | 01        | 78                  | 72          | 63                   | 59   |
| A07BE      | 01        | 100                 | 87          | 71                   | 63   |
| A07BE      | 02        | 71                  | 64          | 60                   | 57   |
| A07BE      | 03        | 70                  | 66          | 61                   | 58   |
| A07BE      | 04        | 49                  | 25          | 6                    | 0    |
| A08BE      | 01        | 27                  | 17          | 0                    | 0    |
| A08BE      | 02        | 49                  | 22          | 4                    | 0    |
| A08BE      | 03        | 100                 | 49          | 32                   | 12   |
| A08BE      | 04        | 57                  | 64          | 60                   | 57   |
| A08BE      | 05        | 62                  | 60          | 57                   | 49   |
| A08BE      | 06        | 69                  | 71          | 62                   | 59   |
| A08BE      | 07        | 98                  | 83          | 69                   | 61   |
| A08BE      | 08        | --                  | 60          | 58                   | 57   |
| A08BE      | 09        | --                  | 25          | 22                   | 18   |
| A08BE      | 10        | --                  | 69          | 68                   | 66   |
| A08BE      | 11        | --                  | 28          | 25                   | 21   |
| A08BE      | 12        | --                  | 33          | 30                   | 28   |
| A09BE      | 01        | 74                  | 65          | 60                   | 57   |
| A09BE      | 02        | --                  | 96          | 93                   | 89   |
| A10BE      | 01        | 49                  | 94          | 78                   | 66   |
| A10BE      | 02        | 30                  | 50          | 34                   | 13   |
| A10BE      | 03        | 80                  | 24          | 5                    | 0    |
| A10BE      | 04        | --                  | 47          | 44                   | 40   |
| A11BE      | 01        | 66                  | 45          | 26                   | 7    |
| AHELIBE    | 01        | 100                 | 94          | 78                   | 66   |
| AHELIBE    | 02        | 100                 | 94          | 78                   | 66   |
| AHELIBE    | 03        | 100                 | 100         | 97                   | 93   |
| ATANHOLDBE | 01        | 80                  | 73          | 63                   | 60   |
| ATASHOLDBE | 01        | 96                  | 81          | 67                   | 61   |
| ATBNHOLDBE | 01        | 83                  | 80          | 67                   | 61   |
| ATBSHOLDBE | 01        | 81                  | 75          | 64                   | 60   |
| R16BE      | 01        | 84                  | 78          | 65                   | 53   |
| T01BE      | 01        | 77                  | 65          | 55                   | 45   |
| T02BE      | 01        | 76                  | 65          | 55                   | 45   |
| T03BE      | 01        | 100                 | 94          | 84                   | 74   |
| T03BE      | 02        | 41                  | 29          | 19                   | 9    |
| T03BE      | 03        | 45                  | 19          | 9                    | 0    |
| T03BE      | 04        | 6                   | 12          | 2                    | 0    |
| T03BE      | 05        | 9                   | 7           | 0                    | 0    |
| T03BE      | 06        | 39                  | 34          | 24                   | 14   |
| T03BE      | 07        | 65                  | 64          | 54                   | 44   |
| T04BE      | 01        | 42                  | 30          | 20                   | 10   |
| T04BE      | 02        | 29                  | 41          | 31                   | 21   |
| T05BE      | 01        | 40                  | 26          | 16                   | 6    |
| T05BE      | 02        | 69                  | 65          | 55                   | 45   |

**Table 1C - PAST, PRESENT, AND FUTURE PCI**

| BranchID | SectionID | Past Inspection PCI | Current PCI | Predicted Future PCI |      |
|----------|-----------|---------------------|-------------|----------------------|------|
|          |           | 2016                | 2022        | 2027                 | 2032 |
| T06BE    | 01        | 100                 | 79          | 69                   | 59   |
| T06BE    | 02        | 52                  | 63          | 53                   | 43   |
| T07BE    | 01        | 100                 | 86          | 76                   | 66   |
| T07BE    | 02        | 46                  | 90          | 80                   | 70   |
| T07BE    | 03        | 53                  | 21          | 11                   | 1    |
| T08BE    | 01        | 62                  | 64          | 54                   | 44   |
| T09BE    | 01        | 72                  | 57          | 47                   | 37   |
| T10BE    | 01        | 100                 | 91          | 81                   | 71   |
| T10BE    | 02        | 53                  | 90          | 80                   | 70   |
| T11BE    | 01        | 100                 | 94          | 84                   | 74   |
| TA1BE    | 01        | 79                  | 67          | 57                   | 47   |
| TA1BE    | 02        | 74                  | 79          | 66                   | 53   |
| TA2BE    | 01        | 79                  | 83          | 73                   | 63   |
| TA2BE    | 02        | 81                  | 81          | 68                   | 55   |
| TA3BE    | 01        | 83                  | 71          | 61                   | 51   |
| TA3BE    | 02        | 81                  | 84          | 74                   | 64   |
| TA4BE    | 01        | 89                  | 81          | 71                   | 61   |
| TA4BE    | 02        | 91                  | 78          | 68                   | 58   |
| TA5BE    | 01        | 89                  | 75          | 65                   | 55   |
| TA5BE    | 02        | 91                  | 77          | 67                   | 57   |
| TA6BE    | 01        | 85                  | 73          | 63                   | 53   |
| TA6BE    | 02        | 100                 | 94          | 81                   | 68   |
| TABE     | 01        | 100                 | 87          | 77                   | 67   |
| TAEROBE  | 01        | 70                  | 69          | 59                   | 49   |
| TAEROBE  | 02        | 72                  | 70          | 60                   | 50   |
| TAEROBE  | 03        | 73                  | 61          | 51                   | 41   |
| TAEROBE  | 04        | 80                  | 70          | 60                   | 50   |
| TAEROBE  | 05        | 76                  | 74          | 64                   | 54   |
| TAEROBE  | 06        | 76                  | 77          | 67                   | 57   |
| TAEROBE  | 07        | 77                  | 73          | 63                   | 53   |
| TAEROBE  | 08        | 71                  | 70          | 60                   | 50   |
| TB1BE    | 01        | 84                  | 75          | 65                   | 55   |
| TB2BE    | 01        | 76                  | 75          | 65                   | 55   |
| TB2BE    | 02        | --                  | 80          | 70                   | 60   |
| TB3BE    | 01        | 82                  | 71          | 61                   | 51   |
| TB3BE    | 02        | --                  | 84          | 74                   | 64   |
| TB4BE    | 01        | 84                  | 75          | 65                   | 55   |
| TB4BE    | 02        | --                  | 75          | 65                   | 55   |
| TB5BE    | 01        | 83                  | 68          | 58                   | 48   |
| TB5BE    | 02        | --                  | 70          | 60                   | 50   |
| TB6BE    | 01        | 79                  | 77          | 67                   | 57   |
| TB6BE    | 02        | --                  | 70          | 60                   | 50   |
| TBBBE    | 01        | 82                  | 81          | 71                   | 61   |
| TBBE     | 01        | 80                  | 72          | 62                   | 52   |
| THELIBE  | 01        | 100                 | 94          | 84                   | 74   |
| THELIBE  | 02        | 100                 | 94          | 84                   | 74   |
| TLA10BE  | 01        | 87                  | 89          | 79                   | 69   |
| TLA10BE  | 02        | 70                  | 60          | 50                   | 40   |
| TLA7BE   | 01        | 99                  | 88          | 78                   | 68   |
| TLA8BE   | 01        | 89                  | 90          | 80                   | 70   |
| TLA8BE   | 02        | 94                  | 69          | 59                   | 49   |
| TLA9BE   | 01        | 87                  | 89          | 79                   | 69   |
| TLA9BE   | 02        | 56                  | 62          | 52                   | 42   |
| TLCBE    | 01        | 89                  | 75          | 65                   | 55   |
| TLEBE    | 01        | 94                  | 94          | 84                   | 74   |

Abbreviations:

PCI = Pavement Condition Index

**Table 2C - BEND AIRPORT FUNCTIONAL REMAINING LIFE ANALYSIS**

| Branch ID  | Section ID | Surface Type | Current PCI | Years to Major | Major M&R Trigger | Years to End of    |
|------------|------------|--------------|-------------|----------------|-------------------|--------------------|
|            |            |              |             | M&R            | PCI <sup>1</sup>  | Functional Service |
| A01BE      | 01         | AC           | 92          | > 20           | 50                | > 20               |
| A02BE      | 01         | AC           | 93          | > 20           | 50                | > 20               |
| A02BE      | 02         | AC           | 52          | 0 - 5          | 50                | 0 - 5              |
| A02BE      | 03         | AC           | 62          | 11 - 15        | 50                | 11 - 15            |
| A02BE      | 04         | AC           | 58          | 0 - 5          | 50                | 6 - 10             |
| A02BE      | 05         | AC           | 94          | > 20           | 50                | > 20               |
| A02BE      | 06         | AC           | 94          | > 20           | 50                | > 20               |
| A02BE      | 07         | AC           | 92          | > 20           | 50                | > 20               |
| A03BE      | 01         | AC           | 53          | 0 - 5          | 50                | 0 - 5              |
| A03BE      | 02         | AC           | 52          | 0 - 5          | 50                | 0 - 5              |
| A04BE      | 01         | AC           | 89          | > 20           | 50                | > 20               |
| A04BE      | 02         | AC           | 76          | > 20           | 50                | > 20               |
| A05BE      | 01         | AC           | 49          | 0 - 5          | 50                | 0 - 5              |
| A05BE      | 02         | AAC          | 76          | > 20           | 50                | > 20               |
| A06BE      | 01         | AC           | 72          | 16 - 20        | 50                | > 20               |
| A07BE      | 01         | AC           | 87          | > 20           | 50                | > 20               |
| A07BE      | 02         | AC           | 64          | 11 - 15        | 50                | 16 - 20            |
| A07BE      | 03         | AC           | 66          | 11 - 15        | 50                | 16 - 20            |
| A07BE      | 04         | AC           | 25          | 0 - 5          | 50                | 0 - 5              |
| A08BE      | 01         | AC           | 17          | 0 - 5          | 50                | 0 - 5              |
| A08BE      | 02         | AC           | 22          | 0 - 5          | 50                | 0 - 5              |
| A08BE      | 03         | AC           | 49          | 0 - 5          | 50                | 0 - 5              |
| A08BE      | 04         | AC           | 64          | 11 - 15        | 50                | 16 - 20            |
| A08BE      | 05         | AC           | 60          | 6 - 10         | 50                | 11 - 15            |
| A08BE      | 06         | AC           | 71          | 16 - 20        | 50                | > 20               |
| A08BE      | 07         | AC           | 83          | > 20           | 50                | > 20               |
| A08BE      | 08         | AC           | 60          | > 20           | 50                | > 20               |
| A08BE      | 09         | PCC          | 25          | 0 - 5          | 50                | 0 - 5              |
| A08BE      | 10         | AC           | 69          | > 20           | 50                | > 20               |
| A08BE      | 11         | PCC          | 28          | 0 - 5          | 50                | 0 - 5              |
| A08BE      | 12         | AC           | 33          | 0 - 5          | 50                | 0 - 5              |
| A09BE      | 01         | AC           | 65          | 11 - 15        | 50                | 16 - 20            |
| A09BE      | 02         | PCC          | 96          | > 20           | 50                | > 20               |
| A10BE      | 01         | AC           | 94          | > 20           | 50                | > 20               |
| A10BE      | 02         | AC           | 50          | 0 - 5          | 50                | 0 - 5              |
| A10BE      | 03         | AC           | 24          | 0 - 5          | 50                | 0 - 5              |
| A10BE      | 04         | PCC          | 47          | 0 - 5          | 50                | 6 - 10             |
| A11BE      | 01         | AC           | 45          | 0 - 5          | 50                | 0 - 5              |
| AHELIBE    | 01         | AC           | 94          | > 20           | 50                | > 20               |
| AHELIBE    | 02         | AC           | 94          | > 20           | 50                | > 20               |
| AHELIBE    | 03         | PCC          | 100         | > 20           | 50                | > 20               |
| ATANHOLDBE | 01         | AC           | 73          | 16 - 20        | 50                | > 20               |
| ATASHOLDBE | 01         | AC           | 81          | > 20           | 50                | > 20               |
| ATBNHOLDBE | 01         | AC           | 80          | > 20           | 50                | > 20               |
| ATBSHOLDBE | 01         | AC           | 75          | > 20           | 50                | > 20               |
| R16BE      | 01         | AC           | 78          | 0 - 5          | 65                | 11 - 15            |
| T01BE      | 01         | AC           | 65          | 0 - 5          | 60                | 11 - 15            |
| T02BE      | 01         | AC           | 65          | 0 - 5          | 60                | 11 - 15            |
| T03BE      | 01         | AC           | 94          | 16 - 20        | 60                | > 20               |
| T03BE      | 02         | AC           | 29          | 0 - 5          | 60                | 0 - 5              |
| T03BE      | 03         | AC           | 19          | 0 - 5          | 60                | 0 - 5              |
| T03BE      | 04         | AC           | 12          | 0 - 5          | 60                | 0 - 5              |
| T03BE      | 05         | AC           | 7           | 0 - 5          | 60                | 0 - 5              |
| T03BE      | 06         | AC           | 34          | 0 - 5          | 60                | 0 - 5              |
| T03BE      | 07         | AC           | 64          | 0 - 5          | 60                | 11 - 15            |

**Table 2C - BEND AIRPORT FUNCTIONAL REMAINING LIFE ANALYSIS**

| Branch ID | Section ID | Surface Type | Current PCI | Years to Major | Major M&R Trigger | Years to End of    |
|-----------|------------|--------------|-------------|----------------|-------------------|--------------------|
|           |            |              |             | M&R            | PCI <sup>1</sup>  | Functional Service |
| T04BE     | 01         | AC           | 30          | 0 - 5          | 60                | 0 - 5              |
| T04BE     | 02         | AC           | 41          | 0 - 5          | 60                | 0 - 5              |
| T05BE     | 01         | AC           | 26          | 0 - 5          | 60                | 0 - 5              |
| T05BE     | 02         | AC           | 65          | 0 - 5          | 60                | 11 - 15            |
| T06BE     | 01         | AC           | 79          | 6 - 10         | 60                | > 20               |
| T06BE     | 02         | AC           | 63          | 0 - 5          | 60                | 11 - 15            |
| T07BE     | 01         | AC           | 86          | 11 - 15        | 60                | > 20               |
| T07BE     | 02         | AC           | 90          | 11 - 15        | 60                | > 20               |
| T07BE     | 03         | AC           | 21          | 0 - 5          | 60                | 0 - 5              |
| T08BE     | 01         | AC           | 64          | 0 - 5          | 60                | 11 - 15            |
| T09BE     | 01         | AC           | 57          | 0 - 5          | 60                | 6 - 10             |
| T10BE     | 01         | AC           | 91          | 11 - 15        | 60                | > 20               |
| T10BE     | 02         | AC           | 90          | 11 - 15        | 60                | > 20               |
| T11BE     | 01         | AC           | 94          | 16 - 20        | 60                | > 20               |
| TA1BE     | 01         | AC           | 67          | 0 - 5          | 60                | 11 - 15            |
| TA1BE     | 02         | AAC          | 79          | 6 - 10         | 60                | 11 - 15            |
| TA2BE     | 01         | AC           | 83          | 11 - 15        | 60                | > 20               |
| TA2BE     | 02         | AAC          | 81          | 6 - 10         | 60                | 11 - 15            |
| TA3BE     | 01         | AC           | 71          | 0 - 5          | 60                | 11 - 15            |
| TA3BE     | 02         | AC           | 84          | 11 - 15        | 60                | > 20               |
| TA4BE     | 01         | AC           | 81          | 6 - 10         | 60                | > 20               |
| TA4BE     | 02         | AC           | 78          | 6 - 10         | 60                | 16 - 20            |
| TA5BE     | 01         | AC           | 75          | 6 - 10         | 60                | 16 - 20            |
| TA5BE     | 02         | AC           | 77          | 6 - 10         | 60                | 16 - 20            |
| TA6BE     | 01         | AC           | 73          | 6 - 10         | 60                | 16 - 20            |
| TA6BE     | 02         | AAC          | 94          | 11 - 15        | 60                | > 20               |
| TABE      | 01         | AC           | 87          | 11 - 15        | 60                | > 20               |
| TAEROBE   | 01         | AC           | 69          | 0 - 5          | 60                | 11 - 15            |
| TAEROBE   | 02         | AC           | 70          | 0 - 5          | 60                | 11 - 15            |
| TAEROBE   | 03         | AC           | 61          | 0 - 5          | 60                | 6 - 10             |
| TAEROBE   | 04         | AC           | 70          | 0 - 5          | 60                | 11 - 15            |
| TAEROBE   | 05         | AC           | 74          | 6 - 10         | 60                | 16 - 20            |
| TAEROBE   | 06         | AC           | 77          | 6 - 10         | 60                | 16 - 20            |
| TAEROBE   | 07         | AC           | 73          | 6 - 10         | 60                | 16 - 20            |
| TAEROBE   | 08         | AC           | 70          | 0 - 5          | 60                | 11 - 15            |
| TB1BE     | 01         | AC           | 75          | 6 - 10         | 60                | 16 - 20            |
| TB2BE     | 01         | AC           | 75          | 6 - 10         | 60                | 16 - 20            |
| TB2BE     | 02         | AC           | 80          | 6 - 10         | 60                | > 20               |
| TB3BE     | 01         | AC           | 71          | 0 - 5          | 60                | 11 - 15            |
| TB3BE     | 02         | AC           | 84          | 11 - 15        | 60                | > 20               |
| TB4BE     | 01         | AC           | 75          | 6 - 10         | 60                | 16 - 20            |
| TB4BE     | 02         | AC           | 75          | 6 - 10         | 60                | 16 - 20            |
| TB5BE     | 01         | AC           | 68          | 0 - 5          | 60                | 11 - 15            |
| TB5BE     | 02         | AC           | 70          | 0 - 5          | 60                | 11 - 15            |
| TB6BE     | 01         | AC           | 77          | 6 - 10         | 60                | 16 - 20            |
| TB6BE     | 02         | AC           | 70          | 0 - 5          | 60                | 11 - 15            |
| TBBBE     | 01         | AC           | 81          | 6 - 10         | 60                | > 20               |
| TBBE      | 01         | AC           | 72          | 0 - 5          | 60                | 11 - 15            |
| THELIBE   | 01         | AC           | 94          | 16 - 20        | 60                | > 20               |
| THELIBE   | 02         | AC           | 94          | 16 - 20        | 60                | > 20               |
| TLA10BE   | 01         | AC           | 89          | 11 - 15        | 60                | > 20               |
| TLA10BE   | 02         | AC           | 60          | 0 - 5          | 60                | 6 - 10             |
| TLA7BE    | 01         | AC           | 88          | 11 - 15        | 60                | > 20               |
| TLA8BE    | 01         | AC           | 90          | 11 - 15        | 60                | > 20               |
| TLA8BE    | 02         | AC           | 69          | 0 - 5          | 60                | 11 - 15            |

**Table 2C - BEND AIRPORT FUNCTIONAL REMAINING LIFE ANALYSIS**

| Branch ID | Section ID | Surface Type | Current PCI | Years to Major M&R | Major M&R Trigger PCI <sup>1</sup> | Years to End of Functional Service |
|-----------|------------|--------------|-------------|--------------------|------------------------------------|------------------------------------|
| TLA9BE    | 01         | AC           | 89          | 11 - 15            | 60                                 | > 20                               |
| TLA9BE    | 02         | AC           | 62          | 0 - 5              | 60                                 | 6 - 10                             |
| TLCBE     | 01         | AC           | 75          | 6 - 10             | 60                                 | 16 - 20                            |
| TLEBE     | 01         | AC           | 94          | 16 - 20            | 60                                 | > 20                               |

Abbreviations:

M&R = Maintenance and Rehabilitation; AC = Asphalt Concrete, AAC = AC overlaid AC,  
PCC = Portland Cement Concrete

<sup>1</sup> Major M&R Trigger PCI = Critical PCI

## **APPENDIX D**

---

### *Unit Cost Data and Maintenance and Rehabilitation Plan*

## APPENDIX D

### UNIT COST DATA AND MAINTENANCE AND REHABILITATION PLAN

#### D.1 ANALYSIS METHODOLOGY

We evaluated the M&R needs, as determined from the PAVER analysis results, in order to develop project recommendations for the next five years. The purpose of this analysis is to determine the M&R needs of the Bend Airport pavement network condition over time. We used PAVER v7 software to develop network-level project recommendations for the next five years.

The PAVER M&R Work Planning Module identifies when and where M&R is required and how much it will cost. M&R plans can be developed either by assuming an annual budget or by identifying specific constraints, such as a condition goal to determine the budget required to meet the goal. The M&R work planning analysis was based on a five-year period beginning on August 1, 2023. A backlog elimination analysis scenario was selected to generate a list of global maintenance and rehabilitation projects in order to optimize the allocation of capital and establish preservation-based project recommendations. The repair strategies considered for pavement sections in our analysis are as follows:

- Reconstruction – Considered for pavements with a PCI less than 40.
- Flexible Overlay – Considered for pavements between 40 PCI and the critical PCI, and for pavements exhibiting significant load-related distresses.
- Global Maintenance – Treatments (fog seal, slurry seal, thin AC overlay) applied to an entire pavement section with the intent of slowing the rate of deterioration.
- Localized Maintenance – Maintenance performed on a routine basis such as crack sealing, wide crack repair, and patching.

It should be noted that the five-year list of recommended projects only includes the highest-cost maintenance items and does not include routine localized maintenance (e.g., crack sealing) work that should also be conducted in addition to and concurrently with the five-year work plan.

##### D.1.1 Pavement Rank and Use Prioritization

Pavement sections are assigned a rank to establish their relative importance in the overall pavement network, which is most commonly defined by their use (e.g., Taxiway, Apron, Runway). The PAVER analysis uses the combination of the section rank and the branch use

to define the priority of each section during the M&R analysis. Table 1D displays the branch use and section rank prioritization schema we used for analysis.

**Table 1D: M&R WORK PRIORITY BY BRANCH USE AND SECTION RANK**

| Branch Use | Section Rank |           |          |
|------------|--------------|-----------|----------|
|            | Primary      | Secondary | Tertiary |
| RUNWAY     | 1            | 3         | 6        |
| TAXIWAY    | 2            | 5         | 8        |
| APRON      | 4            | 7         | 9        |

## D.2 MAINTENANCE POLICIES AND UNIT COSTS

The distress-maintenance policies are policies that determine what type of work should be applied to a specific distress type and severity. For example, on an AC pavement, a medium-severity longitudinal/transverse crack would be repaired by crack sealing. Policies for all distress types and severities are established by ASTM D5340.

Although our work scope does not include budget analysis, we did assign construction costs to the maintenance work so that PAVER would allocate M&R projects that were approximately equal in cost for each year of the five-year period. The anticipated cost of performing M&R is based on cost tables that relate M&R work type cost to PCI. We reviewed the unit costs from the 2017 report and updated them by reviewing the bid tabulations for recent projects within the vicinity of Bend Airport and information provided by the project team. The costs for reconstruction are based on the existing pavement sections present within each branch use at Bend Airport. The costs represent the fully-loaded costs and include aspects of the project such as administration, contingencies, mobilization, and striping. The cost tables used in the analysis are presented in Table 2D below.

**Table 2D: BEND AIRPORT UNIT COST DATA**

| Type of M&R              | Work Type                              | Unit Cost | Work Unit |
|--------------------------|----------------------------------------|-----------|-----------|
| Major M&R                | Complete Reconstruction with AC        | \$18.50   | Sq Ft     |
|                          | Cold Mill and Overlay – 3 Inches Thick | \$7.30    | Sq Ft     |
| Global M&R               | Surface Treatment - Slurry Seal        | \$0.33    | Sq Ft     |
|                          | Surface Treatment - Fog Seal           | \$0.20    | Sq Ft     |
|                          | Crack Sealing - AC                     | \$2.00    | Ft        |
|                          | Crack Sealing - PCC                    | \$15.00   | Ft        |
| Localized Preventive M&R | Crack Sealing – Wide Cracks            | \$33.00   | Ft        |
|                          | AC Patching – Full Depth               | \$50.00   | Sq Ft     |
|                          | PCC Patching – Full Depth              | \$100.00  | Sq Ft     |

### **D.3 RECOMMENDED LOCALIZED MAINTENANCE**

In order to properly maintain aging pavements, localized M&R activities such as crack sealing and patching should be performed on a routine basis. A list of recommended localized maintenance activities is provided in Table 3D of this appendix.

### **D.4 RECOMMENDED GLOBAL MAINTENANCE AND REHABILITATION PROJECTS**

Global maintenance and rehabilitation projects refer to activities such as slurry seal and thin AC overlays, as well as thick AC overlays and reconstruction. A list of recommended global M&R activities is provided in Table 4D of this appendix.

**Table 3D - BEND AIRPORT NETWORK MAINTENANCE REPORT**

| Network | Branch ID | Section ID | Distress                | Severity | Action                   | Work Quantity | Unit | Unit Cost | Work Cost | Section Total |
|---------|-----------|------------|-------------------------|----------|--------------------------|---------------|------|-----------|-----------|---------------|
| Bend    | A01BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 42            | Ft   | \$2.00    | \$85      | \$85          |
| Bend    | A02BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 50            | Ft   | \$2.00    | \$100     | \$100         |
| Bend    | A02BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 9,637         | Ft   | \$2.00    | \$19,274  | \$47,183      |
| Bend    | A02BE     | 02         | Long. & Trans. Cracking | High     | Crack Seal - Wide Cracks | 99            | Ft   | \$33.00   | \$3,265   |               |
| Bend    | A02BE     | 02         | Alligator Cracking      | Medium   | Patching - AC Deep       | 493           | SqFt | \$50.00   | \$24,645  |               |
| Bend    | A02BE     | 03         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 2,316         | Ft   | \$2.00    | \$4,631   | \$6,777       |
| Bend    | A02BE     | 03         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 1,073         | Ft   | \$2.00    | \$2,145   |               |
| Bend    | A02BE     | 04         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 3,452         | Ft   | \$2.00    | \$6,905   | \$13,468      |
| Bend    | A02BE     | 04         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 811           | Ft   | \$2.00    | \$1,623   |               |
| Bend    | A02BE     | 04         | Alligator Cracking      | Medium   | Patching - AC Deep       | 99            | SqFt | \$50.00   | \$4,940   |               |
| Bend    | A02BE     | 06         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 14            | Ft   | \$2.00    | \$29      | \$29          |
| Bend    | A02BE     | 07         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 5             | Ft   | \$2.00    | \$10      | \$10          |
| Bend    | A03BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 798           | Ft   | \$2.00    | \$1,596   | \$27,894      |
| Bend    | A03BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 1,671         | Ft   | \$2.00    | \$3,342   |               |
| Bend    | A03BE     | 01         | Alligator Cracking      | Medium   | Patching - AC Deep       | 460           | SqFt | \$50.00   | \$22,956  |               |
| Bend    | A03BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 417           | Ft   | \$2.00    | \$834     | \$7,396       |
| Bend    | A03BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 220           | Ft   | \$2.00    | \$440     |               |
| Bend    | A03BE     | 02         | Alligator Cracking      | Medium   | Patching - AC Deep       | 123           | SqFt | \$50.00   | \$6,122   |               |
| Bend    | A04BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 414           | Ft   | \$2.00    | \$828     | \$828         |
| Bend    | A04BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 236           | Ft   | \$2.00    | \$472     | \$512         |
| Bend    | A04BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 20            | Ft   | \$2.00    | \$40      |               |
| Bend    | A05BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 412           | Ft   | \$2.00    | \$824     | \$7,934       |
| Bend    | A05BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 508           | Ft   | \$2.00    | \$1,016   |               |
| Bend    | A05BE     | 01         | Alligator Cracking      | High     | Patching - AC Deep       | 80            | SqFt | \$50.00   | \$3,994   |               |
| Bend    | A05BE     | 01         | Alligator Cracking      | Medium   | Patching - AC Deep       | 42            | SqFt | \$50.00   | \$2,100   |               |
| Bend    | A05BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 243           | Ft   | \$2.00    | \$486     | \$548         |
| Bend    | A05BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 31            | Ft   | \$2.00    | \$62      |               |
| Bend    | A06BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 298           | Ft   | \$2.00    | \$596     | \$3,352       |
| Bend    | A06BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 636           | Ft   | \$2.00    | \$1,271   |               |
| Bend    | A06BE     | 01         | Alligator Cracking      | Medium   | Patching - AC Deep       | 30            | SqFt | \$50.00   | \$1,485   |               |
| Bend    | A07BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 94            | Ft   | \$2.00    | \$187     | \$187         |
| Bend    | A07BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 639           | Ft   | \$2.00    | \$1,278   | \$1,300       |
| Bend    | A07BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 11            | Ft   | \$2.00    | \$22      |               |
| Bend    | A07BE     | 03         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 204           | Ft   | \$2.00    | \$408     | \$1,624       |
| Bend    | A07BE     | 03         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 608           | Ft   | \$2.00    | \$1,216   |               |
| Bend    | A07BE     | 04         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 253           | Ft   | \$2.00    | \$506     | \$50,462      |
| Bend    | A07BE     | 04         | Alligator Cracking      | Medium   | Patching - AC Deep       | 999           | SqFt | \$50.00   | \$49,956  |               |
| Bend    | A08BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 300           | Ft   | \$2.00    | \$600     | \$78,330      |
| Bend    | A08BE     | 01         | Alligator Cracking      | Medium   | Patching - AC Deep       | 1,554         | SqFt | \$50.00   | \$77,730  |               |
| Bend    | A08BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 336           | Ft   | \$2.00    | \$672     | \$58,299      |
| Bend    | A08BE     | 02         | Alligator Cracking      | Medium   | Patching - AC Deep       | 1,153         | SqFt | \$50.00   | \$57,627  |               |

**Table 3D - BEND AIRPORT NETWORK MAINTENANCE REPORT**

| Network | Branch ID  | Section ID | Distress                | Severity | Action                    | Work Quantity | Unit | Unit Cost | Work Cost | Section Total |
|---------|------------|------------|-------------------------|----------|---------------------------|---------------|------|-----------|-----------|---------------|
| Bend    | A08BE      | 03         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 516           | Ft   | \$2.00    | \$1,032   | \$10,227      |
| Bend    | A08BE      | 03         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 100           | Ft   | \$2.00    | \$200     |               |
| Bend    | A08BE      | 03         | Alligator Cracking      | Medium   | Patching - AC Deep        | 180           | SqFt | \$50.00   | \$8,995   |               |
| Bend    | A08BE      | 04         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 305           | Ft   | \$2.00    | \$610     | \$610         |
| Bend    | A08BE      | 05         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 236           | Ft   | \$2.00    | \$472     | \$2,139       |
| Bend    | A08BE      | 05         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 432           | Ft   | \$2.00    | \$864     |               |
| Bend    | A08BE      | 05         | Alligator Cracking      | Medium   | Patching - AC Deep        | 16            | SqFt | \$50.00   | \$803     |               |
| Bend    | A08BE      | 06         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 429           | Ft   | \$2.00    | \$858     | \$858         |
| Bend    | A08BE      | 07         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 52            | Ft   | \$2.00    | \$103     | \$863         |
| Bend    | A08BE      | 07         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 380           | Ft   | \$2.00    | \$760     |               |
| Bend    | A08BE      | 08         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 5             | Ft   | \$2.00    | \$10      |               |
| Bend    | A08BE      | 08         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 70            | Ft   | \$2.00    | \$140     | \$1,143       |
| Bend    | A08BE      | 08         | Alligator Cracking      | Medium   | Patching - AC Deep        | 19            | SqFt | \$50.00   | \$993     |               |
| Bend    | A08BE      | 09         | Linear Cracking         | Medium   | Crack Sealing - PCC       | 48            | Ft   | \$15.00   | \$720     |               |
| Bend    | A08BE      | 09         | Shattered Slab          | Low      | Crack Sealing - PCC       | 48            | Ft   | \$15.00   | \$720     | \$15,840      |
| Bend    | A08BE      | 09         | Shattered Slab          | High     | Patching - PCC Full Depth | 144           | SqFt | \$100.00  | \$14,400  |               |
| Bend    | A08BE      | 10         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 60            | Ft   | \$2.00    | \$120     |               |
| Bend    | A08BE      | 11         | Shattered Slab          | Low      | Crack Sealing - PCC       | 96            | Ft   | \$15.00   | \$1,440   | \$3,363       |
| Bend    | A08BE      | 11         | Corner Break            | Medium   | Crack Sealing - PCC       | 8             | Ft   | \$15.00   | \$123     |               |
| Bend    | A08BE      | 11         | Linear Cracking         | Medium   | Crack Sealing - PCC       | 24            | Ft   | \$15.00   | \$360     |               |
| Bend    | A08BE      | 11         | Linear Cracking         | Low      | Crack Sealing - PCC       | 48            | Ft   | \$15.00   | \$720     |               |
| Bend    | A08BE      | 11         | Shattered Slab          | Medium   | Crack Sealing - PCC       | 48            | Ft   | \$15.00   | \$720     |               |
| Bend    | A08BE      | 12         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 219           | Ft   | \$2.00    | \$438     | \$20,738      |
| Bend    | A08BE      | 12         | Alligator Cracking      | Medium   | Patching - AC Deep        | 406           | SqFt | \$50.00   | \$20,300  |               |
| Bend    | A09BE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 221           | Ft   | \$2.00    | \$443     |               |
| Bend    | A09BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 534           | Ft   | \$2.00    | \$1,068   | \$4,227       |
| Bend    | A09BE      | 01         | Alligator Cracking      | Medium   | Patching - AC Deep        | 54            | SqFt | \$50.00   | \$2,717   |               |
| Bend    | A10BE      | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 36            | Ft   | \$2.00    | \$72      |               |
| Bend    | A10BE      | 02         | Alligator Cracking      | Medium   | Patching - AC Deep        | 42            | SqFt | \$50.00   | \$2,100   | \$2,172       |
| Bend    | A10BE      | 03         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 70            | Ft   | \$2.00    | \$140     |               |
| Bend    | A10BE      | 03         | Alligator Cracking      | Medium   | Patching - AC Deep        | 579           | SqFt | \$50.00   | \$28,937  |               |
| Bend    | A10BE      | 04         | Shattered Slab          | Low      | Crack Sealing - PCC       | 64            | Ft   | \$15.00   | \$960     | \$2,400       |
| Bend    | A10BE      | 04         | Linear Cracking         | Medium   | Crack Sealing - PCC       | 16            | Ft   | \$15.00   | \$240     |               |
| Bend    | A10BE      | 04         | Linear Cracking         | Low      | Crack Sealing - PCC       | 80            | Ft   | \$15.00   | \$1,200   |               |
| Bend    | A11BE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 92            | Ft   | \$2.00    | \$184     | \$18,011      |
| Bend    | A11BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 354           | Ft   | \$2.00    | \$708     |               |
| Bend    | A11BE      | 01         | Alligator Cracking      | Medium   | Patching - AC Deep        | 342           | SqFt | \$50.00   | \$17,119  |               |
| Bend    | ATANHOLDBE | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 119           | Ft   | \$2.00    | \$239     | \$2,335       |
| Bend    | ATANHOLDBE | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 1,048         | Ft   | \$2.00    | \$2,096   |               |
| Bend    | ATASHOLDBE | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC        | 160           | Ft   | \$2.00    | \$320     |               |
| Bend    | ATASHOLDBE | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC        | 79            | Ft   | \$2.00    | \$159     | \$479         |

**Table 3D - BEND AIRPORT NETWORK MAINTENANCE REPORT**

| Network | Branch ID  | Section ID | Distress                | Severity | Action                   | Work Quantity | Unit | Unit Cost | Work Cost | Section Total |
|---------|------------|------------|-------------------------|----------|--------------------------|---------------|------|-----------|-----------|---------------|
| Bend    | ATBNHOLDBE | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 560           | Ft   | \$2.00    | \$1,121   | \$1,121       |
| Bend    | ATBSHOLDBE | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 625           | Ft   | \$2.00    | \$1,250   | \$1,250       |
| Bend    | R16BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 4,345         | Ft   | \$2.00    | \$8,690   | \$36,608      |
| Bend    | R16BE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 13,959        | Ft   | \$2.00    | \$27,918  |               |
| Bend    | T01BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 326           | Ft   | \$2.00    | \$652     | \$652         |
| Bend    | T02BE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 30            | Ft   | \$2.00    | \$60      | \$595         |
| Bend    | T02BE      | 01         | Alligator Cracking      | Low      | Crack Sealing - AC       | 11            | Ft   | \$2.00    | \$21      |               |
| Bend    | T02BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 257           | Ft   | \$2.00    | \$514     | \$12,108      |
| Bend    | T03BE      | 02         | Block Cracking          | Medium   | Crack Sealing - AC       | 122           | Ft   | \$2.00    | \$244     |               |
| Bend    | T03BE      | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 155           | Ft   | \$2.00    | \$310     | \$113,110     |
| Bend    | T03BE      | 02         | Alligator Cracking      | Medium   | Patching - AC Deep       | 231           | SqFt | \$50.00   | \$11,555  |               |
| Bend    | T03BE      | 03         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 623           | Ft   | \$2.00    | \$1,246   | \$140,462     |
| Bend    | T03BE      | 03         | Alligator Cracking      | Medium   | Patching - AC Deep       | 2,238         | SqFt | \$50.00   | \$111,864 |               |
| Bend    | T03BE      | 04         | Alligator Cracking      | Medium   | Patching - AC Deep       | 2,809         | SqFt | \$50.00   | \$140,462 | \$140,462     |
| Bend    | T03BE      | 05         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 15            | Ft   | \$2.00    | \$29      | \$510,981     |
| Bend    | T03BE      | 05         | Long. & Trans. Cracking | High     | Crack Seal - Wide Cracks | 49            | Ft   | \$33.00   | \$1,606   |               |
| Bend    | T03BE      | 05         | Alligator Cracking      | Medium   | Patching - AC Deep       | 6,164         | SqFt | \$50.00   | \$308,204 | \$6,773       |
| Bend    | T03BE      | 05         | Alligator Cracking      | High     | Patching - AC Deep       | 4,022         | SqFt | \$50.00   | \$201,143 |               |
| Bend    | T03BE      | 06         | Block Cracking          | Medium   | Crack Sealing - AC       | 488           | Ft   | \$2.00    | \$975     | \$404         |
| Bend    | T03BE      | 06         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 387           | Ft   | \$2.00    | \$774     |               |
| Bend    | T03BE      | 06         | Long. & Trans. Cracking | High     | Crack Seal - Wide Cracks | 47            | Ft   | \$33.00   | \$1,551   | \$83,681      |
| Bend    | T03BE      | 06         | Alligator Cracking      | High     | Patching - AC Deep       | 70            | SqFt | \$50.00   | \$3,473   |               |
| Bend    | T03BE      | 07         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 202           | Ft   | \$2.00    | \$404     | \$404         |
| Bend    | T04BE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 177           | Ft   | \$2.00    | \$354     | \$17,285      |
| Bend    | T04BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 534           | Ft   | \$2.00    | \$1,067   |               |
| Bend    | T04BE      | 01         | Alligator Cracking      | Medium   | Patching - AC Deep       | 1,434         | SqFt | \$50.00   | \$71,667  | \$136,346     |
| Bend    | T04BE      | 01         | Alligator Cracking      | High     | Patching - AC Deep       | 212           | SqFt | \$50.00   | \$10,592  |               |
| Bend    | T04BE      | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 472           | Ft   | \$2.00    | \$944     | \$740         |
| Bend    | T04BE      | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 80            | Ft   | \$2.00    | \$160     |               |
| Bend    | T04BE      | 02         | Long. & Trans. Cracking | High     | Crack Seal - Wide Cracks | 95            | Ft   | \$33.00   | \$3,135   | \$160         |
| Bend    | T04BE      | 02         | Alligator Cracking      | Medium   | Patching - AC Deep       | 260           | SqFt | \$50.00   | \$13,046  |               |
| Bend    | T05BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 133           | Ft   | \$2.00    | \$266     | \$60          |
| Bend    | T05BE      | 01         | Block Cracking          | Medium   | Crack Sealing - AC       | 558           | Ft   | \$2.00    | \$1,117   |               |
| Bend    | T05BE      | 01         | Alligator Cracking      | Medium   | Patching - AC Deep       | 2,700         | SqFt | \$50.00   | \$134,962 | \$160         |
| Bend    | T05BE      | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 30            | Ft   | \$2.00    | \$60      | \$160         |
| Bend    | T06BE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 80            | Ft   | \$2.00    | \$160     | \$740         |
| Bend    | T06BE      | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC       | 280           | Ft   | \$2.00    | \$560     |               |
| Bend    | T06BE      | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 90            | Ft   | \$2.00    | \$180     | \$740         |
| Bend    | T07BE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 70            | Ft   | \$2.00    | \$140     | \$140         |
| Bend    | T07BE      | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC       | 20            | Ft   | \$2.00    | \$40      | \$40          |

**Table 3D - BEND AIRPORT NETWORK MAINTENANCE REPORT**

| Network | Branch ID | Section ID | Distress                | Severity | Action             | Work Quantity | Unit | Unit Cost | Work Cost | Section Total |
|---------|-----------|------------|-------------------------|----------|--------------------|---------------|------|-----------|-----------|---------------|
| Bend    | T07BE     | 03         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 230           | Ft   | \$2.00    | \$460     | \$41,589      |
| Bend    | T07BE     | 03         | Alligator Cracking      | High     | Patching - AC Deep | 177           | SqFt | \$50.00   | \$8,818   |               |
| Bend    | T07BE     | 03         | Alligator Cracking      | Medium   | Patching - AC Deep | 646           | SqFt | \$50.00   | \$32,311  |               |
| Bend    | T08BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,708         | Ft   | \$2.00    | \$3,415   | \$4,912       |
| Bend    | T08BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 748           | Ft   | \$2.00    | \$1,496   |               |
| Bend    | T09BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 129           | Ft   | \$2.00    | \$258     |               |
| Bend    | T10BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 8             | Ft   | \$2.00    | \$16      | \$16          |
| Bend    | T10BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 8             | Ft   | \$2.00    | \$16      | \$16          |
| Bend    | TA1BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 7             | Ft   | \$2.00    | \$14      | \$1,545       |
| Bend    | TA1BE     | 01         | Alligator Cracking      | Low      | Crack Sealing - AC | 10            | Ft   | \$2.00    | \$19      |               |
| Bend    | TA1BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 512           | Ft   | \$2.00    | \$1,024   |               |
| Bend    | TA1BE     | 01         | Block Cracking          | Low      | Crack Sealing - AC | 244           | Ft   | \$2.00    | \$488     |               |
| Bend    | TA1BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 60            | Ft   | \$2.00    | \$120     | \$120         |
| Bend    | TA2BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 157           | Ft   | \$2.00    | \$315     | \$443         |
| Bend    | TA2BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 64            | Ft   | \$2.00    | \$128     |               |
| Bend    | TA2BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 100           | Ft   | \$2.00    | \$200     |               |
| Bend    | TA3BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 146           | Ft   | \$2.00    | \$292     | \$516         |
| Bend    | TA3BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 112           | Ft   | \$2.00    | \$224     |               |
| Bend    | TA3BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 70            | Ft   | \$2.00    | \$140     |               |
| Bend    | TA4BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 69            | Ft   | \$2.00    | \$138     | \$723         |
| Bend    | TA4BE     | 01         | Patching                | High     | Patching - AC Deep | 12            | SqFt | \$50.00   | \$585     |               |
| Bend    | TA4BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 45            | Ft   | \$2.00    | \$90      |               |
| Bend    | TA4BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 25            | Ft   | \$2.00    | \$50      | \$140         |
| Bend    | TA5BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 111           | Ft   | \$2.00    | \$222     | \$256         |
| Bend    | TA5BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 17            | Ft   | \$2.00    | \$34      |               |
| Bend    | TA5BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 50            | Ft   | \$2.00    | \$100     |               |
| Bend    | TA5BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 22            | Ft   | \$2.00    | \$44      | \$144         |
| Bend    | TA6BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 310           | Ft   | \$2.00    | \$620     | \$914         |
| Bend    | TA6BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 19            | Ft   | \$2.00    | \$38      |               |
| Bend    | TA6BE     | 01         | Block Cracking          | Medium   | Crack Sealing - AC | 122           | Ft   | \$2.00    | \$244     |               |
| Bend    | TA6BE     | 01         | Alligator Cracking      | Low      | Crack Sealing - AC | 6             | Ft   | \$2.00    | \$12      |               |
| Bend    | TABE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 491           | Ft   | \$2.00    | \$982     |               |
| Bend    | TABE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,676         | Ft   | \$2.00    | \$3,351   | \$4,333       |
| Bend    | TAEROBE   | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 1,546         | Ft   | \$2.00    | \$3,093   | \$4,215       |
| Bend    | TAEROBE   | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 561           | Ft   | \$2.00    | \$1,123   |               |
| Bend    | TAEROBE   | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 1,281         | Ft   | \$2.00    | \$2,562   |               |
| Bend    | TAEROBE   | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,573         | Ft   | \$2.00    | \$3,147   | \$5,709       |
| Bend    | TAEROBE   | 03         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 3,585         | Ft   | \$2.00    | \$7,170   | \$8,937       |
| Bend    | TAEROBE   | 03         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 884           | Ft   | \$2.00    | \$1,767   |               |
| Bend    | TAEROBE   | 04         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,553         | Ft   | \$2.00    | \$3,105   |               |
| Bend    | TAEROBE   | 04         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 1,175         | Ft   | \$2.00    | \$2,350   | \$5,455       |

**Table 3D - BEND AIRPORT NETWORK MAINTENANCE REPORT**

| Network | Branch ID | Section ID | Distress                | Severity | Action             | Work Quantity | Unit | Unit Cost | Work Cost | Section Total |
|---------|-----------|------------|-------------------------|----------|--------------------|---------------|------|-----------|-----------|---------------|
| Bend    | TAEROBE   | 05         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,399         | Ft   | \$2.00    | \$2,797   | \$4,342       |
| Bend    | TAEROBE   | 05         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 773           | Ft   | \$2.00    | \$1,545   |               |
| Bend    | TAEROBE   | 06         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 678           | Ft   | \$2.00    | \$1,356   | \$4,694       |
| Bend    | TAEROBE   | 06         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,669         | Ft   | \$2.00    | \$3,338   |               |
| Bend    | TAEROBE   | 07         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 1,027         | Ft   | \$2.00    | \$2,053   | \$4,047       |
| Bend    | TAEROBE   | 07         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 997           | Ft   | \$2.00    | \$1,994   |               |
| Bend    | TAEROBE   | 08         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 1,677         | Ft   | \$2.00    | \$3,353   | \$5,219       |
| Bend    | TAEROBE   | 08         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 933           | Ft   | \$2.00    | \$1,866   |               |
| Bend    | TB1BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 255           | Ft   | \$2.00    | \$510     | \$570         |
| Bend    | TB1BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 30            | Ft   | \$2.00    | \$60      |               |
| Bend    | TB2BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 200           | Ft   | \$2.00    | \$400     | \$400         |
| Bend    | TB2BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 5             | Ft   | \$2.00    | \$10      | \$190         |
| Bend    | TB2BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 90            | Ft   | \$2.00    | \$180     |               |
| Bend    | TB3BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 56            | Ft   | \$2.00    | \$112     | \$406         |
| Bend    | TB3BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 147           | Ft   | \$2.00    | \$294     |               |
| Bend    | TB3BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 60            | Ft   | \$2.00    | \$120     | \$126         |
| Bend    | TB3BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 3             | Ft   | \$2.00    | \$6       |               |
| Bend    | TB4BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 73            | Ft   | \$2.00    | \$146     | \$170         |
| Bend    | TB4BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 12            | Ft   | \$2.00    | \$24      |               |
| Bend    | TB4BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 110           | Ft   | \$2.00    | \$220     | \$220         |
| Bend    | TB5BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 20            | Ft   | \$2.00    | \$40      | \$364         |
| Bend    | TB5BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 154           | Ft   | \$2.00    | \$308     |               |
| Bend    | TB5BE     | 01         | Alligator Cracking      | Low      | Crack Sealing - AC | 8             | Ft   | \$2.00    | \$16      | \$250         |
| Bend    | TB5BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 10            | Ft   | \$2.00    | \$20      |               |
| Bend    | TB5BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 115           | Ft   | \$2.00    | \$230     | \$230         |
| Bend    | TB6BE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 243           | Ft   | \$2.00    | \$486     | \$738         |
| Bend    | TB6BE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 126           | Ft   | \$2.00    | \$252     |               |
| Bend    | TB6BE     | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 25            | Ft   | \$2.00    | \$50      | \$150         |
| Bend    | TB6BE     | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 50            | Ft   | \$2.00    | \$100     |               |
| Bend    | TBBBE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 983           | Ft   | \$2.00    | \$1,966   | \$2,307       |
| Bend    | TBBBE     | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 171           | Ft   | \$2.00    | \$341     |               |
| Bend    | TBBE      | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 410           | Ft   | \$2.00    | \$821     | \$13,559      |
| Bend    | TBBE      | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 6,369         | Ft   | \$2.00    | \$12,738  |               |
| Bend    | TLA10BE   | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 50            | Ft   | \$2.00    | \$100     | \$100         |
| Bend    | TLA10BE   | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 1,905         | Ft   | \$2.00    | \$3,810   | \$5,529       |
| Bend    | TLA10BE   | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 859           | Ft   | \$2.00    | \$1,719   |               |
| Bend    | TLA7BE    | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 25            | Ft   | \$2.00    | \$50      | \$72          |
| Bend    | TLA7BE    | 01         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 11            | Ft   | \$2.00    | \$22      |               |
| Bend    | TLA8BE    | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 44            | Ft   | \$2.00    | \$88      | \$88          |
| Bend    | TLA8BE    | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 23            | Ft   | \$2.00    | \$46      | \$182         |
| Bend    | TLA8BE    | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 68            | Ft   | \$2.00    | \$136     |               |

**Table 3D - BEND AIRPORT NETWORK MAINTENANCE REPORT**

| Network | Branch ID | Section ID | Distress                | Severity | Action             | Work Quantity | Unit | Unit Cost | Work Cost | Section Total |
|---------|-----------|------------|-------------------------|----------|--------------------|---------------|------|-----------|-----------|---------------|
| Bend    | TLA9BE    | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 68            | Ft   | \$2.00    | \$136     | \$136         |
| Bend    | TLA9BE    | 02         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 304           | Ft   | \$2.00    | \$608     | \$1,280       |
| Bend    | TLA9BE    | 02         | Long. & Trans. Cracking | Medium   | Crack Sealing - AC | 336           | Ft   | \$2.00    | \$672     |               |
| Bend    | TLCBE     | 01         | Long. & Trans. Cracking | Low      | Crack Sealing - AC | 60            | Ft   | \$2.00    | \$120     | \$120         |

Long. = Longitudinal; Trans. = Transverse; AC = Asphalt Concrete; PCC = Portland Cement Concrete; Ft = Feet; SqFt = Square Feet

Table 4D - FIVE-YEAR GLOBAL MAINTENANCE AND REHABILITATION PLAN

| Action Year | Branch ID  | Section ID | Branch Use | Surface Type | Current PCI | Action      | Area, square feet | Unit Cost per square foot | Total Cost  |
|-------------|------------|------------|------------|--------------|-------------|-------------|-------------------|---------------------------|-------------|
| 2023        | AHELIBE    | 01         | APRON      | AC           | 94          | Fog Seal    | 393,378           | \$0.20                    | \$78,676    |
|             | AHELIBE    | 02         | APRON      | AC           | 94          | Fog Seal    | 44,220            | \$0.20                    | \$8,844     |
|             | ATBNHOLDBE | 01         | APRON      | AC           | 80          | Fog Seal    | 31,198            | \$0.20                    | \$6,240     |
|             | ATBSHOLDBE | 01         | APRON      | AC           | 75          | Fog Seal    | 33,049            | \$0.20                    | \$6,610     |
|             | R16BE      | 01         | RUNWAY     | AC           | 78          | Slurry Seal | 390,000           | \$0.33                    | \$128,700   |
|             | T01BE      | 01         | TAXIWAY    | AC           | 65          | Slurry Seal | 5,840             | \$0.33                    | \$1,927     |
|             | T02BE      | 01         | TAXIWAY    | AC           | 65          | Slurry Seal | 11,370            | \$0.33                    | \$3,752     |
|             | T03BE      | 01         | TAXIWAY    | AC           | 94          | Slurry Seal | 7,392             | \$0.33                    | \$2,439     |
|             | T05BE      | 02         | TAXIWAY    | AC           | 65          | Slurry Seal | 1,271             | \$0.33                    | \$419       |
|             | T06BE      | 01         | TAXIWAY    | AC           | 79          | Slurry Seal | 2,250             | \$0.33                    | \$743       |
|             | T07BE      | 01         | TAXIWAY    | AC           | 86          | Slurry Seal | 4,332             | \$0.33                    | \$1,430     |
|             | T07BE      | 02         | TAXIWAY    | AC           | 90          | Slurry Seal | 6,156             | \$0.33                    | \$2,031     |
|             | T09BE      | 01         | TAXIWAY    | AC           | 57          | Overlay     | 1,216             | \$7.30                    | \$8,877     |
|             | T10BE      | 01         | TAXIWAY    | AC           | 91          | Slurry Seal | 2,849             | \$0.33                    | \$940       |
|             | T10BE      | 02         | TAXIWAY    | AC           | 90          | Slurry Seal | 1,060             | \$0.33                    | \$350       |
|             | T11BE      | 01         | TAXIWAY    | AC           | 94          | Slurry Seal | 2,611             | \$0.33                    | \$862       |
|             | TA1BE      | 01         | TAXIWAY    | AC           | 67          | Slurry Seal | 12,685            | \$0.33                    | \$4,186     |
|             | TA1BE      | 02         | TAXIWAY    | AAC          | 79          | Slurry Seal | 2,030             | \$0.33                    | \$670       |
|             | TA2BE      | 01         | TAXIWAY    | AC           | 83          | Slurry Seal | 8,275             | \$0.33                    | \$2,731     |
|             | TA2BE      | 02         | TAXIWAY    | AAC          | 81          | Slurry Seal | 2,945             | \$0.33                    | \$972       |
|             | TA3BE      | 01         | TAXIWAY    | AC           | 71          | Slurry Seal | 8,315             | \$0.33                    | \$2,744     |
|             | TA3BE      | 02         | TAXIWAY    | AC           | 84          | Slurry Seal | 2,885             | \$0.33                    | \$952       |
|             | TA4BE      | 01         | TAXIWAY    | AC           | 81          | Slurry Seal | 8,400             | \$0.33                    | \$2,772     |
|             | TA4BE      | 02         | TAXIWAY    | AC           | 78          | Slurry Seal | 2,860             | \$0.33                    | \$944       |
|             | TA5BE      | 01         | TAXIWAY    | AC           | 75          | Slurry Seal | 8,480             | \$0.33                    | \$2,798     |
|             | TA5BE      | 02         | TAXIWAY    | AC           | 77          | Slurry Seal | 2,890             | \$0.33                    | \$954       |
|             | TA6BE      | 01         | TAXIWAY    | AC           | 73          | Slurry Seal | 12,716            | \$0.33                    | \$4,196     |
|             | TA6BE      | 02         | TAXIWAY    | AAC          | 94          | Slurry Seal | 2,000             | \$0.33                    | \$660       |
|             | TABE       | 01         | TAXIWAY    | AC           | 87          | Slurry Seal | 182,005           | \$0.33                    | \$60,062    |
|             | TAEROBE    | 3          | TAXIWAY    | AC           | 61          | Overlay     | 54,823            | \$7.30                    | \$400,225   |
|             | TB1BE      | 01         | TAXIWAY    | AC           | 75          | Slurry Seal | 12,660            | \$0.33                    | \$4,178     |
|             | TB2BE      | 01         | TAXIWAY    | AC           | 75          | Slurry Seal | 8,364             | \$0.33                    | \$2,760     |
|             | TB2BE      | 02         | TAXIWAY    | AC           | 80          | Slurry Seal | 2,943             | \$0.33                    | \$971       |
|             | TB3BE      | 01         | TAXIWAY    | AC           | 71          | Slurry Seal | 8,358             | \$0.33                    | \$2,758     |
|             | TB3BE      | 02         | TAXIWAY    | AC           | 84          | Slurry Seal | 2,949             | \$0.33                    | \$973       |
|             | TB4BE      | 01         | TAXIWAY    | AC           | 75          | Slurry Seal | 8,361             | \$0.33                    | \$2,759     |
|             | TB4BE      | 02         | TAXIWAY    | AC           | 75          | Slurry Seal | 2,946             | \$0.33                    | \$972       |
|             | TB5BE      | 01         | TAXIWAY    | AC           | 68          | Slurry Seal | 8,431             | \$0.33                    | \$2,782     |
|             | TB5BE      | 02         | TAXIWAY    | AC           | 70          | Slurry Seal | 2,876             | \$0.33                    | \$949       |
|             | TB6BE      | 01         | TAXIWAY    | AC           | 77          | Slurry Seal | 12,729            | \$0.33                    | \$4,201     |
|             | TB6BE      | 02         | TAXIWAY    | AC           | 70          | Slurry Seal | 2,026             | \$0.33                    | \$669       |
|             | TLA10BE    | 01         | TAXIWAY    | AC           | 89          | Slurry Seal | 6,215             | \$0.33                    | \$2,051     |
|             | TLA10BE    | 02         | TAXIWAY    | AC           | 60          | Overlay     | 27,138            | \$7.30                    | \$198,116   |
|             | TLA7BE     | 01         | TAXIWAY    | AC           | 88          | Slurry Seal | 8,976             | \$0.33                    | \$2,962     |
|             | TLA8BE     | 01         | TAXIWAY    | AC           | 90          | Slurry Seal | 5,862             | \$0.33                    | \$1,934     |
|             | TLA8BE     | 02         | TAXIWAY    | AC           | 69          | Slurry Seal | 2,625             | \$0.33                    | \$866       |
|             | TLA9BE     | 01         | TAXIWAY    | AC           | 89          | Slurry Seal | 4,115             | \$0.33                    | \$1,358     |
|             | TLA9BE     | 02         | TAXIWAY    | AC           | 62          | Overlay     | 5,923             | \$7.30                    | \$43,240    |
| 2024        | A01BE      | 01         | APRON      | AC           | 92          | Fog Seal    | 14,132            | \$0.20                    | \$2,826     |
|             | A02BE      | 01         | APRON      | AC           | 93          | Fog Seal    | 65,227            | \$0.20                    | \$13,046    |
|             | A02BE      | 02         | APRON      | AC           | 52          | Overlay     | 98,940            | \$11.72                   | \$1,159,984 |
|             | A02BE      | 03         | APRON      | AC           | 62          | Fog Seal    | 36,867            | \$0.20                    | \$7,373     |
|             | A02BE      | 04         | APRON      | AC           | 58          | Fog Seal    | 62,888            | \$0.20                    | \$12,578    |
|             | A02BE      | 05         | APRON      | AC           | 94          | Fog Seal    | 97,120            | \$0.20                    | \$19,424    |
|             | A02BE      | 06         | APRON      | AC           | 94          | Fog Seal    | 72,650            | \$0.20                    | \$14,530    |
|             | A02BE      | 07         | APRON      | AC           | 92          | Fog Seal    | 4,560             | \$0.20                    | \$912       |
|             | A04BE      | 01         | APRON      | AC           | 89          | Fog Seal    | 36,640            | \$0.20                    | \$7,328     |
|             | A04BE      | 02         | APRON      | AC           | 76          | Fog Seal    | 7,510             | \$0.20                    | \$1,502     |
|             | A05BE      | 02         | APRON      | AAC          | 76          | Fog Seal    | 9,080             | \$0.20                    | \$1,816     |
|             | A06BE      | 01         | APRON      | AC           | 72          | Fog Seal    | 30,000            | \$0.20                    | \$6,000     |
|             | A07BE      | 01         | APRON      | AC           | 87          | Fog Seal    | 15,810            | \$0.20                    | \$3,162     |
|             | A07BE      | 02         | APRON      | AC           | 64          | Fog Seal    | 9,223             | \$0.20                    | \$1,845     |
|             | A07BE      | 03         | APRON      | AC           | 66          | Fog Seal    | 12,472            | \$0.20                    | \$2,494     |
|             | A08BE      | 04         | APRON      | AC           | 64          | Fog Seal    | 4,365             | \$0.20                    | \$873       |
|             | A08BE      | 05         | APRON      | AC           | 60          | Fog Seal    | 8,050             | \$0.20                    | \$1,610     |
|             | A08BE      | 06         | APRON      | AC           | 71          | Fog Seal    | 9,411             | \$0.20                    | \$1,882     |
|             | A08BE      | 07         | APRON      | AC           | 83          | Fog Seal    | 31,202            | \$0.20                    | \$6,240     |
|             | A08BE      | 08         | APRON      | AC           | 60          | Fog Seal    | 1,557             | \$0.20                    | \$311       |
|             | A08BE      | 10         | APRON      | AC           | 69          | Fog Seal    | 840               | \$0.20                    | \$168       |
|             | A09BE      | 01         | APRON      | AC           | 65          | Fog Seal    | 15,000            | \$0.20                    | \$3,000     |
|             | A10BE      | 01         | APRON      | AC           | 94          | Fog Seal    | 3,655             | \$0.20                    | \$731       |
|             | ATANHOLDBE | 01         | APRON      | AC           | 73          | Fog Seal    | 31,349            | \$0.20                    | \$6,270     |
|             | ATASHOLDBE | 01         | APRON      | AC           | 81          | Fog Seal    | 33,318            | \$0.20                    | \$6,664     |

Table 4D - FIVE-YEAR GLOBAL MAINTENANCE AND REHABILITATION PLAN

| Action Year | Branch ID | Section ID | Branch Use | Surface Type | Current PCI | Action         | Area, square feet | Unit Cost per square foot | Total Cost |
|-------------|-----------|------------|------------|--------------|-------------|----------------|-------------------|---------------------------|------------|
| 2025        | T06BE     | 02         | TAXIWAY    | AC           | 63          | Overlay        | 8,040             | \$7.30                    | \$58,695   |
|             | T03BE     | 02         | TAXIWAY    | AC           | 29          | Reconstruction | 5,062             | \$18.50                   | \$93,646   |
|             | T04BE     | 01         | TAXIWAY    | AC           | 30          | Reconstruction | 15,759            | \$18.50                   | \$291,538  |
|             | T04BE     | 02         | TAXIWAY    | AC           | 41          | Reconstruction | 8,666             | \$18.50                   | \$160,319  |
|             | T05BE     | 01         | TAXIWAY    | AC           | 26          | Reconstruction | 24,436            | \$18.50                   | \$452,061  |
|             | TAEROBE   | 01         | TAXIWAY    | AC           | 69          | Slurry Seal    | 40,188            | \$0.33                    | \$13,262   |
|             | TAEROBE   | 02         | TAXIWAY    | AC           | 70          | Slurry Seal    | 38,299            | \$0.33                    | \$12,639   |
|             | TAEROBE   | 04         | TAXIWAY    | AC           | 70          | Slurry Seal    | 39,175            | \$0.33                    | \$12,928   |
|             | TAEROBE   | 05         | TAXIWAY    | AC           | 74          | Slurry Seal    | 38,964            | \$0.33                    | \$12,858   |
|             | TAEROBE   | 06         | TAXIWAY    | AC           | 77          | Slurry Seal    | 37,723            | \$0.33                    | \$12,449   |
|             | TAEROBE   | 07         | TAXIWAY    | AC           | 73          | Slurry Seal    | 40,813            | \$0.33                    | \$13,468   |
|             | TAEROBE   | 08         | TAXIWAY    | AC           | 70          | Slurry Seal    | 41,016            | \$0.33                    | \$13,535   |
|             | TBBBE     | 01         | TAXIWAY    | AC           | 81          | Slurry Seal    | 36,692            | \$0.33                    | \$12,108   |
|             | TBBE      | 01         | TAXIWAY    | AC           | 72          | Slurry Seal    | 181,500           | \$0.33                    | \$59,895   |
|             | THELIBE   | 01         | TAXIWAY    | AC           | 94          | Slurry Seal    | 16,126            | \$0.33                    | \$5,322    |
|             | THELIBE   | 02         | TAXIWAY    | AC           | 94          | Slurry Seal    | 10,117            | \$0.33                    | \$3,339    |
| 2026        | TLCBE     | 01         | TAXIWAY    | AC           | 75          | Slurry Seal    | 5,156             | \$0.33                    | \$1,701    |
|             | TLEBE     | 01         | TAXIWAY    | AC           | 94          | Slurry Seal    | 5,330             | \$0.33                    | \$1,759    |
|             | A03BE     | 01         | APRON      | AC           | 53          | Overlay        | 52,460            | \$10.08                   | \$528,681  |
|             | T03BE     | 03         | TAXIWAY    | AC           | 19          | Reconstruction | 10,800            | \$18.50                   | \$199,798  |
|             | T03BE     | 04         | TAXIWAY    | AC           | 12          | Reconstruction | 4,683             | \$18.50                   | \$86,634   |
|             | T03BE     | 05         | TAXIWAY    | AC           | 7           | Reconstruction | 21,900            | \$18.50                   | \$405,145  |
| 2027        | T03BE     | 06         | TAXIWAY    | AC           | 34          | Reconstruction | 6,600             | \$18.50                   | \$122,099  |
|             | T03BE     | 07         | TAXIWAY    | AC           | 64          | Overlay        | 2,834             | \$7.30                    | \$20,689   |
|             | A03BE     | 02         | APRON      | AC           | 52          | Reconstruction | 8,520             | \$18.50                   | \$157,618  |
|             | A05BE     | 01         | APRON      | AC           | 49          | Reconstruction | 7,160             | \$18.50                   | \$132,458  |
|             | A07BE     | 04         | APRON      | AC           | 25          | Reconstruction | 5,610             | \$18.50                   | \$103,784  |
|             | A08BE     | 01         | APRON      | AC           | 17          | Reconstruction | 5,923             | \$18.50                   | \$109,574  |
|             | A08BE     | 02         | APRON      | AC           | 22          | Reconstruction | 5,912             | \$18.50                   | \$109,371  |
|             | A08BE     | 03         | APRON      | AC           | 49          | Reconstruction | 5,840             | \$18.50                   | \$108,039  |
|             | A08BE     | 09         | APRON      | PCC          | 25          | Reconstruction | 1,804             | \$18.50                   | \$33,374   |
|             | A08BE     | 11         | APRON      | PCC          | 28          | Reconstruction | 2,500             | \$18.50                   | \$46,249   |
|             | A08BE     | 12         | APRON      | AC           | 33          | Reconstruction | 3,030             | \$18.50                   | \$56,054   |
|             | A10BE     | 02         | APRON      | AC           | 50          | Reconstruction | 920               | \$18.50                   | \$17,020   |
|             | A10BE     | 03         | APRON      | AC           | 24          | Reconstruction | 2,385             | \$18.50                   | \$44,122   |
|             | A11BE     | 01         | APRON      | AC           | 45          | Reconstruction | 9,920             | \$18.50                   | \$183,518  |
|             | T07BE     | 03         | TAXIWAY    | AC           | 21          | Reconstruction | 7,570             | \$18.50                   | \$140,043  |
|             | T08BE     | 01         | TAXIWAY    | AC           | 64          | Overlay        | 17,039            | \$7.30                    | \$124,390  |

Abbreviations:

PCI = Pavement Condition Index, AC = Asphalt Concrete, AAC = AC overlaid AC, PCC = Portland Cement Concrete

| Cost Summary                     |                    |
|----------------------------------|--------------------|
| 2022 Total Project Cost          | \$1,012,207        |
| 2023 Total Project Cost          | \$1,341,265        |
| 2024 Total Project Cost          | \$1,172,827        |
| 2025 Total Project Cost          | \$1,363,046        |
| 2026 Total Project Cost          | \$1,365,615        |
| <b>Total 5-Year Project Cost</b> | <b>\$6,254,959</b> |

---

## **APPENDIX E**

### *Re-Inspection Report*

# Re-Inspection Report

ODA\_WOC3\_9-1-2022\_PostBendAnalysis

Generated Date 9/1/2022

Page 1 of 118

|                             |                                |                      |                                   |                    |              |                          |             |
|-----------------------------|--------------------------------|----------------------|-----------------------------------|--------------------|--------------|--------------------------|-------------|
| <b>Network:</b>             | Bend                           | <b>Name:</b>         | Bend Municipal                    |                    |              |                          |             |
| <b>Branch:</b>              | A01BE                          | <b>Name:</b>         | Apron 01 Bend                     | <b>Use:</b>        | APRON        | <b>Area:</b>             | 14,132 SqFt |
| <b>Section:</b>             | 01                             | of                   | 1                                 | <b>From:</b>       | TABE-01      | <b>To:</b>               | T04BE       |
| <b>Surface:</b>             | AC                             | <b>Family:</b>       | 2022_Central_Cat1/2_Apr on_AC/AAC | <b>Zone:</b>       | KBDN         | <b>Category:</b>         | L           |
| <b>Area:</b>                | 14,132 SqFt                    | <b>Length:</b>       | 340 Ft                            | <b>Width:</b>      | 47 Ft        | <b>Joint Length:</b>     | Ft          |
| <b>Slabs:</b>               |                                | <b>Slab Length:</b>  | Ft                                | <b>Slab Width:</b> | Ft           | <b>Joint Length:</b>     | Ft          |
| <b>Shoulder:</b>            |                                | <b>Street Type:</b>  |                                   | <b>Grade:</b>      | 0            | <b>Lanes:</b>            | 0           |
| <b>Section Comments:</b>    |                                |                      |                                   |                    |              |                          |             |
| <b>Work Date:</b>           | 9/1/2012                       | <b>Work Type:</b>    | Subbase - Aggregate               | <b>Code:</b>       | SB-AG        | <b>Is Major M&amp;R:</b> | False       |
| <b>Work Date:</b>           | 9/2/2012                       | <b>Work Type:</b>    | Base Course - Aggregate           | <b>Code:</b>       | BA-AG        | <b>Is Major M&amp;R:</b> | False       |
| <b>Work Date:</b>           | 9/3/2012                       | <b>Work Type:</b>    | New Construction - AC             | <b>Code:</b>       | NC-AC        | <b>Is Major M&amp;R:</b> | True        |
| <b>Last Insp. Date:</b>     | 3/1/2022                       | <b>TotalSamples:</b> | 3                                 | <b>Surveyed:</b>   | 2            |                          |             |
| <b>Conditions:</b>          | PCI: 92                        |                      |                                   |                    |              |                          |             |
| <b>Inspection Comments:</b> |                                |                      |                                   |                    |              |                          |             |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>         | R                                 | <b>Area:</b>       | 5321.00 SqFt | <b>PCI:</b>              | 90          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                      |                                   |                    |              |                          |             |
| 57                          | WEATHERING                     | L                    | 5321.00                           | SqFt               |              |                          |             |
| 48                          | L & T CR                       | L                    | 30.00                             | Ft                 |              |                          |             |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>         | R                                 | <b>Area:</b>       | 4700.00 SqFt | <b>PCI:</b>              | 94          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                      |                                   |                    |              |                          |             |
| 57                          | WEATHERING                     | L                    | 4700.00                           | SqFt               |              |                          |             |

|                           |                                |         |                                         |                |              |           |        |               |       |               |          |   |
|---------------------------|--------------------------------|---------|-----------------------------------------|----------------|--------------|-----------|--------|---------------|-------|---------------|----------|---|
| Network:                  | Bend                           |         | Name:                                   | Bend Municipal |              |           |        |               |       |               |          |   |
| Branch:                   | A02BE                          |         | Name:                                   | Apron 02 Bend  |              | Use:      | APRON  |               | Area: | 438,252 SqFt  |          |   |
| Section:                  | 06                             | of 7    | From:                                   | Section 04     |              |           | To:    | North End     |       | Last Const.:  | 7/3/2018 |   |
| Surface:                  | AC                             | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC       |                | Zone:        | KBDN      |        | Category:     | L     |               | Rank:    | P |
| Area:                     | 72,650 SqFt                    |         | Length:                                 | 300 Ft         |              | Width:    | 245 Ft |               |       |               |          |   |
| Slabs:                    | Slab Length:                   |         | Ft                                      |                | Slab Width:  | Ft        |        | Joint Length: | Ft    |               |          |   |
| Shoulder:                 | Street Type:                   |         |                                         |                | Grade:       | 0         |        | Lanes:        | 0     |               |          |   |
| Section Comments:         |                                |         |                                         |                |              |           |        |               |       |               |          |   |
| Work Date:                | 9/1/1995                       |         | Work Type: Base Course - Aggregate      |                |              |           | Code:  | BA-AG         |       | Is Major M&R: | True     |   |
| Work Date:                | 9/2/1995                       |         | Work Type: New Construction - AC        |                |              |           | Code:  | NC-AC         |       | Is Major M&R: | True     |   |
| Work Date:                | 9/1/2004                       |         | Work Type: Crack Sealing - AC           |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                | 9/1/2008                       |         | Work Type: Crack Sealing - AC           |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                | 7/1/2018                       |         | Work Type: Subbase - Aggregate          |                |              |           | Code:  | SB-AG         |       | Is Major M&R: | False    |   |
| Work Date:                | 7/2/2018                       |         | Work Type: Base Course - Aggregate      |                |              |           | Code:  | BA-AG         |       | Is Major M&R: | False    |   |
| Work Date:                | 7/3/2018                       |         | Work Type: Complete Reconstruction - AC |                |              |           | Code:  | CR-AC         |       | Is Major M&R: | True     |   |
| Last Insp. Date: 3/1/2022 |                                |         |                                         |                |              |           |        |               |       |               |          |   |
| Conditions:               |                                | PCI:    | 94                                      | TotalSamples:  | 15           | Surveyed: | 5      |               |       |               |          |   |
| Inspection Comments:      |                                |         |                                         |                |              |           |        |               |       |               |          |   |
| Sample Number:            | 03                             | Type:   | R                                       | Area:          | 5200.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          | Created by Inspection Schedule |         |                                         |                |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING                     |         | L                                       | 5200.00 SqFt   |              |           |        |               |       |               |          |   |
| Sample Number:            | 07                             | Type:   | R                                       | Area:          | 5000.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          | Created by Inspection Schedule |         |                                         |                |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING                     |         | L                                       | 5000.00 SqFt   |              |           |        |               |       |               |          |   |
| Sample Number:            | 10                             | Type:   | R                                       | Area:          | 5200.00 SqFt |           | PCI:   | 92            |       |               |          |   |
| Sample Comments:          | Created by Inspection Schedule |         |                                         |                |              |           |        |               |       |               |          |   |
| 48                        | L & T CR                       |         | L                                       | 5.00 Ft        |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING                     |         | L                                       | 5200.00 SqFt   |              |           |        |               |       |               |          |   |
| Sample Number:            | 11                             | Type:   | R                                       | Area:          | 5000.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          | Created by Inspection Schedule |         |                                         |                |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING                     |         | L                                       | 5000.00 SqFt   |              |           |        |               |       |               |          |   |
| Sample Number:            | 13                             | Type:   | R                                       | Area:          | 5000.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          | Created by Inspection Schedule |         |                                         |                |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING                     |         | L                                       | 5000.00 SqFt   |              |           |        |               |       |               |          |   |

|                                                 |              |         |                                             |               |                |           |           |               |              |
|-------------------------------------------------|--------------|---------|---------------------------------------------|---------------|----------------|-----------|-----------|---------------|--------------|
| Network:                                        | Bend         |         |                                             | Name:         | Bend Municipal |           |           |               |              |
| Branch:                                         | A02BE        |         | Name:                                       | Apron 02 Bend |                | Use:      | APRON     | Area:         | 438,252 SqFt |
| Section:                                        | 05           | of      | 7                                           | From:         | Section 03     |           | To:       | Section 06    |              |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        |               | Zone:          | KBDN      | Category: | L             | Rank: P      |
| Area:                                           | 97,120 SqFt  |         | Length:                                     | 410 Ft        |                | Width:    | 217 Ft    |               |              |
| Slabs:                                          | Slab Length: |         | Ft                                          |               | Slab Width:    | Ft        |           | Joint Length: | Ft           |
| Shoulder:                                       | Street Type: |         | Grade:                                      |               | 0              |           | Lanes:    | 0             |              |
| Section Comments:                               |              |         |                                             |               |                |           |           |               |              |
| Work Date:                                      | 9/1/1977     |         | Work Type: Base Course - Cinders (Major MR) |               |                |           | Code:     | BA-CI         |              |
| Work Date:                                      | 9/2/1977     |         | Work Type: New Construction - AC            |               |                |           | Code:     | NC-AC         |              |
| Work Date:                                      | 9/1/1995     |         | Work Type: Surface Treatment - Slurry Seal  |               |                |           | Code:     | ST-SS         |              |
| Work Date:                                      | 9/2/1995     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:     | CS-AC         |              |
| Work Date:                                      | 7/1/2018     |         | Work Type: Subbase - Aggregate              |               |                |           | Code:     | SB-AG         |              |
| Work Date:                                      | 7/2/2018     |         | Work Type: Base Course - Aggregate          |               |                |           | Code:     | BA-AG         |              |
| Work Date:                                      | 7/3/2018     |         | Work Type: Complete Reconstruction - AC     |               |                |           | Code:     | CR-AC         |              |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 20            |                | Surveyed: | 8         |               |              |
| Conditions:                                     | PCI: 94      |         |                                             |               |                |           |           |               |              |
| Inspection Comments:                            |              |         |                                             |               |                |           |           |               |              |
| Sample Number:                                  | 07           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 5000.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 08           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 5000.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 09           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 5000.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 11           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 5000.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 12           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 5000.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 15           | Type:   | R                                           | Area:         | 2701.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments:                                |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 2701.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 19           | Type:   | R                                           | Area:         | 4985.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments:                                |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 4985.00                                     |               | SqFt           |           |           |               |              |
| Sample Number:                                  | 20           | Type:   | R                                           | Area:         | 4038.00 SqFt   |           | PCI:      | 94            |              |
| Sample Comments:                                |              |         |                                             |               |                |           |           |               |              |
| 57                                              | WEATHERING   | L       | 4038.00                                     |               | SqFt           |           |           |               |              |

|                                                 |              |         |                                             |                |              |           |        |               |       |               |          |   |
|-------------------------------------------------|--------------|---------|---------------------------------------------|----------------|--------------|-----------|--------|---------------|-------|---------------|----------|---|
| Network:                                        | Bend         |         | Name:                                       | Bend Municipal |              |           |        |               |       |               |          |   |
| Branch:                                         | A02BE        |         | Name:                                       | Apron 02 Bend  |              | Use:      | APRON  |               | Area: | 438,252 SqFt  |          |   |
| Section:                                        | 03           | of 7    | From:                                       | Section 02     |              |           | To:    | West          |       | Last Const.:  | 9/2/1999 |   |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        |                | Zone:        | KBDN      |        | Category:     | L     |               | Rank:    | P |
| Area:                                           | 36,867 SqFt  |         | Length:                                     | 497 Ft         |              | Width:    | 70 Ft  |               |       |               |          |   |
| Slabs:                                          | Slab Length: |         | Ft                                          |                | Slab Width:  | Ft        |        | Joint Length: | Ft    |               |          |   |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                | 0            |           | Lanes: | 0             |       |               |          |   |
| Section Comments:                               |              |         |                                             |                |              |           |        |               |       |               |          |   |
| Work Date:                                      | 9/1/1999     |         | Work Type: Base Course - Unknown (Major MR) |                |              |           | Code:  | BA-UN         |       | Is Major M&R: | True     |   |
| Work Date:                                      | 9/2/1999     |         | Work Type: Complete Reconstruction - AC     |                |              |           | Code:  | CR-AC         |       | Is Major M&R: | True     |   |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                                      | 7/1/2018     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:  | CS-AC         |       | Is Major M&R: | False    |   |
| Work Date:                                      | 7/2/2018     |         | Work Type: Surface Seal - Fog Seal          |                |              |           | Code:  | SS-FS         |       | Is Major M&R: | False    |   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 7              |              | Surveyed: | 4      |               |       |               |          |   |
| Conditions:                                     | PCI:         | 62      |                                             |                |              |           |        |               |       |               |          |   |
| Inspection Comments:                            |              |         |                                             |                |              |           |        |               |       |               |          |   |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:          | 5250.00 SqFt |           | PCI:   | 63            |       |               |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                |              |           |        |               |       |               |          |   |
| 57                                              | WEATHERING   | M       | 5250.00                                     | SqFt           |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | M       | 325.00                                      | Ft             |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | L       | 68.00                                       | Ft             |              |           |        |               |       |               |          |   |
| Sample Number:                                  | 03           | Type:   | R                                           | Area:          | 5250.00 SqFt |           | PCI:   | 64            |       |               |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                |              |           |        |               |       |               |          |   |
| 57                                              | WEATHERING   | M       | 5250.00                                     | SqFt           |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | M       | 225.00                                      | Ft             |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | M       | 38.00                                       | Ft             |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | L       | 225.00                                      | Ft             |              |           |        |               |       |               |          |   |
| Sample Number:                                  | 04           | Type:   | R                                           | Area:          | 5250.00 SqFt |           | PCI:   | 59            |       |               |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | M       | 378.00                                      | Ft             |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | L       | 118.00                                      | Ft             |              |           |        |               |       |               |          |   |
| 57                                              | WEATHERING   | M       | 5250.00                                     | SqFt           |              |           |        |               |       |               |          |   |
| Sample Number:                                  | 05           | Type:   | R                                           | Area:          | 5250.00 SqFt |           | PCI:   | 60            |       |               |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | M       | 353.00                                      | Ft             |              |           |        |               |       |               |          |   |
| 48                                              | L & T CR     | L       | 200.00                                      | Ft             |              |           |        |               |       |               |          |   |
| 57                                              | WEATHERING   | M       | 5250.00                                     | SqFt           |              |           |        |               |       |               |          |   |

|                                                 |              |         |                                             |               |                |           |        |               |              |               |          |
|-------------------------------------------------|--------------|---------|---------------------------------------------|---------------|----------------|-----------|--------|---------------|--------------|---------------|----------|
| Network:                                        | Bend         |         |                                             | Name:         | Bend Municipal |           |        |               |              |               |          |
| Branch:                                         | A02BE        |         | Name:                                       | Apron 02 Bend |                | Use:      | APRON  | Area:         | 438,252 SqFt |               |          |
| Section:                                        | 04           | of      | 7                                           | From:         | Section 02     |           |        | To:           | Section 05   | Last Const.:  | 9/2/1999 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        |               | Zone:          | KBDN      |        | Category:     | L            | Rank:         | P        |
| Area:                                           | 62,888 SqFt  |         | Length:                                     | 225 Ft        |                | Width:    | 290 Ft |               |              |               |          |
| Slabs:                                          | Slab Length: |         | Ft                                          |               | Slab Width:    | Ft        |        | Joint Length: | Ft           |               |          |
| Shoulder:                                       | Street Type: |         |                                             |               | Grade:         | 0         |        | Lanes:        | 0            |               |          |
| Section Comments:                               |              |         |                                             |               |                |           |        |               |              |               |          |
| Work Date:                                      | 9/1/1999     |         | Work Type: Base Course - Cinders (Major MR) |               |                |           | Code:  | BA-CI         |              | Is Major M&R: | True     |
| Work Date:                                      | 9/2/1999     |         | Work Type: Complete Reconstruction - AC     |               |                |           | Code:  | CR-AC         |              | Is Major M&R: | True     |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False    |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False    |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False    |
| Work Date:                                      | 9/2/2012     |         | Work Type: Patching - AC Deep               |               |                |           | Code:  | PA-AD         |              | Is Major M&R: | False    |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False    |
| Work Date:                                      | 7/1/2018     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False    |
| Work Date:                                      | 7/2/2018     |         | Work Type: Surface Seal - Fog Seal          |               |                |           | Code:  | SS-FS         |              | Is Major M&R: | False    |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 13            |                | Surveyed: | 4      |               |              |               |          |
| Conditions:                                     | PCI: 58      |         |                                             |               |                |           |        |               |              |               |          |
| Inspection Comments:                            |              |         |                                             |               |                |           |        |               |              |               |          |
| Sample Number:                                  | 04           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:   | 57            |              |               |          |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |        |               |              |               |          |
| 41                                              | ALLIGATOR CR |         | M                                           | 20.00         | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | M                                           | 178.00        | Ft             |           |        |               |              |               |          |
| 50                                              | PATCHING     |         | L                                           | 9.00          | SqFt           |           |        |               |              |               |          |
| 50                                              | PATCHING     |         | L                                           | 600.00        | SqFt           |           |        |               |              |               |          |
| 50                                              | PATCHING     |         | L                                           | 16.00         | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | L                                           | 132.00        | Ft             |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | M                                           | 15.00         | SqFt           |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | L                                           | 4985.00       | SqFt           |           |        |               |              |               |          |
| Sample Number:                                  | 05           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:   | 61            |              |               |          |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | M                                           | 250.00        | Ft             |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | L                                           | 4900.00       | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | L                                           | 30.00         | Ft             |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | M                                           | 100.00        | SqFt           |           |        |               |              |               |          |
| 50                                              | PATCHING     |         | L                                           | 63.00         | SqFt           |           |        |               |              |               |          |
| Sample Number:                                  | 08           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:   | 58            |              |               |          |
| Sample Comments:                                |              |         |                                             |               |                |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | L                                           | 4920.00       | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | M                                           | 202.00        | Ft             |           |        |               |              |               |          |
| 50                                              | PATCHING     |         | L                                           | 16.00         | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | L                                           | 41.00         | Ft             |           |        |               |              |               |          |
| 50                                              | PATCHING     |         | L                                           | 27.00         | SqFt           |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | M                                           | 80.00         | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | M                                           | 138.00        | Ft             |           |        |               |              |               |          |
| Sample Number:                                  | 09           | Type:   | R                                           | Area:         | 5000.00 SqFt   |           | PCI:   | 56            |              |               |          |
| Sample Comments:                                |              |         |                                             |               |                |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | L                                           | 4880.00       | SqFt           |           |        |               |              |               |          |
| 57                                              | WEATHERING   |         | M                                           | 120.00        | SqFt           |           |        |               |              |               |          |
| 48                                              | L & T CR     |         | M                                           | 330.00        | Ft             |           |        |               |              |               |          |

|    |          |   |       |      |
|----|----------|---|-------|------|
| 48 | L & T CR | L | 55.00 | Ft   |
| 50 | PATCHING | L | 63.00 | SqFt |

|                      |  |              |  |               |  |                                   |  |           |  |               |  |               |  |              |  |          |  |
|----------------------|--|--------------|--|---------------|--|-----------------------------------|--|-----------|--|---------------|--|---------------|--|--------------|--|----------|--|
| Network:             |  | Bend         |  | Name:         |  | Bend Municipal                    |  |           |  |               |  |               |  |              |  |          |  |
| Branch:              |  | A02BE        |  | Name:         |  | Apron 02 Bend                     |  | Use:      |  | APRON         |  | Area:         |  | 438,252 SqFt |  |          |  |
| Section:             |  | 07           |  | of 7          |  | From:                             |  | T07BE-02  |  | To:           |  | End           |  | Last Const.: |  | 7/3/2018 |  |
| Surface:             |  | AC           |  | Family:       |  | 2022_Central_Cat1/2_Apr on_AC/AAC |  | Zone:     |  | Category:     |  | Rank:         |  | P            |  |          |  |
| Area:                |  | 4,560 SqFt   |  | Length:       |  | 50 Ft                             |  | Width:    |  | 85 Ft         |  |               |  |              |  |          |  |
| Slabs:               |  | Slab Length: |  | Ft            |  | Slab Width:                       |  | Ft        |  | Joint Length: |  | Ft            |  |              |  |          |  |
| Shoulder:            |  | Street Type: |  | Grade:        |  | 0                                 |  | Lanes:    |  | 0             |  |               |  |              |  |          |  |
| Section Comments:    |  |              |  |               |  |                                   |  |           |  |               |  |               |  |              |  |          |  |
| Work Date:           |  | 1/1/1900     |  | Work Type:    |  | New Construction - Initial        |  | Code:     |  | NU-IN         |  | Is Major M&R: |  | True         |  |          |  |
| Work Date:           |  | 7/1/2018     |  | Work Type:    |  | Subbase - Aggregate               |  | Code:     |  | SB-AG         |  | Is Major M&R: |  | False        |  |          |  |
| Work Date:           |  | 7/2/2018     |  | Work Type:    |  | Base Course - Aggregate           |  | Code:     |  | BA-AG         |  | Is Major M&R: |  | False        |  |          |  |
| Work Date:           |  | 7/3/2018     |  | Work Type:    |  | Complete Reconstruction - AC      |  | Code:     |  | CR-AC         |  | Is Major M&R: |  | True         |  |          |  |
| Last Insp. Date:     |  | 3/1/2022     |  | TotalSamples: |  | 1                                 |  | Surveyed: |  | 1             |  |               |  |              |  |          |  |
| Conditions:          |  | PCI: 92      |  |               |  |                                   |  |           |  |               |  |               |  |              |  |          |  |
| Inspection Comments: |  |              |  |               |  |                                   |  |           |  |               |  |               |  |              |  |          |  |
| Sample Number:       |  | 01           |  | Type:         |  | R                                 |  | Area:     |  | 4560.00 SqFt  |  | PCI:          |  | 92           |  |          |  |
| Sample Comments:     |  |              |  |               |  |                                   |  |           |  |               |  |               |  |              |  |          |  |
| 48                   |  | L & T CR     |  | L             |  | 5.00 Ft                           |  |           |  |               |  |               |  |              |  |          |  |
| 57                   |  | WEATHERING   |  | L             |  | 4560.00 SqFt                      |  |           |  |               |  |               |  |              |  |          |  |

|                             |                                |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
|-----------------------------|--------------------------------|----------------|-------------------------------------------|----------------|--------------------|------------------|---------------|----------------------|--------------|--------------------------|----------|--|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                              | Bend Municipal |                    |                  |               |                      |              |                          |          |  |
| <b>Branch:</b>              | A02BE                          |                | <b>Name:</b>                              | Apron 02 Bend  |                    | <b>Use:</b>      | APRON         |                      | <b>Area:</b> | 438,252 SqFt             |          |  |
| <b>Section:</b>             | 01                             | of 7           | <b>From:</b>                              | TABE-01        |                    |                  | <b>To:</b>    | West                 |              | <b>Last Const.:</b>      | 9/3/2012 |  |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Apron_AC/AAC          |                | <b>Zone:</b>       | KBDN             |               | <b>Category:</b>     | L            | <b>Rank:</b>             | P        |  |
| <b>Area:</b>                | 65,227 SqFt                    |                | <b>Length:</b>                            | 1,388 Ft       |                    | <b>Width:</b>    | 47 Ft         |                      |              |                          |          |  |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                        |                | <b>Slab Width:</b> | Ft               |               | <b>Joint Length:</b> | Ft           |                          |          |  |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                | <b>Grade:</b>                             |                | 0                  |                  | <b>Lanes:</b> | 0                    |              |                          |          |  |
| <b>Section Comments:</b>    |                                |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b> Subbase - Aggregate     |                |                    |                  | <b>Code:</b>  | SB-AG                |              | <b>Is Major M&amp;R:</b> | False    |  |
| <b>Work Date:</b>           | 9/2/2012                       |                | <b>Work Type:</b> Base Course - Aggregate |                |                    |                  | <b>Code:</b>  | BA-AG                |              | <b>Is Major M&amp;R:</b> | False    |  |
| <b>Work Date:</b>           | 9/3/2012                       |                | <b>Work Type:</b> New Construction - AC   |                |                    |                  | <b>Code:</b>  | NC-AC                |              | <b>Is Major M&amp;R:</b> | True     |  |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                      | 14             |                    | <b>Surveyed:</b> | 5             |                      |              |                          |          |  |
| <b>Conditions:</b>          | PCI:                           | 93             |                                           |                |                    |                  |               |                      |              |                          |          |  |
| <b>Inspection Comments:</b> |                                |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                         | <b>Area:</b>   | 4700.00 SqFt       |                  | <b>PCI:</b>   | 90                   |              |                          |          |  |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| 48                          | L & T CR                       | L              | 18.00                                     | Ft             |                    |                  |               |                      |              |                          |          |  |
| 57                          | WEATHERING                     | L              | 4700.00                                   | SqFt           |                    |                  |               |                      |              |                          |          |  |
| <b>Sample Number:</b>       | 04                             | <b>Type:</b>   | R                                         | <b>Area:</b>   | 4700.00 SqFt       |                  | <b>PCI:</b>   | 92                   |              |                          |          |  |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| 57                          | WEATHERING                     | L              | 4630.00                                   | SqFt           |                    |                  |               |                      |              |                          |          |  |
| 57                          | WEATHERING                     | M              | 70.00                                     | SqFt           |                    |                  |               |                      |              |                          |          |  |
| <b>Sample Number:</b>       | 07                             | <b>Type:</b>   | R                                         | <b>Area:</b>   | 4700.00 SqFt       |                  | <b>PCI:</b>   | 94                   |              |                          |          |  |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| 57                          | WEATHERING                     | L              | 4700.00                                   | SqFt           |                    |                  |               |                      |              |                          |          |  |
| <b>Sample Number:</b>       | 10                             | <b>Type:</b>   | R                                         | <b>Area:</b>   | 4700.00 SqFt       |                  | <b>PCI:</b>   | 94                   |              |                          |          |  |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| 57                          | WEATHERING                     | L              | 4700.00                                   | SqFt           |                    |                  |               |                      |              |                          |          |  |
| <b>Sample Number:</b>       | 13                             | <b>Type:</b>   | R                                         | <b>Area:</b>   | 4700.00 SqFt       |                  | <b>PCI:</b>   | 94                   |              |                          |          |  |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                           |                |                    |                  |               |                      |              |                          |          |  |
| 57                          | WEATHERING                     | L              | 4700.00                                   | SqFt           |                    |                  |               |                      |              |                          |          |  |

|                      |                                |         |                                    |               |                |           |        |               |              |               |       |
|----------------------|--------------------------------|---------|------------------------------------|---------------|----------------|-----------|--------|---------------|--------------|---------------|-------|
| Network:             | Bend                           |         |                                    | Name:         | Bend Municipal |           |        |               |              |               |       |
| Branch:              | A02BE                          |         | Name:                              | Apron 02 Bend |                | Use:      | APRON  | Area:         | 438,252 SqFt |               |       |
| Section:             | 02                             | of      | 7                                  | From:         | Section 01     |           |        | To:           | South End    |               |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC  |               | Zone:          | KBDN      |        | Category:     | L            | Rank:         | P     |
| Area:                | 98,940 SqFt                    |         | Length:                            | 450 Ft        |                | Width:    | 220 Ft |               |              |               |       |
| Slabs:               | Slab Length:                   |         | Ft                                 |               | Slab Width:    | Ft        |        | Joint Length: | Ft           |               |       |
| Shoulder:            | Street Type:                   |         | Grade:                             |               | 0              |           | Lanes: | 0             |              |               |       |
| Section Comments:    |                                |         |                                    |               |                |           |        |               |              |               |       |
| Work Date:           | 9/1/2005                       |         | Work Type: New Construction - AC   |               |                |           | Code:  | NC-AC         |              | Is Major M&R: | True  |
| Work Date:           | 9/1/2012                       |         | Work Type: Crack Sealing - AC      |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False |
| Work Date:           | 9/2/2012                       |         | Work Type: Patching - AC Deep      |               |                |           | Code:  | PA-AD         |              | Is Major M&R: | False |
| Work Date:           | 9/1/2015                       |         | Work Type: Crack Sealing - AC      |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False |
| Work Date:           | 7/1/2018                       |         | Work Type: Crack Sealing - AC      |               |                |           | Code:  | CS-AC         |              | Is Major M&R: | False |
| Work Date:           | 7/2/2018                       |         | Work Type: Surface Seal - Fog Seal |               |                |           | Code:  | SS-FS         |              | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                      | 20            |                | Surveyed: | 5      |               |              |               |       |
| Conditions:          | PCI: 52                        |         |                                    |               |                |           |        |               |              |               |       |
| Inspection Comments: |                                |         |                                    |               |                |           |        |               |              |               |       |
| Sample Number:       | 01                             | Type:   | R                                  | Area:         | 5000.00 SqFt   |           | PCI:   | 49            |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |               |                |           |        |               |              |               |       |
| 57                   | WEATHERING                     | L       | 3500.00                            | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 118.00                             | Ft            |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 18.00                              | SqFt          |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 12.00                              | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 360.00                             | Ft            |                |           |        |               |              |               |       |
| 57                   | WEATHERING                     | M       | 1500.00                            | SqFt          |                |           |        |               |              |               |       |
| Sample Number:       | 07                             | Type:   | R                                  | Area:         | 5000.00 SqFt   |           | PCI:   | 54            |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |               |                |           |        |               |              |               |       |
| 57                   | WEATHERING                     | L       | 5000.00                            | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | H       | 25.00                              | Ft            |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 84.00                              | Ft            |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 10.00                              | SqFt          |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 20.00                              | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 168.00                             | Ft            |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 100.00                             | Ft            |                |           |        |               |              |               |       |
| Sample Number:       | 12                             | Type:   | R                                  | Area:         | 5000.00 SqFt   |           | PCI:   | 51            |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |               |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 4.00                               | SqFt          |                |           |        |               |              |               |       |
| 57                   | WEATHERING                     | L       | 5000.00                            | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 270.00                             | Ft            |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 202.00                             | Ft            |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 95.00                              | Ft            |                |           |        |               |              |               |       |
| Sample Number:       | 13                             | Type:   | R                                  | Area:         | 5000.00 SqFt   |           | PCI:   | 50            |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |               |                |           |        |               |              |               |       |
| 57                   | WEATHERING                     | L       | 5000.00                            | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 325.00                             | Ft            |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 15.00                              | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 281.00                             | Ft            |                |           |        |               |              |               |       |
| Sample Number:       | 18                             | Type:   | R                                  | Area:         | 5000.00 SqFt   |           | PCI:   | 54            |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |               |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 6.00                               | SqFt          |                |           |        |               |              |               |       |
| 48                   | L & T CR                       | M       | 318.00                             | Ft            |                |           |        |               |              |               |       |
| 41                   | ALLIGATOR CR                   | M       | 18.00                              | SqFt          |                |           |        |               |              |               |       |

|    |            |   |         |      |
|----|------------|---|---------|------|
| 57 | WEATHERING | L | 5000.00 | SqFt |
| 50 | PATCHING   | L | 12.00   | SqFt |
| 48 | L & T CR   | M | 114.00  | Ft   |

|                                                 |              |         |                                             |               |                |           |        |           |               |               |       |
|-------------------------------------------------|--------------|---------|---------------------------------------------|---------------|----------------|-----------|--------|-----------|---------------|---------------|-------|
| Network:                                        | Bend         |         |                                             | Name:         | Bend Municipal |           |        |           |               |               |       |
| Branch:                                         | A03BE        |         | Name:                                       | Apron 03 Bend |                | Use:      | APRON  | Area:     | 60,980 SqFt   |               |       |
| Section:                                        | 01           | of      | 2                                           | From:         | Taxiway 16     |           |        | To:       | Section 02    |               |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        |               | Zone:          | KBDN      |        | Category: | L             | Rank:         | S     |
| Area:                                           | 52,460 SqFt  |         | Length:                                     | 350 Ft        |                | Width:    | 213 Ft |           |               |               |       |
| Slabs:                                          | Slab Length: |         | Ft                                          |               | Slab Width:    |           | Ft     |           | Joint Length: | Ft            |       |
| Shoulder:                                       | Street Type: |         | Grade:                                      |               | 0              |           | Lanes: |           | 0             |               |       |
| Section Comments:                               |              |         |                                             |               |                |           |        |           |               |               |       |
| Work Date:                                      | 9/1/1995     |         | Work Type: Base Course - Unknown (Major MR) |               |                |           | Code:  | BA-UN     |               | Is Major M&R: | True  |
| Work Date:                                      | 9/2/1995     |         | Work Type: New Construction - AC            |               |                |           | Code:  | NC-AC     |               | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2000     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC     |               | Is Major M&R: | False |
| Work Date:                                      | 9/2/2000     |         | Work Type: Surface Seal - Fog Seal          |               |                |           | Code:  | SS-FS     |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC     |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Seal - Wide Cracks         |               |                |           | Code:  | CS-WD     |               | Is Major M&R: | False |
| Work Date:                                      | 9/2/2008     |         | Work Type: Patching - AC Deep               |               |                |           | Code:  | PA-AD     |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC     |               | Is Major M&R: | False |
| Work Date:                                      | 9/2/2012     |         | Work Type: Patching - AC Deep               |               |                |           | Code:  | PA-AD     |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |               |                |           | Code:  | CS-AC     |               | Is Major M&R: | False |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 10            |                | Surveyed: |        | 4         |               |               |       |
| Conditions:                                     | PCI: 53      |         |                                             |               |                |           |        |           |               |               |       |
| Inspection Comments:                            |              |         |                                             |               |                |           |        |           |               |               |       |
| Sample Number:                                  | 01           | Type:   | R                                           | Area:         | 6270.00 SqFt   |           | PCI:   | 55        |               |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | L       | 37.00                                       | SqFt          |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | M       | 37.00                                       | SqFt          |                |           |        |           |               |               |       |
| 41                                              | ALLIGATOR CR | M       | 4.00                                        | SqFt          |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | M       | 158.00                                      | Ft            |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | L       | 37.00                                       | SqFt          |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | L       | 37.00                                       | SqFt          |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | L       | 150.00                                      | Ft            |                |           |        |           |               |               |       |
| 57                                              | WEATHERING   | M       | 6270.00                                     | SqFt          |                |           |        |           |               |               |       |
| 41                                              | ALLIGATOR CR | M       | 6.00                                        | SqFt          |                |           |        |           |               |               |       |
| Sample Number:                                  | 05           | Type:   | R                                           | Area:         | 5254.00 SqFt   |           | PCI:   | 40        |               |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | M       | 65.00                                       | SqFt          |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | M       | 236.00                                      | Ft            |                |           |        |           |               |               |       |
| 41                                              | ALLIGATOR CR | M       | 24.00                                       | SqFt          |                |           |        |           |               |               |       |
| 41                                              | ALLIGATOR CR | M       | 96.00                                       | SqFt          |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | L       | 75.00                                       | Ft            |                |           |        |           |               |               |       |
| 57                                              | WEATHERING   | M       | 5254.00                                     | SqFt          |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | L       | 154.00                                      | SqFt          |                |           |        |           |               |               |       |
| Sample Number:                                  | 06           | Type:   | R                                           | Area:         | 5770.00 SqFt   |           | PCI:   | 65        |               |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | M       | 224.00                                      | Ft            |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | L       | 126.00                                      | SqFt          |                |           |        |           |               |               |       |
| 50                                              | PATCHING     | M       | 52.00                                       | SqFt          |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | L       | 60.00                                       | Ft            |                |           |        |           |               |               |       |
| Sample Number:                                  | 10           | Type:   | R                                           | Area:         | 5250.00 SqFt   |           | PCI:   | 54        |               |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |               |                |           |        |           |               |               |       |
| 48                                              | L & T CR     | L       | 58.00                                       | Ft            |                |           |        |           |               |               |       |

|    |              |   |         |      |
|----|--------------|---|---------|------|
| 48 | L & T CR     | M | 100.00  | Ft   |
| 41 | ALLIGATOR CR | M | 32.00   | SqFt |
| 50 | PATCHING     | L | 141.00  | SqFt |
| 50 | PATCHING     | M | 12.00   | SqFt |
| 57 | WEATHERING   | M | 5250.00 | SqFt |

|                      |                                |               |                                      |           |               |           |       |               |          |
|----------------------|--------------------------------|---------------|--------------------------------------|-----------|---------------|-----------|-------|---------------|----------|
| Network:             | Bend                           | Name:         | Bend Municipal                       |           |               |           |       |               |          |
| Branch:              | A03BE                          | Name:         | Apron 03 Bend                        |           | Use:          | APRON     | Area: | 60,980 SqFt   |          |
| Section:             | 02                             | of            | 2                                    | From:     | Section 01    | To:       | -     | Last Const.:  | 9/1/2005 |
| Surface:             | AC                             | Family:       | 2022_Central_Cat1/2_Apr<br>on_AC/AAC | Zone:     | KBDN          | Category: | L     | Rank:         | S        |
| Area:                | 8,520 SqFt                     | Length:       | 213 Ft                               | Width:    | 40 Ft         |           |       |               |          |
| Slabs:               | Slab Length:                   | Ft            | Slab Width:                          | Ft        | Joint Length: | Ft        |       |               |          |
| Shoulder:            | Street Type:                   | Grade:        | 0                                    | Lanes:    | 0             |           |       |               |          |
| Section Comments:    |                                |               |                                      |           |               |           |       |               |          |
| Work Date:           | 9/1/2005                       | Work Type:    | New Construction - AC                |           |               | Code:     | NC-AC | Is Major M&R: | True     |
| Work Date:           | 9/1/2008                       | Work Type:    | Crack Sealing - AC                   |           |               | Code:     | CS-AC | Is Major M&R: | False    |
| Work Date:           | 9/1/2012                       | Work Type:    | Crack Sealing - AC                   |           |               | Code:     | CS-AC | Is Major M&R: | False    |
| Work Date:           | 9/1/2015                       | Work Type:    | Crack Sealing - AC                   |           |               | Code:     | CS-AC | Is Major M&R: | False    |
| Last Insp. Date:     | 3/1/2022                       | TotalSamples: | 2                                    | Surveyed: | 2             |           |       |               |          |
| Conditions:          | PCI:                           | 52            |                                      |           |               |           |       |               |          |
| Inspection Comments: |                                |               |                                      |           |               |           |       |               |          |
| Sample Number:       | 01                             | Type:         | R                                    | Area:     | 4000.00 SqFt  | PCI:      | 48    |               |          |
| Sample Comments:     | Created by Inspection Schedule |               |                                      |           |               |           |       |               |          |
| 48                   | L & T CR                       | M             | 200.00                               | Ft        |               |           |       |               |          |
| 50                   | PATCHING                       | L             | 204.00                               | SqFt      |               |           |       |               |          |
| 41                   | ALLIGATOR CR                   | M             | 52.00                                | SqFt      |               |           |       |               |          |
| 48                   | L & T CR                       | L             | 120.00                               | Ft        |               |           |       |               |          |
| 57                   | WEATHERING                     | L             | 4000.00                              | SqFt      |               |           |       |               |          |
| Sample Number:       | 02                             | Type:         | R                                    | Area:     | 4520.00 SqFt  | PCI:      | 55    |               |          |
| Sample Comments:     | Created by Inspection Schedule |               |                                      |           |               |           |       |               |          |
| 50                   | PATCHING                       | L             | 131.00                               | SqFt      |               |           |       |               |          |
| 48                   | L & T CR                       | L             | 100.00                               | Ft        |               |           |       |               |          |
| 48                   | L & T CR                       | M             | 217.00                               | Ft        |               |           |       |               |          |
| 41                   | ALLIGATOR CR                   | M             | 30.00                                | SqFt      |               |           |       |               |          |
| 50                   | PATCHING                       | L             | 110.00                               | SqFt      |               |           |       |               |          |
| 57                   | WEATHERING                     | L             | 4520.00                              | SqFt      |               |           |       |               |          |

|                      |              |  |                                       |                                   |             |           |              |               |              |               |      |
|----------------------|--------------|--|---------------------------------------|-----------------------------------|-------------|-----------|--------------|---------------|--------------|---------------|------|
| Network:             | Bend         |  | Name:                                 | Bend Municipal                    |             |           |              |               |              |               |      |
| Branch:              | A04BE        |  | Name:                                 | Apron 04 Bend                     |             | Use:      | APRON        | Area:         | 44,150 SqFt  |               |      |
| Section:             | 02 of 2      |  | From:                                 | A04BE-01                          |             | To:       | TLA7BE-01    |               | Last Const.: | 7/1/2013      |      |
| Surface:             | AC           |  | Family:                               | 2022_Central_Cat1/2_Apr on_AC/AAC |             | Zone:     | Category:    |               | Rank:        | S             |      |
| Area:                | 7,510 SqFt   |  | Length:                               | 120 Ft                            |             | Width:    | 50 Ft        |               |              |               |      |
| Slabs:               | Slab Length: |  | Ft                                    |                                   | Slab Width: | Ft        |              | Joint Length: | Ft           |               |      |
| Shoulder:            | Street Type: |  | Grade:                                |                                   | 0           |           | Lanes:       | 0             |              |               |      |
| Section Comments:    |              |  |                                       |                                   |             |           |              |               |              |               |      |
| Work Date:           | 7/1/2013     |  | Work Type: New Construction - Initial |                                   |             |           | Code:        | NU-IN         |              | Is Major M&R: | True |
| Last Insp. Date:     | 3/1/2022     |  | TotalSamples:                         | 2                                 |             | Surveyed: | 2            |               |              |               |      |
| Conditions:          | PCI: 76      |  |                                       |                                   |             |           |              |               |              |               |      |
| Inspection Comments: |              |  |                                       |                                   |             |           |              |               |              |               |      |
| Sample Number:       | 01           |  | Type:                                 | R                                 |             | Area:     | 3735.00 SqFt |               | PCI:         | 76            |      |
| Sample Comments:     |              |  |                                       |                                   |             |           |              |               |              |               |      |
| 48                   | L & T CR     |  | L                                     | 25.00 Ft                          |             |           |              |               |              |               |      |
| 48                   | L & T CR     |  | L                                     | 108.00 Ft                         |             |           |              |               |              |               |      |
| 48                   | L & T CR     |  | M                                     | 20.00 Ft                          |             |           |              |               |              |               |      |
| 48                   | L & T CR     |  | L                                     | 6.00 Ft                           |             |           |              |               |              |               |      |
| 48                   | L & T CR     |  | L                                     | 34.00 Ft                          |             |           |              |               |              |               |      |
| 57                   | WEATHERING   |  | L                                     | 3735.00 SqFt                      |             |           |              |               |              |               |      |
| Sample Number:       | 02           |  | Type:                                 | R                                 |             | Area:     | 3775.00 SqFt |               | PCI:         | 75            |      |
| Sample Comments:     |              |  |                                       |                                   |             |           |              |               |              |               |      |
| 57                   | WEATHERING   |  | L                                     | 2000.00 SqFt                      |             |           |              |               |              |               |      |
| 48                   | L & T CR     |  | L                                     | 63.00 Ft                          |             |           |              |               |              |               |      |
| 57                   | WEATHERING   |  | M                                     | 1775.00 SqFt                      |             |           |              |               |              |               |      |

|                      |                                |         |                                      |               |                |              |                         |               |       |             |              |               |       |
|----------------------|--------------------------------|---------|--------------------------------------|---------------|----------------|--------------|-------------------------|---------------|-------|-------------|--------------|---------------|-------|
| Network:             | Bend                           |         |                                      | Name:         | Bend Municipal |              |                         |               |       |             |              |               |       |
| Branch:              | A04BE                          |         | Name:                                | Apron 04 Bend |                | Use:         | APRON                   |               | Area: | 44,150 SqFt |              |               |       |
| Section:             | 01                             | of      | 2                                    | From:         | TABE-01        |              |                         | To:           | West  |             | Last Const.: | 9/3/2012      |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC |               | Zone:          | KBDN         |                         | Category:     | L     |             | Rank:        | S             |       |
| Area:                | 36,640 SqFt                    |         | Length:                              | 478 Ft        |                | Width:       | 75 Ft                   |               |       |             |              |               |       |
| Slabs:               | Slab Length:                   |         | Ft                                   |               | Slab Width:    | Ft           |                         | Joint Length: | Ft    |             |              |               |       |
| Shoulder:            | Street Type:                   |         |                                      |               | Grade:         | 0            |                         | Lanes:        | 0     |             |              |               |       |
| Section Comments:    |                                |         |                                      |               |                |              |                         |               |       |             |              |               |       |
| Work Date:           | 9/1/2012                       |         | Work Type:                           |               |                |              | Subbase - Aggregate     |               | Code: | SB-AG       |              | Is Major M&R: | False |
| Work Date:           | 9/2/2012                       |         | Work Type:                           |               |                |              | Base Course - Aggregate |               | Code: | BA-AG       |              | Is Major M&R: | False |
| Work Date:           | 9/3/2012                       |         | Work Type:                           |               |                |              | New Construction - AC   |               | Code: | NC-AC       |              | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                        | 7             |                | Surveyed:    | 4                       |               |       |             |              |               |       |
| Conditions:          | PCI:                           | 89      |                                      |               |                |              |                         |               |       |             |              |               |       |
| Inspection Comments: |                                |         |                                      |               |                |              |                         |               |       |             |              |               |       |
| Sample Number:       | 01                             | Type:   | R                                    |               | Area:          | 4906.00 SqFt |                         | PCI:          | 89    |             |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |               |                |              |                         |               |       |             |              |               |       |
| 48                   | L & T CR                       |         | L                                    | 43.00 Ft      |                |              |                         |               |       |             |              |               |       |
| 57                   | WEATHERING                     |         | L                                    | 4906.00 SqFt  |                |              |                         |               |       |             |              |               |       |
| Sample Number:       | 02                             | Type:   | R                                    |               | Area:          | 5625.00 SqFt |                         | PCI:          | 90    |             |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |               |                |              |                         |               |       |             |              |               |       |
| 48                   | L & T CR                       |         | L                                    | 38.00 Ft      |                |              |                         |               |       |             |              |               |       |
| 57                   | WEATHERING                     |         | L                                    | 5625.00 SqFt  |                |              |                         |               |       |             |              |               |       |
| Sample Number:       | 05                             | Type:   | R                                    |               | Area:          | 5625.00 SqFt |                         | PCI:          | 89    |             |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |               |                |              |                         |               |       |             |              |               |       |
| 57                   | WEATHERING                     |         | L                                    | 5625.00 SqFt  |                |              |                         |               |       |             |              |               |       |
| 48                   | L & T CR                       |         | L                                    | 45.00 Ft      |                |              |                         |               |       |             |              |               |       |
| Sample Number:       | 06                             | Type:   | R                                    |               | Area:          | 5625.00 SqFt |                         | PCI:          | 87    |             |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |               |                |              |                         |               |       |             |              |               |       |
| 57                   | WEATHERING                     |         | L                                    | 5625.00 SqFt  |                |              |                         |               |       |             |              |               |       |
| 48                   | L & T CR                       |         | L                                    | 38.00 Ft      |                |              |                         |               |       |             |              |               |       |
| 48                   | L & T CR                       |         | L                                    | 82.00 Ft      |                |              |                         |               |       |             |              |               |       |

|                                                 |              |         |                                   |                                             |                |        |           |           |               |              |               |       |
|-------------------------------------------------|--------------|---------|-----------------------------------|---------------------------------------------|----------------|--------|-----------|-----------|---------------|--------------|---------------|-------|
| Network:                                        | Bend         |         |                                   | Name:                                       | Bend Municipal |        |           |           |               |              |               |       |
| Branch:                                         | A05BE        |         | Name:                             | Apron 05 Bend                               |                | Use:   | APRON     | Area:     | 16,240 SqFt   |              |               |       |
| Section:                                        | 01           | of      | 2                                 | From:                                       | Taxiway        |        |           | To:       | End           | Last Const.: | 9/1/2005      |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC |                                             | Zone:          | KBDN   |           | Category: | L             | Rank:        | S             |       |
| Area:                                           | 7,160 SqFt   |         | Length:                           | 232 Ft                                      |                | Width: | 30 Ft     |           |               |              |               |       |
| Slabs:                                          | Slab Length: |         | Ft                                |                                             | Slab Width:    |        | Ft        |           | Joint Length: |              | Ft            |       |
| Shoulder:                                       | Street Type: |         |                                   |                                             | Grade:         | 0      |           | Lanes:    | 0             |              |               |       |
| Section Comments:                               |              |         |                                   |                                             |                |        |           |           |               |              |               |       |
| Work Date:                                      | 9/1/1994     |         |                                   | Work Type: Base Course - Unknown (Major MR) |                |        |           | Code:     | BA-UN         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/2/1994     |         |                                   | Work Type: New Construction - AC            |                |        |           | Code:     | NC-AC         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2000     |         |                                   | Work Type: Crack Sealing - AC               |                |        |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/2/2000     |         |                                   | Work Type: Surface Seal - Fog Seal          |                |        |           | Code:     | SS-FS         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2004     |         |                                   | Work Type: Crack Sealing - AC               |                |        |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2005     |         |                                   | Work Type: New Construction - AC            |                |        |           | Code:     | NC-AC         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2008     |         |                                   | Work Type: Crack Sealing - AC               |                |        |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2012     |         |                                   | Work Type: Crack Sealing - AC               |                |        |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2015     |         |                                   | Work Type: Crack Sealing - AC               |                |        |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Last Insp. Date:                                | 3/1/2022     |         |                                   | TotalSamples:                               | 2              |        | Surveyed: | 2         |               |              |               |       |
| Conditions:                                     | PCI:         | 49      |                                   |                                             |                |        |           |           |               |              |               |       |
| Inspection Comments:                            |              |         |                                   |                                             |                |        |           |           |               |              |               |       |
| Sample Number:                                  | 01           | Type:   | R                                 | Area:                                       | 3200.00 SqFt   |        |           | PCI:      | 40            |              |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                   |                                             |                |        |           |           |               |              |               |       |
| 48                                              | L & T CR     |         | L                                 | 241.00                                      | Ft             |        |           |           |               |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 50.00                                       | Ft             |        |           |           |               |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 150.00                                      | Ft             |        |           |           |               |              |               |       |
| 41                                              | ALLIGATOR CR |         | H                                 | 48.00                                       | SqFt           |        |           |           |               |              |               |       |
| 41                                              | ALLIGATOR CR |         | M                                 | 6.00                                        | SqFt           |        |           |           |               |              |               |       |
| 57                                              | WEATHERING   |         | L                                 | 3200.00                                     | SqFt           |        |           |           |               |              |               |       |
| Sample Number:                                  | 02           | Type:   | R                                 | Area:                                       | 3960.00 SqFt   |        |           | PCI:      | 57            |              |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                   |                                             |                |        |           |           |               |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 150.00                                      | Ft             |        |           |           |               |              |               |       |
| 41                                              | ALLIGATOR CR |         | M                                 | 6.00                                        | SqFt           |        |           |           |               |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 62.00                                       | Ft             |        |           |           |               |              |               |       |
| 41                                              | ALLIGATOR CR |         | M                                 | 4.00                                        | SqFt           |        |           |           |               |              |               |       |
| 41                                              | ALLIGATOR CR |         | M                                 | 4.00                                        | SqFt           |        |           |           |               |              |               |       |
| 57                                              | WEATHERING   |         | L                                 | 3960.00                                     | SqFt           |        |           |           |               |              |               |       |
| 48                                              | L & T CR     |         | L                                 | 267.00                                      | Ft             |        |           |           |               |              |               |       |

|                             |                                |                |                                                    |                |                    |                  |              |                      |             |                          |          |
|-----------------------------|--------------------------------|----------------|----------------------------------------------------|----------------|--------------------|------------------|--------------|----------------------|-------------|--------------------------|----------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                       | Bend Municipal |                    |                  |              |                      |             |                          |          |
| <b>Branch:</b>              | A05BE                          |                | <b>Name:</b>                                       | Apron 05 Bend  |                    | <b>Use:</b>      | APRON        | <b>Area:</b>         | 16,240 SqFt |                          |          |
| <b>Section:</b>             | 02                             | of 2           | <b>From:</b>                                       | Taxiway        |                    |                  | <b>To:</b>   | End                  |             | <b>Last Const.:</b>      | 9/1/2011 |
| <b>Surface:</b>             | AAC                            | <b>Family:</b> | 2022_Central_Cat1/2_Apr on_AC/AAC                  |                | <b>Zone:</b>       | KBDN             |              | <b>Category:</b>     | L           | <b>Rank:</b>             | S        |
| <b>Area:</b>                | 9,080 SqFt                     |                | <b>Length:</b>                                     | 227 Ft         |                    | <b>Width:</b>    | 40 Ft        |                      |             |                          |          |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                 |                | <b>Slab Width:</b> | Ft               |              | <b>Joint Length:</b> | Ft          |                          |          |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                    |                | <b>Grade:</b>      | 0                |              | <b>Lanes:</b>        | 0           |                          |          |
| <b>Section Comments:</b>    |                                |                |                                                    |                |                    |                  |              |                      |             |                          |          |
| <b>Work Date:</b>           | 9/1/1994                       |                | <b>Work Type:</b> Base Course - Unknown (Major MR) |                |                    |                  | <b>Code:</b> | BA-UN                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/2/1994                       |                | <b>Work Type:</b> New Construction - AC            |                |                    |                  | <b>Code:</b> | NC-AC                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/1/2000                       |                | <b>Work Type:</b> Crack Sealing - AC               |                |                    |                  | <b>Code:</b> | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/2/2000                       |                | <b>Work Type:</b> Surface Seal - Fog Seal          |                |                    |                  | <b>Code:</b> | SS-FS                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/1/2004                       |                | <b>Work Type:</b> Crack Sealing - AC               |                |                    |                  | <b>Code:</b> | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/1/2005                       |                | <b>Work Type:</b> New Construction - Initial       |                |                    |                  | <b>Code:</b> | NU-IN                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/1/2005                       |                | <b>Work Type:</b> New Construction - AC            |                |                    |                  | <b>Code:</b> | NC-AC                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/1/2008                       |                | <b>Work Type:</b> Crack Sealing - AC               |                |                    |                  | <b>Code:</b> | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/1/2011                       |                | <b>Work Type:</b> Overlay - AC Structural          |                |                    |                  | <b>Code:</b> | OL-AS                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                               | 2              |                    | <b>Surveyed:</b> | 2            |                      |             |                          |          |
| <b>Conditions:</b>          | PCI: 76                        |                |                                                    |                |                    |                  |              |                      |             |                          |          |
| <b>Inspection Comments:</b> |                                |                |                                                    |                |                    |                  |              |                      |             |                          |          |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                  | <b>Area:</b>   | 4000.00 SqFt       |                  | <b>PCI:</b>  | 74                   |             |                          |          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                |                    |                  |              |                      |             |                          |          |
| 57                          | WEATHERING                     | L              | 4000.00                                            | SqFt           |                    |                  |              |                      |             |                          |          |
| 48                          | L & T CR                       | M              | 130.00                                             | Ft             |                    |                  |              |                      |             |                          |          |
| 48                          | L & T CR                       | L              | 13.00                                              | Ft             |                    |                  |              |                      |             |                          |          |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>   | R                                                  | <b>Area:</b>   | 5080.00 SqFt       |                  | <b>PCI:</b>  | 77                   |             |                          |          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                |                    |                  |              |                      |             |                          |          |
| 48                          | L & T CR                       | L              | 18.00                                              | Ft             |                    |                  |              |                      |             |                          |          |
| 48                          | L & T CR                       | M              | 40.00                                              | Ft             |                    |                  |              |                      |             |                          |          |
| 57                          | WEATHERING                     | L              | 5080.00                                            | SqFt           |                    |                  |              |                      |             |                          |          |
| 48                          | L & T CR                       | M              | 73.00                                              | Ft             |                    |                  |              |                      |             |                          |          |

|                      |                                |         |                                   |                |              |             |           |               |                       |
|----------------------|--------------------------------|---------|-----------------------------------|----------------|--------------|-------------|-----------|---------------|-----------------------|
| Network:             | Bend                           |         | Name:                             | Bend Municipal |              |             |           |               |                       |
| Branch:              | A06BE                          |         | Name:                             | Apron 06 Bend  |              | Use:        | APRON     | Area:         | 30,000 SqFt           |
| Section:             | 01                             | of      | 1                                 | From:          | T27BE-01     |             | To:       | -             | Last Const.: 9/1/2008 |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC | Zone:          | KBDN         |             | Category: | L             | Rank: S               |
| Area:                | 30,000 SqFt                    |         | Length:                           | 300 Ft         |              | Width:      | 100 Ft    |               |                       |
| Slabs:               | Slab Length:                   |         | Ft                                |                | Slab Width:  | Ft          |           | Joint Length: | Ft                    |
| Shoulder:            | Street Type:                   |         | Grade:                            |                | 0            |             | Lanes:    | 0             |                       |
| Section Comments:    |                                |         |                                   |                |              |             |           |               |                       |
| Work Date:           | 9/1/2008                       |         | Work Type: New Construction - AC  |                |              |             | Code:     | NC-AC         | Is Major M&R: True    |
| Work Date:           | 9/1/2015                       |         | Work Type: Crack Sealing - AC     |                |              |             | Code:     | CS-AC         | Is Major M&R: False   |
| Work Date:           | 9/2/2015                       |         | Work Type: Patching - AC Deep     |                |              |             | Code:     | PA-AD         | Is Major M&R: False   |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                     | 6              |              | Surveyed: 3 |           |               |                       |
| Conditions:          | PCI:                           | 72      |                                   |                |              |             |           |               |                       |
| Inspection Comments: |                                |         |                                   |                |              |             |           |               |                       |
| Sample Number:       | 01                             | Type:   | R                                 | Area:          | 5200.00 SqFt |             | PCI:      | 67            |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                   |                |              |             |           |               |                       |
| 57                   | WEATHERING                     |         | L                                 | 5200.00        | SqFt         |             |           |               |                       |
| 50                   | PATCHING                       |         | L                                 | 224.00         | SqFt         |             |           |               |                       |
| 48                   | L & T CR                       |         | M                                 | 131.00         | Ft           |             |           |               |                       |
| 41                   | ALLIGATOR CR                   |         | M                                 | 6.00           | SqFt         |             |           |               |                       |
| Sample Number:       | 02                             | Type:   | R                                 | Area:          | 5000.00 SqFt |             | PCI:      | 67            |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                   |                |              |             |           |               |                       |
| 57                   | WEATHERING                     |         | L                                 | 5000.00        | SqFt         |             |           |               |                       |
| 48                   | L & T CR                       |         | M                                 | 191.00         | Ft           |             |           |               |                       |
| 50                   | PATCHING                       |         | L                                 | 102.00         | SqFt         |             |           |               |                       |
| 48                   | L & T CR                       |         | L                                 | 8.00           | Ft           |             |           |               |                       |
| Sample Number:       | 04                             | Type:   | R                                 | Area:          | 5000.00 SqFt |             | PCI:      | 80            |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                   |                |              |             |           |               |                       |
| 50                   | PATCHING                       |         | L                                 | 150.00         | SqFt         |             |           |               |                       |
| 57                   | WEATHERING                     |         | L                                 | 5000.00        | SqFt         |             |           |               |                       |
| 48                   | L & T CR                       |         | L                                 | 143.00         | Ft           |             |           |               |                       |

|                                                 |              |         |                                             |                |              |           |           |               |                       |
|-------------------------------------------------|--------------|---------|---------------------------------------------|----------------|--------------|-----------|-----------|---------------|-----------------------|
| Network:                                        | Bend         |         | Name:                                       | Bend Municipal |              |           |           |               |                       |
| Branch:                                         | A07BE        |         | Name:                                       | Apron 07 Bend  |              | Use:      | APRON     | Area:         | 43,115 SqFt           |
| Section:                                        | 02           | of      | 4                                           | From:          | T15-01       |           | To:       | South         | Last Const.: 9/2/1999 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        | Zone:          | KBDN         |           | Category: | L             | Rank: S               |
| Area:                                           | 9,223 SqFt   |         | Length:                                     | 263 Ft         |              | Width:    | 50 Ft     |               |                       |
| Slabs:                                          | Slab Length: |         | Ft                                          |                | Slab Width:  | Ft        |           | Joint Length: | Ft                    |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                | 0            |           | Lanes:    | 0             |                       |
| Section Comments:                               |              |         |                                             |                |              |           |           |               |                       |
| Work Date:                                      | 9/1/1999     |         | Work Type: Base Course - Unknown (Major MR) |                |              |           | Code:     | BA-UN         | Is Major M&R: True    |
| Work Date:                                      | 9/2/1999     |         | Work Type: New Construction - AC            |                |              |           | Code:     | NC-AC         | Is Major M&R: True    |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:     | CS-AC         | Is Major M&R: False   |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:     | CS-AC         | Is Major M&R: False   |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |                |              |           | Code:     | CS-AC         | Is Major M&R: False   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 2              |              | Surveyed: | 2         |               |                       |
| Conditions:                                     | PCI: 64      |         |                                             |                |              |           |           |               |                       |
| Inspection Comments:                            |              |         |                                             |                |              |           |           |               |                       |
| Sample Number:                                  | 01           | Type:   | R                                           | Area:          | 4222.00 SqFt |           | PCI:      | 63            |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                |              |           |           |               |                       |
| 48                                              | L & T CR     | M       | 160.00                                      | Ft             |              |           |           |               |                       |
| 57                                              | WEATHERING   | M       | 4222.00                                     | SqFt           |              |           |           |               |                       |
| 48                                              | L & T CR     | M       | 26.00                                       | Ft             |              |           |           |               |                       |
| 48                                              | L & T CR     | M       | 118.00                                      | Ft             |              |           |           |               |                       |
| 48                                              | L & T CR     | L       | 11.00                                       | Ft             |              |           |           |               |                       |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:          | 5001.00 SqFt |           | PCI:      | 65            |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                |              |           |           |               |                       |
| 48                                              | L & T CR     | M       | 100.00                                      | Ft             |              |           |           |               |                       |
| 57                                              | WEATHERING   | M       | 5001.00                                     | SqFt           |              |           |           |               |                       |
| 48                                              | L & T CR     | M       | 235.00                                      | Ft             |              |           |           |               |                       |

|                      |              |                                |                                             |                |              |           |           |               |                       |
|----------------------|--------------|--------------------------------|---------------------------------------------|----------------|--------------|-----------|-----------|---------------|-----------------------|
| Network:             | Bend         |                                | Name:                                       | Bend Municipal |              |           |           |               |                       |
| Branch:              | A07BE        |                                | Name:                                       | Apron 07 Bend  |              | Use:      | APRON     | Area:         | 43,115 SqFt           |
| Section:             | 03           | of                             | 4                                           | From:          | T15-01       |           | To:       | South         | Last Const.: 9/2/1999 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        | Zone:          | KBDN         |           | Category: | L             | Rank: S               |
| Area:                | 12,472 SqFt  |                                | Length:                                     | 270 Ft         |              | Width:    | 50 Ft     |               |                       |
| Slabs:               | Slab Length: |                                | Ft                                          |                | Slab Width:  | Ft        |           | Joint Length: | Ft                    |
| Shoulder:            | Street Type: |                                | Grade:                                      |                | 0            |           | Lanes:    | 0             |                       |
| Section Comments:    |              |                                |                                             |                |              |           |           |               |                       |
| Work Date:           | 9/1/1999     |                                | Work Type: Base Course - Unknown (Major MR) |                |              |           | Code:     | BA-UN         | Is Major M&R: True    |
| Work Date:           | 9/2/1999     |                                | Work Type: New Construction - AC            |                |              |           | Code:     | NC-AC         | Is Major M&R: True    |
| Work Date:           | 9/1/2004     |                                | Work Type: Crack Sealing - AC               |                |              |           | Code:     | CS-AC         | Is Major M&R: False   |
| Work Date:           | 9/1/2012     |                                | Work Type: Crack Sealing - AC               |                |              |           | Code:     | CS-AC         | Is Major M&R: False   |
| Work Date:           | 9/1/2015     |                                | Work Type: Crack Sealing - AC               |                |              |           | Code:     | CS-AC         | Is Major M&R: False   |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                               | 2              |              | Surveyed: | 2         |               |                       |
| Conditions:          | PCI: 66      |                                |                                             |                |              |           |           |               |                       |
| Inspection Comments: |              |                                |                                             |                |              |           |           |               |                       |
| Sample Number:       | 01           | Type:                          | R                                           | Area:          | 5800.00 SqFt |           | PCI:      | 67            |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                             |                |              |           |           |               |                       |
| 48                   | L & T CR     | M                              | 265.00 Ft                                   |                |              |           |           |               |                       |
| 57                   | WEATHERING   | M                              | 5800.00 SqFt                                |                |              |           |           |               |                       |
| 48                   | L & T CR     | L                              | 84.00 Ft                                    |                |              |           |           |               |                       |
| Sample Number:       | 02           | Type:                          | R                                           | Area:          | 6672.00 SqFt |           | PCI:      | 66            |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                             |                |              |           |           |               |                       |
| 50                   | PATCHING     | L                              | 72.00 SqFt                                  |                |              |           |           |               |                       |
| 48                   | L & T CR     | M                              | 343.00 Ft                                   |                |              |           |           |               |                       |
| 48                   | L & T CR     | L                              | 120.00 Ft                                   |                |              |           |           |               |                       |

|                      |              |                                |                                      |                |              |             |               |                     |                       |
|----------------------|--------------|--------------------------------|--------------------------------------|----------------|--------------|-------------|---------------|---------------------|-----------------------|
| Network:             | Bend         |                                | Name:                                | Bend Municipal |              |             |               |                     |                       |
| Branch:              | A07BE        |                                | Name:                                | Apron 07 Bend  |              | Use:        | APRON         | Area:               | 43,115 SqFt           |
| Section:             | 01           | of 4                           | From:                                | A07BE-02       |              |             | To:           | East                | Last Const.: 9/3/2012 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Apr<br>on_AC/AAC | Zone:          | KBDN         | Category:   | L             | Rank:               | S                     |
| Area:                | 15,810 SqFt  |                                | Length:                              | 223 Ft         |              | Width:      | 56 Ft         |                     |                       |
| Slabs:               | Slab Length: |                                | Ft                                   | Slab Width:    |              | Ft          | Joint Length: |                     | Ft                    |
| Shoulder:            | Street Type: |                                | Grade:                               |                | 0            | Lanes:      |               | 0                   |                       |
| Section Comments:    |              |                                |                                      |                |              |             |               |                     |                       |
| Work Date:           | 9/1/2012     |                                | Work Type: Subbase - Aggregate       |                |              | Code:       | SB-AG         | Is Major M&R: False |                       |
| Work Date:           | 9/2/2012     |                                | Work Type: Base Course - Aggregate   |                |              | Code:       | BA-AG         | Is Major M&R: False |                       |
| Work Date:           | 9/3/2012     |                                | Work Type: New Construction - AC     |                |              | Code:       | NC-AC         | Is Major M&R: True  |                       |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                        | 4              |              | Surveyed: 3 |               |                     |                       |
| Conditions:          | PCI:         | 87                             |                                      |                |              |             |               |                     |                       |
| Inspection Comments: |              |                                |                                      |                |              |             |               |                     |                       |
| Sample Number:       | 01           | Type:                          | R                                    | Area:          | 4875.00 SqFt |             | PCI:          | 84                  |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                      |                |              |             |               |                     |                       |
| 57                   | WEATHERING   | L                              | 4875.00 SqFt                         |                |              |             |               |                     |                       |
| 48                   | L & T CR     | M                              | 42.00 Ft                             |                |              |             |               |                     |                       |
| Sample Number:       | 02           | Type:                          | R                                    | Area:          | 3918.00 SqFt |             | PCI:          | 85                  |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                      |                |              |             |               |                     |                       |
| 48                   | L & T CR     | M                              | 30.00 Ft                             |                |              |             |               |                     |                       |
| 57                   | WEATHERING   | L                              | 3918.00 SqFt                         |                |              |             |               |                     |                       |
| Sample Number:       | 03           | Type:                          | R                                    | Area:          | 3358.00 SqFt |             | PCI:          | 94                  |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                      |                |              |             |               |                     |                       |
| 57                   | WEATHERING   | L                              | 3358.00 SqFt                         |                |              |             |               |                     |                       |

|                                                 |              |         |                                   |                       |              |        |       |               |             |              |               |       |
|-------------------------------------------------|--------------|---------|-----------------------------------|-----------------------|--------------|--------|-------|---------------|-------------|--------------|---------------|-------|
| Network:                                        | Bend         |         | Name:                             | Bend Municipal        |              |        |       |               |             |              |               |       |
| Branch:                                         | A07BE        |         | Name:                             | Apron 07 Bend         |              | Use:   | APRON | Area:         | 43,115 SqFt |              |               |       |
| Section:                                        | 04           | of 4    | From:                             | A07BE-03              |              |        | To:   | West          |             | Last Const.: | 9/1/2005      |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC |                       | Zone:        | KBDN   |       | Category:     | L           |              | Rank:         | S     |
| Area:                                           | 5,610 SqFt   |         | Length:                           | 270 Ft                |              | Width: | 20 Ft |               |             |              |               |       |
| Slabs:                                          | Slab Length: |         | Ft                                |                       | Slab Width:  | Ft     |       | Joint Length: | Ft          |              |               |       |
| Shoulder:                                       | Street Type: |         |                                   |                       | Grade:       | 0      |       | Lanes:        | 0           |              |               |       |
| Section Comments:                               |              |         |                                   |                       |              |        |       |               |             |              |               |       |
| Work Date:                                      | 9/1/2005     |         | Work Type:                        | New Construction - AC |              |        |       | Code:         | NC-AC       |              | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2012     |         | Work Type:                        | Crack Sealing - AC    |              |        |       | Code:         | CS-AC       |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2015     |         | Work Type:                        | Crack Sealing - AC    |              |        |       | Code:         | CS-AC       |              | Is Major M&R: | False |
| Last Insp. Date: 3/1/2022                       |              |         |                                   |                       |              |        |       |               |             |              |               |       |
| TotalSamples:                                   |              | 1       |                                   | Surveyed:             |              | 1      |       |               |             |              |               |       |
| Conditions:                                     | PCI: 25      |         |                                   |                       |              |        |       |               |             |              |               |       |
| Inspection Comments:                            |              |         |                                   |                       |              |        |       |               |             |              |               |       |
| Sample Number:                                  | 01           | Type:   | R                                 | Area:                 | 5610.00 SqFt |        | PCI:  | 25            |             |              |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                   |                       |              |        |       |               |             |              |               |       |
| 50                                              | PATCHING     |         | L                                 | 32.00                 | SqFt         |        |       |               |             |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 102.00                | Ft           |        |       |               |             |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 86.00                 | Ft           |        |       |               |             |              |               |       |
| 48                                              | L & T CR     |         | M                                 | 65.00                 | Ft           |        |       |               |             |              |               |       |
| 41                                              | ALLIGATOR CR |         | M                                 | 56.00                 | SqFt         |        |       |               |             |              |               |       |
| 41                                              | ALLIGATOR CR |         | M                                 | 820.00                | SqFt         |        |       |               |             |              |               |       |
| 57                                              | WEATHERING   |         | L                                 | 5610.00               | SqFt         |        |       |               |             |              |               |       |

|                      |              |                                |                                       |                |              |             |           |               |                     |          |
|----------------------|--------------|--------------------------------|---------------------------------------|----------------|--------------|-------------|-----------|---------------|---------------------|----------|
| Network:             | Bend         |                                | Name:                                 | Bend Municipal |              |             |           |               |                     |          |
| Branch:              | A08BE        |                                | Name:                                 | Apron 08 Bend  |              | Use:        | APRON     | Area:         | 80,434 SqFt         |          |
| Section:             | 06           | of                             | 12                                    | From:          | T19BE-01     |             | To:       | END           | Last Const.:        | 1/1/2002 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Apr<br>on_AC/AAC  |                | Zone:        | KBDN        | Category: | L             | Rank:               | S        |
| Area:                | 9,411 SqFt   |                                | Length:                               | 358 Ft         |              | Width:      | 25 Ft     |               |                     |          |
| Slabs:               | Slab Length: |                                | Ft                                    |                | Slab Width:  | Ft          |           | Joint Length: | Ft                  |          |
| Shoulder:            | Street Type: |                                |                                       |                | Grade:       | 0           |           | Lanes:        | 0                   |          |
| Section Comments:    |              |                                |                                       |                |              |             |           |               |                     |          |
| Work Date:           | 1/1/2002     |                                | Work Type: New Construction - Initial |                |              |             | Code:     | NU-IN         | Is Major M&R: True  |          |
| Work Date:           | 9/1/2012     |                                | Work Type: Crack Sealing - AC         |                |              |             | Code:     | CS-AC         | Is Major M&R: False |          |
| Work Date:           | 9/1/2015     |                                | Work Type: Crack Sealing - AC         |                |              |             | Code:     | CS-AC         | Is Major M&R: False |          |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                         | 2              |              | Surveyed: 2 |           |               |                     |          |
| Conditions:          | PCI:         | 71                             |                                       |                |              |             |           |               |                     |          |
| Inspection Comments: |              |                                |                                       |                |              |             |           |               |                     |          |
| Sample Number:       | 01           | Type:                          | R                                     | Area:          | 4465.00 SqFt |             | PCI:      | 71            |                     |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                       |                |              |             |           |               |                     |          |
| 57                   | WEATHERING   |                                | L                                     | 4465.00 SqFt   |              |             |           |               |                     |          |
| 48                   | L & T CR     |                                | M                                     | 192.00 Ft      |              |             |           |               |                     |          |
| Sample Number:       | 02           | Type:                          | R                                     | Area:          | 4946.00 SqFt |             | PCI:      | 70            |                     |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                       |                |              |             |           |               |                     |          |
| 48                   | L & T CR     |                                | M                                     | 237.00 Ft      |              |             |           |               |                     |          |
| 57                   | WEATHERING   |                                | L                                     | 4946.00 SqFt   |              |             |           |               |                     |          |

|                             |                                |  |                                                    |                                   |                    |                   |              |                      |                              |                                |
|-----------------------------|--------------------------------|--|----------------------------------------------------|-----------------------------------|--------------------|-------------------|--------------|----------------------|------------------------------|--------------------------------|
| <b>Network:</b>             | Bend                           |  | <b>Name:</b>                                       | Bend Municipal                    |                    |                   |              |                      |                              |                                |
| <b>Branch:</b>              | A08BE                          |  | <b>Name:</b>                                       | Apron 08 Bend                     |                    | <b>Use:</b> APRON | <b>Area:</b> | 80,434 SqFt          |                              |                                |
| <b>Section:</b>             | 02 of 12                       |  | <b>From:</b>                                       | T20-01                            |                    | <b>To:</b>        | END          |                      | <b>Last Const.:</b> 9/2/1999 |                                |
| <b>Surface:</b>             | AC                             |  | <b>Family:</b>                                     | 2022_Central_Cat1/2_Apr on_AC/AAC |                    | <b>Zone:</b>      | KBDN         |                      | <b>Category:</b> L           | <b>Rank:</b> S                 |
| <b>Area:</b>                | 5,912 SqFt                     |  | <b>Length:</b>                                     | 235 Ft                            |                    | <b>Width:</b>     | 25 Ft        |                      |                              |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |  | Ft                                                 |                                   | <b>Slab Width:</b> | Ft                |              | <b>Joint Length:</b> | Ft                           |                                |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |  | <b>Grade:</b> 0                                    |                                   | <b>Lanes:</b> 0    |                   |              |                      |                              |                                |
| <b>Section Comments:</b>    |                                |  |                                                    |                                   |                    |                   |              |                      |                              |                                |
| <b>Work Date:</b>           | 9/1/1999                       |  | <b>Work Type:</b> Base Course - Unknown (Major MR) |                                   |                    |                   | <b>Code:</b> | BA-UN                |                              | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/2/1999                       |  | <b>Work Type:</b> New Construction - AC            |                                   |                    |                   | <b>Code:</b> | NC-AC                |                              | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/1/2008                       |  | <b>Work Type:</b> Crack Sealing - AC               |                                   |                    |                   | <b>Code:</b> | CS-AC                |                              | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/2/2008                       |  | <b>Work Type:</b> Patching - AC Deep               |                                   |                    |                   | <b>Code:</b> | PA-AD                |                              | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2012                       |  | <b>Work Type:</b> Patching - AC Deep               |                                   |                    |                   | <b>Code:</b> | PA-AD                |                              | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2012                       |  | <b>Work Type:</b> Crack Sealing - AC               |                                   |                    |                   | <b>Code:</b> | CS-AC                |                              | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2015                       |  | <b>Work Type:</b> Crack Sealing - AC               |                                   |                    |                   | <b>Code:</b> | CS-AC                |                              | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |  | <b>TotalSamples:</b>                               | 1                                 |                    | <b>Surveyed:</b>  | 1            |                      |                              |                                |
| <b>Conditions:</b>          | PCI: 22                        |  |                                                    |                                   |                    |                   |              |                      |                              |                                |
| <b>Inspection Comments:</b> |                                |  |                                                    |                                   |                    |                   |              |                      |                              |                                |
| <b>Sample Number:</b>       | 01                             |  | <b>Type:</b>                                       | R                                 |                    | <b>Area:</b>      | 5912.00 SqFt |                      | <b>PCI:</b>                  | 22                             |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |  |                                                    |                                   |                    |                   |              |                      |                              |                                |
| 48                          | L & T CR                       |  | M                                                  | 336.00                            |                    | Ft                |              |                      |                              |                                |
| 50                          | PATCHING                       |  | L                                                  | 45.00                             |                    | SqFt              |              |                      |                              |                                |
| 41                          | ALLIGATOR CR                   |  | M                                                  | 1020.00                           |                    | SqFt              |              |                      |                              |                                |
| 57                          | WEATHERING                     |  | L                                                  | 5912.00                           |                    | SqFt              |              |                      |                              |                                |
| 50                          | PATCHING                       |  | M                                                  | 470.00                            |                    | SqFt              |              |                      |                              |                                |

|                             |                                |                |                                   |                                                    |                    |               |                  |                  |                      |                     |                          |       |
|-----------------------------|--------------------------------|----------------|-----------------------------------|----------------------------------------------------|--------------------|---------------|------------------|------------------|----------------------|---------------------|--------------------------|-------|
| <b>Network:</b>             | Bend                           |                |                                   | <b>Name:</b>                                       | Bend Municipal     |               |                  |                  |                      |                     |                          |       |
| <b>Branch:</b>              | A08BE                          |                |                                   | <b>Name:</b>                                       | Apron 08 Bend      |               | <b>Use:</b>      | APRON            | <b>Area:</b>         | 80,434 SqFt         |                          |       |
| <b>Section:</b>             | 01                             | of             | 12                                | <b>From:</b>                                       | T19-01             |               |                  | <b>To:</b>       | END                  | <b>Last Const.:</b> | 9/2/1999                 |       |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Apr on_AC/AAC |                                                    | <b>Zone:</b>       | KBDN          |                  | <b>Category:</b> | L                    | <b>Rank:</b>        | S                        |       |
| <b>Area:</b>                | 5,923 SqFt                     |                | <b>Length:</b>                    | 235 Ft                                             |                    | <b>Width:</b> | 25 Ft            |                  |                      |                     |                          |       |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                |                                                    | <b>Slab Width:</b> |               | Ft               |                  | <b>Joint Length:</b> | Ft                  |                          |       |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                   |                                                    | <b>Grade:</b>      |               | 0                |                  | <b>Lanes:</b>        | 0                   |                          |       |
| <b>Section Comments:</b>    |                                |                |                                   |                                                    |                    |               |                  |                  |                      |                     |                          |       |
| <b>Work Date:</b>           | 9/1/1999                       |                |                                   | <b>Work Type:</b> Base Course - Unknown (Major MR) |                    |               |                  | <b>Code:</b>     | BA-UN                |                     | <b>Is Major M&amp;R:</b> | True  |
| <b>Work Date:</b>           | 9/2/1999                       |                |                                   | <b>Work Type:</b> New Construction - AC            |                    |               |                  | <b>Code:</b>     | NC-AC                |                     | <b>Is Major M&amp;R:</b> | True  |
| <b>Work Date:</b>           | 9/1/2008                       |                |                                   | <b>Work Type:</b> Crack Sealing - AC               |                    |               |                  | <b>Code:</b>     | CS-AC                |                     | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>           | 9/2/2008                       |                |                                   | <b>Work Type:</b> Patching - AC Deep               |                    |               |                  | <b>Code:</b>     | PA-AD                |                     | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>           | 9/1/2015                       |                |                                   | <b>Work Type:</b> Crack Sealing - AC               |                    |               |                  | <b>Code:</b>     | CS-AC                |                     | <b>Is Major M&amp;R:</b> | False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                |                                   | <b>TotalSamples:</b>                               | 1                  |               | <b>Surveyed:</b> | 1                |                      |                     |                          |       |
| <b>Conditions:</b>          | <b>PCI:</b> 17                 |                |                                   |                                                    |                    |               |                  |                  |                      |                     |                          |       |
| <b>Inspection Comments:</b> |                                |                |                                   |                                                    |                    |               |                  |                  |                      |                     |                          |       |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                 | <b>Area:</b>                                       | 5923.00 SqFt       |               |                  | <b>PCI:</b>      | 17                   |                     |                          |       |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                   |                                                    |                    |               |                  |                  |                      |                     |                          |       |
| 50                          | PATCHING                       |                | L                                 | 360.00                                             | SqFt               |               |                  |                  |                      |                     |                          |       |
| 41                          | ALLIGATOR CR                   |                | M                                 | 1400.00                                            | SqFt               |               |                  |                  |                      |                     |                          |       |
| 48                          | L & T CR                       |                | M                                 | 300.00                                             | Ft                 |               |                  |                  |                      |                     |                          |       |
| 57                          | WEATHERING                     |                | M                                 | 5923.00                                            | SqFt               |               |                  |                  |                      |                     |                          |       |

|                      |              |                                |                                       |               |                |             |           |               |                       |
|----------------------|--------------|--------------------------------|---------------------------------------|---------------|----------------|-------------|-----------|---------------|-----------------------|
| Network:             | Bend         |                                |                                       | Name:         | Bend Municipal |             |           |               |                       |
| Branch:              | A08BE        |                                | Name:                                 | Apron 08 Bend |                | Use:        | APRON     | Area:         | 80,434 SqFt           |
| Section:             | 05           | of                             | 12                                    | From:         | T19BE-01       |             | To:       | END           | Last Const.: 1/1/2002 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Apr<br>on_AC/AAC  |               | Zone:          | KBDN        | Category: | L             | Rank: S               |
| Area:                | 8,050 SqFt   |                                | Length:                               | 330 Ft        |                | Width:      | 25 Ft     |               |                       |
| Slabs:               | Slab Length: |                                | Ft                                    |               | Slab Width:    | Ft          |           | Joint Length: | Ft                    |
| Shoulder:            | Street Type: |                                |                                       |               | Grade:         | 0           |           | Lanes:        | 0                     |
| Section Comments:    |              |                                |                                       |               |                |             |           |               |                       |
| Work Date:           | 1/1/2002     |                                | Work Type: New Construction - Initial |               |                |             | Code:     | NU-IN         | Is Major M&R: True    |
| Work Date:           | 9/1/2012     |                                | Work Type: Crack Sealing - AC         |               |                |             | Code:     | CS-AC         | Is Major M&R: False   |
| Work Date:           | 9/1/2015     |                                | Work Type: Crack Sealing - AC         |               |                |             | Code:     | CS-AC         | Is Major M&R: False   |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                         | 2             |                | Surveyed: 2 |           |               |                       |
| Conditions:          | PCI:         | 60                             |                                       |               |                |             |           |               |                       |
| Inspection Comments: |              |                                |                                       |               |                |             |           |               |                       |
| Sample Number:       | 01           | Type:                          | R                                     | Area:         | 3772.00 SqFt   |             | PCI:      | 63            |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                       |               |                |             |           |               |                       |
| 48                   | L & T CR     |                                | M                                     | 200.00 Ft     |                |             |           |               |                       |
| 57                   | WEATHERING   |                                | L                                     | 3772.00 SqFt  |                |             |           |               |                       |
| 48                   | L & T CR     |                                | L                                     | 136.00 Ft     |                |             |           |               |                       |
| Sample Number:       | 02           | Type:                          | R                                     | Area:         | 4277.00 SqFt   |             | PCI:      | 56            |                       |
| Sample Comments:     |              | Created by Inspection Schedule |                                       |               |                |             |           |               |                       |
| 57                   | WEATHERING   |                                | L                                     | 4277.00 SqFt  |                |             |           |               |                       |
| 41                   | ALLIGATOR CR |                                | M                                     | 4.00 SqFt     |                |             |           |               |                       |
| 50                   | PATCHING     |                                | L                                     | 10.00 SqFt    |                |             |           |               |                       |
| 48                   | L & T CR     |                                | M                                     | 232.00 Ft     |                |             |           |               |                       |
| 48                   | L & T CR     |                                | L                                     | 100.00 Ft     |                |             |           |               |                       |

|                      |              |              |                                   |                            |              |           |           |               |             |               |          |
|----------------------|--------------|--------------|-----------------------------------|----------------------------|--------------|-----------|-----------|---------------|-------------|---------------|----------|
| Network:             | Bend         |              | Name:                             | Bend Municipal             |              |           |           |               |             |               |          |
| Branch:              | A08BE        |              | Name:                             | Apron 08 Bend              |              | Use:      | APRON     | Area:         | 80,434 SqFt |               |          |
| Section:             | 08           | of 12        | From:                             | TLA10BE-02                 |              |           | To:       | A08BE-09      |             | Last Const.:  | 1/1/1900 |
| Surface:             | AC           | Family:      | 2022_Central_Cat1/2_Apr on_AC/AAC |                            | Zone:        |           | Category: |               | Rank:       | S             |          |
| Area:                | 1,557 SqFt   |              | Length:                           | 65 Ft                      |              | Width:    | 60 Ft     |               |             |               |          |
| Slabs:               |              | Slab Length: | Ft                                |                            | Slab Width:  | Ft        |           | Joint Length: | Ft          |               |          |
| Shoulder:            |              | Street Type: |                                   | Grade:                     | 0            |           | Lanes:    | 0             |             |               |          |
| Section Comments:    |              |              |                                   |                            |              |           |           |               |             |               |          |
| Work Date:           | 1/1/1900     |              | Work Type:                        | New Construction - Initial |              |           | Code:     | NU-IN         |             | Is Major M&R: | True     |
| Last Insp. Date:     | 3/1/2022     |              | TotalSamples:                     | 1                          |              | Surveyed: | 1         |               |             |               |          |
| Conditions:          | PCI:         | 60           |                                   |                            |              |           |           |               |             |               |          |
| Inspection Comments: |              |              |                                   |                            |              |           |           |               |             |               |          |
| Sample Number:       | 01           | Type:        | R                                 | Area:                      | 1557.00 SqFt |           | PCI:      | 60            |             |               |          |
| Sample Comments:     |              |              |                                   |                            |              |           |           |               |             |               |          |
| 48                   | L & T CR     |              | M                                 | 70.00 Ft                   |              |           |           |               |             |               |          |
| 48                   | L & T CR     |              | L                                 | 5.00 Ft                    |              |           |           |               |             |               |          |
| 57                   | WEATHERING   |              | M                                 | 1557.00 SqFt               |              |           |           |               |             |               |          |
| 41                   | ALLIGATOR CR |              | M                                 | 6.00 SqFt                  |              |           |           |               |             |               |          |

|                      |              |              |                                  |                            |             |                |        |               |             |              |               |      |
|----------------------|--------------|--------------|----------------------------------|----------------------------|-------------|----------------|--------|---------------|-------------|--------------|---------------|------|
| Network:             |              | Bend         |                                  | Name:                      |             | Bend Municipal |        |               |             |              |               |      |
| Branch:              | A08BE        |              | Name:                            | Apron 08 Bend              |             | Use:           | APRON  | Area:         | 80,434 SqFt |              |               |      |
| Section:             | 11           | of 12        |                                  | From:                      | A08BE-10    |                | To:    | End           |             | Last Const.: | 1/1/1900      |      |
| Surface:             | PCC          | Family:      | 2022_Central_Cat1/2_All Uses_PCC |                            | Zone:       |                |        | Category:     | Rank: S     |              |               |      |
| Area:                | 2,500 SqFt   |              | Length:                          | 100 Ft                     |             | Width:         | 25 Ft  |               |             |              |               |      |
| Slabs:               | 16           | Slab Length: | 12 Ft                            |                            | Slab Width: | 12 Ft          |        | Joint Length: | 292 Ft      |              |               |      |
| Shoulder:            | Street Type: |              | Grade:                           |                            | 0           |                | Lanes: | 0             |             |              |               |      |
| Section Comments:    |              |              |                                  |                            |             |                |        |               |             |              |               |      |
| Work Date:           | 1/1/1900     |              | Work Type:                       | New Construction - Initial |             |                |        | Code:         | NU-IN       |              | Is Major M&R: | True |
| Last Insp. Date:     | 3/1/2022     |              | TotalSamples:                    | 1                          |             | Surveyed:      | 1      |               |             |              |               |      |
| Conditions:          | PCI:         | 28           |                                  |                            |             |                |        |               |             |              |               |      |
| Inspection Comments: |              |              |                                  |                            |             |                |        |               |             |              |               |      |
| Sample Number:       | 01           | Type:        | R                                |                            | Area:       | 17.00 Slabs    |        | PCI:          | 28          |              |               |      |
| Sample Comments:     |              |              |                                  |                            |             |                |        |               |             |              |               |      |
| 72                   | SHAT. SLAB   |              | L                                | 2.00 Slabs                 |             |                |        |               |             |              |               |      |
| 62                   | CORNER BREAK |              | M                                | 1.00 Slabs                 |             |                |        |               |             |              |               |      |
| 74                   | JOINT SPALL  |              | L                                | 2.00 Slabs                 |             |                |        |               |             |              |               |      |
| 72                   | SHAT. SLAB   |              | M                                | 1.00 Slabs                 |             |                |        |               |             |              |               |      |
| 72                   | SHAT. SLAB   |              | L                                | 2.00 Slabs                 |             |                |        |               |             |              |               |      |
| 63                   | LINEAR CR    |              | M                                | 1.00 Slabs                 |             |                |        |               |             |              |               |      |
| 72                   | SHAT. SLAB   |              | M                                | 1.00 Slabs                 |             |                |        |               |             |              |               |      |
| 73                   | SHRINKAGE CR |              | N                                | 3.00 Slabs                 |             |                |        |               |             |              |               |      |
| 63                   | LINEAR CR    |              | M                                | 1.00 Slabs                 |             |                |        |               |             |              |               |      |
| 63                   | LINEAR CR    |              | L                                | 4.00 Slabs                 |             |                |        |               |             |              |               |      |

|                      |              |  |               |                                  |  |             |             |       |               |               |      |
|----------------------|--------------|--|---------------|----------------------------------|--|-------------|-------------|-------|---------------|---------------|------|
| Network:             | Bend         |  | Name:         | Bend Municipal                   |  |             |             |       |               |               |      |
| Branch:              | A08BE        |  | Name:         | Apron 08 Bend                    |  | Use:        | APRON       | Area: | 80,434 SqFt   |               |      |
| Section:             | 09 of 12     |  | From:         | A08BE-08                         |  | To:         | End         |       | Last Const.:  | 1/1/1900      |      |
| Surface:             | PCC          |  | Family:       | 2022_Central_Cat1/2_All Uses_PCC |  | Zone:       | Category:   |       | Rank:         | S             |      |
| Area:                | 1,804 SqFt   |  | Length:       | 70 Ft                            |  | Width:      | 25 Ft       |       |               |               |      |
| Slabs:               | 10           |  | Slab Length:  | 12 Ft                            |  | Slab Width: | 12 Ft       |       | Joint Length: | 197 Ft        |      |
| Shoulder:            |              |  | Street Type:  |                                  |  | Grade:      | 0           |       | Lanes:        | 0             |      |
| Section Comments:    |              |  |               |                                  |  |             |             |       |               |               |      |
| Work Date:           | 1/1/1900     |  | Work Type:    | New Construction - Initial       |  |             | Code:       | NU-IN |               | Is Major M&R: | True |
| Last Insp. Date:     | 3/1/2022     |  | TotalSamples: | 1                                |  | Surveyed:   | 1           |       |               |               |      |
| Conditions:          | PCI: 25      |  |               |                                  |  |             |             |       |               |               |      |
| Inspection Comments: |              |  |               |                                  |  |             |             |       |               |               |      |
| Sample Number:       | 01           |  | Type:         | R                                |  | Area:       | 12.00 Slabs |       | PCI:          | 25            |      |
| Sample Comments:     |              |  |               |                                  |  |             |             |       |               |               |      |
| 72                   | SHAT. SLAB   |  | H             | 1.00 Slabs                       |  |             |             |       |               |               |      |
| 72                   | SHAT. SLAB   |  | L             | 2.00 Slabs                       |  |             |             |       |               |               |      |
| 63                   | LINEAR CR    |  | M             | 4.00 Slabs                       |  |             |             |       |               |               |      |
| 73                   | SHRINKAGE CR |  | N             | 1.00 Slabs                       |  |             |             |       |               |               |      |

|                      |              |         |                                   |       |                |  |                            |       |               |             |              |               |      |
|----------------------|--------------|---------|-----------------------------------|-------|----------------|--|----------------------------|-------|---------------|-------------|--------------|---------------|------|
| Network:             | Bend         |         | Name:                             |       | Bend Municipal |  |                            |       |               |             |              |               |      |
| Branch:              | A08BE        |         | Name:                             |       | Apron 08 Bend  |  | Use:                       | APRON | Area:         | 80,434 SqFt |              |               |      |
| Section:             | 10           | of 12   |                                   | From: | TLA10BE-02     |  |                            | To:   | A08BE-10      |             | Last Const.: | 1/1/1900      |      |
| Surface:             | AC           | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC |       | Zone:          |  | Category:                  |       |               | Rank:       |              | S             |      |
| Area:                | 840 SqFt     |         | Length:                           |       | 105 Ft         |  | Width:                     |       | 8 Ft          |             |              |               |      |
| Slabs:               | Slab Length: |         | Ft                                |       | Slab Width:    |  | Ft                         |       | Joint Length: |             | Ft           |               |      |
| Shoulder:            | Street Type: |         | Grade:                            |       | 0              |  | Lanes:                     |       | 0             |             |              |               |      |
| Section Comments:    |              |         |                                   |       |                |  |                            |       |               |             |              |               |      |
| Work Date:           | 1/1/1900     |         | Work Type:                        |       |                |  | New Construction - Initial |       | Code:         | NU-IN       |              | Is Major M&R: | True |
| Last Insp. Date:     | 3/1/2022     |         | TotalSamples:                     |       | 1              |  | Surveyed:                  |       | 1             |             |              |               |      |
| Conditions:          | PCI:         | 69      |                                   |       |                |  |                            |       |               |             |              |               |      |
| Inspection Comments: |              |         |                                   |       |                |  |                            |       |               |             |              |               |      |
| Sample Number:       | 01           | Type:   | R                                 |       | Area:          |  | 840.00 SqFt                |       | PCI:          |             | 69           |               |      |
| Sample Comments:     |              |         |                                   |       |                |  |                            |       |               |             |              |               |      |
| 48                   | L & T CR     |         | M                                 |       | 60.00 Ft       |  |                            |       |               |             |              |               |      |

|                             |                     |                |                                              |               |                    |                  |              |               |                      |                               |                     |              |   |
|-----------------------------|---------------------|----------------|----------------------------------------------|---------------|--------------------|------------------|--------------|---------------|----------------------|-------------------------------|---------------------|--------------|---|
| <b>Network:</b>             | Bend                |                |                                              | <b>Name:</b>  | Bend Municipal     |                  |              |               |                      |                               |                     |              |   |
| <b>Branch:</b>              | A08BE               |                | <b>Name:</b>                                 | Apron 08 Bend |                    | <b>Use:</b>      | APRON        |               | <b>Area:</b>         | 80,434 SqFt                   |                     |              |   |
| <b>Section:</b>             | 12                  | of             | 12                                           | <b>From:</b>  | TLA10BE-02         |                  |              | <b>To:</b>    | End                  |                               | <b>Last Const.:</b> | 1/1/1900     |   |
| <b>Surface:</b>             | AC                  | <b>Family:</b> | 2022_Central_Cat1/2_Apr<br>on_AC/AAC         |               | <b>Zone:</b>       |                  |              |               | <b>Category:</b>     |                               |                     | <b>Rank:</b> | S |
| <b>Area:</b>                | 3,030 SqFt          |                | <b>Length:</b>                               | 100 Ft        |                    | <b>Width:</b>    | 30 Ft        |               |                      |                               |                     |              |   |
| <b>Slabs:</b>               | <b>Slab Length:</b> |                | Ft                                           |               | <b>Slab Width:</b> |                  | Ft           |               | <b>Joint Length:</b> |                               | Ft                  |              |   |
| <b>Shoulder:</b>            | <b>Street Type:</b> |                |                                              |               | <b>Grade:</b>      | 0                |              | <b>Lanes:</b> |                      | 0                             |                     |              |   |
| <b>Section Comments:</b>    |                     |                |                                              |               |                    |                  |              |               |                      |                               |                     |              |   |
| <b>Work Date:</b>           | 1/1/1900            |                | <b>Work Type:</b> New Construction - Initial |               |                    |                  | <b>Code:</b> | NU-IN         |                      | <b>Is Major M&amp;R:</b> True |                     |              |   |
| <b>Last Insp. Date:</b>     | 3/1/2022            |                | <b>TotalSamples:</b>                         | 1             |                    | <b>Surveyed:</b> |              | 1             |                      |                               |                     |              |   |
| <b>Conditions:</b>          | PCI: 33             |                |                                              |               |                    |                  |              |               |                      |                               |                     |              |   |
| <b>Inspection Comments:</b> |                     |                |                                              |               |                    |                  |              |               |                      |                               |                     |              |   |
| <b>Sample Number:</b>       | 01                  | <b>Type:</b>   | R                                            | <b>Area:</b>  | 3030.00 SqFt       |                  | <b>PCI:</b>  |               | 33                   |                               |                     |              |   |
| <b>Sample Comments:</b>     |                     |                |                                              |               |                    |                  |              |               |                      |                               |                     |              |   |
| 48                          | L & T CR            |                | M                                            | 129.00 Ft     |                    |                  |              |               |                      |                               |                     |              |   |
| 41                          | ALLIGATOR CR        |                | M                                            | 320.00 SqFt   |                    |                  |              |               |                      |                               |                     |              |   |
| 48                          | L & T CR            |                | M                                            | 90.00 Ft      |                    |                  |              |               |                      |                               |                     |              |   |
| 41                          | ALLIGATOR CR        |                | M                                            | 9.00 SqFt     |                    |                  |              |               |                      |                               |                     |              |   |
| 57                          | WEATHERING          |                | L                                            | 3030.00 SqFt  |                    |                  |              |               |                      |                               |                     |              |   |

|                      |                                |              |                                      |                                 |                |           |       |               |       |               |       |
|----------------------|--------------------------------|--------------|--------------------------------------|---------------------------------|----------------|-----------|-------|---------------|-------|---------------|-------|
| Network:             | Bend                           |              |                                      | Name:                           | Bend Municipal |           |       |               |       |               |       |
| Branch:              | A08BE                          |              | Name:                                | Apron 08 Bend                   |                | Use:      | APRON |               | Area: | 80,434 SqFt   |       |
| Section:             | 03                             | of           | 12                                   | From:                           | -              |           |       | To:           | -     |               |       |
| Surface:             | AC                             | Family:      | 2022_Central_Cat1/2_Apr<br>on_AC/AAC |                                 | Zone:          | KBDN      |       | Category:     | L     |               |       |
| Area:                | 5,840 SqFt                     |              | Length:                              | 195 Ft                          |                | Width:    | 30 Ft |               |       |               |       |
| Slabs:               |                                | Slab Length: | Ft                                   |                                 | Slab Width:    | Ft        |       | Joint Length: | Ft    |               |       |
| Shoulder:            |                                | Street Type: |                                      |                                 | Grade:         | 0         |       | Lanes:        | 0     |               |       |
| Section Comments:    |                                |              |                                      |                                 |                |           |       |               |       |               |       |
| Work Date:           | 9/1/2005                       |              | Work Type:                           | New Construction - AC           |                |           | Code: | NC-AC         |       | Is Major M&R: | True  |
| Work Date:           | 9/1/2012                       |              | Work Type:                           | Crack Sealing - AC              |                |           | Code: | CS-AC         |       | Is Major M&R: | False |
| Work Date:           | 9/2/2012                       |              | Work Type:                           | Patching - AC Deep              |                |           | Code: | PA-AD         |       | Is Major M&R: | False |
| Work Date:           | 9/1/2015                       |              | Work Type:                           | Crack Sealing - AC              |                |           | Code: | CS-AC         |       | Is Major M&R: | False |
| Work Date:           | 6/1/2017                       |              | Work Type:                           | Surface Treatment - Slurry Seal |                |           | Code: | ST-SS         |       | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |              | TotalSamples:                        | 2                               |                | Surveyed: | 2     |               |       |               |       |
| Conditions:          | PCI:                           | 49           |                                      |                                 |                |           |       |               |       |               |       |
| Inspection Comments: |                                |              |                                      |                                 |                |           |       |               |       |               |       |
| Sample Number:       | 01                             | Type:        | R                                    | Area:                           | 3600.00 SqFt   |           | PCI:  | 37            |       |               |       |
| Sample Comments:     | Created by Inspection Schedule |              |                                      |                                 |                |           |       |               |       |               |       |
| 50                   | PATCHING                       | L            | 94.00                                | SqFt                            |                |           |       |               |       |               |       |
| 48                   | L & T CR                       | M            | 60.00                                | Ft                              |                |           |       |               |       |               |       |
| 57                   | WEATHERING                     | L            | 3600.00                              | SqFt                            |                |           |       |               |       |               |       |
| 48                   | L & T CR                       | L            | 52.00                                | Ft                              |                |           |       |               |       |               |       |
| 41                   | ALLIGATOR CR                   | M            | 130.00                               | SqFt                            |                |           |       |               |       |               |       |
| 48                   | L & T CR                       | L            | 258.00                               | Ft                              |                |           |       |               |       |               |       |
| Sample Number:       | 02                             | Type:        | R                                    | Area:                           | 2240.00 SqFt   |           | PCI:  | 68            |       |               |       |
| Sample Comments:     | Created by Inspection Schedule |              |                                      |                                 |                |           |       |               |       |               |       |
| 48                   | L & T CR                       | M            | 40.00                                | Ft                              |                |           |       |               |       |               |       |
| 57                   | WEATHERING                     | L            | 2240.00                              | SqFt                            |                |           |       |               |       |               |       |
| 48                   | L & T CR                       | L            | 206.00                               | Ft                              |                |           |       |               |       |               |       |

|                                                        |                                                 |                             |                          |
|--------------------------------------------------------|-------------------------------------------------|-----------------------------|--------------------------|
| <b>Network:</b> Bend                                   |                                                 | <b>Name:</b> Bend Municipal |                          |
| <b>Branch:</b> A08BE                                   | <b>Name:</b> Apron 08 Bend                      | <b>Use:</b> APRON           | <b>Area:</b> 80,434 SqFt |
| <b>Section:</b> 07                                     | of 12                                           | <b>From:</b> T16-01         | <b>To:</b> East          |
| <b>Surface:</b> AC                                     | <b>Family:</b> 2022_Central_Cat1/2_Apron_AC/AAC | <b>Zone:</b> KBDN           | <b>Category:</b> L       |
| <b>Area:</b> 31,202 SqFt                               | <b>Length:</b> 552 Ft                           | <b>Width:</b> 56 Ft         |                          |
| <b>Slabs:</b>                                          | <b>Slab Length:</b> Ft                          | <b>Slab Width:</b> Ft       | <b>Joint Length:</b> Ft  |
| <b>Shoulder:</b>                                       | <b>Street Type:</b>                             | <b>Grade:</b> 0             | <b>Lanes:</b> 0          |
| <b>Section Comments:</b>                               |                                                 |                             |                          |
| <b>Work Date:</b> 9/1/2012                             | <b>Work Type:</b> Subbase - Aggregate           |                             | <b>Code:</b> SB-AG       |
| <b>Work Date:</b> 9/2/2012                             | <b>Work Type:</b> Base Course - Aggregate       |                             | <b>Code:</b> BA-AG       |
| <b>Work Date:</b> 9/3/2012                             | <b>Work Type:</b> New Construction - AC         |                             | <b>Code:</b> NC-AC       |
| <b>Last Insp. Date:</b> 3/1/2022                       | <b>TotalSamples:</b> 6                          | <b>Surveyed:</b> 3          |                          |
| <b>Conditions:</b> PCI: 83                             |                                                 |                             |                          |
| <b>Inspection Comments:</b>                            |                                                 |                             |                          |
| <b>Sample Number:</b> 01                               | <b>Type:</b> R                                  | <b>Area:</b> 5721.00 SqFt   | <b>PCI:</b> 89           |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                 |                             |                          |
| 57 WEATHERING                                          | L                                               | 5721.00 SqFt                |                          |
| 48 L & T CR                                            | M                                               | 15.00 Ft                    |                          |
| <b>Sample Number:</b> 03                               | <b>Type:</b> R                                  | <b>Area:</b> 5600.00 SqFt   | <b>PCI:</b> 80           |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                 |                             |                          |
| 57 WEATHERING                                          | L                                               | 5600.00 SqFt                |                          |
| 48 L & T CR                                            | L                                               | 10.00 Ft                    |                          |
| 48 L & T CR                                            | M                                               | 86.00 Ft                    |                          |
| <b>Sample Number:</b> 05                               | <b>Type:</b> R                                  | <b>Area:</b> 5600.00 SqFt   | <b>PCI:</b> 79           |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                 |                             |                          |
| 48 L & T CR                                            | M                                               | 105.00 Ft                   |                          |
| 57 WEATHERING                                          | L                                               | 5600.00 SqFt                |                          |
| 48 L & T CR                                            | L                                               | 18.00 Ft                    |                          |

|                             |                                |                |                                         |               |                    |                  |              |                  |                      |                          |              |   |
|-----------------------------|--------------------------------|----------------|-----------------------------------------|---------------|--------------------|------------------|--------------|------------------|----------------------|--------------------------|--------------|---|
| <b>Network:</b>             | Bend                           |                |                                         | <b>Name:</b>  | Bend Municipal     |                  |              |                  |                      |                          |              |   |
| <b>Branch:</b>              | A08BE                          |                | <b>Name:</b>                            | Apron 08 Bend |                    | <b>Use:</b>      | APRON        |                  | <b>Area:</b>         | 80,434 SqFt              |              |   |
| <b>Section:</b>             | 04                             | of             | 12                                      | <b>From:</b>  | -                  |                  | <b>To:</b>   | -                |                      | <b>Last Const.:</b>      | 9/1/2005     |   |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Apr<br>on_AC/AAC    |               | <b>Zone:</b>       | KBDN             |              | <b>Category:</b> | L                    |                          | <b>Rank:</b> | S |
| <b>Area:</b>                | 4,365 SqFt                     |                | <b>Length:</b>                          | 130 Ft        |                    | <b>Width:</b>    | 35 Ft        |                  |                      |                          |              |   |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                      |               | <b>Slab Width:</b> |                  | Ft           |                  | <b>Joint Length:</b> | Ft                       |              |   |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                         |               | <b>Grade:</b>      | 0                |              | <b>Lanes:</b>    | 0                    |                          |              |   |
| <b>Section Comments:</b>    |                                |                |                                         |               |                    |                  |              |                  |                      |                          |              |   |
| <b>Work Date:</b>           | 9/1/2005                       |                | <b>Work Type:</b> New Construction - AC |               |                    |                  | <b>Code:</b> | NC-AC            |                      | <b>Is Major M&amp;R:</b> | True         |   |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b> Crack Sealing - AC    |               |                    |                  | <b>Code:</b> | CS-AC            |                      | <b>Is Major M&amp;R:</b> | False        |   |
| <b>Work Date:</b>           | 9/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC    |               |                    |                  | <b>Code:</b> | CS-AC            |                      | <b>Is Major M&amp;R:</b> | False        |   |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                    | 1             |                    | <b>Surveyed:</b> | 1            |                  |                      |                          |              |   |
| <b>Conditions:</b>          | PCI:                           | 64             |                                         |               |                    |                  |              |                  |                      |                          |              |   |
| <b>Inspection Comments:</b> |                                |                |                                         |               |                    |                  |              |                  |                      |                          |              |   |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                       | <b>Area:</b>  | 4365.00 SqFt       |                  | <b>PCI:</b>  | 64               |                      |                          |              |   |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                         |               |                    |                  |              |                  |                      |                          |              |   |
| 48                          | L & T CR                       |                | M                                       | 165.00 Ft     |                    |                  |              |                  |                      |                          |              |   |
| 57                          | WEATHERING                     |                | M                                       | 4365.00 SqFt  |                    |                  |              |                  |                      |                          |              |   |
| 48                          | L & T CR                       |                | M                                       | 140.00 Ft     |                    |                  |              |                  |                      |                          |              |   |

|                      |             |              |                                       |                |             |           |           |               |                       |
|----------------------|-------------|--------------|---------------------------------------|----------------|-------------|-----------|-----------|---------------|-----------------------|
| Network:             | Bend        |              | Name:                                 | Bend Municipal |             |           |           |               |                       |
| Branch:              | A09BE       |              | Name:                                 | Apron 09 Bend  |             | Use:      | APRON     | Area:         | 17,585 SqFt           |
| Section:             | 02          | of 2         | From:                                 | A09BE-01       |             |           | To:       | End           | Last Const.: 1/1/1900 |
| Surface:             | PCC         | Family:      | 2022_Central_Cat1/2_All_Uses_PCC      |                | Zone:       |           | Category: |               | Rank: S               |
| Area:                | 2,585 SqFt  |              | Length:                               | 100 Ft         |             | Width:    | 25 Ft     |               |                       |
| Slabs:               | 16          | Slab Length: | 13 Ft                                 |                | Slab Width: | 12 Ft     |           | Joint Length: | 285 Ft                |
| Shoulder:            |             | Street Type: |                                       |                | Grade:      | 0         |           | Lanes:        | 0                     |
| Section Comments:    |             |              |                                       |                |             |           |           |               |                       |
| Work Date:           | 1/1/1900    |              | Work Type: New Construction - Initial |                |             |           | Code:     | NU-IN         | Is Major M&R: True    |
| Last Insp. Date:     | 3/1/2022    |              | TotalSamples:                         | 1              |             | Surveyed: | 1         |               |                       |
| Conditions:          | PCI:        | 96           |                                       |                |             |           |           |               |                       |
| Inspection Comments: |             |              |                                       |                |             |           |           |               |                       |
| Sample Number:       | 01          | Type:        | R                                     | Area:          | 16.00 Slabs |           | PCI:      | 96            |                       |
| Sample Comments:     |             |              |                                       |                |             |           |           |               |                       |
| 74                   | JOINT SPALL |              | L                                     | 2.00 Slabs     |             |           |           |               |                       |

|                             |                                |                |                                         |              |                    |                  |                  |                      |                     |                                |
|-----------------------------|--------------------------------|----------------|-----------------------------------------|--------------|--------------------|------------------|------------------|----------------------|---------------------|--------------------------------|
| <b>Network:</b>             | Bend                           | <b>Name:</b>   | Bend Municipal                          |              |                    |                  |                  |                      |                     |                                |
| <b>Branch:</b>              | A09BE                          | <b>Name:</b>   | Apron 09 Bend                           |              | <b>Use:</b>        | APRON            | <b>Area:</b>     | 17,585 SqFt          |                     |                                |
| <b>Section:</b>             | 01                             | of             | 2                                       | <b>From:</b> | Taxiway 22         |                  | <b>To:</b>       | -                    | <b>Last Const.:</b> | 9/1/2005                       |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Apr<br>on_AC/AAC    |              | <b>Zone:</b>       | KBDN             | <b>Category:</b> | L                    | <b>Rank:</b>        | S                              |
| <b>Area:</b>                | 15,000 SqFt                    |                | <b>Length:</b>                          | 120 Ft       |                    | <b>Width:</b>    | 125 Ft           |                      |                     |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                      |              | <b>Slab Width:</b> | Ft               |                  | <b>Joint Length:</b> | Ft                  |                                |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                         |              | <b>Grade:</b>      | 0                |                  | <b>Lanes:</b>        | 0                   |                                |
| <b>Section Comments:</b>    |                                |                |                                         |              |                    |                  |                  |                      |                     |                                |
| <b>Work Date:</b>           | 9/1/2005                       |                | <b>Work Type:</b> New Construction - AC |              |                    |                  | <b>Code:</b>     | NC-AC                |                     | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC    |              |                    |                  | <b>Code:</b>     | CS-AC                |                     | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                    | 3            |                    | <b>Surveyed:</b> | 2                |                      |                     |                                |
| <b>Conditions:</b>          | PCI: 65                        |                |                                         |              |                    |                  |                  |                      |                     |                                |
| <b>Inspection Comments:</b> |                                |                |                                         |              |                    |                  |                  |                      |                     |                                |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                       | <b>Area:</b> | 6000.00 SqFt       |                  | <b>PCI:</b>      | 59                   |                     |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                         |              |                    |                  |                  |                      |                     |                                |
| 57                          | WEATHERING                     | M              | 6000.00                                 | SqFt         |                    |                  |                  |                      |                     |                                |
| 48                          | L & T CR                       | L              | 115.00                                  | Ft           |                    |                  |                  |                      |                     |                                |
| 48                          | L & T CR                       | M              | 200.00                                  | Ft           |                    |                  |                  |                      |                     |                                |
| 41                          | ALLIGATOR CR                   | M              | 23.00                                   | SqFt         |                    |                  |                  |                      |                     |                                |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>   | R                                       | <b>Area:</b> | 6000.00 SqFt       |                  | <b>PCI:</b>      | 70                   |                     |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                         |              |                    |                  |                  |                      |                     |                                |
| 48                          | L & T CR                       | M              | 227.00                                  | Ft           |                    |                  |                  |                      |                     |                                |
| 48                          | L & T CR                       | L              | 62.00                                   | Ft           |                    |                  |                  |                      |                     |                                |
| 57                          | WEATHERING                     | M              | 6000.00                                 | SqFt         |                    |                  |                  |                      |                     |                                |

|                      |                                |         |                                             |               |                |           |       |               |            |                     |          |   |
|----------------------|--------------------------------|---------|---------------------------------------------|---------------|----------------|-----------|-------|---------------|------------|---------------------|----------|---|
| Network:             | Bend                           |         |                                             | Name:         | Bend Municipal |           |       |               |            |                     |          |   |
| Branch:              | A10BE                          |         | Name:                                       | Apron 10 Bend |                | Use:      | APRON | Area:         | 9,087 SqFt |                     |          |   |
| Section:             | 01                             | of      | 4                                           | From:         | T21-01         |           | To:   | END           |            | Last Const.:        | 9/2/1999 |   |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC        |               | Zone:          | KBDN      |       | Category:     | L          |                     | Rank:    | S |
| Area:                | 3,655 SqFt                     |         | Length:                                     | 120 Ft        |                | Width:    | 30 Ft |               |            |                     |          |   |
| Slabs:               | Slab Length:                   |         | Ft                                          |               | Slab Width:    | Ft        |       | Joint Length: | Ft         |                     |          |   |
| Shoulder:            | Street Type:                   |         |                                             |               | Grade:         | 0         |       | Lanes:        | 0          |                     |          |   |
| Section Comments:    |                                |         |                                             |               |                |           |       |               |            |                     |          |   |
| Work Date:           | 9/1/1999                       |         | Work Type: Base Course - Unknown (Major MR) |               |                |           | Code: | BA-UN         |            | Is Major M&R: True  |          |   |
| Work Date:           | 9/2/1999                       |         | Work Type: New Construction - AC            |               |                |           | Code: | NC-AC         |            | Is Major M&R: True  |          |   |
| Work Date:           | 9/1/2008                       |         | Work Type: Crack Sealing - AC               |               |                |           | Code: | CS-AC         |            | Is Major M&R: False |          |   |
| Work Date:           | 9/1/2015                       |         | Work Type: Crack Sealing - AC               |               |                |           | Code: | CS-AC         |            | Is Major M&R: False |          |   |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                               | 1             |                | Surveyed: | 1     |               |            |                     |          |   |
| Conditions:          | PCI: 94                        |         |                                             |               |                |           |       |               |            |                     |          |   |
| Inspection Comments: |                                |         |                                             |               |                |           |       |               |            |                     |          |   |
| Sample Number:       | 01                             | Type:   | R                                           | Area:         | 3655.00 SqFt   |           | PCI:  | 94            |            |                     |          |   |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |               |                |           |       |               |            |                     |          |   |
| 57                   | WEATHERING                     |         | L                                           | 3655.00 SqFt  |                |           |       |               |            |                     |          |   |

|                      |              |  |               |                                  |                |             |             |       |               |            |               |      |
|----------------------|--------------|--|---------------|----------------------------------|----------------|-------------|-------------|-------|---------------|------------|---------------|------|
| Network:             | Bend         |  |               | Name:                            | Bend Municipal |             |             |       |               |            |               |      |
| Branch:              | A10BE        |  | Name:         | Apron 10 Bend                    |                | Use:        | APRON       |       | Area:         | 9,087 SqFt |               |      |
| Section:             | 04           |  | of            | 4                                |                | From:       | A10BE-01    |       | To:           | End        |               |      |
| Surface:             | PCC          |  | Family:       | 2022_Central_Cat1/2_All_Uses_PCC |                | Zone:       |             |       | Category:     | Rank: S    |               |      |
| Area:                | 2,127 SqFt   |  | Length:       | 100 Ft                           |                | Width:      | 22 Ft       |       |               |            |               |      |
| Slabs:               | 8            |  | Slab Length:  | 20 Ft                            |                | Slab Width: | 12 Ft       |       | Joint Length: | 166 Ft     |               |      |
| Shoulder:            |              |  | Street Type:  |                                  |                | Grade:      | 0           |       | Lanes:        | 0          |               |      |
| Section Comments:    |              |  |               |                                  |                |             |             |       |               |            |               |      |
| Work Date:           | 1/1/1900     |  | Work Type:    | New Construction - Initial       |                |             |             | Code: | NU-IN         |            | Is Major M&R: | True |
| Last Insp. Date:     | 3/1/2022     |  | TotalSamples: | 1                                |                | Surveyed:   | 1           |       |               |            |               |      |
| Conditions:          | PCI: 47      |  |               |                                  |                |             |             |       |               |            |               |      |
| Inspection Comments: |              |  |               |                                  |                |             |             |       |               |            |               |      |
| Sample Number:       | 01           |  | Type:         | R                                |                | Area:       | 10.00 Slabs |       | PCI:          | 47         |               |      |
| Sample Comments:     |              |  |               |                                  |                |             |             |       |               |            |               |      |
| 73                   | SHRINKAGE CR |  | N             | 3.00                             |                | Slabs       |             |       |               |            |               |      |
| 63                   | LINEAR CR    |  | L             | 5.00                             |                | Slabs       |             |       |               |            |               |      |
| 72                   | SHAT. SLAB   |  | L             | 2.00                             |                | Slabs       |             |       |               |            |               |      |
| 63                   | LINEAR CR    |  | M             | 1.00                             |                | Slabs       |             |       |               |            |               |      |

|                                                 |              |      |               |                                      |  |                |             |       |               |    |               |              |          |  |
|-------------------------------------------------|--------------|------|---------------|--------------------------------------|--|----------------|-------------|-------|---------------|----|---------------|--------------|----------|--|
| Network:                                        |              | Bend |               | Name:                                |  | Bend Municipal |             |       |               |    |               |              |          |  |
| Branch:                                         | A10BE        |      | Name:         | Apron 10 Bend                        |  | Use:           | APRON       | Area: | 9,087 SqFt    |    |               |              |          |  |
| Section:                                        | 02           |      | of            | 4                                    |  | From:          | -           |       | To:           | -  |               | Last Const.: | 9/1/2005 |  |
| Surface:                                        | AC           |      | Family:       | 2022_Central_Cat1/2_Apr<br>on_AC/AAC |  | Zone:          | KBDN        |       | Category:     | L  |               | Rank:        | S        |  |
| Area:                                           | 920 SqFt     |      | Length:       | 50 Ft                                |  | Width:         | 20 Ft       |       |               |    |               |              |          |  |
| Slabs:                                          |              |      | Slab Length:  | Ft                                   |  | Slab Width:    | Ft          |       | Joint Length: |    |               | Ft           |          |  |
| Shoulder:                                       |              |      | Street Type:  |                                      |  | Grade:         | 0           |       | Lanes:        | 0  |               |              |          |  |
| Section Comments:                               |              |      |               |                                      |  |                |             |       |               |    |               |              |          |  |
| Work Date:                                      | 9/1/2005     |      | Work Type:    | New Construction - AC                |  |                |             | Code: | NC-AC         |    | Is Major M&R: | True         |          |  |
| Work Date:                                      | 9/1/2015     |      | Work Type:    | Crack Sealing - AC                   |  |                |             | Code: | CS-AC         |    | Is Major M&R: | False        |          |  |
| Last Insp. Date:                                | 3/1/2022     |      | TotalSamples: | 1                                    |  | Surveyed:      | 1           |       |               |    |               |              |          |  |
| Conditions:                                     | PCI: 50      |      |               |                                      |  |                |             |       |               |    |               |              |          |  |
| Inspection Comments:                            |              |      |               |                                      |  |                |             |       |               |    |               |              |          |  |
| Sample Number:                                  | 01           |      | Type:         | R                                    |  | Area:          | 920.00 SqFt |       | PCI:          | 50 |               |              |          |  |
| Sample Comments: Created by Inspection Schedule |              |      |               |                                      |  |                |             |       |               |    |               |              |          |  |
| 57                                              | WEATHERING   |      | M             | 920.00 SqFt                          |  |                |             |       |               |    |               |              |          |  |
| 48                                              | L & T CR     |      | M             | 36.00 Ft                             |  |                |             |       |               |    |               |              |          |  |
| 41                                              | ALLIGATOR CR |      | M             | 20.00 SqFt                           |  |                |             |       |               |    |               |              |          |  |

|                                                        |                                                  |                             |                         |                                |
|--------------------------------------------------------|--------------------------------------------------|-----------------------------|-------------------------|--------------------------------|
| <b>Network:</b> Bend                                   |                                                  | <b>Name:</b> Bend Municipal |                         |                                |
| <b>Branch:</b> A10BE                                   | <b>Name:</b> Apron 10 Bend                       | <b>Use:</b> APRON           | <b>Area:</b> 9,087 SqFt |                                |
| <b>Section:</b> 03                                     | of 4                                             | <b>From:</b> -              | <b>To:</b> -            | <b>Last Const.:</b> 9/1/2005   |
| <b>Surface:</b> AC                                     | <b>Family:</b> 2022_Central_Cat1/2_Apr on_AC/AAC | <b>Zone:</b> KBDN           | <b>Category:</b> L      | <b>Rank:</b> S                 |
| <b>Area:</b> 2,385 SqFt                                | <b>Length:</b> 30 Ft                             | <b>Width:</b> 80 Ft         |                         |                                |
| <b>Slabs:</b>                                          | <b>Slab Length:</b> Ft                           | <b>Slab Width:</b> Ft       | <b>Joint Length:</b> Ft |                                |
| <b>Shoulder:</b>                                       | <b>Street Type:</b>                              | <b>Grade:</b> 0             | <b>Lanes:</b> 0         |                                |
| <b>Section Comments:</b>                               |                                                  |                             |                         |                                |
| <b>Work Date:</b> 9/1/2005                             | <b>Work Type:</b> New Construction - AC          |                             | <b>Code:</b> NC-AC      | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b> 9/1/2015                             | <b>Work Type:</b> Crack Sealing - AC             |                             | <b>Code:</b> CS-AC      | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b> 3/1/2022                       | <b>TotalSamples:</b> 1                           | <b>Surveyed:</b> 1          |                         |                                |
| <b>Conditions:</b> PCI: 24                             |                                                  |                             |                         |                                |
| <b>Inspection Comments:</b>                            |                                                  |                             |                         |                                |
| <b>Sample Number:</b> 01                               | <b>Type:</b> R                                   | <b>Area:</b> 2385.00 SqFt   | <b>PCI:</b> 24          |                                |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                  |                             |                         |                                |
| 57                                                     | WEATHERING                                       | M                           | 2385.00 SqFt            |                                |
| 41                                                     | ALLIGATOR CR                                     | M                           | 6.00 SqFt               |                                |
| 41                                                     | ALLIGATOR CR                                     | M                           | 480.00 SqFt             |                                |
| 48                                                     | L & T CR                                         | L                           | 29.00 Ft                |                                |
| 48                                                     | L & T CR                                         | L                           | 41.00 Ft                |                                |

|                      |                                |      |               |                                   |  |                |              |       |               |    |               |          |   |
|----------------------|--------------------------------|------|---------------|-----------------------------------|--|----------------|--------------|-------|---------------|----|---------------|----------|---|
| Network:             |                                | Bend |               | Name:                             |  | Bend Municipal |              |       |               |    |               |          |   |
| Branch:              | A11BE                          |      | Name:         | Apron 11 Bend                     |  | Use:           | APRON        | Area: | 9,920 SqFt    |    |               |          |   |
| Section:             | 01                             |      | of            | 1                                 |  | From:          | Taxiway 23   |       | To:           | -  | Last Const.:  | 9/1/2005 |   |
| Surface:             | AC                             |      | Family:       | 2022_Central_Cat1/2_Apr on_AC/AAC |  | Zone:          | KBDN         |       | Category:     | L  |               | Rank:    | S |
| Area:                | 9,920 SqFt                     |      | Length:       | 124 Ft                            |  | Width:         | 80 Ft        |       |               |    |               |          |   |
| Slabs:               |                                |      | Slab Length:  | Ft                                |  | Slab Width:    | Ft           |       | Joint Length: | Ft |               |          |   |
| Shoulder:            |                                |      | Street Type:  |                                   |  | Grade:         | 0            |       | Lanes:        | 0  |               |          |   |
| Section Comments:    |                                |      |               |                                   |  |                |              |       |               |    |               |          |   |
| Work Date:           | 9/1/2005                       |      | Work Type:    | New Construction - AC             |  |                |              | Code: | NC-AC         |    | Is Major M&R: | True     |   |
| Work Date:           | 9/1/2015                       |      | Work Type:    | Crack Sealing - AC                |  |                |              | Code: | CS-AC         |    | Is Major M&R: | False    |   |
| Work Date:           | 9/2/2015                       |      | Work Type:    | Patching - AC Deep                |  |                |              | Code: | PA-AD         |    | Is Major M&R: | False    |   |
| Last Insp. Date:     | 3/1/2022                       |      | TotalSamples: | 2                                 |  | Surveyed:      | 2            |       |               |    |               |          |   |
| Conditions:          | PCI: 45                        |      |               |                                   |  |                |              |       |               |    |               |          |   |
| Inspection Comments: |                                |      |               |                                   |  |                |              |       |               |    |               |          |   |
| Sample Number:       | 01                             |      | Type:         | R                                 |  | Area:          | 6000.00 SqFt |       | PCI:          | 49 |               |          |   |
| Sample Comments:     | Created by Inspection Schedule |      |               |                                   |  |                |              |       |               |    |               |          |   |
| 50                   | PATCHING                       |      | L             | 88.00 SqFt                        |  |                |              |       |               |    |               |          |   |
| 48                   | L & T CR                       |      | L             | 32.00 Ft                          |  |                |              |       |               |    |               |          |   |
| 50                   | PATCHING                       |      | L             | 65.00 SqFt                        |  |                |              |       |               |    |               |          |   |
| 50                   | PATCHING                       |      | L             | 15.00 SqFt                        |  |                |              |       |               |    |               |          |   |
| 48                   | L & T CR                       |      | M             | 198.00 Ft                         |  |                |              |       |               |    |               |          |   |
| 50                   | PATCHING                       |      | L             | 66.00 SqFt                        |  |                |              |       |               |    |               |          |   |
| 50                   | PATCHING                       |      | L             | 24.00 SqFt                        |  |                |              |       |               |    |               |          |   |
| 57                   | WEATHERING                     |      | M             | 6000.00 SqFt                      |  |                |              |       |               |    |               |          |   |
| 41                   | ALLIGATOR CR                   |      | M             | 100.00 SqFt                       |  |                |              |       |               |    |               |          |   |
| Sample Number:       | 02                             |      | Type:         | R                                 |  | Area:          | 3920.00 SqFt |       | PCI:          | 39 |               |          |   |
| Sample Comments:     | Created by Inspection Schedule |      |               |                                   |  |                |              |       |               |    |               |          |   |
| 48                   | L & T CR                       |      | M             | 71.00 Ft                          |  |                |              |       |               |    |               |          |   |
| 48                   | L & T CR                       |      | L             | 60.00 Ft                          |  |                |              |       |               |    |               |          |   |
| 48                   | L & T CR                       |      | M             | 85.00 Ft                          |  |                |              |       |               |    |               |          |   |
| 41                   | ALLIGATOR CR                   |      | M             | 142.00 SqFt                       |  |                |              |       |               |    |               |          |   |
| 57                   | WEATHERING                     |      | M             | 3920.00 SqFt                      |  |                |              |       |               |    |               |          |   |
| 50                   | PATCHING                       |      | L             | 75.00 SqFt                        |  |                |              |       |               |    |               |          |   |
| 41                   | ALLIGATOR CR                   |      | M             | 30.00 SqFt                        |  |                |              |       |               |    |               |          |   |

|                           |              |         |                                    |                       |              |           |        |               |       |               |          |   |
|---------------------------|--------------|---------|------------------------------------|-----------------------|--------------|-----------|--------|---------------|-------|---------------|----------|---|
| Network:                  | Bend         |         | Name:                              | Bend Municipal        |              |           |        |               |       |               |          |   |
| Branch:                   | AHELIBE      |         | Name:                              | Helicopter Apron Bend |              | Use:      | APRON  |               | Area: | 482,878 SqFt  |          |   |
| Section:                  | 01           | of 3    | From:                              | See Map               |              |           | To:    | -             |       | Last Const.:  | 7/3/2017 |   |
| Surface:                  | AC           | Family: | 2022_Central_Cat1/2_Apron_AC/AAC   |                       | Zone:        | KBDN      |        | Category:     | L     |               | Rank:    | P |
| Area:                     | 393,378 SqFt |         | Length:                            | 540 Ft                |              | Width:    | 723 Ft |               |       |               |          |   |
| Slabs:                    | Slab Length: |         | Ft                                 |                       | Slab Width:  | Ft        |        | Joint Length: | Ft    |               |          |   |
| Shoulder:                 | Street Type: |         | Grade:                             |                       | 0            |           | Lanes: | 0             |       |               |          |   |
| Section Comments:         |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| Work Date:                | 7/1/2017     |         | Work Type: Subbase - Aggregate     |                       |              |           | Code:  | SB-AG         |       | Is Major M&R: | False    |   |
| Work Date:                | 7/2/2017     |         | Work Type: Base Course - Aggregate |                       |              |           | Code:  | BA-AG         |       | Is Major M&R: | False    |   |
| Work Date:                | 7/3/2017     |         | Work Type: New Construction - AC   |                       |              |           | Code:  | NC-AC         |       | Is Major M&R: | True     |   |
| Last Insp. Date: 3/1/2022 |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| Conditions:               | PCI:         | 94      | TotalSamples:                      | 80                    |              | Surveyed: | 7      |               |       |               |          |   |
| Inspection Comments:      |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| Sample Number:            | 01           | Type:   | R                                  | Area:                 | 4985.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 4985.00 SqFt          |              |           |        |               |       |               |          |   |
| Sample Number:            | 16           | Type:   | R                                  | Area:                 | 4550.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 4550.00 SqFt          |              |           |        |               |       |               |          |   |
| Sample Number:            | 32           | Type:   | R                                  | Area:                 | 5930.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 5930.00 SqFt          |              |           |        |               |       |               |          |   |
| Sample Number:            | 46           | Type:   | R                                  | Area:                 | 6130.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 6130.00 SqFt          |              |           |        |               |       |               |          |   |
| Sample Number:            | 55           | Type:   | R                                  | Area:                 | 4435.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 4435.00 SqFt          |              |           |        |               |       |               |          |   |
| Sample Number:            | 69           | Type:   | R                                  | Area:                 | 4200.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 4200.00 SqFt          |              |           |        |               |       |               |          |   |
| Sample Number:            | 78           | Type:   | R                                  | Area:                 | 5980.00 SqFt |           | PCI:   | 94            |       |               |          |   |
| Sample Comments:          |              |         |                                    |                       |              |           |        |               |       |               |          |   |
| 57                        | WEATHERING   |         | L                                  | 5980.00 SqFt          |              |           |        |               |       |               |          |   |

|                      |                                           |               |                                  |                       |             |               |          |               |              |
|----------------------|-------------------------------------------|---------------|----------------------------------|-----------------------|-------------|---------------|----------|---------------|--------------|
| Network:             | Bend                                      |               | Name:                            | Bend Municipal        |             |               |          |               |              |
| Branch:              | AHELIBE                                   |               | Name:                            | Helicopter Apron Bend |             | Use:          | APRON    | Area:         | 482,878 SqFt |
| Section:             | 03                                        | of            | 3                                | From:                 | See Map     | To:           | --       | Last Const.:  | 7/2/2017     |
| Surface:             | PCC                                       | Family:       | 2022_Central_Cat1/2_All_Uses_PCC | Zone:                 | KBDN        | Category:     | L        | Rank:         | P            |
| Area:                | 45,280 SqFt                               | Length:       | 212 Ft                           | Width:                | 212 Ft      |               |          |               |              |
| Slabs:               | 334                                       | Slab Length:  | 12 Ft                            | Slab Width:           | 12 Ft       | Joint Length: | 7,119 Ft |               |              |
| Shoulder:            |                                           | Street Type:  |                                  | Grade:                | 0           | Lanes:        | 0        |               |              |
| Section Comments:    | All concrete pads considered one section. |               |                                  |                       |             |               |          |               |              |
| Work Date:           | 7/1/2017                                  | Work Type:    | Subbase - Aggregate              |                       |             | Code:         | SB-AG    | Is Major M&R: | False        |
| Work Date:           | 7/2/2017                                  | Work Type:    | New Construction - PCC           |                       |             | Code:         | NC-PC    | Is Major M&R: | True         |
| Last Insp. Date:     | 3/1/2022                                  | TotalSamples: | 28                               | Surveyed:             | 10          |               |          |               |              |
| Conditions:          | PCI:                                      | 100           |                                  |                       |             |               |          |               |              |
| Inspection Comments: |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 01                                        | Type:         | R                                | Area:                 | 16.00 Slabs | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 05                                        | Type:         | R                                | Area:                 | 18.00 Slabs | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 07                                        | Type:         | R                                | Area:                 | 18.00 Slabs | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 09                                        | Type:         | R                                | Area:                 | 18.00 Slabs | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 11                                        | Type:         | R                                | Area:                 | 9.00 Slabs  | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 14                                        | Type:         | R                                | Area:                 | 9.00 Slabs  | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 18                                        | Type:         | R                                | Area:                 | 9.00 Slabs  | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 21                                        | Type:         | R                                | Area:                 | 9.00 Slabs  | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 25                                        | Type:         | R                                | Area:                 | 9.00 Slabs  | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |
| Sample Number:       | 28                                        | Type:         | R                                | Area:                 | 9.00 Slabs  | PCI:          | 100      |               |              |
| Sample Comments:     |                                           |               |                                  |                       |             |               |          |               |              |
| <No Distress>        |                                           |               |                                  |                       |             |               |          |               |              |

|                      |              |         |                                    |                       |      |              |               |       |                     |          |
|----------------------|--------------|---------|------------------------------------|-----------------------|------|--------------|---------------|-------|---------------------|----------|
| Network:             | Bend         |         | Name:                              | Bend Municipal        |      |              |               |       |                     |          |
| Branch:              | AHELIBE      |         | Name:                              | Helicopter Apron Bend |      | Use:         | APRON         | Area: | 482,878 SqFt        |          |
| Section:             | 02           | of 3    | From:                              | See Map               |      |              | To:           | --    | Last Const.:        | 7/3/2017 |
| Surface:             | AC           | Family: | 2022_Central_Cat1/2_Apr on_AC/AAC  | Zone:                 | KBDN |              | Category:     | L     | Rank:               | P        |
| Area:                | 44,220 SqFt  |         | Length:                            | 225 Ft                |      | Width:       | 225 Ft        |       |                     |          |
| Slabs:               | Slab Length: |         | Ft                                 | Slab Width:           |      | Ft           | Joint Length: |       | Ft                  |          |
| Shoulder:            | Street Type: |         | Grade:                             |                       | 0    | Lanes:       |               | 0     |                     |          |
| Section Comments:    |              |         |                                    |                       |      |              |               |       |                     |          |
| Work Date:           | 7/1/2017     |         | Work Type: Subbase - Aggregate     |                       |      |              | Code:         | SB-AG | Is Major M&R: False |          |
| Work Date:           | 7/2/2017     |         | Work Type: Base Course - Aggregate |                       |      |              | Code:         | BA-AG | Is Major M&R: False |          |
| Work Date:           | 7/3/2017     |         | Work Type: New Construction - AC   |                       |      |              | Code:         | NC-AC | Is Major M&R: True  |          |
| Last Insp. Date:     | 3/1/2022     |         | TotalSamples:                      | 9                     |      | Surveyed:    |               | 4     |                     |          |
| Conditions:          | PCI: 94      |         |                                    |                       |      |              |               |       |                     |          |
| Inspection Comments: |              |         |                                    |                       |      |              |               |       |                     |          |
| Sample Number:       | 01           | Type:   | R                                  | Area:                 |      | 4985.00 SqFt | PCI:          | 94    |                     |          |
| Sample Comments:     |              |         |                                    |                       |      |              |               |       |                     |          |
| 57                   | WEATHERING   |         | L                                  | 4985.00 SqFt          |      |              |               |       |                     |          |
| Sample Number:       | 04           | Type:   | R                                  | Area:                 |      | 4790.00 SqFt | PCI:          | 94    |                     |          |
| Sample Comments:     |              |         |                                    |                       |      |              |               |       |                     |          |
| 57                   | WEATHERING   |         | L                                  | 4790.00 SqFt          |      |              |               |       |                     |          |
| Sample Number:       | 05           | Type:   | R                                  | Area:                 |      | 3615.00 SqFt | PCI:          | 94    |                     |          |
| Sample Comments:     |              |         |                                    |                       |      |              |               |       |                     |          |
| 57                   | WEATHERING   |         | L                                  | 3615.00 SqFt          |      |              |               |       |                     |          |
| Sample Number:       | 08           | Type:   | R                                  | Area:                 |      | 6100.00 SqFt | PCI:          | 94    |                     |          |
| Sample Comments:     |              |         |                                    |                       |      |              |               |       |                     |          |
| 57                   | WEATHERING   |         | L                                  | 6100.00 SqFt          |      |              |               |       |                     |          |

|                      |                                |         |                                      |                              |                |              |        |               |             |               |       |
|----------------------|--------------------------------|---------|--------------------------------------|------------------------------|----------------|--------------|--------|---------------|-------------|---------------|-------|
| Network:             | Bend                           |         |                                      | Name:                        | Bend Municipal |              |        |               |             |               |       |
| Branch:              | ATANHOLDBE                     |         | Name:                                | TW A North Run-Up Apron Bend |                | Use:         | APRON  | Area:         | 31,349 SqFt |               |       |
| Section:             | 01                             | of 1    |                                      | From:                        | TABE-01        |              |        | To:           | North End   |               |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Apr<br>on_AC/AAC |                              | Zone:          | KBDN         |        | Category:     | L           | Rank:         | S     |
| Area:                | 31,349 SqFt                    |         | Length:                              | 350 Ft                       |                | Width:       | 105 Ft |               |             |               |       |
| Slabs:               | Slab Length:                   |         | Ft                                   |                              | Slab Width:    | Ft           |        | Joint Length: | Ft          |               |       |
| Shoulder:            | Street Type:                   |         |                                      |                              | Grade:         | 0            |        | Lanes:        | 0           |               |       |
| Section Comments:    |                                |         |                                      |                              |                |              |        |               |             |               |       |
| Work Date:           | 9/1/2012                       |         | Work Type: Subbase - Aggregate       |                              |                |              | Code:  | SB-AG         |             | Is Major M&R: | False |
| Work Date:           | 9/2/2012                       |         | Work Type: Base Course - Aggregate   |                              |                |              | Code:  | BA-AG         |             | Is Major M&R: | False |
| Work Date:           | 9/3/2012                       |         | Work Type: New Construction - AC     |                              |                |              | Code:  | NC-AC         |             | Is Major M&R: | True  |
| Work Date:           | 9/1/2015                       |         | Work Type: Crack Sealing - AC        |                              |                |              | Code:  | CS-AC         |             | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                        | 7                            |                | Surveyed:    | 4      |               |             |               |       |
| Conditions:          | PCI:                           | 73      |                                      |                              |                |              |        |               |             |               |       |
| Inspection Comments: |                                |         |                                      |                              |                |              |        |               |             |               |       |
| Sample Number:       | 01                             | Type:   | R                                    |                              | Area:          | 4440.00 SqFt |        | PCI:          | 70          |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |                              |                |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 70.00 Ft       |              |        |               |             |               |       |
| 57                   | WEATHERING                     |         | L                                    |                              | 4440.00 SqFt   |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 90.00 Ft       |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 45.00 Ft       |              |        |               |             |               |       |
| Sample Number:       | 02                             | Type:   | R                                    |                              | Area:          | 5000.00 SqFt |        | PCI:          | 69          |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |                              |                |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 150.00 Ft      |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 100.00 Ft      |              |        |               |             |               |       |
| 57                   | WEATHERING                     |         | L                                    |                              | 5000.00 SqFt   |              |        |               |             |               |       |
| Sample Number:       | 05                             | Type:   | R                                    |                              | Area:          | 5000.00 SqFt |        | PCI:          | 75          |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |                              |                |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 45.00 Ft       |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 70.00 Ft       |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | L                                    |                              | 45.00 Ft       |              |        |               |             |               |       |
| 57                   | WEATHERING                     |         | L                                    |                              | 5000.00 SqFt   |              |        |               |             |               |       |
| Sample Number:       | 06                             | Type:   | R                                    |                              | Area:          | 5000.00 SqFt |        | PCI:          | 79          |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                      |                              |                |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | L                                    |                              | 29.00 Ft       |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 30.00 Ft       |              |        |               |             |               |       |
| 48                   | L & T CR                       |         | M                                    |                              | 50.00 Ft       |              |        |               |             |               |       |
| 57                   | WEATHERING                     |         | L                                    |                              | 5000.00 SqFt   |              |        |               |             |               |       |

|                      |                                |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
|----------------------|--------------------------------|--|------------------------------------|-----------------------------------|-------------|-----------|--------------|---------------|-----------|---------------|----------|-------|---|--|
| Network:             | Bend                           |  | Name:                              | Bend Municipal                    |             |           |              |               |           |               |          |       |   |  |
| Branch:              | ATASHOLDBE                     |  | Name:                              | TW A South Run-Up Apron Bend      |             | Use:      | APRON        |               | Area:     | 33,318 SqFt   |          |       |   |  |
| Section:             | 01 of 1                        |  | From:                              | TABE-01                           |             |           | To:          | South End     |           | Last Const.:  | 9/3/2012 |       |   |  |
| Surface:             | AC                             |  | Family:                            | 2022_Central_Cat1/2_Apr on_AC/AAC |             | Zone:     | KBDN         |               | Category: | L             |          | Rank: | S |  |
| Area:                | 33,318 SqFt                    |  | Length:                            | 330 Ft                            |             | Width:    | 105 Ft       |               |           |               |          |       |   |  |
| Slabs:               | Slab Length:                   |  | Ft                                 |                                   | Slab Width: | Ft        |              | Joint Length: | Ft        |               |          |       |   |  |
| Shoulder:            | Street Type:                   |  | Grade:                             |                                   | 0           |           | Lanes:       | 0             |           |               |          |       |   |  |
| Section Comments:    |                                |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| Work Date:           | 9/1/2012                       |  | Work Type: Subbase - Aggregate     |                                   |             |           | Code:        | SB-AG         |           | Is Major M&R: | False    |       |   |  |
| Work Date:           | 9/2/2012                       |  | Work Type: Base Course - Aggregate |                                   |             |           | Code:        | BA-AG         |           | Is Major M&R: | False    |       |   |  |
| Work Date:           | 9/3/2012                       |  | Work Type: New Construction - AC   |                                   |             |           | Code:        | NC-AC         |           | Is Major M&R: | True     |       |   |  |
| Last Insp. Date:     | 3/1/2022                       |  | TotalSamples:                      | 7                                 |             | Surveyed: | 4            |               |           |               |          |       |   |  |
| Conditions:          | PCI: 81                        |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| Inspection Comments: |                                |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| Sample Number:       | 02                             |  | Type:                              | R                                 |             | Area:     | 5500.00 SqFt |               | PCI:      | 81            |          |       |   |  |
| Sample Comments:     | Created by Inspection Schedule |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| 48                   | L & T CR                       |  | M                                  | 36.00 Ft                          |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | M                                  | 550.00 SqFt                       |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | L                                  | 4950.00 SqFt                      |             |           |              |               |           |               |          |       |   |  |
| Sample Number:       | 03                             |  | Type:                              | R                                 |             | Area:     | 5500.00 SqFt |               | PCI:      | 85            |          |       |   |  |
| Sample Comments:     | Created by Inspection Schedule |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | M                                  | 550.00 SqFt                       |             |           |              |               |           |               |          |       |   |  |
| 48                   | L & T CR                       |  | M                                  | 9.00 Ft                           |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | L                                  | 4950.00 SqFt                      |             |           |              |               |           |               |          |       |   |  |
| Sample Number:       | 06                             |  | Type:                              | R                                 |             | Area:     | 5000.00 SqFt |               | PCI:      | 79            |          |       |   |  |
| Sample Comments:     | Created by Inspection Schedule |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| 48                   | L & T CR                       |  | M                                  | 15.00 Ft                          |             |           |              |               |           |               |          |       |   |  |
| 48                   | L & T CR                       |  | L                                  | 50.00 Ft                          |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | M                                  | 500.00 SqFt                       |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | L                                  | 4500.00 SqFt                      |             |           |              |               |           |               |          |       |   |  |
| Sample Number:       | 07                             |  | Type:                              | R                                 |             | Area:     | 5000.00 SqFt |               | PCI:      | 80            |          |       |   |  |
| Sample Comments:     | Created by Inspection Schedule |  |                                    |                                   |             |           |              |               |           |               |          |       |   |  |
| 48                   | L & T CR                       |  | M                                  | 41.00 Ft                          |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | L                                  | 4500.00 SqFt                      |             |           |              |               |           |               |          |       |   |  |
| 57                   | WEATHERING                     |  | M                                  | 500.00 SqFt                       |             |           |              |               |           |               |          |       |   |  |

|                          |                                |                |                                                   |                              |                    |                  |               |                      |             |                          |       |
|--------------------------|--------------------------------|----------------|---------------------------------------------------|------------------------------|--------------------|------------------|---------------|----------------------|-------------|--------------------------|-------|
| <b>Network:</b>          | Bend                           |                | <b>Name:</b>                                      | Bend Municipal               |                    |                  |               |                      |             |                          |       |
| <b>Branch:</b>           | ATBNHOLDBE                     |                | <b>Name:</b>                                      | TW B North Run-Up Apron Bend |                    | <b>Use:</b>      | APRON         | <b>Area:</b>         | 31,198 SqFt |                          |       |
| <b>Section:</b>          | 01                             | of 1           | <b>From:</b>                                      | Taxiway B                    |                    |                  | <b>To:</b>    | -                    |             |                          |       |
| <b>Surface:</b>          | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Apr on_AC/AAC                 |                              | <b>Zone:</b>       | KBDN             |               | <b>Category:</b>     | L           | <b>Rank:</b>             | S     |
| <b>Area:</b>             | 31,198 SqFt                    |                | <b>Length:</b>                                    | 375 Ft                       |                    | <b>Width:</b>    | 105 Ft        |                      |             |                          |       |
| <b>Slabs:</b>            | <b>Slab Length:</b>            |                | Ft                                                |                              | <b>Slab Width:</b> | Ft               |               | <b>Joint Length:</b> | Ft          |                          |       |
| <b>Shoulder:</b>         | <b>Street Type:</b>            |                | <b>Grade:</b>                                     |                              | 0                  |                  | <b>Lanes:</b> | 0                    |             |                          |       |
| <b>Section Comments:</b> |                                |                |                                                   |                              |                    |                  |               |                      |             |                          |       |
| <b>Work Date:</b>        | 10/1/2010                      |                | <b>Work Type:</b> Subbase - Aggregate             |                              |                    |                  | <b>Code:</b>  | SB-AG                |             | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>        | 10/2/2010                      |                | <b>Work Type:</b> Base Course - Crushed Aggregate |                              |                    |                  | <b>Code:</b>  | BA-CA                |             | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>        | 10/3/2010                      |                | <b>Work Type:</b> New Construction - AC           |                              |                    |                  | <b>Code:</b>  | NC-AC                |             | <b>Is Major M&amp;R:</b> | True  |
| <b>Last Insp. Date:</b>  | 3/1/2022                       |                | <b>TotalSamples:</b>                              | 7                            |                    | <b>Surveyed:</b> | 4             |                      |             |                          |       |
| <b>Conditions:</b>       | <b>PCI:</b> 80                 |                | <b>Inspection Comments:</b>                       |                              |                    |                  |               |                      |             |                          |       |
| <b>Sample Number:</b>    | 02                             | <b>Type:</b>   | R                                                 | <b>Area:</b>                 | 4419.00 SqFt       |                  | <b>PCI:</b>   | 78                   |             |                          |       |
| <b>Sample Comments:</b>  | Created by Inspection Schedule |                |                                                   |                              |                    |                  |               |                      |             |                          |       |
| 48                       | L & T CR                       |                | M                                                 | 100.00                       | Ft                 |                  |               |                      |             |                          |       |
| 57                       | WEATHERING                     |                | L                                                 | 4419.00                      | SqFt               |                  |               |                      |             |                          |       |
| <b>Sample Number:</b>    | 03                             | <b>Type:</b>   | R                                                 | <b>Area:</b>                 | 5225.00 SqFt       |                  | <b>PCI:</b>   | 83                   |             |                          |       |
| <b>Sample Comments:</b>  | Created by Inspection Schedule |                |                                                   |                              |                    |                  |               |                      |             |                          |       |
| 57                       | WEATHERING                     |                | L                                                 | 5225.00                      | SqFt               |                  |               |                      |             |                          |       |
| 48                       | L & T CR                       |                | M                                                 | 60.00                        | Ft                 |                  |               |                      |             |                          |       |
| <b>Sample Number:</b>    | 05                             | <b>Type:</b>   | R                                                 | <b>Area:</b>                 | 5250.00 SqFt       |                  | <b>PCI:</b>   | 80                   |             |                          |       |
| <b>Sample Comments:</b>  | Created by Inspection Schedule |                |                                                   |                              |                    |                  |               |                      |             |                          |       |
| 57                       | WEATHERING                     |                | L                                                 | 5250.00                      | SqFt               |                  |               |                      |             |                          |       |
| 48                       | L & T CR                       |                | M                                                 | 100.00                       | Ft                 |                  |               |                      |             |                          |       |
| <b>Sample Number:</b>    | 06                             | <b>Type:</b>   | R                                                 | <b>Area:</b>                 | 4038.00 SqFt       |                  | <b>PCI:</b>   | 79                   |             |                          |       |
| <b>Sample Comments:</b>  | Created by Inspection Schedule |                |                                                   |                              |                    |                  |               |                      |             |                          |       |
| 48                       | L & T CR                       |                | M                                                 | 80.00                        | Ft                 |                  |               |                      |             |                          |       |
| 57                       | WEATHERING                     |                | L                                                 | 4038.00                      | SqFt               |                  |               |                      |             |                          |       |

|                             |            |                                |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
|-----------------------------|------------|--------------------------------|--|---------------------------------------------------|--|-----------------------------------|--|--------------------|--|--------------|--|--------------------------------|--|-------------|--|
| <b>Network:</b>             |            | Bend                           |  | <b>Name:</b>                                      |  | Bend Municipal                    |  |                    |  |              |  |                                |  |             |  |
| <b>Branch:</b>              |            | ATBSHOLDBE                     |  | <b>Name:</b>                                      |  | TW B South Run-Up Apron Bend      |  | <b>Use:</b>        |  | APRON        |  | <b>Area:</b>                   |  | 33,049 SqFt |  |
| <b>Section:</b>             |            | 01 of 1                        |  | <b>From:</b>                                      |  | Taxiway B                         |  | <b>To:</b>         |  | -            |  | <b>Last Const.:</b>            |  | 10/3/2010   |  |
| <b>Surface:</b>             |            | AC                             |  | <b>Family:</b>                                    |  | 2022_Central_Cat1/2_Apr on_AC/AAC |  | <b>Zone:</b>       |  | KBDN         |  | <b>Category:</b>               |  | L Rank: S   |  |
| <b>Area:</b>                |            | 33,049 SqFt                    |  | <b>Length:</b>                                    |  | 375 Ft                            |  | <b>Width:</b>      |  | 105 Ft       |  |                                |  |             |  |
| <b>Slabs:</b>               |            |                                |  | <b>Slab Length:</b>                               |  | Ft                                |  | <b>Slab Width:</b> |  | Ft           |  | <b>Joint Length:</b>           |  | Ft          |  |
| <b>Shoulder:</b>            |            |                                |  | <b>Street Type:</b>                               |  |                                   |  | <b>Grade:</b>      |  | 0            |  | <b>Lanes:</b>                  |  | 0           |  |
| <b>Section Comments:</b>    |            |                                |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
| <b>Work Date:</b>           |            | 10/1/2010                      |  | <b>Work Type:</b> Subbase - Aggregate             |  |                                   |  | <b>Code:</b>       |  | SB-AG        |  | <b>Is Major M&amp;R:</b> False |  |             |  |
| <b>Work Date:</b>           |            | 10/2/2010                      |  | <b>Work Type:</b> Base Course - Crushed Aggregate |  |                                   |  | <b>Code:</b>       |  | BA-CA        |  | <b>Is Major M&amp;R:</b> False |  |             |  |
| <b>Work Date:</b>           |            | 10/3/2010                      |  | <b>Work Type:</b> New Construction - AC           |  |                                   |  | <b>Code:</b>       |  | NC-AC        |  | <b>Is Major M&amp;R:</b> True  |  |             |  |
| <b>Last Insp. Date:</b>     |            | 3/1/2022                       |  | <b>TotalSamples:</b>                              |  | 6                                 |  | <b>Surveyed:</b>   |  | 3            |  |                                |  |             |  |
| <b>Conditions:</b>          |            | <b>PCI:</b> 75                 |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
| <b>Inspection Comments:</b> |            |                                |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
| <b>Sample Number:</b>       |            | 02                             |  | <b>Type:</b>                                      |  | R                                 |  | <b>Area:</b>       |  | 5171.00 SqFt |  | <b>PCI:</b>                    |  | 75          |  |
| <b>Sample Comments:</b>     |            | Created by Inspection Schedule |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
| 57                          | WEATHERING |                                |  | M                                                 |  | 2571.00 SqFt                      |  |                    |  |              |  |                                |  |             |  |
| 57                          | WEATHERING |                                |  | L                                                 |  | 2500.00 SqFt                      |  |                    |  |              |  |                                |  |             |  |
| 48                          | L & T CR   |                                |  | L                                                 |  | 125.00 Ft                         |  |                    |  |              |  |                                |  |             |  |
| <b>Sample Number:</b>       |            | 03                             |  | <b>Type:</b>                                      |  | R                                 |  | <b>Area:</b>       |  | 5250.00 SqFt |  | <b>PCI:</b>                    |  | 75          |  |
| <b>Sample Comments:</b>     |            | Created by Inspection Schedule |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
| 57                          | WEATHERING |                                |  | L                                                 |  | 2625.00 SqFt                      |  |                    |  |              |  |                                |  |             |  |
| 57                          | WEATHERING |                                |  | M                                                 |  | 2625.00 SqFt                      |  |                    |  |              |  |                                |  |             |  |
| 48                          | L & T CR   |                                |  | L                                                 |  | 125.00 Ft                         |  |                    |  |              |  |                                |  |             |  |
| <b>Sample Number:</b>       |            | 05                             |  | <b>Type:</b>                                      |  | R                                 |  | <b>Area:</b>       |  | 5179.00 SqFt |  | <b>PCI:</b>                    |  | 75          |  |
| <b>Sample Comments:</b>     |            | Created by Inspection Schedule |  |                                                   |  |                                   |  |                    |  |              |  |                                |  |             |  |
| 57                          | WEATHERING |                                |  | L                                                 |  | 2550.00 SqFt                      |  |                    |  |              |  |                                |  |             |  |
| 57                          | WEATHERING |                                |  | M                                                 |  | 2629.00 SqFt                      |  |                    |  |              |  |                                |  |             |  |
| 48                          | L & T CR   |                                |  | L                                                 |  | 45.00 Ft                          |  |                    |  |              |  |                                |  |             |  |

|                      |                                |         |                                            |                   |               |              |           |               |               |               |           |
|----------------------|--------------------------------|---------|--------------------------------------------|-------------------|---------------|--------------|-----------|---------------|---------------|---------------|-----------|
| Network:             | Bend                           |         | Name:                                      | Bend Municipal    |               |              |           |               |               |               |           |
| Branch:              | R16BE                          |         | Name:                                      | Runway 16/34 Bend |               | Use:         | RUNWAY    | Area:         | 390,000 SqFt  |               |           |
| Section:             | 01                             | of      | 1                                          | From:             | Runway 16 End |              | To:       | Runway 34 End |               | Last Const.:  | 10/3/2006 |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_RW_AC/AAC              |                   | Zone:         | KBDN         | Category: | L             |               | Rank:         | P         |
| Area:                | 390,000 SqFt                   |         | Length:                                    | 5,200 Ft          |               | Width:       | 75 Ft     |               |               |               |           |
| Slabs:               | Slab Length:                   |         | Ft                                         |                   | Slab Width:   |              | Ft        |               | Joint Length: | Ft            |           |
| Shoulder:            | Street Type:                   |         |                                            |                   | Grade:        | 0            |           | Lanes:        | 0             |               |           |
| Section Comments:    |                                |         |                                            |                   |               |              |           |               |               |               |           |
| Work Date:           | 9/1/1977                       |         | Work Type: Base Course - Aggregate         |                   |               |              | Code:     | BA-AG         |               | Is Major M&R: | True      |
| Work Date:           | 9/2/1977                       |         | Work Type: New Construction - AC           |                   |               |              | Code:     | NC-AC         |               | Is Major M&R: | True      |
| Work Date:           | 9/1/1995                       |         | Work Type: Crack Sealing - AC              |                   |               |              | Code:     | CS-AC         |               | Is Major M&R: | False     |
| Work Date:           | 10/1/2006                      |         | Work Type: Subbase - Aggregate             |                   |               |              | Code:     | SB-AG         |               | Is Major M&R: | False     |
| Work Date:           | 10/2/2006                      |         | Work Type: Base Course - Crushed Aggregate |                   |               |              | Code:     | BA-CA         |               | Is Major M&R: | False     |
| Work Date:           | 10/3/2006                      |         | Work Type: New Construction - AC           |                   |               |              | Code:     | NC-AC         |               | Is Major M&R: | True      |
| Work Date:           | 9/1/2012                       |         | Work Type: Crack Sealing - AC              |                   |               |              | Code:     | CS-AC         |               | Is Major M&R: | False     |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                              | 70                |               | Surveyed:    | 6         |               |               |               |           |
| Conditions:          | PCI:                           | 78      |                                            |                   |               |              |           |               |               |               |           |
| Inspection Comments: |                                |         |                                            |                   |               |              |           |               |               |               |           |
| Sample Number:       | 02                             | Type:   | R                                          |                   | Area:         | 5625.00 SqFt |           | PCI:          | 80            |               |           |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                   |               |              |           |               |               |               |           |
| 57                   | WEATHERING                     | L       | 5625.00                                    | SqFt              |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 300.00                                     | Ft                |               |              |           |               |               |               |           |
| Sample Number:       | 16                             | Type:   | R                                          |                   | Area:         | 5625.00 SqFt |           | PCI:          | 77            |               |           |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                   |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 36.00                                      | Ft                |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | M       | 75.00                                      | Ft                |               |              |           |               |               |               |           |
| 57                   | WEATHERING                     | L       | 5625.00                                    | SqFt              |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 150.00                                     | Ft                |               |              |           |               |               |               |           |
| Sample Number:       | 26                             | Type:   | R                                          |                   | Area:         | 5625.00 SqFt |           | PCI:          | 77            |               |           |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                   |               |              |           |               |               |               |           |
| 57                   | WEATHERING                     | L       | 5625.00                                    | SqFt              |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 225.00                                     | Ft                |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | M       | 75.00                                      | Ft                |               |              |           |               |               |               |           |
| Sample Number:       | 39                             | Type:   | R                                          |                   | Area:         | 5625.00 SqFt |           | PCI:          | 77            |               |           |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                   |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 15.00                                      | Ft                |               |              |           |               |               |               |           |
| 57                   | WEATHERING                     | L       | 5625.00                                    | SqFt              |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | M       | 125.00                                     | Ft                |               |              |           |               |               |               |           |
| Sample Number:       | 54                             | Type:   | R                                          |                   | Area:         | 5625.00 SqFt |           | PCI:          | 75            |               |           |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                   |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 56.00                                      | Ft                |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | M       | 26.00                                      | Ft                |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | M       | 75.00                                      | Ft                |               |              |           |               |               |               |           |
| 57                   | WEATHERING                     | L       | 5625.00                                    | SqFt              |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 150.00                                     | Ft                |               |              |           |               |               |               |           |
| Sample Number:       | 68                             | Type:   | R                                          |                   | Area:         | 5625.00 SqFt |           | PCI:          | 80            |               |           |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                   |               |              |           |               |               |               |           |
| 57                   | WEATHERING                     | L       | 5625.00                                    | SqFt              |               |              |           |               |               |               |           |
| 48                   | L & T CR                       | L       | 276.00                                     | Ft                |               |              |           |               |               |               |           |

|                             |                                |                |                                                    |                 |                    |                  |              |                  |                      |                          |          |
|-----------------------------|--------------------------------|----------------|----------------------------------------------------|-----------------|--------------------|------------------|--------------|------------------|----------------------|--------------------------|----------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                       | Bend Municipal  |                    |                  |              |                  |                      |                          |          |
| <b>Branch:</b>              | T01BE                          |                | <b>Name:</b>                                       | Taxiway 01 Bend |                    | <b>Use:</b>      | TAXIWAY      | <b>Area:</b>     | 5,840 SqFt           |                          |          |
| <b>Section:</b>             | 01                             | of 1           | <b>From:</b>                                       | T03-01          |                    |                  | <b>To:</b>   | End              |                      | <b>Last Const.:</b>      | 9/2/1998 |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxiway_AC                     |                 | <b>Zone:</b>       | KBDN             |              | <b>Category:</b> | L                    | <b>Rank:</b>             | S        |
| <b>Area:</b>                | 5,840 SqFt                     |                | <b>Length:</b>                                     | 200 Ft          |                    | <b>Width:</b>    | 25 Ft        |                  |                      |                          |          |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                 |                 | <b>Slab Width:</b> |                  | Ft           |                  | <b>Joint Length:</b> | Ft                       |          |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                    |                 | <b>Grade:</b>      | 0                |              | <b>Lanes:</b>    | 0                    |                          |          |
| <b>Section Comments:</b>    |                                |                |                                                    |                 |                    |                  |              |                  |                      |                          |          |
| <b>Work Date:</b>           | 9/1/1998                       |                | <b>Work Type:</b> Base Course - Unknown (Major MR) |                 |                    |                  | <b>Code:</b> | BA-UN            |                      | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/2/1998                       |                | <b>Work Type:</b> New Construction - AC            |                 |                    |                  | <b>Code:</b> | NC-AC            |                      | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/1/2008                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC            |                      | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC            |                      | <b>Is Major M&amp;R:</b> | False    |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                               | 2               |                    | <b>Surveyed:</b> | 2            |                  |                      |                          |          |
| <b>Conditions:</b>          | PCI:                           | 65             |                                                    |                 |                    |                  |              |                  |                      |                          |          |
| <b>Inspection Comments:</b> |                                |                |                                                    |                 |                    |                  |              |                  |                      |                          |          |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 2405.00 SqFt       |                  | <b>PCI:</b>  | 66               |                      |                          |          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                 |                    |                  |              |                  |                      |                          |          |
| 57                          | WEATHERING                     | L              | 2405.00                                            |                 | SqFt               |                  |              |                  |                      |                          |          |
| 48                          | L & T CR                       | M              | 110.00                                             |                 | Ft                 |                  |              |                  |                      |                          |          |
| 48                          | L & T CR                       | M              | 45.00                                              |                 | Ft                 |                  |              |                  |                      |                          |          |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 3435.00 SqFt       |                  | <b>PCI:</b>  | 64               |                      |                          |          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                 |                    |                  |              |                  |                      |                          |          |
| 48                          | L & T CR                       | M              | 72.00                                              |                 | Ft                 |                  |              |                  |                      |                          |          |
| 57                          | WEATHERING                     | L              | 3435.00                                            |                 | SqFt               |                  |              |                  |                      |                          |          |
| 54                          | SHOVING                        | L              | 540.00                                             |                 | SqFt               |                  |              |                  |                      |                          |          |
| 48                          | L & T CR                       | M              | 40.00                                              |                 | Ft                 |                  |              |                  |                      |                          |          |
| 48                          | L & T CR                       | M              | 30.00                                              |                 | Ft                 |                  |              |                  |                      |                          |          |
| 48                          | L & T CR                       | M              | 29.00                                              |                 | Ft                 |                  |              |                  |                      |                          |          |

|                      |                                |         |                                |                 |             |                |                                  |               |             |              |          |               |       |
|----------------------|--------------------------------|---------|--------------------------------|-----------------|-------------|----------------|----------------------------------|---------------|-------------|--------------|----------|---------------|-------|
| Network:             |                                | Bend    |                                | Name:           |             | Bend Municipal |                                  |               |             |              |          |               |       |
| Branch:              | T02BE                          |         | Name:                          | Taxiway 02 Bend |             | Use:           | TAXIWAY                          | Area:         | 11,370 SqFt |              |          |               |       |
| Section:             | 01                             | of 1    |                                | From:           | T03-01, 02  |                | To:                              | End           |             | Last Const.: | 9/2/1995 |               |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxiway_AC |                 | Zone:       | KBDN           |                                  | Category:     | L           |              | Rank:    | S             |       |
| Area:                | 11,370 SqFt                    |         | Length:                        | 330 Ft          |             | Width:         | 25 Ft                            |               |             |              |          |               |       |
| Slabs:               | Slab Length:                   |         | Ft                             |                 | Slab Width: | Ft             |                                  | Joint Length: | Ft          |              |          |               |       |
| Shoulder:            | Street Type:                   |         |                                |                 | Grade:      | 0              |                                  | Lanes:        | 0           |              |          |               |       |
| Section Comments:    |                                |         |                                |                 |             |                |                                  |               |             |              |          |               |       |
| Work Date:           | 9/1/1995                       |         | Work Type:                     |                 |             |                | Base Course - Unknown (Major MR) |               | Code:       | BA-UN        |          | Is Major M&R: | True  |
| Work Date:           | 9/2/1995                       |         | Work Type:                     |                 |             |                | New Construction - AC            |               | Code:       | NC-AC        |          | Is Major M&R: | True  |
| Work Date:           | 9/1/2012                       |         | Work Type:                     |                 |             |                | Crack Sealing - AC               |               | Code:       | CS-AC        |          | Is Major M&R: | False |
| Work Date:           | 9/1/2015                       |         | Work Type:                     |                 |             |                | Crack Sealing - AC               |               | Code:       | CS-AC        |          | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                  | 2               |             | Surveyed:      |                                  | 2             |             |              |          |               |       |
| Conditions:          | PCI: 65                        |         |                                |                 |             |                |                                  |               |             |              |          |               |       |
| Inspection Comments: |                                |         |                                |                 |             |                |                                  |               |             |              |          |               |       |
| Sample Number:       | 01                             | Type:   | R                              |                 | Area:       | 5140.00 SqFt   |                                  | PCI:          | 70          |              |          |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                |                 |             |                |                                  |               |             |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 160.00          | SqFt        |                |                                  |               |             |              |          |               |       |
| 57                   | WEATHERING                     |         | M                              | 5140.00         | SqFt        |                |                                  |               |             |              |          |               |       |
| 48                   | L & T CR                       |         | M                              | 77.00           | Ft          |                |                                  |               |             |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 200.00          | SqFt        |                |                                  |               |             |              |          |               |       |
| 48                   | L & T CR                       |         | L                              | 7.00            | Ft          |                |                                  |               |             |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 200.00          | SqFt        |                |                                  |               |             |              |          |               |       |
| Sample Number:       | 02                             | Type:   | R                              |                 | Area:       | 6230.00 SqFt   |                                  | PCI:          | 62          |              |          |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                |                 |             |                |                                  |               |             |              |          |               |       |
| 48                   | L & T CR                       |         | L                              | 23.00           | Ft          |                |                                  |               |             |              |          |               |       |
| 50                   | PATCHING                       |         | M                              | 250.00          | SqFt        |                |                                  |               |             |              |          |               |       |
| 48                   | L & T CR                       |         | M                              | 180.00          | Ft          |                |                                  |               |             |              |          |               |       |
| 57                   | WEATHERING                     |         | M                              | 6230.00         | SqFt        |                |                                  |               |             |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | L                              | 15.00           | SqFt        |                |                                  |               |             |              |          |               |       |

|                             |                                |                |                                                    |                 |                    |                  |                  |              |                                |
|-----------------------------|--------------------------------|----------------|----------------------------------------------------|-----------------|--------------------|------------------|------------------|--------------|--------------------------------|
| <b>Network:</b>             | Bend                           |                |                                                    | <b>Name:</b>    | Bend Municipal     |                  |                  |              |                                |
| <b>Branch:</b>              | T03BE                          |                | <b>Name:</b>                                       | Taxiway 03 Bend |                    | <b>Use:</b>      | TAXIWAY          | <b>Area:</b> | 59,271 SqFt                    |
| <b>Section:</b>             | 02                             | of             | 7                                                  | <b>From:</b>    | T03BE-01           |                  | <b>To:</b>       | T02-01       | <b>Last Const.:</b> 9/2/1994   |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxiway_AC                     | <b>Zone:</b>    | KBDN               |                  | <b>Category:</b> | L            | <b>Rank:</b> S                 |
| <b>Area:</b>                | 5,062 SqFt                     |                | <b>Length:</b>                                     | 144 Ft          |                    | <b>Width:</b>    | 30 Ft            |              |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                 |                 | <b>Slab Width:</b> |                  | Ft               |              | <b>Joint Length:</b> Ft        |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                | <b>Grade:</b> 0                                    |                 | <b>Lanes:</b> 0    |                  |                  |              |                                |
| <b>Section Comments:</b>    |                                |                |                                                    |                 |                    |                  |                  |              |                                |
| <b>Work Date:</b>           | 9/1/1994                       |                | <b>Work Type:</b> Base Course - Unknown (Major MR) |                 |                    |                  | <b>Code:</b>     | BA-UN        | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/2/1994                       |                | <b>Work Type:</b> New Construction - AC            |                 |                    |                  | <b>Code:</b>     | NC-AC        | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/3/1994                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b>     | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2000                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b>     | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/2/2000                       |                | <b>Work Type:</b> Surface Seal - Fog Seal          |                 |                    |                  | <b>Code:</b>     | SS-FS        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2004                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b>     | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2008                       |                | <b>Work Type:</b> Crack Seal - Wide Cracks         |                 |                    |                  | <b>Code:</b>     | CS-WD        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/2/2008                       |                | <b>Work Type:</b> Patching - AC Deep               |                 |                    |                  | <b>Code:</b>     | PA-AD        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b> Patching - AC Deep               |                 |                    |                  | <b>Code:</b>     | PA-AD        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b>     | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                               | 1               |                    | <b>Surveyed:</b> | 1                |              |                                |
| <b>Conditions:</b>          | PCI: 29                        |                |                                                    |                 |                    |                  |                  |              |                                |
| <b>Inspection Comments:</b> |                                |                |                                                    |                 |                    |                  |                  |              |                                |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 5062.00 SqFt       |                  | <b>PCI:</b>      | 29           |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                 |                    |                  |                  |              |                                |
| 48                          | L & T CR                       |                | M                                                  | 155.00 Ft       |                    |                  |                  |              |                                |
| 50                          | PATCHING                       |                | M                                                  | 60.00 SqFt      |                    |                  |                  |              |                                |
| 41                          | ALLIGATOR CR                   |                | M                                                  | 64.00 SqFt      |                    |                  |                  |              |                                |
| 50                          | PATCHING                       |                | L                                                  | 240.00 SqFt     |                    |                  |                  |              |                                |
| 43                          | BLOCK CR                       |                | M                                                  | 400.00 SqFt     |                    |                  |                  |              |                                |
| 57                          | WEATHERING                     |                | M                                                  | 5062.00 SqFt    |                    |                  |                  |              |                                |
| 41                          | ALLIGATOR CR                   |                | M                                                  | 110.00 SqFt     |                    |                  |                  |              |                                |
| 54                          | SHOVING                        |                | L                                                  | 75.00 SqFt      |                    |                  |                  |              |                                |

|                      |                                |         |                                             |                 |                |           |           |               |                       |
|----------------------|--------------------------------|---------|---------------------------------------------|-----------------|----------------|-----------|-----------|---------------|-----------------------|
| Network:             | Bend                           |         |                                             | Name:           | Bend Municipal |           |           |               |                       |
| Branch:              | T03BE                          |         | Name:                                       | Taxiway 03 Bend |                | Use:      | TAXIWAY   | Area:         | 59,271 SqFt           |
| Section:             | 05                             | of      | 7                                           | From:           | T03-04         |           | To:       | T03-06        | Last Const.: 9/2/1955 |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxiway_AC              | Zone:           | KBDN           |           | Category: | L             | Rank: S               |
| Area:                | 21,900 SqFt                    |         | Length:                                     | 365 Ft          |                | Width:    | 60 Ft     |               |                       |
| Slabs:               | Slab Length:                   |         | Ft                                          |                 | Slab Width:    | Ft        |           | Joint Length: | Ft                    |
| Shoulder:            | Street Type:                   |         | Grade:                                      |                 | 0              |           | Lanes:    | 0             |                       |
| Section Comments:    |                                |         |                                             |                 |                |           |           |               |                       |
| Work Date:           | 9/1/1955                       |         | Work Type: Base Course - Unknown (Major MR) |                 |                |           | Code:     | BA-UN         |                       |
| Work Date:           | 9/2/1955                       |         | Work Type: New Construction - AC            |                 |                |           | Code:     | NC-AC         |                       |
| Work Date:           | 9/1/1988                       |         | Work Type: Crack Sealing - AC               |                 |                |           | Code:     | CS-AC         |                       |
| Work Date:           | 9/1/2000                       |         | Work Type: Surface Seal - Fog Seal          |                 |                |           | Code:     | SS-FS         |                       |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                               | 4               |                | Surveyed: | 3         |               |                       |
| Conditions:          | PCI:                           | 7       |                                             |                 |                |           |           |               |                       |
| Inspection Comments: |                                |         |                                             |                 |                |           |           |               |                       |
| Sample Number:       | 01                             | Type:   | R                                           | Area:           | 6000.00 SqFt   |           | PCI:      | 12            |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                 |                |           |           |               |                       |
| 57                   | WEATHERING                     | L       | 3000.00                                     | SqFt            |                |           |           |               |                       |
| 50                   | PATCHING                       | L       | 1500.00                                     | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | H       | 200.00                                      | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | M       | 1200.00                                     | SqFt            |                |           |           |               |                       |
| 57                   | WEATHERING                     | M       | 3000.00                                     | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | M       | 750.00                                      | SqFt            |                |           |           |               |                       |
| Sample Number:       | 02                             | Type:   | R                                           | Area:           | 6000.00 SqFt   |           | PCI:      | 3             |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                 |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | M       | 1600.00                                     | SqFt            |                |           |           |               |                       |
| 57                   | WEATHERING                     | M       | 6000.00                                     | SqFt            |                |           |           |               |                       |
| 50                   | PATCHING                       | L       | 50.00                                       | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | M       | 360.00                                      | SqFt            |                |           |           |               |                       |
| 48                   | L & T CR                       | H       | 40.00                                       | Ft              |                |           |           |               |                       |
| 50                   | PATCHING                       | M       | 600.00                                      | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | H       | 2000.00                                     | SqFt            |                |           |           |               |                       |
| 50                   | PATCHING                       | L       | 700.00                                      | SqFt            |                |           |           |               |                       |
| Sample Number:       | 03                             | Type:   | R                                           | Area:           | 6000.00 SqFt   |           | PCI:      | 6             |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                 |                |           |           |               |                       |
| 48                   | L & T CR                       | M       | 12.00                                       | Ft              |                |           |           |               |                       |
| 57                   | WEATHERING                     | M       | 600.00                                      | SqFt            |                |           |           |               |                       |
| 50                   | PATCHING                       | M       | 66.00                                       | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | M       | 900.00                                      | SqFt            |                |           |           |               |                       |
| 41                   | ALLIGATOR CR                   | H       | 900.00                                      | SqFt            |                |           |           |               |                       |
| 50                   | PATCHING                       | L       | 600.00                                      | SqFt            |                |           |           |               |                       |

|                                                        |                     |                |                                                    |                 |                    |                  |             |                  |                      |             |                          |          |
|--------------------------------------------------------|---------------------|----------------|----------------------------------------------------|-----------------|--------------------|------------------|-------------|------------------|----------------------|-------------|--------------------------|----------|
| <b>Network:</b>                                        | Bend                |                | <b>Name:</b>                                       | Bend Municipal  |                    |                  |             |                  |                      |             |                          |          |
| <b>Branch:</b>                                         | T03BE               |                | <b>Name:</b>                                       | Taxiway 03 Bend |                    | <b>Use:</b>      | TAXIWAY     |                  | <b>Area:</b>         | 59,271 SqFt |                          |          |
| <b>Section:</b>                                        | 06                  | of             | 7                                                  | <b>From:</b>    | T03-05             |                  |             | <b>To:</b>       | T03-07               |             | <b>Last Const.:</b>      | 9/2/1988 |
| <b>Surface:</b>                                        | AC                  | <b>Family:</b> | 2022_Central_Cat1/2_Taxi way_AC                    |                 | <b>Zone:</b>       | KBDN             |             | <b>Category:</b> | L                    |             | <b>Rank:</b>             | S        |
| <b>Area:</b>                                           | 6,600 SqFt          |                | <b>Length:</b>                                     | 110 Ft          |                    | <b>Width:</b>    | 60 Ft       |                  |                      |             |                          |          |
| <b>Slabs:</b>                                          | <b>Slab Length:</b> |                | Ft                                                 |                 | <b>Slab Width:</b> |                  | Ft          |                  | <b>Joint Length:</b> |             | Ft                       |          |
| <b>Shoulder:</b>                                       | <b>Street Type:</b> |                |                                                    |                 | <b>Grade:</b>      |                  | 0           |                  | <b>Lanes:</b>        |             | 0                        |          |
| <b>Section Comments:</b>                               |                     |                |                                                    |                 |                    |                  |             |                  |                      |             |                          |          |
| <b>Work Date:</b>                                      | 9/1/1988            |                | <b>Work Type:</b> Base Course - Unknown (Major MR) |                 |                    |                  |             | <b>Code:</b>     | BA-UN                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>                                      | 9/2/1988            |                | <b>Work Type:</b> New Construction - AC            |                 |                    |                  |             | <b>Code:</b>     | NC-AC                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>                                      | 9/3/1988            |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  |             | <b>Code:</b>     | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>                                      | 9/4/1988            |                | <b>Work Type:</b> Surface Seal - Coal Tar          |                 |                    |                  |             | <b>Code:</b>     | SS-CT                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>                                      | 9/1/2000            |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  |             | <b>Code:</b>     | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>                                      | 9/1/2004            |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  |             | <b>Code:</b>     | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Last Insp. Date:</b>                                | 3/1/2022            |                | <b>TotalSamples:</b>                               | 1               |                    | <b>Surveyed:</b> | 1           |                  |                      |             |                          |          |
| <b>Conditions:</b>                                     | PCI: 34             |                |                                                    |                 |                    |                  |             |                  |                      |             |                          |          |
| <b>Inspection Comments:</b>                            |                     |                |                                                    |                 |                    |                  |             |                  |                      |             |                          |          |
| <b>Sample Number:</b>                                  | 01                  | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 6600.00 SqFt       |                  | <b>PCI:</b> | 34               |                      |             |                          |          |
| <b>Sample Comments:</b> Created by Inspection Schedule |                     |                |                                                    |                 |                    |                  |             |                  |                      |             |                          |          |
| 48                                                     | L & T CR            |                | M                                                  | 287.00          | Ft                 |                  |             |                  |                      |             |                          |          |
| 48                                                     | L & T CR            |                | M                                                  | 100.00          | Ft                 |                  |             |                  |                      |             |                          |          |
| 41                                                     | ALLIGATOR CR        |                | H                                                  | 40.00           | SqFt               |                  |             |                  |                      |             |                          |          |
| 57                                                     | WEATHERING          |                | L                                                  | 6600.00         | SqFt               |                  |             |                  |                      |             |                          |          |
| 43                                                     | BLOCK CR            |                | M                                                  | 1600.00         | SqFt               |                  |             |                  |                      |             |                          |          |
| 50                                                     | PATCHING            |                | L                                                  | 234.00          | SqFt               |                  |             |                  |                      |             |                          |          |
| 48                                                     | L & T CR            |                | H                                                  | 47.00           | Ft                 |                  |             |                  |                      |             |                          |          |

|                      |                                |      |               |                                  |  |                |              |       |               |        |              |               |       |
|----------------------|--------------------------------|------|---------------|----------------------------------|--|----------------|--------------|-------|---------------|--------|--------------|---------------|-------|
| Network:             |                                | Bend |               | Name:                            |  | Bend Municipal |              |       |               |        |              |               |       |
| Branch:              | T03BE                          |      | Name:         | Taxiway 03 Bend                  |  | Use:           | TAXIWAY      | Area: | 59,271 SqFt   |        |              |               |       |
| Section:             | 07                             |      | of            | 7                                |  | From:          | T03-06       |       | To:           | A01-03 | Last Const.: | 9/2/1999      |       |
| Surface:             | AC                             |      | Family:       | 2022_Central_Cat1/2_Taxiway_AC   |  | Zone:          | KBDN         |       | Category:     | L      |              | Rank:         | S     |
| Area:                | 2,834 SqFt                     |      | Length:       | 45 Ft                            |  | Width:         | 60 Ft        |       |               |        |              |               |       |
| Slabs:               |                                |      | Slab Length:  | Ft                               |  | Slab Width:    | Ft           |       | Joint Length: | Ft     |              |               |       |
| Shoulder:            |                                |      | Street Type:  |                                  |  | Grade:         | 0            |       | Lanes:        | 0      |              |               |       |
| Section Comments:    |                                |      |               |                                  |  |                |              |       |               |        |              |               |       |
| Work Date:           | 9/1/1999                       |      | Work Type:    | Base Course - Unknown (Major MR) |  |                |              |       | Code:         | BA-UN  |              | Is Major M&R: | True  |
| Work Date:           | 9/2/1999                       |      | Work Type:    | New Construction - AC            |  |                |              |       | Code:         | NC-AC  |              | Is Major M&R: | True  |
| Work Date:           | 9/1/2004                       |      | Work Type:    | Crack Sealing - AC               |  |                |              |       | Code:         | CS-AC  |              | Is Major M&R: | False |
| Work Date:           | 9/1/2008                       |      | Work Type:    | Crack Sealing - AC               |  |                |              |       | Code:         | CS-AC  |              | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |      | TotalSamples: | 1                                |  | Surveyed:      | 1            |       |               |        |              |               |       |
| Conditions:          | PCI: 64                        |      |               |                                  |  |                |              |       |               |        |              |               |       |
| Inspection Comments: |                                |      |               |                                  |  |                |              |       |               |        |              |               |       |
| Sample Number:       | 01                             |      | Type:         | R                                |  | Area:          | 2834.00 SqFt |       | PCI:          | 64     |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |      |               |                                  |  |                |              |       |               |        |              |               |       |
| 57                   | WEATHERING                     |      | M             | 2834.00 SqFt                     |  |                |              |       |               |        |              |               |       |
| 48                   | L & T CR                       |      | M             | 202.00 Ft                        |  |                |              |       |               |        |              |               |       |

|                      |                                |         |                                |                                  |             |                |              |               |              |          |               |       |
|----------------------|--------------------------------|---------|--------------------------------|----------------------------------|-------------|----------------|--------------|---------------|--------------|----------|---------------|-------|
| Network:             |                                | Bend    |                                | Name:                            |             | Bend Municipal |              |               |              |          |               |       |
| Branch:              | T03BE                          |         | Name:                          | Taxiway 03 Bend                  |             | Use:           | TAXIWAY      | Area:         | 59,271 SqFt  |          |               |       |
| Section:             | 03                             | of      | 7                              | From:                            | T02-02      |                | To:          | T03-04        | Last Const.: | 9/2/1996 |               |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxiway_AC |                                  | Zone:       | KBDN           |              | Category:     | L            | Rank:    | S             |       |
| Area:                | 10,800 SqFt                    |         | Length:                        | 190 Ft                           |             | Width:         | 60 Ft        |               |              |          |               |       |
| Slabs:               | Slab Length:                   |         | Ft                             |                                  | Slab Width: | Ft             |              | Joint Length: | Ft           |          |               |       |
| Shoulder:            | Street Type:                   |         |                                |                                  | Grade:      | 0              |              | Lanes:        | 0            |          |               |       |
| Section Comments:    |                                |         |                                |                                  |             |                |              |               |              |          |               |       |
| Work Date:           | 9/1/1996                       |         | Work Type:                     | New Construction - AC            |             |                |              | Code:         | NC-AC        |          | Is Major M&R: | True  |
| Work Date:           | 9/2/1996                       |         | Work Type:                     | Base Course - Unknown (Major MR) |             |                |              | Code:         | BA-UN        |          | Is Major M&R: | True  |
| Work Date:           | 9/1/2000                       |         | Work Type:                     | Crack Sealing - AC               |             |                |              | Code:         | CS-AC        |          | Is Major M&R: | False |
| Work Date:           | 9/2/2000                       |         | Work Type:                     | Surface Seal - Fog Seal          |             |                |              | Code:         | SS-FS        |          | Is Major M&R: | False |
| Work Date:           | 9/1/2008                       |         | Work Type:                     | Crack Seal - Wide Cracks         |             |                |              | Code:         | CS-WD        |          | Is Major M&R: | False |
| Work Date:           | 9/2/2008                       |         | Work Type:                     | Patching - AC Deep               |             |                |              | Code:         | PA-AD        |          | Is Major M&R: | False |
| Work Date:           | 9/1/2012                       |         | Work Type:                     | Crack Sealing - AC               |             |                |              | Code:         | CS-AC        |          | Is Major M&R: | False |
| Work Date:           | 9/1/2015                       |         | Work Type:                     | Crack Sealing - AC               |             |                |              | Code:         | CS-AC        |          | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                  | 2                                |             | Surveyed:      | 2            |               |              |          |               |       |
| Conditions:          | PCI:                           |         | 19                             |                                  |             |                |              |               |              |          |               |       |
| Inspection Comments: |                                |         |                                |                                  |             |                |              |               |              |          |               |       |
| Sample Number:       | 01                             |         | Type:                          | R                                |             | Area:          | 6000.00 SqFt |               | PCI:         | 18       |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                |                                  |             |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 64.00                            | SqFt        |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 180.00                           | SqFt        |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 175.00                           | SqFt        |                |              |               |              |          |               |       |
| 57                   | WEATHERING                     |         | M                              | 6000.00                          | SqFt        |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 400.00                           | SqFt        |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 200.00                           | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 52.00                            | SqFt        |                |              |               |              |          |               |       |
| 48                   | L & T CR                       |         | M                              | 290.00                           | Ft          |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 210.00                           | SqFt        |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 30.00                            | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | M                              | 45.00                            | SqFt        |                |              |               |              |          |               |       |
| 48                   | L & T CR                       |         | M                              | 186.00                           | Ft          |                |              |               |              |          |               |       |
| Sample Number:       | 02                             |         | Type:                          | R                                |             | Area:          | 4800.00 SqFt |               | PCI:         | 21       |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                |                                  |             |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 600.00                           | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 36.00                            | SqFt        |                |              |               |              |          |               |       |
| 48                   | L & T CR                       |         | M                              | 62.00                            | Ft          |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 80.00                            | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | M                              | 90.00                            | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | M                              | 150.00                           | SqFt        |                |              |               |              |          |               |       |
| 41                   | ALLIGATOR CR                   |         | M                              | 176.00                           | SqFt        |                |              |               |              |          |               |       |
| 57                   | WEATHERING                     |         | M                              | 4800.00                          | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | M                              | 40.00                            | SqFt        |                |              |               |              |          |               |       |
| 50                   | PATCHING                       |         | L                              | 30.00                            | SqFt        |                |              |               |              |          |               |       |
| 48                   | L & T CR                       |         | M                              | 85.00                            | Ft          |                |              |               |              |          |               |       |

|                             |                                |                |                                                    |                    |              |                  |                      |              |                                |
|-----------------------------|--------------------------------|----------------|----------------------------------------------------|--------------------|--------------|------------------|----------------------|--------------|--------------------------------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                       | Bend Municipal     |              |                  |                      |              |                                |
| <b>Branch:</b>              | T03BE                          |                | <b>Name:</b>                                       | Taxiway 03 Bend    |              | <b>Use:</b>      | TAXIWAY              | <b>Area:</b> | 59,271 SqFt                    |
| <b>Section:</b>             | 04                             | of             | 7                                                  | <b>From:</b>       | T03-03       |                  | <b>To:</b>           | T03-05       | <b>Last Const.:</b> 9/2/1966   |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxi<br>way_AC                 | <b>Zone:</b>       | KBDN         |                  | <b>Category:</b>     | L            | <b>Rank:</b> S                 |
| <b>Area:</b>                | 4,683 SqFt                     |                | <b>Length:</b>                                     | 78 Ft              |              | <b>Width:</b>    | 60 Ft                |              |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                 | <b>Slab Width:</b> |              | Ft               | <b>Joint Length:</b> |              | Ft                             |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                    | <b>Grade:</b>      |              | 0                | <b>Lanes:</b>        |              | 0                              |
| <b>Section Comments:</b>    |                                |                |                                                    |                    |              |                  |                      |              |                                |
| <b>Work Date:</b>           | 9/1/1966                       |                | <b>Work Type:</b> Base Course - Unknown (Major MR) |                    |              |                  | <b>Code:</b>         | BA-UN        | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/2/1966                       |                | <b>Work Type:</b> New Construction - AC            |                    |              |                  | <b>Code:</b>         | NC-AC        | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/1/1988                       |                | <b>Work Type:</b> Crack Sealing - AC               |                    |              |                  | <b>Code:</b>         | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/1/2000                       |                | <b>Work Type:</b> Crack Sealing - AC               |                    |              |                  | <b>Code:</b>         | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/2/2000                       |                | <b>Work Type:</b> Surface Seal - Fog Seal          |                    |              |                  | <b>Code:</b>         | SS-FS        | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                               | 1                  |              | <b>Surveyed:</b> | 1                    |              |                                |
| <b>Conditions:</b>          | PCI:                           | 12             |                                                    |                    |              |                  |                      |              |                                |
| <b>Inspection Comments:</b> |                                |                |                                                    |                    |              |                  |                      |              |                                |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                  | <b>Area:</b>       | 4683.00 SqFt |                  | <b>PCI:</b>          | 12           |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                    |              |                  |                      |              |                                |
| 57                          | WEATHERING                     |                | M                                                  | 4683.00 SqFt       |              |                  |                      |              |                                |
| 50                          | PATCHING                       |                | M                                                  | 120.00 SqFt        |              |                  |                      |              |                                |
| 41                          | ALLIGATOR CR                   |                | M                                                  | 2600.00 SqFt       |              |                  |                      |              |                                |

|                      |                                |         |                                 |              |              |                              |               |               |              |          |
|----------------------|--------------------------------|---------|---------------------------------|--------------|--------------|------------------------------|---------------|---------------|--------------|----------|
| Network:             | Bend                           | Name:   | Bend Municipal                  |              |              |                              |               |               |              |          |
| Branch:              | T03BE                          | Name:   | Taxiway 03 Bend                 |              | Use:         | TAXIWAY                      | Area:         | 59,271 SqFt   |              |          |
| Section:             | 01                             | of 7    | From:                           | TABE-01      |              | To:                          | T03BE-02      |               | Last Const.: | 9/3/2012 |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxi way_AC | Zone:        | KBDN         | Category:                    | L             |               | Rank:        | S        |
| Area:                | 7,392 SqFt                     |         | Length:                         | 150 Ft       |              | Width:                       | 30 Ft         |               |              |          |
| Slabs:               | Slab Length:                   |         | Ft                              | Slab Width:  |              | Ft                           | Joint Length: |               | Ft           |          |
| Shoulder:            | Street Type:                   |         |                                 | Grade:       | 0            |                              | Lanes:        | 0             |              |          |
| Section Comments:    |                                |         |                                 |              |              |                              |               |               |              |          |
| Work Date:           | 9/1/2012                       |         | Work Type:                      |              |              | Subbase - Aggregate          |               | Code:         | SB-AG        |          |
|                      |                                |         |                                 |              |              |                              |               | Is Major M&R: | False        |          |
| Work Date:           | 9/2/2012                       |         | Work Type:                      |              |              | Base Course - Aggregate      |               | Code:         | BA-AG        |          |
|                      |                                |         |                                 |              |              |                              |               | Is Major M&R: | False        |          |
| Work Date:           | 9/3/2012                       |         | Work Type:                      |              |              | Complete Reconstruction - AC |               | Code:         | CR-AC        |          |
|                      |                                |         |                                 |              |              |                              |               | Is Major M&R: | True         |          |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                   | 2            |              | Surveyed:                    | 2             |               |              |          |
| Conditions:          | PCI:                           | 94      |                                 |              |              |                              |               |               |              |          |
| Inspection Comments: |                                |         |                                 |              |              |                              |               |               |              |          |
| Sample Number:       | 01                             | Type:   | R                               | Area:        | 3662.00 SqFt |                              | PCI:          | 94            |              |          |
| Sample Comments:     | Created by Inspection Schedule |         |                                 |              |              |                              |               |               |              |          |
| 57                   | WEATHERING                     |         | L                               | 3662.00 SqFt |              |                              |               |               |              |          |
| Sample Number:       | 02                             | Type:   | R                               | Area:        | 3730.00 SqFt |                              | PCI:          | 94            |              |          |
| Sample Comments:     | Created by Inspection Schedule |         |                                 |              |              |                              |               |               |              |          |
| 57                   | WEATHERING                     |         | L                               | 3730.00 SqFt |              |                              |               |               |              |          |

|                                                 |              |         |                                             |                 |                |             |           |        |               |               |       |
|-------------------------------------------------|--------------|---------|---------------------------------------------|-----------------|----------------|-------------|-----------|--------|---------------|---------------|-------|
| Network:                                        | Bend         |         |                                             | Name:           | Bend Municipal |             |           |        |               |               |       |
| Branch:                                         | T04BE        |         | Name:                                       | Taxiway 04 Bend |                | Use:        | TAXIWAY   | Area:  | 24,425 SqFt   |               |       |
| Section:                                        | 01           | of      | 2                                           | From:           | T03-01         |             | To:       | T04-02 | Last Const.:  | 9/2/1996      |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxiway_AC              | Zone:           | KBDN           |             | Category: | L      | Rank:         | S             |       |
| Area:                                           | 15,759 SqFt  |         | Length:                                     | 524 Ft          |                | Width:      | 30 Ft     |        |               |               |       |
| Slabs:                                          | Slab Length: |         | Ft                                          |                 | Slab Width:    |             | Ft        |        | Joint Length: | Ft            |       |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                 | 0              |             | Lanes:    |        | 0             |               |       |
| Section Comments:                               |              |         |                                             |                 |                |             |           |        |               |               |       |
| Work Date:                                      | 9/1/1996     |         | Work Type: Base Course - Unknown (Major MR) |                 |                |             | Code:     | BA-UN  |               | Is Major M&R: | True  |
| Work Date:                                      | 9/2/1996     |         | Work Type: New Construction - AC            |                 |                |             | Code:     | NC-AC  |               | Is Major M&R: | True  |
| Work Date:                                      | 9/3/1996     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2000     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  |               | Is Major M&R: | False |
| Work Date:                                      | 9/2/2000     |         | Work Type: Surface Seal - Fog Seal          |                 |                |             | Code:     | SS-FS  |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Seal - Wide Cracks         |                 |                |             | Code:     | CS-WD  |               | Is Major M&R: | False |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  |               | Is Major M&R: | False |
| Work Date:                                      | 9/2/2015     |         | Work Type: Patching - AC Full Depth         |                 |                |             | Code:     | PA-AF  |               | Is Major M&R: | False |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 3               |                | Surveyed: 2 |           |        |               |               |       |
| Conditions:                                     | PCI: 30      |         |                                             |                 |                |             |           |        |               |               |       |
| Inspection Comments:                            |              |         |                                             |                 |                |             |           |        |               |               |       |
| Sample Number:                                  | 01           | Type:   | R                                           | Area:           | 6004.00 SqFt   |             | PCI:      | 40     |               |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |             |           |        |               |               |       |
| 48                                              | L & T CR     |         | M                                           | 257.00          | Ft             |             |           |        |               |               |       |
| 50                                              | PATCHING     |         | L                                           | 14.00           | SqFt           |             |           |        |               |               |       |
| 48                                              | L & T CR     |         | L                                           | 135.00          | Ft             |             |           |        |               |               |       |
| 57                                              | WEATHERING   |         | M                                           | 6004.00         | SqFt           |             |           |        |               |               |       |
| 41                                              | ALLIGATOR CR |         | M                                           | 180.00          | SqFt           |             |           |        |               |               |       |
| 50                                              | PATCHING     |         | L                                           | 60.00           | SqFt           |             |           |        |               |               |       |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:           | 6014.00 SqFt   |             | PCI:      | 20     |               |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |             |           |        |               |               |       |
| 48                                              | L & T CR     |         | M                                           | 150.00          | Ft             |             |           |        |               |               |       |
| 50                                              | PATCHING     |         | L                                           | 45.00           | SqFt           |             |           |        |               |               |       |
| 50                                              | PATCHING     |         | L                                           | 61.00           | SqFt           |             |           |        |               |               |       |
| 41                                              | ALLIGATOR CR |         | H                                           | 120.00          | SqFt           |             |           |        |               |               |       |
| 41                                              | ALLIGATOR CR |         | M                                           | 800.00          | SqFt           |             |           |        |               |               |       |
| 57                                              | WEATHERING   |         | M                                           | 6014.00         | SqFt           |             |           |        |               |               |       |

|                                                        |                                                    |                             |                                                      |
|--------------------------------------------------------|----------------------------------------------------|-----------------------------|------------------------------------------------------|
| <b>Network:</b> Bend                                   |                                                    | <b>Name:</b> Bend Municipal |                                                      |
| <b>Branch:</b> T04BE                                   | <b>Name:</b> Taxiway 04 Bend                       | <b>Use:</b> TAXIWAY         | <b>Area:</b> 24,425 SqFt                             |
| <b>Section:</b> 02 of 2                                | <b>From:</b> T04-01                                | <b>To:</b> T06-01           | <b>Last Const.:</b> 9/2/1963                         |
| <b>Surface:</b> AC                                     | <b>Family:</b> 2022_Central_Cat1/2_Taxiway_AC      | <b>Zone:</b> KBDN           | <b>Category:</b> L<br><b>Rank:</b> S                 |
| <b>Area:</b> 8,666 SqFt                                | <b>Length:</b> 214 Ft                              | <b>Width:</b> 40 Ft         |                                                      |
| <b>Slabs:</b>                                          | <b>Slab Length:</b> Ft                             | <b>Slab Width:</b> Ft       | <b>Joint Length:</b> Ft                              |
| <b>Shoulder:</b>                                       | <b>Street Type:</b>                                | <b>Grade:</b> 0             | <b>Lanes:</b> 0                                      |
| <b>Section Comments:</b>                               |                                                    |                             |                                                      |
| <b>Work Date:</b> 9/1/1963                             | <b>Work Type:</b> Base Course - Unknown (Major MR) |                             | <b>Code:</b> BA-UN<br><b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b> 9/2/1963                             | <b>Work Type:</b> New Construction - AC            |                             | <b>Code:</b> NC-AC<br><b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b> 9/1/1995                             | <b>Work Type:</b> Crack Sealing - AC               |                             | <b>Code:</b> CS-AC<br><b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b> 3/1/2022                       | <b>TotalSamples:</b> 2                             | <b>Surveyed:</b> 2          |                                                      |
| <b>Conditions:</b> PCI: 41                             |                                                    |                             |                                                      |
| <b>Inspection Comments:</b>                            |                                                    |                             |                                                      |
| <b>Sample Number:</b> 01                               | <b>Type:</b> R                                     | <b>Area:</b> 4000.00 SqFt   | <b>PCI:</b> 29                                       |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                    |                             |                                                      |
| 41                                                     | ALLIGATOR CR                                       | M                           | 60.00 SqFt                                           |
| 57                                                     | WEATHERING                                         | L                           | 2000.00 SqFt                                         |
| 50                                                     | PATCHING                                           | L                           | 48.00 SqFt                                           |
| 48                                                     | L & T CR                                           | M                           | 200.00 Ft                                            |
| 48                                                     | L & T CR                                           | M                           | 62.00 Ft                                             |
| 48                                                     | L & T CR                                           | H                           | 25.00 Ft                                             |
| 41                                                     | ALLIGATOR CR                                       | M                           | 140.00 SqFt                                          |
| 57                                                     | WEATHERING                                         | M                           | 2000.00 SqFt                                         |
| <b>Sample Number:</b> 02                               | <b>Type:</b> R                                     | <b>Area:</b> 4666.00 SqFt   | <b>PCI:</b> 51                                       |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                    |                             |                                                      |
| 48                                                     | L & T CR                                           | L                           | 80.00 Ft                                             |
| 48                                                     | L & T CR                                           | M                           | 210.00 Ft                                            |
| 48                                                     | L & T CR                                           | H                           | 70.00 Ft                                             |
| 57                                                     | WEATHERING                                         | L                           | 2333.00 SqFt                                         |
| 50                                                     | PATCHING                                           | L                           | 210.00 SqFt                                          |
| 57                                                     | WEATHERING                                         | M                           | 2333.00 SqFt                                         |

|                                                 |              |         |                                             |                 |                |             |           |        |                       |
|-------------------------------------------------|--------------|---------|---------------------------------------------|-----------------|----------------|-------------|-----------|--------|-----------------------|
| Network:                                        | Bend         |         |                                             | Name:           | Bend Municipal |             |           |        |                       |
| Branch:                                         | T05BE        |         | Name:                                       | Taxiway 05 Bend |                | Use:        | TAXIWAY   | Area:  | 25,707 SqFt           |
| Section:                                        | 01           | of      | 2                                           | From:           | T03-01         |             | To:       | T05-02 | Last Const.: 9/2/1993 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxiway_AC              | Zone:           | KBDN           |             | Category: | L      | Rank: S               |
| Area:                                           | 24,436 SqFt  |         | Length:                                     | 778 Ft          |                | Width:      | 30 Ft     |        |                       |
| Slabs:                                          | Slab Length: |         | Ft                                          |                 | Slab Width:    |             | Ft        |        | Joint Length: Ft      |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                 | 0              |             | Lanes:    |        | 0                     |
| Section Comments:                               |              |         |                                             |                 |                |             |           |        |                       |
| Work Date:                                      | 9/1/1993     |         | Work Type: Base Course - Unknown (Major MR) |                 |                |             | Code:     | BA-UN  | Is Major M&R: True    |
| Work Date:                                      | 9/2/1993     |         | Work Type: New Construction - AC            |                 |                |             | Code:     | NC-AC  | Is Major M&R: True    |
| Work Date:                                      | 9/3/1993     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  | Is Major M&R: False   |
| Work Date:                                      | 9/1/2000     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  | Is Major M&R: False   |
| Work Date:                                      | 9/2/2000     |         | Work Type: Surface Seal - Fog Seal          |                 |                |             | Code:     | SS-FS  | Is Major M&R: False   |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  | Is Major M&R: False   |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Seal - Wide Cracks         |                 |                |             | Code:     | CS-WD  | Is Major M&R: False   |
| Work Date:                                      | 9/2/2008     |         | Work Type: Patching - AC Deep               |                 |                |             | Code:     | PA-AD  | Is Major M&R: False   |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  | Is Major M&R: False   |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC  | Is Major M&R: False   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 4               |                | Surveyed: 3 |           |        |                       |
| Conditions:                                     | PCI: 26      |         |                                             |                 |                |             |           |        |                       |
| Inspection Comments:                            |              |         |                                             |                 |                |             |           |        |                       |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:           | 6000.00 SqFt   |             | PCI:      | 39     |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |             |           |        |                       |
| 43                                              | BLOCK CR     | M       | 1300.00                                     | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 100.00                                      | SqFt            |                |             |           |        |                       |
| 41                                              | ALLIGATOR CR | M       | 200.00                                      | SqFt            |                |             |           |        |                       |
| 57                                              | WEATHERING   | M       | 6000.00                                     | SqFt            |                |             |           |        |                       |
| Sample Number:                                  | 03           | Type:   | R                                           | Area:           | 6000.00 SqFt   |             | PCI:      | 23     |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 114.00                                      | SqFt            |                |             |           |        |                       |
| 48                                              | L & T CR     | M       | 58.00                                       | Ft              |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 1200.00                                     | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 30.00                                       | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | M       | 40.00                                       | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | M       | 56.00                                       | SqFt            |                |             |           |        |                       |
| 41                                              | ALLIGATOR CR | M       | 650.00                                      | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 35.00                                       | SqFt            |                |             |           |        |                       |
| 57                                              | WEATHERING   | M       | 6000.00                                     | SqFt            |                |             |           |        |                       |
| 48                                              | L & T CR     | M       | 42.00                                       | Ft              |                |             |           |        |                       |
| Sample Number:                                  | 04           | Type:   | R                                           | Area:           | 6340.00 SqFt   |             | PCI:      | 17     |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |             |           |        |                       |
| 57                                              | WEATHERING   | M       | 6340.00                                     | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 600.00                                      | SqFt            |                |             |           |        |                       |
| 43                                              | BLOCK CR     | M       | 75.00                                       | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | L       | 215.00                                      | SqFt            |                |             |           |        |                       |
| 50                                              | PATCHING     | M       | 220.00                                      | SqFt            |                |             |           |        |                       |
| 41                                              | ALLIGATOR CR | M       | 60.00                                       | SqFt            |                |             |           |        |                       |
| 41                                              | ALLIGATOR CR | M       | 962.00                                      | SqFt            |                |             |           |        |                       |

|                             |                                |                |                                                    |                 |                    |                  |              |                      |             |                          |          |
|-----------------------------|--------------------------------|----------------|----------------------------------------------------|-----------------|--------------------|------------------|--------------|----------------------|-------------|--------------------------|----------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                       | Bend Municipal  |                    |                  |              |                      |             |                          |          |
| <b>Branch:</b>              | T05BE                          |                | <b>Name:</b>                                       | Taxiway 05 Bend |                    | <b>Use:</b>      | TAXIWAY      | <b>Area:</b>         | 25,707 SqFt |                          |          |
| <b>Section:</b>             | 02                             | of 2           | <b>From:</b>                                       | T05-01          |                    |                  | <b>To:</b>   | T06-02               |             | <b>Last Const.:</b>      | 9/2/1999 |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxiway_AC                     |                 | <b>Zone:</b>       | KBDN             |              | <b>Category:</b>     | L           | <b>Rank:</b>             | S        |
| <b>Area:</b>                | 1,271 SqFt                     |                | <b>Length:</b>                                     | 20 Ft           |                    | <b>Width:</b>    | 55 Ft        |                      |             |                          |          |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                 |                 | <b>Slab Width:</b> | Ft               |              | <b>Joint Length:</b> | Ft          |                          |          |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                    |                 | <b>Grade:</b>      | 0                |              | <b>Lanes:</b>        | 0           |                          |          |
| <b>Section Comments:</b>    |                                |                |                                                    |                 |                    |                  |              |                      |             |                          |          |
| <b>Work Date:</b>           | 9/1/1999                       |                | <b>Work Type:</b> Base Course - Unknown (Major MR) |                 |                    |                  | <b>Code:</b> | BA-UN                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/2/1999                       |                | <b>Work Type:</b> New Construction - AC            |                 |                    |                  | <b>Code:</b> | NC-AC                |             | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/1/2008                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC                |             | <b>Is Major M&amp;R:</b> | False    |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                               | 1               |                    | <b>Surveyed:</b> | 1            |                      |             |                          |          |
| <b>Conditions:</b>          | <b>PCI:</b> 65                 |                |                                                    |                 |                    |                  |              |                      |             |                          |          |
| <b>Inspection Comments:</b> |                                |                |                                                    |                 |                    |                  |              |                      |             |                          |          |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 1271.00 SqFt       |                  | <b>PCI:</b>  | 65                   |             |                          |          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                 |                    |                  |              |                      |             |                          |          |
| 50                          | PATCHING                       |                | L                                                  | 280.00          | SqFt               |                  |              |                      |             |                          |          |
| 48                          | L & T CR                       |                | M                                                  | 30.00           | Ft                 |                  |              |                      |             |                          |          |
| 57                          | WEATHERING                     |                | M                                                  | 1271.00         | SqFt               |                  |              |                      |             |                          |          |

|                      |              |                                |                                |                                  |              |           |         |               |             |  |               |          |
|----------------------|--------------|--------------------------------|--------------------------------|----------------------------------|--------------|-----------|---------|---------------|-------------|--|---------------|----------|
| Network:             | Bend         |                                | Name:                          | Bend Municipal                   |              |           |         |               |             |  |               |          |
| Branch:              | T06BE        |                                | Name:                          | Taxiway 06 Bend                  |              | Use:      | TAXIWAY | Area:         | 10,290 SqFt |  |               |          |
| Section:             | 01           | of                             | 2                              | From:                            | TA-02        |           |         | To:           | T06-02      |  | Last Const.:  | 9/3/2012 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxiway_AC |                                  | Zone:        | KBDN      |         | Category:     | L           |  | Rank:         | P        |
| Area:                | 2,250 SqFt   |                                | Length:                        | 45 Ft                            |              | Width:    | 50 Ft   |               |             |  |               |          |
| Slabs:               | Slab Length: |                                | Ft                             |                                  | Slab Width:  | Ft        |         | Joint Length: | Ft          |  |               |          |
| Shoulder:            | Street Type: |                                | Grade:                         |                                  | 0            |           | Lanes:  | 0             |             |  |               |          |
| Section Comments:    |              |                                |                                |                                  |              |           |         |               |             |  |               |          |
| Work Date:           | 9/1/1955     |                                | Work Type:                     | Base Course - Cinders (Major MR) |              |           |         | Code:         | BA-CI       |  | Is Major M&R: | True     |
| Work Date:           | 9/2/1955     |                                | Work Type:                     | New Construction - AC            |              |           |         | Code:         | NC-AC       |  | Is Major M&R: | True     |
| Work Date:           | 9/1/1995     |                                | Work Type:                     | Crack Sealing - AC               |              |           |         | Code:         | CS-AC       |  | Is Major M&R: | False    |
| Work Date:           | 9/1/2012     |                                | Work Type:                     | Subbase - Aggregate              |              |           |         | Code:         | SB-AG       |  | Is Major M&R: | False    |
| Work Date:           | 9/2/2012     |                                | Work Type:                     | Base Course - Aggregate          |              |           |         | Code:         | BA-AG       |  | Is Major M&R: | False    |
| Work Date:           | 9/3/2012     |                                | Work Type:                     | Complete Reconstruction - AC     |              |           |         | Code:         | CR-AC       |  | Is Major M&R: | True     |
| Work Date:           | 7/1/2018     |                                | Work Type:                     | Crack Sealing - AC               |              |           |         | Code:         | CS-AC       |  | Is Major M&R: | False    |
| Work Date:           | 7/2/2018     |                                | Work Type:                     | Surface Seal - Fog Seal          |              |           |         | Code:         | SS-FS       |  | Is Major M&R: | False    |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                  | 1                                |              | Surveyed: | 1       |               |             |  |               |          |
| Conditions:          | PCI:         | 79                             |                                |                                  |              |           |         |               |             |  |               |          |
| Inspection Comments: |              |                                |                                |                                  |              |           |         |               |             |  |               |          |
| Sample Number:       | 01           | Type:                          | R                              | Area:                            | 5370.00 SqFt |           |         | PCI:          | 79          |  |               |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                |                                  |              |           |         |               |             |  |               |          |
| 57                   | WEATHERING   | L                              | 5200.00 SqFt                   |                                  |              |           |         |               |             |  |               |          |
| 57                   | WEATHERING   | M                              | 170.00 SqFt                    |                                  |              |           |         |               |             |  |               |          |
| 48                   | L & T CR     | M                              | 15.00 Ft                       |                                  |              |           |         |               |             |  |               |          |
| 48                   | L & T CR     | M                              | 65.00 Ft                       |                                  |              |           |         |               |             |  |               |          |

|                                                 |            |         |                                |                 |                                  |             |           |           |               |              |               |       |
|-------------------------------------------------|------------|---------|--------------------------------|-----------------|----------------------------------|-------------|-----------|-----------|---------------|--------------|---------------|-------|
| Network:                                        | Bend       |         |                                | Name:           | Bend Municipal                   |             |           |           |               |              |               |       |
| Branch:                                         | T06BE      |         | Name:                          | Taxiway 06 Bend |                                  | Use:        | TAXIWAY   | Area:     | 10,290 SqFt   |              |               |       |
| Section:                                        | 02         | of      | 2                              | From:           | T06-01                           |             | To:       | A01-01    |               | Last Const.: | 9/2/1999      |       |
| Surface:                                        | AC         | Family: | 2022_Central_Cat1/2_Taxiway_AC |                 | Zone:                            | KBDN        |           | Category: | L             |              | Rank:         | P     |
| Area:                                           | 8,040 SqFt |         | Length:                        | 220 Ft          |                                  | Width:      | 35 Ft     |           |               |              |               |       |
| Slabs:                                          |            |         | Slab Length:                   | Ft              |                                  | Slab Width: | Ft        |           | Joint Length: | Ft           |               |       |
| Shoulder:                                       |            |         | Street Type:                   |                 |                                  | Grade:      | 0         |           | Lanes:        | 0            |               |       |
| Section Comments:                               |            |         |                                |                 |                                  |             |           |           |               |              |               |       |
| Work Date:                                      | 9/1/1999   |         |                                | Work Type:      | Base Course - Unknown (Major MR) |             |           | Code:     | BA-UN         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/2/1999   |         |                                | Work Type:      | New Construction - AC            |             |           | Code:     | NC-AC         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2008   |         |                                | Work Type:      | Crack Sealing - AC               |             |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2012   |         |                                | Work Type:      | Crack Sealing - AC               |             |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2015   |         |                                | Work Type:      | Crack Sealing - AC               |             |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 7/1/2018   |         |                                | Work Type:      | Crack Sealing - AC               |             |           | Code:     | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 7/2/2018   |         |                                | Work Type:      | Surface Seal - Fog Seal          |             |           | Code:     | SS-FS         |              | Is Major M&R: | False |
| Last Insp. Date:                                | 3/1/2022   |         |                                | TotalSamples:   | 1                                |             | Surveyed: | 1         |               |              |               |       |
| Conditions:                                     | PCI:       | 63      |                                |                 |                                  |             |           |           |               |              |               |       |
| Inspection Comments:                            |            |         |                                |                 |                                  |             |           |           |               |              |               |       |
| Sample Number:                                  | 01         | Type:   | R                              | Area:           | 4897.00 SqFt                     |             | PCI:      | 63        |               |              |               |       |
| Sample Comments: Created by Inspection Schedule |            |         |                                |                 |                                  |             |           |           |               |              |               |       |
| 48                                              | L & T CR   |         | L                              | 90.00 Ft        |                                  |             |           |           |               |              |               |       |
| 57                                              | WEATHERING |         | M                              | 4897.00 SqFt    |                                  |             |           |           |               |              |               |       |
| 48                                              | L & T CR   |         | M                              | 200.00 Ft       |                                  |             |           |           |               |              |               |       |
| 48                                              | L & T CR   |         | M                              | 80.00 Ft        |                                  |             |           |           |               |              |               |       |

|                                                 |              |         |                                 |                                  |              |           |           |               |             |              |               |       |
|-------------------------------------------------|--------------|---------|---------------------------------|----------------------------------|--------------|-----------|-----------|---------------|-------------|--------------|---------------|-------|
| Network:                                        | Bend         |         | Name:                           | Bend Municipal                   |              |           |           |               |             |              |               |       |
| Branch:                                         | T07BE        |         | Name:                           | Taxiway 07 Bend                  |              | Use:      | TAXIWAY   | Area:         | 18,058 SqFt |              |               |       |
| Section:                                        | 02           | of 3    | From:                           | T12BE-01                         |              |           | To:       | T12BE-03      |             | Last Const.: | 7/3/2018      |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC |                                  | Zone:        | KBDN      | Category: | L             |             | Rank:        | P             |       |
| Area:                                           | 6,156 SqFt   |         | Length:                         | 170 Ft                           |              | Width:    | 40 Ft     |               |             |              |               |       |
| Slabs:                                          | Slab Length: |         | Ft                              |                                  | Slab Width:  | Ft        |           | Joint Length: | Ft          |              |               |       |
| Shoulder:                                       | Street Type: |         | Grade:                          |                                  | 0            |           | Lanes:    | 0             |             |              |               |       |
| Section Comments:                               |              |         |                                 |                                  |              |           |           |               |             |              |               |       |
| Work Date:                                      | 9/1/1999     |         | Work Type:                      | Base Course - Unknown (Major MR) |              |           |           | Code:         | BA-UN       |              | Is Major M&R: | True  |
| Work Date:                                      | 9/2/1999     |         | Work Type:                      | New Construction - AC            |              |           |           | Code:         | NC-AC       |              | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2004     |         | Work Type:                      | Crack Sealing - AC               |              |           |           | Code:         | CS-AC       |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2008     |         | Work Type:                      | Crack Seal - Wide Cracks         |              |           |           | Code:         | CS-WD       |              | Is Major M&R: | False |
| Work Date:                                      | 7/1/2018     |         | Work Type:                      | Subbase - Aggregate              |              |           |           | Code:         | SB-AG       |              | Is Major M&R: | False |
| Work Date:                                      | 7/2/2018     |         | Work Type:                      | Base Course - Aggregate          |              |           |           | Code:         | BA-AG       |              | Is Major M&R: | False |
| Work Date:                                      | 7/3/2018     |         | Work Type:                      | Complete Reconstruction - AC     |              |           |           | Code:         | CR-AC       |              | Is Major M&R: | True  |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                   | 1                                |              | Surveyed: | 1         |               |             |              |               |       |
| Conditions:                                     | PCI:         | 90      |                                 |                                  |              |           |           |               |             |              |               |       |
| Inspection Comments:                            |              |         |                                 |                                  |              |           |           |               |             |              |               |       |
| Sample Number:                                  | 01           | Type:   | R                               | Area:                            | 6156.00 SqFt |           | PCI:      | 90            |             |              |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                 |                                  |              |           |           |               |             |              |               |       |
| 57                                              | WEATHERING   |         | L                               | 6156.00 SqFt                     |              |           |           |               |             |              |               |       |
| 48                                              | L & T CR     |         | L                               | 20.00 Ft                         |              |           |           |               |             |              |               |       |

|                                                 |              |         |                                             |                 |                |           |           |               |                       |
|-------------------------------------------------|--------------|---------|---------------------------------------------|-----------------|----------------|-----------|-----------|---------------|-----------------------|
| Network:                                        | Bend         |         |                                             | Name:           | Bend Municipal |           |           |               |                       |
| Branch:                                         | T07BE        |         | Name:                                       | Taxiway 07 Bend |                | Use:      | TAXIWAY   | Area:         | 18,058 SqFt           |
| Section:                                        | 03           | of      | 3                                           | From:           | T12-02         |           | To:       | End           | Last Const.: 9/2/1961 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxiway_AC              | Zone:           | KBDN           |           | Category: | L             | Rank: S               |
| Area:                                           | 7,570 SqFt   |         | Length:                                     | 190 Ft          |                | Width:    | 40 Ft     |               |                       |
| Slabs:                                          | Slab Length: |         | Ft                                          |                 | Slab Width:    | Ft        |           | Joint Length: | Ft                    |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                 | 0              |           | Lanes:    | 0             |                       |
| Section Comments:                               |              |         |                                             |                 |                |           |           |               |                       |
| Work Date:                                      | 9/1/1961     |         | Work Type: Base Course - Unknown (Major MR) |                 |                |           | Code:     | BA-UN         |                       |
| Work Date:                                      | 9/2/1961     |         | Work Type: New Construction - AC            |                 |                |           | Code:     | NC-AC         |                       |
| Work Date:                                      | 9/1/2000     |         | Work Type: Crack Sealing - AC               |                 |                |           | Code:     | CS-AC         |                       |
| Work Date:                                      | 9/2/2000     |         | Work Type: Surface Seal - Fog Seal          |                 |                |           | Code:     | SS-FS         |                       |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                 |                |           | Code:     | CS-AC         |                       |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Sealing - AC               |                 |                |           | Code:     | CS-AC         |                       |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |                 |                |           | Code:     | CS-AC         |                       |
| Work Date:                                      | 9/2/2012     |         | Work Type: Patching - AC Deep               |                 |                |           | Code:     | PA-AD         |                       |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 2               |                | Surveyed: | 2         |               |                       |
| Conditions:                                     | PCI: 21      |         |                                             |                 |                |           |           |               |                       |
| Inspection Comments:                            |              |         |                                             |                 |                |           |           |               |                       |
| Sample Number:                                  | 01           | Type:   | R                                           | Area:           | 3570.00 SqFt   |           | PCI:      | 19            |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |           |           |               |                       |
| 48                                              | L & T CR     |         | M                                           | 230.00          | SqFt           |           |           |               |                       |
| 50                                              | PATCHING     |         | M                                           | 44.00           | SqFt           |           |           |               |                       |
| 41                                              | ALLIGATOR CR |         | H                                           | 52.00           | SqFt           |           |           |               |                       |
| 41                                              | ALLIGATOR CR |         | M                                           | 320.00          | SqFt           |           |           |               |                       |
| 57                                              | WEATHERING   |         | M                                           | 3570.00         | SqFt           |           |           |               |                       |
| 50                                              | PATCHING     |         | L                                           | 140.00          | SqFt           |           |           |               |                       |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:           | 4000.00 SqFt   |           | PCI:      | 24            |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |           |           |               |                       |
| 50                                              | PATCHING     |         | M                                           | 43.00           | SqFt           |           |           |               |                       |
| 57                                              | WEATHERING   |         | M                                           | 4000.00         | SqFt           |           |           |               |                       |
| 41                                              | ALLIGATOR CR |         | H                                           | 75.00           | SqFt           |           |           |               |                       |
| 50                                              | PATCHING     |         | M                                           | 208.00          | SqFt           |           |           |               |                       |
| 41                                              | ALLIGATOR CR |         | M                                           | 228.00          | SqFt           |           |           |               |                       |
| 50                                              | PATCHING     |         | M                                           | 46.00           | SqFt           |           |           |               |                       |
| 50                                              | PATCHING     |         | L                                           | 144.00          | SqFt           |           |           |               |                       |

|                      |              |                                |                                |                 |              |                |                              |               |             |              |          |               |       |
|----------------------|--------------|--------------------------------|--------------------------------|-----------------|--------------|----------------|------------------------------|---------------|-------------|--------------|----------|---------------|-------|
| Network:             |              | Bend                           |                                | Name:           |              | Bend Municipal |                              |               |             |              |          |               |       |
| Branch:              | T07BE        |                                | Name:                          | Taxiway 07 Bend |              | Use:           | TAXIWAY                      | Area:         | 18,058 SqFt |              |          |               |       |
| Section:             | 01           | of 3                           |                                | From:           | TABE-01      |                | To:                          | T12BE-02      |             | Last Const.: | 9/3/2012 |               |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxiway_AC |                 | Zone:        | KBDN           |                              | Category:     | L           |              | Rank:    | P             |       |
| Area:                | 4,332 SqFt   |                                | Length:                        | 87 Ft           |              | Width:         | 40 Ft                        |               |             |              |          |               |       |
| Slabs:               | Slab Length: |                                | Ft                             |                 | Slab Width:  | Ft             |                              | Joint Length: | Ft          |              |          |               |       |
| Shoulder:            | Street Type: |                                |                                |                 | Grade:       | 0              |                              | Lanes:        | 0           |              |          |               |       |
| Section Comments:    |              |                                |                                |                 |              |                |                              |               |             |              |          |               |       |
| Work Date:           | 9/1/2012     |                                | Work Type:                     |                 |              |                | Subbase - Aggregate          |               | Code:       | SB-AG        |          | Is Major M&R: | False |
| Work Date:           | 9/2/2012     |                                | Work Type:                     |                 |              |                | Base Course - Aggregate      |               | Code:       | BA-AG        |          | Is Major M&R: | False |
| Work Date:           | 9/3/2012     |                                | Work Type:                     |                 |              |                | Complete Reconstruction - AC |               | Code:       | CR-AC        |          | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                  | 1               |              | Surveyed:      | 1                            |               |             |              |          |               |       |
| Conditions:          | PCI: 86      |                                |                                |                 |              |                |                              |               |             |              |          |               |       |
| Inspection Comments: |              |                                |                                |                 |              |                |                              |               |             |              |          |               |       |
| Sample Number:       | 01           | Type:                          | R                              | Area:           | 4332.00 SqFt |                | PCI:                         | 86            |             |              |          |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                |                 |              |                |                              |               |             |              |          |               |       |
| 57                   | WEATHERING   |                                | M                              | 110.00 SqFt     |              |                |                              |               |             |              |          |               |       |
| 48                   | L & T CR     |                                | L                              | 70.00 Ft        |              |                |                              |               |             |              |          |               |       |
| 57                   | WEATHERING   |                                | L                              | 4222.00 SqFt    |              |                |                              |               |             |              |          |               |       |

|                                                        |                                                    |                             |                                                      |
|--------------------------------------------------------|----------------------------------------------------|-----------------------------|------------------------------------------------------|
| <b>Network:</b> Bend                                   |                                                    | <b>Name:</b> Bend Municipal |                                                      |
| <b>Branch:</b> T08BE                                   | <b>Name:</b> Taxiway 08 Bend                       | <b>Use:</b> TAXIWAY         | <b>Area:</b> 17,039 SqFt                             |
| <b>Section:</b> 01 of 1                                | <b>From:</b> T17-01                                | <b>To:</b> T15-01           | <b>Last Const.:</b> 9/2/1999                         |
| <b>Surface:</b> AC                                     | <b>Family:</b> 2022_Central_Cat1/2_Taxiway_AC      | <b>Zone:</b> KBDN           | <b>Category:</b> L<br><b>Rank:</b> S                 |
| <b>Area:</b> 17,039 SqFt                               | <b>Length:</b> 635 Ft                              | <b>Width:</b> 25 Ft         |                                                      |
| <b>Slabs:</b>                                          | <b>Slab Length:</b> Ft                             | <b>Slab Width:</b> Ft       | <b>Joint Length:</b> Ft                              |
| <b>Shoulder:</b>                                       | <b>Street Type:</b>                                | <b>Grade:</b> 0             | <b>Lanes:</b> 0                                      |
| <b>Section Comments:</b>                               |                                                    |                             |                                                      |
| <b>Work Date:</b> 9/1/1999                             | <b>Work Type:</b> Base Course - Unknown (Major MR) |                             | <b>Code:</b> BA-UN<br><b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b> 9/2/1999                             | <b>Work Type:</b> New Construction - AC            |                             | <b>Code:</b> NC-AC<br><b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b> 9/1/2008                             | <b>Work Type:</b> Crack Sealing - AC               |                             | <b>Code:</b> CS-AC<br><b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b> 9/1/2012                             | <b>Work Type:</b> Crack Sealing - AC               |                             | <b>Code:</b> CS-AC<br><b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b> 9/1/2015                             | <b>Work Type:</b> Crack Sealing - AC               |                             | <b>Code:</b> CS-AC<br><b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b> 3/1/2022                       | <b>TotalSamples:</b> 3                             | <b>Surveyed:</b> 2          |                                                      |
| <b>Conditions:</b> PCI: 64                             |                                                    |                             |                                                      |
| <b>Inspection Comments:</b>                            |                                                    |                             |                                                      |
| <b>Sample Number:</b> 01                               | <b>Type:</b> R                                     | <b>Area:</b> 5477.00 SqFt   | <b>PCI:</b> 56                                       |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                    |                             |                                                      |
| 57                                                     | WEATHERING                                         | M                           | 5477.00 SqFt                                         |
| 48                                                     | L & T CR                                           | L                           | 300.00 Ft                                            |
| 48                                                     | L & T CR                                           | L                           | 250.00 Ft                                            |
| 48                                                     | L & T CR                                           | M                           | 309.00 Ft                                            |
| <b>Sample Number:</b> 02                               | <b>Type:</b> R                                     | <b>Area:</b> 5000.00 SqFt   | <b>PCI:</b> 72                                       |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                                    |                             |                                                      |
| 48                                                     | L & T CR                                           | M                           | 66.00 Ft                                             |
| 48                                                     | L & T CR                                           | M                           | 85.00 Ft                                             |
| 48                                                     | L & T CR                                           | L                           | 200.00 Ft                                            |
| 48                                                     | L & T CR                                           | L                           | 200.00 Ft                                            |
| 48                                                     | L & T CR                                           | L                           | 100.00 Ft                                            |

|                      |  |              |  |                                |  |                                |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
|----------------------|--|--------------|--|--------------------------------|--|--------------------------------|--|---------------|--|---------------|--|-----------------------|--|------------|--|--------------|--|----------|--|---------------|--|-------|--|
| Network:             |  | Bend         |  | Name:                          |  | Bend Municipal                 |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| Branch:              |  | T09BE        |  | Name:                          |  | Taxiway 09 Bend                |  | Use:          |  | TAXIWAY       |  | Area:                 |  | 1,216 SqFt |  |              |  |          |  |               |  |       |  |
| Section:             |  | 01           |  | of                             |  | 1                              |  | From:         |  | A07BE         |  | To:                   |  | T17BE      |  | Last Const.: |  | 9/1/2005 |  |               |  |       |  |
| Surface:             |  | AC           |  | Family:                        |  | 2022_Central_Cat1/2_Taxiway_AC |  | Zone:         |  | KBDN          |  | Category:             |  | L          |  | Rank:        |  | S        |  |               |  |       |  |
| Area:                |  | 1,216 SqFt   |  | Length:                        |  | 40 Ft                          |  | Width:        |  | 30 Ft         |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| Slabs:               |  | Slab Length: |  | Ft                             |  | Slab Width:                    |  | Ft            |  | Joint Length: |  | Ft                    |  |            |  |              |  |          |  |               |  |       |  |
| Shoulder:            |  | Street Type: |  | Grade:                         |  | 0                              |  | Lanes:        |  | 0             |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| Section Comments:    |  |              |  |                                |  |                                |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| Work Date:           |  |              |  | 9/1/2005                       |  |                                |  | Work Type:    |  |               |  | New Construction - AC |  |            |  | Code:        |  | NC-AC    |  | Is Major M&R: |  | True  |  |
| Work Date:           |  |              |  | 9/1/2015                       |  |                                |  | Work Type:    |  |               |  | Crack Sealing - AC    |  |            |  | Code:        |  | CS-AC    |  | Is Major M&R: |  | False |  |
| Last Insp. Date:     |  |              |  | 3/1/2022                       |  |                                |  | TotalSamples: |  |               |  | 1                     |  |            |  | Surveyed:    |  |          |  | 1             |  |       |  |
| Conditions:          |  |              |  | PCI:                           |  |                                |  | 57            |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| Inspection Comments: |  |              |  |                                |  |                                |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| Sample Number:       |  | 01           |  | Type:                          |  | R                              |  | Area:         |  | 1216.00 SqFt  |  | PCI:                  |  | 57         |  |              |  |          |  |               |  |       |  |
| Sample Comments:     |  |              |  | Created by Inspection Schedule |  |                                |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| 48                   |  | L & T CR     |  | M                              |  | 64.00 Ft                       |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| 57                   |  | WEATHERING   |  | M                              |  | 1216.00 SqFt                   |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |
| 48                   |  | L & T CR     |  | M                              |  | 65.00 Ft                       |  |               |  |               |  |                       |  |            |  |              |  |          |  |               |  |       |  |

|                                                 |              |      |                                             |                                |             |                |              |               |              |               |       |
|-------------------------------------------------|--------------|------|---------------------------------------------|--------------------------------|-------------|----------------|--------------|---------------|--------------|---------------|-------|
| Network:                                        |              | Bend |                                             | Name:                          |             | Bend Municipal |              |               |              |               |       |
| Branch:                                         | T10BE        |      | Name:                                       | Taxiway 10 Bend                |             | Use:           | TAXIWAY      | Area:         | 3,909 SqFt   |               |       |
| Section:                                        | 02 of 2      |      | From:                                       | T19BE-01                       |             | To:            | A06BE        |               | Last Const.: | 9/2/1999      |       |
| Surface:                                        | AC           |      | Family:                                     | 2022_Central_Cat1/2_Taxiway_AC |             | Zone:          | KBDN         |               | Category:    | L Rank: S     |       |
| Area:                                           | 1,060 SqFt   |      | Length:                                     | 40 Ft                          |             | Width:         | 25 Ft        |               |              |               |       |
| Slabs:                                          | Slab Length: |      | Ft                                          |                                | Slab Width: | Ft             |              | Joint Length: | Ft           |               |       |
| Shoulder:                                       | Street Type: |      | Grade:                                      |                                | 0           |                | Lanes:       | 0             |              |               |       |
| Section Comments:                               |              |      |                                             |                                |             |                |              |               |              |               |       |
| Work Date:                                      | 9/1/1999     |      | Work Type: Base Course - Unknown (Major MR) |                                |             |                | Code:        | BA-UN         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/2/1999     |      | Work Type: New Construction - AC            |                                |             |                | Code:        | NC-AC         |              | Is Major M&R: | True  |
| Work Date:                                      | 9/1/2004     |      | Work Type: Crack Sealing - AC               |                                |             |                | Code:        | CS-AC         |              | Is Major M&R: | False |
| Work Date:                                      | 9/1/2015     |      | Work Type: Crack Sealing - AC               |                                |             |                | Code:        | CS-AC         |              | Is Major M&R: | False |
| Last Insp. Date:                                | 3/1/2022     |      | TotalSamples:                               | 1                              |             | Surveyed:      | 1            |               |              |               |       |
| Conditions:                                     | PCI: 90      |      |                                             |                                |             |                |              |               |              |               |       |
| Inspection Comments:                            |              |      |                                             |                                |             |                |              |               |              |               |       |
| Sample Number:                                  | 01           |      | Type:                                       | R                              |             | Area:          | 1060.00 SqFt |               | PCI:         | 90            |       |
| Sample Comments: Created by Inspection Schedule |              |      |                                             |                                |             |                |              |               |              |               |       |
| 48                                              | L & T CR     |      | L                                           | 8.00 Ft                        |             |                |              |               |              |               |       |
| 57                                              | WEATHERING   |      | L                                           | 1060.00 SqFt                   |             |                |              |               |              |               |       |

|                                                 |              |         |                                 |                              |             |              |         |               |            |  |               |          |
|-------------------------------------------------|--------------|---------|---------------------------------|------------------------------|-------------|--------------|---------|---------------|------------|--|---------------|----------|
| Network:                                        | Bend         |         | Name:                           | Bend Municipal               |             |              |         |               |            |  |               |          |
| Branch:                                         | T10BE        |         | Name:                           | Taxiway 10 Bend              |             | Use:         | TAXIWAY | Area:         | 3,909 SqFt |  |               |          |
| Section:                                        | 01           | of      | 2                               | From:                        | TABE-01     |              |         | To:           | T19BE-02   |  | Last Const.:  | 9/3/2012 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC |                              | Zone:       | KBDN         |         | Category:     | L          |  | Rank:         | S        |
| Area:                                           | 2,849 SqFt   |         | Length:                         | 72 Ft                        |             | Width:       | 25 Ft   |               |            |  |               |          |
| Slabs:                                          | Slab Length: |         | Ft                              |                              | Slab Width: | Ft           |         | Joint Length: | Ft         |  |               |          |
| Shoulder:                                       | Street Type: |         | Grade:                          |                              | 0           |              | Lanes:  | 0             |            |  |               |          |
| Section Comments:                               |              |         |                                 |                              |             |              |         |               |            |  |               |          |
| Work Date:                                      | 9/1/2012     |         | Work Type:                      | Subbase - Aggregate          |             |              |         | Code:         | SB-AG      |  | Is Major M&R: | False    |
| Work Date:                                      | 9/2/2012     |         | Work Type:                      | Base Course - Aggregate      |             |              |         | Code:         | BA-AG      |  | Is Major M&R: | False    |
| Work Date:                                      | 9/3/2012     |         | Work Type:                      | Complete Reconstruction - AC |             |              |         | Code:         | CR-AC      |  | Is Major M&R: | True     |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                   | 1                            |             | Surveyed:    | 1       |               |            |  |               |          |
| Conditions:                                     | PCI:         | 91      |                                 |                              |             |              |         |               |            |  |               |          |
| Inspection Comments:                            |              |         |                                 |                              |             |              |         |               |            |  |               |          |
| Sample Number:                                  | 01           | Type:   | R                               |                              | Area:       | 2849.00 SqFt |         | PCI:          | 91         |  |               |          |
| Sample Comments: Created by Inspection Schedule |              |         |                                 |                              |             |              |         |               |            |  |               |          |
| 48                                              | L & T CR     |         | L                               | 8.00 Ft                      |             |              |         |               |            |  |               |          |
| 57                                              | WEATHERING   |         | L                               | 2849.00 SqFt                 |             |              |         |               |            |  |               |          |

|                      |                                |         |                                |                              |              |           |        |               |          |       |               |       |
|----------------------|--------------------------------|---------|--------------------------------|------------------------------|--------------|-----------|--------|---------------|----------|-------|---------------|-------|
| Network:             | Bend                           |         | Name:                          | Bend Municipal               |              |           |        |               |          |       |               |       |
| Branch:              | T11BE                          | Name:   | Taxiway 11 Bend                |                              | Use:         | TAXIWAY   | Area:  | 2,611 SqFt    |          |       |               |       |
| Section:             | 01                             | of 1    | From:                          | TABE-03                      |              | To:       | A08BE  | Last Const.:  | 9/3/2012 |       |               |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxiway_AC |                              | Zone:        | KBDN      |        | Category:     | L        | Rank: | S             |       |
| Area:                | 2,611 SqFt                     |         | Length:                        | 60 Ft                        |              | Width:    | 30 Ft  |               |          |       |               |       |
| Slabs:               | Slab Length:                   |         | Ft                             |                              | Slab Width:  | Ft        |        | Joint Length: | Ft       |       |               |       |
| Shoulder:            | Street Type:                   |         | Grade:                         |                              | 0            |           | Lanes: | 0             |          |       |               |       |
| Section Comments:    |                                |         |                                |                              |              |           |        |               |          |       |               |       |
| Work Date:           | 9/1/2005                       |         | Work Type:                     | New Construction - AC        |              |           |        | Code:         | NC-AC    |       | Is Major M&R: | True  |
| Work Date:           | 9/1/2012                       |         | Work Type:                     | Subbase - Aggregate          |              |           |        | Code:         | SB-AG    |       | Is Major M&R: | False |
| Work Date:           | 9/2/2012                       |         | Work Type:                     | Base Course - Aggregate      |              |           |        | Code:         | BA-AG    |       | Is Major M&R: | False |
| Work Date:           | 9/3/2012                       |         | Work Type:                     | Complete Reconstruction - AC |              |           |        | Code:         | CR-AC    |       | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                  | 1                            |              | Surveyed: | 1      |               |          |       |               |       |
| Conditions:          | PCI: 94                        |         |                                |                              |              |           |        |               |          |       |               |       |
| Inspection Comments: |                                |         |                                |                              |              |           |        |               |          |       |               |       |
| Sample Number:       | 01                             | Type:   | R                              | Area:                        | 2611.00 SqFt |           | PCI:   | 94            |          |       |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                |                              |              |           |        |               |          |       |               |       |
| 57                   | WEATHERING                     |         | L                              | 2611.00 SqFt                 |              |           |        |               |          |       |               |       |

|                      |                                |      |               |                                 |  |                |               |       |               |          |               |           |   |
|----------------------|--------------------------------|------|---------------|---------------------------------|--|----------------|---------------|-------|---------------|----------|---------------|-----------|---|
| Network:             |                                | Bend |               | Name:                           |  | Bend Municipal |               |       |               |          |               |           |   |
| Branch:              | TA1BE                          |      | Name:         | Taxiway A1 Bend                 |  | Use:           | TAXIWAY       | Area: | 14,715 SqFt   |          |               |           |   |
| Section:             | 01                             |      | of            | 2                               |  | From:          | Runway 34 End |       | To:           | TA1BE-02 | Last Const.:  | 10/3/2006 |   |
| Surface:             | AC                             |      | Family:       | 2022_Central_Cat1/2_Taxiway_AC  |  | Zone:          | KBDN          |       | Category:     | L        |               | Rank:     | P |
| Area:                | 12,685 SqFt                    |      | Length:       | 210 Ft                          |  | Width:         | 35 Ft         |       |               |          |               |           |   |
| Slabs:               |                                |      | Slab Length:  | Ft                              |  | Slab Width:    | Ft            |       | Joint Length: | Ft       |               |           |   |
| Shoulder:            |                                |      | Street Type:  |                                 |  | Grade:         | 0             |       | Lanes:        | 0        |               |           |   |
| Section Comments:    |                                |      |               |                                 |  |                |               |       |               |          |               |           |   |
| Work Date:           | 10/1/2006                      |      | Work Type:    | Subbase - Aggregate             |  |                |               | Code: | SB-AG         |          | Is Major M&R: | False     |   |
| Work Date:           | 10/2/2006                      |      | Work Type:    | Base Course - Crushed Aggregate |  |                |               | Code: | BA-CA         |          | Is Major M&R: | False     |   |
| Work Date:           | 10/3/2006                      |      | Work Type:    | New Construction - AC           |  |                |               | Code: | NC-AC         |          | Is Major M&R: | True      |   |
| Last Insp. Date:     | 3/1/2022                       |      | TotalSamples: | 2                               |  | Surveyed:      | 2             |       |               |          |               |           |   |
| Conditions:          | PCI: 67                        |      |               |                                 |  |                |               |       |               |          |               |           |   |
| Inspection Comments: |                                |      |               |                                 |  |                |               |       |               |          |               |           |   |
| Sample Number:       | 01                             |      | Type:         | R                               |  | Area:          | 6882.00 SqFt  |       | PCI:          | 67       |               |           |   |
| Sample Comments:     | Created by Inspection Schedule |      |               |                                 |  |                |               |       |               |          |               |           |   |
| 48                   | L & T CR                       |      | L             | 200.00 Ft                       |  |                |               |       |               |          |               |           |   |
| 57                   | WEATHERING                     |      | M             | 3442.00 SqFt                    |  |                |               |       |               |          |               |           |   |
| 43                   | BLOCK CR                       |      | L             | 800.00 SqFt                     |  |                |               |       |               |          |               |           |   |
| 57                   | WEATHERING                     |      | L             | 3440.00 SqFt                    |  |                |               |       |               |          |               |           |   |
| Sample Number:       | 02                             |      | Type:         | R                               |  | Area:          | 5803.00 SqFt  |       | PCI:          | 66       |               |           |   |
| Sample Comments:     | Created by Inspection Schedule |      |               |                                 |  |                |               |       |               |          |               |           |   |
| 41                   | ALLIGATOR CR                   |      | L             | 13.00 SqFt                      |  |                |               |       |               |          |               |           |   |
| 57                   | WEATHERING                     |      | L             | 2900.00 SqFt                    |  |                |               |       |               |          |               |           |   |
| 48                   | L & T CR                       |      | M             | 7.00 Ft                         |  |                |               |       |               |          |               |           |   |
| 57                   | WEATHERING                     |      | M             | 2903.00 SqFt                    |  |                |               |       |               |          |               |           |   |
| 48                   | L & T CR                       |      | L             | 154.00 Ft                       |  |                |               |       |               |          |               |           |   |
| 48                   | L & T CR                       |      | L             | 158.00 Ft                       |  |                |               |       |               |          |               |           |   |

|                             |                                |                      |                                     |                  |                      |                  |              |                          |          |
|-----------------------------|--------------------------------|----------------------|-------------------------------------|------------------|----------------------|------------------|--------------|--------------------------|----------|
| <b>Network:</b>             | Bend                           |                      | <b>Name:</b>                        | Bend Municipal   |                      |                  |              |                          |          |
| <b>Branch:</b>              | TA1BE                          | <b>Name:</b>         | Taxiway A1 Bend                     |                  | <b>Use:</b>          | TAXIWAY          | <b>Area:</b> | 14,715 SqFt              |          |
| <b>Section:</b>             | 02                             | of                   | 2                                   | <b>From:</b>     | TA1BE-01             | <b>To:</b>       | TABE-01      | <b>Last Const.:</b>      | 9/2/2012 |
| <b>Surface:</b>             | AAC                            | <b>Family:</b>       | 2022_Central_Cat1/2_Taxi<br>way_AAC | <b>Zone:</b>     | KBDN                 | <b>Category:</b> | L            | <b>Rank:</b>             | P        |
| <b>Area:</b>                | 2,030 SqFt                     | <b>Length:</b>       | 33 Ft                               | <b>Width:</b>    | 60 Ft                |                  |              |                          |          |
| <b>Slabs:</b>               | <b>Slab Length:</b>            | Ft                   | <b>Slab Width:</b>                  | Ft               | <b>Joint Length:</b> | Ft               |              |                          |          |
| <b>Shoulder:</b>            | <b>Street Type:</b>            | <b>Grade:</b>        | 0                                   | <b>Lanes:</b>    | 0                    |                  |              |                          |          |
| <b>Section Comments:</b>    |                                |                      |                                     |                  |                      |                  |              |                          |          |
| <b>Work Date:</b>           | 10/1/2006                      | <b>Work Type:</b>    | Subbase - Aggregate                 |                  |                      | <b>Code:</b>     | SB-AG        | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 10/2/2006                      | <b>Work Type:</b>    | Base Course - Aggregate             |                  |                      | <b>Code:</b>     | BA-AG        | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 10/3/2006                      | <b>Work Type:</b>    | New Construction - AC               |                  |                      | <b>Code:</b>     | NC-AC        | <b>Is Major M&amp;R:</b> | True     |
| <b>Work Date:</b>           | 9/1/2012                       | <b>Work Type:</b>    | Cold Milling                        |                  |                      | <b>Code:</b>     | MI-CO        | <b>Is Major M&amp;R:</b> | False    |
| <b>Work Date:</b>           | 9/2/2012                       | <b>Work Type:</b>    | Surface Reconstruction - AC         |                  |                      | <b>Code:</b>     | SR-AC        | <b>Is Major M&amp;R:</b> | True     |
| <b>Last Insp. Date:</b>     | 3/1/2022                       | <b>TotalSamples:</b> | 1                                   | <b>Surveyed:</b> | 1                    |                  |              |                          |          |
| <b>Conditions:</b>          | PCI:                           | 79                   |                                     |                  |                      |                  |              |                          |          |
| <b>Inspection Comments:</b> |                                |                      |                                     |                  |                      |                  |              |                          |          |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>         | R                                   | <b>Area:</b>     | 2030.00 SqFt         | <b>PCI:</b>      | 79           |                          |          |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                      |                                     |                  |                      |                  |              |                          |          |
| 57                          | WEATHERING                     | L                    | 2030.00                             | SqFt             |                      |                  |              |                          |          |
| 50                          | PATCHING                       | L                    | 126.00                              | SqFt             |                      |                  |              |                          |          |
| 48                          | L & T CR                       | L                    | 60.00                               | Ft               |                      |                  |              |                          |          |

|                                                 |              |         |                                             |                 |                |             |           |          |                        |
|-------------------------------------------------|--------------|---------|---------------------------------------------|-----------------|----------------|-------------|-----------|----------|------------------------|
| Network:                                        | Bend         |         |                                             | Name:           | Bend Municipal |             |           |          |                        |
| Branch:                                         | TA2BE        |         | Name:                                       | Taxiway A2 Bend |                | Use:        | TAXIWAY   | Area:    | 11,220 SqFt            |
| Section:                                        | 01           | of      | 2                                           | From:           | R16BE-01       |             | To:       | TA2BE-02 | Last Const.: 10/3/2006 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxiway_AC              | Zone:           | KBDN           |             | Category: | L        | Rank: P                |
| Area:                                           | 8,275 SqFt   |         | Length:                                     | 210 Ft          |                | Width:      | 35 Ft     |          |                        |
| Slabs:                                          | Slab Length: |         | Ft                                          |                 | Slab Width:    |             | Ft        |          | Joint Length: Ft       |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                 | 0              |             | Lanes: 0  |          |                        |
| Section Comments:                               |              |         |                                             |                 |                |             |           |          |                        |
| Work Date:                                      | 9/1/1919     |         | Work Type: Base Course - Cinders (Major MR) |                 |                |             | Code:     | BA-CI    | Is Major M&R: True     |
| Work Date:                                      | 9/2/1919     |         | Work Type: New Construction - AC            |                 |                |             | Code:     | NC-AC    | Is Major M&R: True     |
| Work Date:                                      | 9/3/1994     |         | Work Type: Overlay - AC Thin                |                 |                |             | Code:     | OL-AT    | Is Major M&R: True     |
| Work Date:                                      | 9/1/1995     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC    | Is Major M&R: False    |
| Work Date:                                      | 9/1/2000     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC    | Is Major M&R: False    |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                 |                |             | Code:     | CS-AC    | Is Major M&R: False    |
| Work Date:                                      | 9/2/2004     |         | Work Type: Surface Treatment - Slurry Seal  |                 |                |             | Code:     | ST-SS    | Is Major M&R: False    |
| Work Date:                                      | 10/1/2006    |         | Work Type: Subbase - Aggregate              |                 |                |             | Code:     | SB-AG    | Is Major M&R: False    |
| Work Date:                                      | 10/2/2006    |         | Work Type: Base Course - Crushed Aggregate  |                 |                |             | Code:     | BA-CA    | Is Major M&R: False    |
| Work Date:                                      | 10/3/2006    |         | Work Type: New Construction - AC            |                 |                |             | Code:     | NC-AC    | Is Major M&R: True     |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 2               |                | Surveyed: 2 |           |          |                        |
| Conditions:                                     | PCI: 83      |         |                                             |                 |                |             |           |          |                        |
| Inspection Comments:                            |              |         |                                             |                 |                |             |           |          |                        |
| Sample Number:                                  | 01           | Type:   | R                                           | Area:           | 4125.00 SqFt   |             | PCI:      | 78       |                        |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                 |                |             |           |          |                        |
| 48                                              | L & T CR     |         | M                                           | 30.00 Ft        |                |             |           |          |                        |
| 48                                              | L & T CR     |         | L                                           | 57.00 Ft        |                |             |           |          |                        |
| 48                                              | L & T CR     |         | M                                           | 17.00 Ft        |                |             |           |          |                        |
| 57                                              | WEATHERING   |         | L                                           | 4125.00 SqFt    |                |             |           |          |                        |
| 48                                              | L & T CR     |         | L                                           | 100.00 Ft       |                |             |           |          |                        |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:           | 4137.00 SqFt   |             | PCI:      | 87       |                        |
| Sample Comments:                                |              |         |                                             |                 |                |             |           |          |                        |
| 48                                              | L & T CR     |         | M                                           | 17.00 Ft        |                |             |           |          |                        |
| 57                                              | WEATHERING   |         | L                                           | 4137.00 SqFt    |                |             |           |          |                        |

|                             |                                |                |                                               |                 |                    |                    |                  |              |                                |
|-----------------------------|--------------------------------|----------------|-----------------------------------------------|-----------------|--------------------|--------------------|------------------|--------------|--------------------------------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                  | Bend Municipal  |                    |                    |                  |              |                                |
| <b>Branch:</b>              | TA2BE                          |                | <b>Name:</b>                                  | Taxiway A2 Bend |                    | <b>Use:</b>        | TAXIWAY          | <b>Area:</b> | 11,220 SqFt                    |
| <b>Section:</b>             | 02                             | of             | 2                                             | <b>From:</b>    | TA2BE-01           |                    | <b>To:</b>       | TABE-01      |                                |
| <b>Surface:</b>             | AAC                            | <b>Family:</b> | 2022_Central_Cat1/2_Taxi<br>way_AAC           |                 | <b>Zone:</b>       | KBDN               | <b>Category:</b> | L            | <b>Rank:</b> P                 |
| <b>Area:</b>                | 2,945 SqFt                     |                | <b>Length:</b>                                | 35 Ft           |                    | <b>Width:</b>      | 75 Ft            |              |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                            |                 | <b>Slab Width:</b> |                    | Ft               |              | <b>Joint Length:</b> Ft        |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                | <b>Grade:</b>                                 |                 | 0                  |                    | <b>Lanes:</b> 0  |              |                                |
| <b>Section Comments:</b>    |                                |                |                                               |                 |                    |                    |                  |              |                                |
| <b>Work Date:</b>           | 10/1/2006                      |                | <b>Work Type:</b> Subbase - Aggregate         |                 |                    |                    | <b>Code:</b>     | SB-AG        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 10/2/2006                      |                | <b>Work Type:</b> Base Course - Aggregate     |                 |                    |                    | <b>Code:</b>     | BA-AG        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 10/3/2006                      |                | <b>Work Type:</b> New Construction - AC       |                 |                    |                    | <b>Code:</b>     | NC-AC        | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b> Cold Milling                |                 |                    |                    | <b>Code:</b>     | MI-CO        | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/2/2012                       |                | <b>Work Type:</b> Surface Reconstruction - AC |                 |                    |                    | <b>Code:</b>     | SR-AC        | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC          |                 |                    |                    | <b>Code:</b>     | CS-AC        | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                          | 2               |                    | <b>Surveyed:</b> 1 |                  |              |                                |
| <b>Conditions:</b>          | PCI: 81                        |                |                                               |                 |                    |                    |                  |              |                                |
| <b>Inspection Comments:</b> |                                |                |                                               |                 |                    |                    |                  |              |                                |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                             | <b>Area:</b>    | 2945.00 SqFt       |                    | <b>PCI:</b>      | 81           |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                               |                 |                    |                    |                  |              |                                |
| 57                          | WEATHERING                     |                | M                                             | 120.00 SqFt     |                    |                    |                  |              |                                |
| 48                          | L & T CR                       |                | L                                             | 100.00 Ft       |                    |                    |                  |              |                                |
| 57                          | WEATHERING                     |                | L                                             | 2825.00 SqFt    |                    |                    |                  |              |                                |

|                                                 |            |         |                                |                                  |              |             |         |       |               |    |               |           |   |
|-------------------------------------------------|------------|---------|--------------------------------|----------------------------------|--------------|-------------|---------|-------|---------------|----|---------------|-----------|---|
| Network:                                        | Bend       |         | Name:                          | Bend Municipal                   |              |             |         |       |               |    |               |           |   |
| Branch:                                         | TA3BE      |         | Name:                          | Taxiway A3 Bend                  |              | Use:        | TAXIWAY | Area: | 11,200 SqFt   |    |               |           |   |
| Section:                                        | 01         | of      | 2                              | From:                            | R16BE-01     |             |         | To:   | TA3BE-02      |    | Last Const.:  | 10/3/2006 |   |
| Surface:                                        | AC         | Family: | 2022_Central_Cat1/2_Taxiway_AC |                                  | Zone:        | KBDN        |         |       | Category:     | L  |               | Rank:     | P |
| Area:                                           | 8,315 SqFt |         | Length:                        | 210 Ft                           |              | Width:      | 35 Ft   |       |               |    |               |           |   |
| Slabs:                                          |            |         | Slab Length:                   | Ft                               |              | Slab Width: | Ft      |       | Joint Length: | Ft |               |           |   |
| Shoulder:                                       |            |         | Street Type:                   |                                  |              | Grade:      | 0       |       | Lanes:        | 0  |               |           |   |
| Section Comments:                               |            |         |                                |                                  |              |             |         |       |               |    |               |           |   |
| Work Date:                                      | 9/1/1919   |         | Work Type:                     | Base Course - Cinders (Major MR) |              |             |         | Code: | BA-CI         |    | Is Major M&R: | True      |   |
| Work Date:                                      | 9/2/1919   |         | Work Type:                     | New Construction - AC            |              |             |         | Code: | NC-AC         |    | Is Major M&R: | True      |   |
| Work Date:                                      | 9/1/1995   |         | Work Type:                     | Overlay - AC Thin                |              |             |         | Code: | OL-AT         |    | Is Major M&R: | True      |   |
| Work Date:                                      | 9/2/1995   |         | Work Type:                     | Crack Sealing - AC               |              |             |         | Code: | CS-AC         |    | Is Major M&R: | False     |   |
| Work Date:                                      | 9/1/2000   |         | Work Type:                     | Crack Sealing - AC               |              |             |         | Code: | CS-AC         |    | Is Major M&R: | False     |   |
| Work Date:                                      | 9/1/2004   |         | Work Type:                     | Crack Sealing - AC               |              |             |         | Code: | CS-AC         |    | Is Major M&R: | False     |   |
| Work Date:                                      | 9/2/2004   |         | Work Type:                     | Surface Treatment - Slurry Seal  |              |             |         | Code: | ST-SS         |    | Is Major M&R: | False     |   |
| Work Date:                                      | 10/1/2006  |         | Work Type:                     | Subbase - Aggregate              |              |             |         | Code: | SB-AG         |    | Is Major M&R: | False     |   |
| Work Date:                                      | 10/2/2006  |         | Work Type:                     | Base Course - Crushed Aggregate  |              |             |         | Code: | BA-CA         |    | Is Major M&R: | False     |   |
| Work Date:                                      | 10/3/2006  |         | Work Type:                     | New Construction - AC            |              |             |         | Code: | NC-AC         |    | Is Major M&R: | True      |   |
| Work Date:                                      | 9/1/2015   |         | Work Type:                     | Crack Sealing - AC               |              |             |         | Code: | CS-AC         |    | Is Major M&R: | False     |   |
| Last Insp. Date:                                | 3/1/2022   |         | TotalSamples:                  | 2                                |              | Surveyed:   | 2       |       |               |    |               |           |   |
| Conditions:                                     | PCI:       |         | 71                             |                                  |              |             |         |       |               |    |               |           |   |
| Inspection Comments:                            |            |         |                                |                                  |              |             |         |       |               |    |               |           |   |
| Sample Number:                                  | 01         | Type:   | R                              | Area:                            | 4138.00 SqFt |             |         | PCI:  | 67            |    |               |           |   |
| Sample Comments: Created by Inspection Schedule |            |         |                                |                                  |              |             |         |       |               |    |               |           |   |
| 57                                              | WEATHERING | L       | 2138.00                        | SqFt                             |              |             |         |       |               |    |               |           |   |
| 48                                              | L & T CR   | L       | 80.00                          | Ft                               |              |             |         |       |               |    |               |           |   |
| 57                                              | WEATHERING | M       | 2000.00                        | SqFt                             |              |             |         |       |               |    |               |           |   |
| 48                                              | L & T CR   | M       | 112.00                         | Ft                               |              |             |         |       |               |    |               |           |   |
| 48                                              | L & T CR   | L       | 48.00                          | Ft                               |              |             |         |       |               |    |               |           |   |
| Sample Number:                                  | 02         | Type:   | R                              | Area:                            | 4177.00 SqFt |             |         | PCI:  | 76            |    |               |           |   |
| Sample Comments:                                |            |         |                                |                                  |              |             |         |       |               |    |               |           |   |
| 57                                              | WEATHERING | M       | 2000.00                        | SqFt                             |              |             |         |       |               |    |               |           |   |
| 48                                              | L & T CR   | L       | 18.00                          | Ft                               |              |             |         |       |               |    |               |           |   |
| 57                                              | WEATHERING | L       | 2177.00                        | SqFt                             |              |             |         |       |               |    |               |           |   |

|                             |                                |      |                                                |                                |                    |                  |              |                      |                  |                                |
|-----------------------------|--------------------------------|------|------------------------------------------------|--------------------------------|--------------------|------------------|--------------|----------------------|------------------|--------------------------------|
| <b>Network:</b>             |                                | Bend |                                                | <b>Name:</b>                   |                    | Bend Municipal   |              |                      |                  |                                |
| <b>Branch:</b>              | TA3BE                          |      | <b>Name:</b>                                   | Taxiway A3 Bend                |                    | <b>Use:</b>      | TAXIWAY      | <b>Area:</b>         | 11,200 SqFt      |                                |
| <b>Section:</b>             | 02                             |      | of                                             | 2                              | <b>From:</b>       | TA3BE-01         |              | <b>To:</b>           | TABE-02          |                                |
| <b>Surface:</b>             | AC                             |      | <b>Family:</b>                                 | 2022_Central_Cat1/2_Taxiway_AC |                    | <b>Zone:</b>     | KBDN         |                      | <b>Category:</b> | L                              |
| <b>Area:</b>                | 2,885 SqFt                     |      | <b>Length:</b>                                 | 35 Ft                          |                    | <b>Width:</b>    | 75 Ft        |                      |                  |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |      | Ft                                             |                                | <b>Slab Width:</b> | Ft               |              | <b>Joint Length:</b> | Ft               |                                |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |      |                                                |                                | <b>Grade:</b>      | 0                |              | <b>Lanes:</b>        | 0                |                                |
| <b>Section Comments:</b>    |                                |      |                                                |                                |                    |                  |              |                      |                  |                                |
| <b>Work Date:</b>           | 9/1/2012                       |      | <b>Work Type:</b> Subbase - Aggregate          |                                |                    |                  | <b>Code:</b> | SB-AG                |                  | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/2/2012                       |      | <b>Work Type:</b> Base Course - Aggregate      |                                |                    |                  | <b>Code:</b> | BA-AG                |                  | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 9/3/2012                       |      | <b>Work Type:</b> Complete Reconstruction - AC |                                |                    |                  | <b>Code:</b> | CR-AC                |                  | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 9/1/2015                       |      | <b>Work Type:</b> Crack Sealing - AC           |                                |                    |                  | <b>Code:</b> | CS-AC                |                  | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |      | <b>TotalSamples:</b>                           | 2                              |                    | <b>Surveyed:</b> | 1            |                      |                  |                                |
| <b>Conditions:</b>          | PCI: 84                        |      |                                                |                                |                    |                  |              |                      |                  |                                |
| <b>Inspection Comments:</b> |                                |      |                                                |                                |                    |                  |              |                      |                  |                                |
| <b>Sample Number:</b>       | 01                             |      | <b>Type:</b>                                   | R                              |                    | <b>Area:</b>     | 2885.00 SqFt |                      | <b>PCI:</b>      | 84                             |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |      |                                                |                                |                    |                  |              |                      |                  |                                |
| 48                          | L & T CR                       |      | L                                              | 70.00 Ft                       |                    |                  |              |                      |                  |                                |
| 57                          | WEATHERING                     |      | M                                              | 70.00 SqFt                     |                    |                  |              |                      |                  |                                |
| 57                          | WEATHERING                     |      | L                                              | 2815.00 SqFt                   |                    |                  |              |                      |                  |                                |

|                      |              |                                |                                             |                 |              |           |         |           |               |               |              |           |
|----------------------|--------------|--------------------------------|---------------------------------------------|-----------------|--------------|-----------|---------|-----------|---------------|---------------|--------------|-----------|
| Network:             | Bend         |                                | Name:                                       | Bend Municipal  |              |           |         |           |               |               |              |           |
| Branch:              | TA4BE        |                                | Name:                                       | Taxiway A4 Bend |              | Use:      | TAXIWAY |           | Area:         | 11,260 SqFt   |              |           |
| Section:             | 01           | of                             | 2                                           | From:           | R16BE-01     |           |         | To:       | TA4BE-02      |               | Last Const.: | 10/3/2006 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxiway_AC              |                 | Zone:        | KBDN      |         | Category: | L             |               | Rank:        | P         |
| Area:                | 8,400 SqFt   |                                | Length:                                     | 210 Ft          |              | Width:    | 35 Ft   |           |               |               |              |           |
| Slabs:               | Slab Length: |                                | Ft                                          |                 | Slab Width:  |           | Ft      |           | Joint Length: |               | Ft           |           |
| Shoulder:            | Street Type: |                                |                                             |                 | Grade:       | 0         |         | Lanes:    |               | 0             |              |           |
| Section Comments:    |              |                                |                                             |                 |              |           |         |           |               |               |              |           |
| Work Date:           | 9/1/1919     |                                | Work Type: Base Course - Cinders (Major MR) |                 |              |           | Code:   | BA-CI     |               | Is Major M&R: |              | True      |
| Work Date:           | 9/2/1919     |                                | Work Type: New Construction - AC            |                 |              |           | Code:   | NC-AC     |               | Is Major M&R: |              | True      |
| Work Date:           | 9/1/1995     |                                | Work Type: Crack Sealing - AC               |                 |              |           | Code:   | CS-AC     |               | Is Major M&R: |              | False     |
| Work Date:           | 9/3/1995     |                                | Work Type: Overlay - AC Thin                |                 |              |           | Code:   | OL-AT     |               | Is Major M&R: |              | True      |
| Work Date:           | 9/1/2000     |                                | Work Type: Crack Sealing - AC               |                 |              |           | Code:   | CS-AC     |               | Is Major M&R: |              | False     |
| Work Date:           | 9/1/2004     |                                | Work Type: Crack Sealing - AC               |                 |              |           | Code:   | CS-AC     |               | Is Major M&R: |              | False     |
| Work Date:           | 9/2/2004     |                                | Work Type: Surface Treatment - Slurry Seal  |                 |              |           | Code:   | ST-SS     |               | Is Major M&R: |              | False     |
| Work Date:           | 10/1/2006    |                                | Work Type: Subbase - Aggregate              |                 |              |           | Code:   | SB-AG     |               | Is Major M&R: |              | False     |
| Work Date:           | 10/2/2006    |                                | Work Type: Base Course - Crushed Aggregate  |                 |              |           | Code:   | BA-CA     |               | Is Major M&R: |              | False     |
| Work Date:           | 10/3/2006    |                                | Work Type: New Construction - AC            |                 |              |           | Code:   | NC-AC     |               | Is Major M&R: |              | True      |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                               | 2               |              | Surveyed: |         | 2         |               |               |              |           |
| Conditions:          | PCI: 81      |                                |                                             |                 |              |           |         |           |               |               |              |           |
| Inspection Comments: |              |                                |                                             |                 |              |           |         |           |               |               |              |           |
| Sample Number:       | 01           | Type:                          | R                                           | Area:           | 4138.00 SqFt |           | PCI:    | 74        |               |               |              |           |
| Sample Comments:     |              | Created by Inspection Schedule |                                             |                 |              |           |         |           |               |               |              |           |
| 48                   | L & T CR     |                                | M                                           | 53.00 Ft        |              |           |         |           |               |               |              |           |
| 50                   | PATCHING     |                                | H                                           | 2.00 SqFt       |              |           |         |           |               |               |              |           |
| 57                   | WEATHERING   |                                | L                                           | 4138.00 SqFt    |              |           |         |           |               |               |              |           |
| Sample Number:       | 02           | Type:                          | R                                           | Area:           | 4262.00 SqFt |           | PCI:    | 88        |               |               |              |           |
| Sample Comments:     |              |                                |                                             |                 |              |           |         |           |               |               |              |           |
| 48                   | L & T CR     |                                | M                                           | 16.00 Ft        |              |           |         |           |               |               |              |           |
| 57                   | WEATHERING   |                                | L                                           | 4262.00 SqFt    |              |           |         |           |               |               |              |           |

|                      |                                |               |                                |           |                |           |         |               |          |
|----------------------|--------------------------------|---------------|--------------------------------|-----------|----------------|-----------|---------|---------------|----------|
| Network:             | Bend                           |               |                                | Name:     | Bend Municipal |           |         |               |          |
| Branch:              | TA4BE                          | Name:         | Taxiway A4 Bend                |           | Use:           | TAXIWAY   | Area:   | 11,260 SqFt   |          |
| Section:             | 02                             | of            | 2                              | From:     | TA4BE-02       | To:       | TABE-01 | Last Const.:  | 9/3/2012 |
| Surface:             | AC                             | Family:       | 2022_Central_Cat1/2_Taxiway_AC | Zone:     | KBDN           | Category: | L       | Rank:         | P        |
| Area:                | 2,860 SqFt                     | Length:       | 35 Ft                          | Width:    | 75 Ft          |           |         |               |          |
| Slabs:               | Slab Length:                   | Ft            | Slab Width:                    | Ft        | Joint Length:  | Ft        |         |               |          |
| Shoulder:            | Street Type:                   | Grade:        | 0                              | Lanes:    | 0              |           |         |               |          |
| Section Comments:    |                                |               |                                |           |                |           |         |               |          |
| Work Date:           | 9/1/2012                       | Work Type:    | Subbase - Aggregate            |           |                | Code:     | SB-AG   | Is Major M&R: | False    |
| Work Date:           | 9/2/2012                       | Work Type:    | Base Course - Aggregate        |           |                | Code:     | BA-AG   | Is Major M&R: | False    |
| Work Date:           | 9/3/2012                       | Work Type:    | Complete Reconstruction - AC   |           |                | Code:     | CR-AC   | Is Major M&R: | True     |
| Work Date:           | 9/1/2015                       | Work Type:    | Crack Sealing - AC             |           |                | Code:     | CS-AC   | Is Major M&R: | False    |
| Last Insp. Date:     | 3/1/2022                       | TotalSamples: | 2                              | Surveyed: | 1              |           |         |               |          |
| Conditions:          | PCI:                           | 78            |                                |           |                |           |         |               |          |
| Inspection Comments: |                                |               |                                |           |                |           |         |               |          |
| Sample Number:       | 01                             | Type:         | R                              | Area:     | 2860.00 SqFt   | PCI:      | 78      |               |          |
| Sample Comments:     | Created by Inspection Schedule |               |                                |           |                |           |         |               |          |
| 57                   | WEATHERING                     | L             | 2860.00                        | SqFt      |                |           |         |               |          |
| 48                   | L & T CR                       | L             | 25.00                          | Ft        |                |           |         |               |          |
| 48                   | L & T CR                       | M             | 45.00                          | Ft        |                |           |         |               |          |

|                             |                                |                |                                                    |                 |                    |                  |              |               |                      |                                |                     |              |   |
|-----------------------------|--------------------------------|----------------|----------------------------------------------------|-----------------|--------------------|------------------|--------------|---------------|----------------------|--------------------------------|---------------------|--------------|---|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                       | Bend Municipal  |                    |                  |              |               |                      |                                |                     |              |   |
| <b>Branch:</b>              | TA5BE                          |                | <b>Name:</b>                                       | Taxiway A5 Bend |                    | <b>Use:</b>      | TAXIWAY      |               | <b>Area:</b>         | 11,370 SqFt                    |                     |              |   |
| <b>Section:</b>             | 01                             | of             | 2                                                  | <b>From:</b>    | R16BE-01           |                  |              | <b>To:</b>    | TA5BE-02             |                                | <b>Last Const.:</b> | 10/3/2006    |   |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxi way_AC                    |                 | <b>Zone:</b>       | KBDN             |              |               | <b>Category:</b>     | L                              |                     | <b>Rank:</b> | P |
| <b>Area:</b>                | 8,480 SqFt                     |                | <b>Length:</b>                                     | 210 Ft          |                    | <b>Width:</b>    | 35 Ft        |               |                      |                                |                     |              |   |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                 |                 | <b>Slab Width:</b> |                  | Ft           |               | <b>Joint Length:</b> |                                | Ft                  |              |   |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                    |                 | <b>Grade:</b>      | 0                |              | <b>Lanes:</b> |                      | 0                              |                     |              |   |
| <b>Section Comments:</b>    |                                |                |                                                    |                 |                    |                  |              |               |                      |                                |                     |              |   |
| <b>Work Date:</b>           | 9/1/1919                       |                | <b>Work Type:</b> Base Course - Cinders (Major MR) |                 |                    |                  | <b>Code:</b> | BA-CI         |                      | <b>Is Major M&amp;R:</b> True  |                     |              |   |
| <b>Work Date:</b>           | 9/2/1919                       |                | <b>Work Type:</b> New Construction - AC            |                 |                    |                  | <b>Code:</b> | NC-AC         |                      | <b>Is Major M&amp;R:</b> True  |                     |              |   |
| <b>Work Date:</b>           | 9/3/1992                       |                | <b>Work Type:</b> Overlay - AC Thin                |                 |                    |                  | <b>Code:</b> | OL-AT         |                      | <b>Is Major M&amp;R:</b> True  |                     |              |   |
| <b>Work Date:</b>           | 9/1/1995                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC         |                      | <b>Is Major M&amp;R:</b> False |                     |              |   |
| <b>Work Date:</b>           | 9/1/2000                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC         |                      | <b>Is Major M&amp;R:</b> False |                     |              |   |
| <b>Work Date:</b>           | 9/1/2004                       |                | <b>Work Type:</b> Crack Sealing - AC               |                 |                    |                  | <b>Code:</b> | CS-AC         |                      | <b>Is Major M&amp;R:</b> False |                     |              |   |
| <b>Work Date:</b>           | 9/2/2004                       |                | <b>Work Type:</b> Surface Treatment - Slurry Seal  |                 |                    |                  | <b>Code:</b> | ST-SS         |                      | <b>Is Major M&amp;R:</b> False |                     |              |   |
| <b>Work Date:</b>           | 10/1/2006                      |                | <b>Work Type:</b> Subbase - Aggregate              |                 |                    |                  | <b>Code:</b> | SB-AG         |                      | <b>Is Major M&amp;R:</b> False |                     |              |   |
| <b>Work Date:</b>           | 10/2/2006                      |                | <b>Work Type:</b> Base Course - Crushed Aggregate  |                 |                    |                  | <b>Code:</b> | BA-CA         |                      | <b>Is Major M&amp;R:</b> False |                     |              |   |
| <b>Work Date:</b>           | 10/3/2006                      |                | <b>Work Type:</b> New Construction - AC            |                 |                    |                  | <b>Code:</b> | NC-AC         |                      | <b>Is Major M&amp;R:</b> True  |                     |              |   |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                               | 2               |                    | <b>Surveyed:</b> | 2            |               |                      |                                |                     |              |   |
| <b>Conditions:</b>          | PCI: 75                        |                |                                                    |                 |                    |                  |              |               |                      |                                |                     |              |   |
| <b>Inspection Comments:</b> |                                |                |                                                    |                 |                    |                  |              |               |                      |                                |                     |              |   |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 4145.00 SqFt       |                  |              | <b>PCI:</b>   | 75                   |                                |                     |              |   |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                    |                 |                    |                  |              |               |                      |                                |                     |              |   |
| 57                          | WEATHERING                     | M              | 4145.00                                            | SqFt            |                    |                  |              |               |                      |                                |                     |              |   |
| 48                          | L & T CR                       | L              | 111.00                                             | Ft              |                    |                  |              |               |                      |                                |                     |              |   |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>   | R                                                  | <b>Area:</b>    | 4335.00 SqFt       |                  |              | <b>PCI:</b>   | 75                   |                                |                     |              |   |
| <b>Sample Comments:</b>     |                                |                |                                                    |                 |                    |                  |              |               |                      |                                |                     |              |   |
| 48                          | L & T CR                       | M              | 17.00                                              | Ft              |                    |                  |              |               |                      |                                |                     |              |   |
| 57                          | WEATHERING                     | L              | 2072.50                                            | SqFt            |                    |                  |              |               |                      |                                |                     |              |   |
| 57                          | WEATHERING                     | M              | 2167.50                                            | SqFt            |                    |                  |              |               |                      |                                |                     |              |   |

|                      |                                |         |                                         |                 |                |           |           |               |                       |
|----------------------|--------------------------------|---------|-----------------------------------------|-----------------|----------------|-----------|-----------|---------------|-----------------------|
| Network:             | Bend                           |         |                                         | Name:           | Bend Municipal |           |           |               |                       |
| Branch:              | TA5BE                          |         | Name:                                   | Taxiway A5 Bend |                | Use:      | TAXIWAY   | Area:         | 11,370 SqFt           |
| Section:             | 02                             | of      | 2                                       | From:           | TA5BE-01       |           | To:       | TABE-01       |                       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxi<br>way_AC      |                 | Zone:          | KBDN      | Category: | L             | Last Const.: 9/3/2012 |
| Area:                | 2,890 SqFt                     |         | Length:                                 | 35 Ft           |                | Width:    | 75 Ft     |               |                       |
| Slabs:               | Slab Length:                   |         | Ft                                      |                 | Slab Width:    | Ft        |           | Joint Length: | Ft                    |
| Shoulder:            | Street Type:                   |         | Grade:                                  |                 | 0              |           | Lanes:    | 0             |                       |
| Section Comments:    |                                |         |                                         |                 |                |           |           |               |                       |
| Work Date:           | 9/1/2012                       |         | Work Type: Subbase - Aggregate          |                 |                |           | Code:     | SB-AG         | Is Major M&R: False   |
| Work Date:           | 9/2/2012                       |         | Work Type: Base Course - Aggregate      |                 |                |           | Code:     | BA-AG         | Is Major M&R: False   |
| Work Date:           | 9/3/2012                       |         | Work Type: Complete Reconstruction - AC |                 |                |           | Code:     | CR-AC         | Is Major M&R: True    |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                           | 2               |                | Surveyed: | 1         |               |                       |
| Conditions:          | PCI: 77                        |         |                                         |                 |                |           |           |               |                       |
| Inspection Comments: |                                |         |                                         |                 |                |           |           |               |                       |
| Sample Number:       | 01                             | Type:   | R                                       | Area:           | 2890.00 SqFt   |           | PCI:      | 77            |                       |
| Sample Comments:     | Created by Inspection Schedule |         |                                         |                 |                |           |           |               |                       |
| 48                   | L & T CR                       |         | M                                       | 50.00 Ft        |                |           |           |               |                       |
| 48                   | L & T CR                       |         | L                                       | 22.00 Ft        |                |           |           |               |                       |
| 57                   | WEATHERING                     |         | L                                       | 2890.00 SqFt    |                |           |           |               |                       |

|                      |                                |               |                                     |                |               |           |         |               |          |
|----------------------|--------------------------------|---------------|-------------------------------------|----------------|---------------|-----------|---------|---------------|----------|
| Network:             | Bend                           |               | Name:                               | Bend Municipal |               |           |         |               |          |
| Branch:              | TA6BE                          | Name:         | Taxiway A6 Bend                     |                | Use:          | TAXIWAY   | Area:   | 14,716 SqFt   |          |
| Section:             | 02                             | of            | 2                                   | From:          | TA6BE-01      | To:       | TABE-01 | Last Const.:  | 9/2/2012 |
| Surface:             | AAC                            | Family:       | 2022_Central_Cat1/2_Taxi<br>way_AAC | Zone:          | KBDN          | Category: | L       | Rank:         | P        |
| Area:                | 2,000 SqFt                     | Length:       | 35 Ft                               | Width:         | 75 Ft         |           |         |               |          |
| Slabs:               | Slab Length:                   | Ft            | Slab Width:                         | Ft             | Joint Length: | Ft        |         |               |          |
| Shoulder:            | Street Type:                   | Grade:        | 0                                   | Lanes:         | 0             |           |         |               |          |
| Section Comments:    |                                |               |                                     |                |               |           |         |               |          |
| Work Date:           | 10/1/2006                      | Work Type:    | Subbase - Aggregate                 |                |               | Code:     | SB-AG   | Is Major M&R: | False    |
| Work Date:           | 10/2/2006                      | Work Type:    | Base Course - Aggregate             |                |               | Code:     | BA-AG   | Is Major M&R: | False    |
| Work Date:           | 10/3/2006                      | Work Type:    | New Construction - AC               |                |               | Code:     | NC-AC   | Is Major M&R: | True     |
| Work Date:           | 9/1/2012                       | Work Type:    | Cold Milling                        |                |               | Code:     | MI-CO   | Is Major M&R: | False    |
| Work Date:           | 9/2/2012                       | Work Type:    | Surface Reconstruction - AC         |                |               | Code:     | SR-AC   | Is Major M&R: | True     |
| Last Insp. Date:     | 3/1/2022                       | TotalSamples: | 1                                   | Surveyed:      | 1             |           |         |               |          |
| Conditions:          | PCI:                           | 94            |                                     |                |               |           |         |               |          |
| Inspection Comments: |                                |               |                                     |                |               |           |         |               |          |
| Sample Number:       | 01                             | Type:         | R                                   | Area:          | 2000.00 SqFt  | PCI:      | 94      |               |          |
| Sample Comments:     | Created by Inspection Schedule |               |                                     |                |               |           |         |               |          |
| 57                   | WEATHERING                     | L             | 2000.00                             | SqFt           |               |           |         |               |          |

|                             |                                |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
|-----------------------------|--------------------------------|----------------|---------------------------------------------------|-----------------|--------------------|------------------|---------------|-------------|----------------------|--------------------------------|---------------------|-----------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                      | Bend Municipal  |                    |                  |               |             |                      |                                |                     |           |
| <b>Branch:</b>              | TA6BE                          |                | <b>Name:</b>                                      | Taxiway A6 Bend |                    | <b>Use:</b>      | TAXIWAY       |             | <b>Area:</b>         | 14,716 SqFt                    |                     |           |
| <b>Section:</b>             | 01                             | of             | 2                                                 | <b>From:</b>    | Runway 16 End      |                  |               | <b>To:</b>  | TA6BE-02             |                                | <b>Last Const.:</b> | 10/3/2006 |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxi<br>way_AC                |                 | <b>Zone:</b>       | KBDN             |               |             | <b>Category:</b>     | L                              | <b>Rank:</b>        | P         |
| <b>Area:</b>                | 12,716 SqFt                    |                | <b>Length:</b>                                    | 210 Ft          |                    | <b>Width:</b>    | 50 Ft         |             |                      |                                |                     |           |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                |                 | <b>Slab Width:</b> |                  | Ft            |             | <b>Joint Length:</b> |                                | Ft                  |           |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                | <b>Grade:</b>                                     |                 | 0                  |                  | <b>Lanes:</b> |             | 0                    |                                |                     |           |
| <b>Section Comments:</b>    |                                |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
| <b>Work Date:</b>           | 10/1/2006                      |                | <b>Work Type:</b> Subbase - Aggregate             |                 |                    |                  | <b>Code:</b>  | SB-AG       |                      | <b>Is Major M&amp;R:</b> False |                     |           |
| <b>Work Date:</b>           | 10/2/2006                      |                | <b>Work Type:</b> Base Course - Crushed Aggregate |                 |                    |                  | <b>Code:</b>  | BA-CA       |                      | <b>Is Major M&amp;R:</b> False |                     |           |
| <b>Work Date:</b>           | 10/3/2006                      |                | <b>Work Type:</b> New Construction - AC           |                 |                    |                  | <b>Code:</b>  | NC-AC       |                      | <b>Is Major M&amp;R:</b> True  |                     |           |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                              | 3               |                    | <b>Surveyed:</b> | 3             |             |                      |                                |                     |           |
| <b>Conditions:</b>          | PCI: 73                        |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
| <b>Inspection Comments:</b> |                                |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                 | <b>Area:</b>    | 3237.00 SqFt       |                  |               | <b>PCI:</b> | 78                   |                                |                     |           |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
| 57                          | WEATHERING                     | L              | 3237.00                                           | SqFt            |                    |                  |               |             |                      |                                |                     |           |
| 48                          | L & T CR                       | M              | 73.00                                             | Ft              |                    |                  |               |             |                      |                                |                     |           |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>   | R                                                 | <b>Area:</b>    | 4973.00 SqFt       |                  |               | <b>PCI:</b> | 62                   |                                |                     |           |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
| 43                          | BLOCK CR                       | M              | 400.00                                            | SqFt            |                    |                  |               |             |                      |                                |                     |           |
| 57                          | WEATHERING                     | L              | 4973.00                                           | SqFt            |                    |                  |               |             |                      |                                |                     |           |
| 41                          | ALLIGATOR CR                   | L              | 6.00                                              | SqFt            |                    |                  |               |             |                      |                                |                     |           |
| 48                          | L & T CR                       | M              | 200.00                                            | Ft              |                    |                  |               |             |                      |                                |                     |           |
| <b>Sample Number:</b>       | 03                             | <b>Type:</b>   | R                                                 | <b>Area:</b>    | 4506.00 SqFt       |                  |               | <b>PCI:</b> | 83                   |                                |                     |           |
| <b>Sample Comments:</b>     |                                |                |                                                   |                 |                    |                  |               |             |                      |                                |                     |           |
| 48                          | L & T CR                       | M              | 37.00                                             | Ft              |                    |                  |               |             |                      |                                |                     |           |
| 48                          | L & T CR                       | L              | 19.00                                             | Ft              |                    |                  |               |             |                      |                                |                     |           |
| 57                          | WEATHERING                     | L              | 4506.00                                           | SqFt            |                    |                  |               |             |                      |                                |                     |           |

|                      |                                |         |                                             |                |                |           |           |          |               |               |       |
|----------------------|--------------------------------|---------|---------------------------------------------|----------------|----------------|-----------|-----------|----------|---------------|---------------|-------|
| Network:             | Bend                           |         |                                             | Name:          | Bend Municipal |           |           |          |               |               |       |
| Branch:              | TABE                           |         | Name:                                       | Taxiway A Bend |                | Use:      | TAXIWAY   | Area:    | 182,005 SqFt  |               |       |
| Section:             | 01                             | of      | 1                                           | From:          | TA1BE-01       |           | To:       | TA6BE-01 |               |               |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxiway_AC              | Zone:          | KBDN           |           | Category: | L        | Rank:         | P             |       |
| Area:                | 182,005 SqFt                   |         | Length:                                     | 5,200 Ft       |                | Width:    | 35 Ft     |          |               |               |       |
| Slabs:               | Slab Length:                   |         | Ft                                          |                | Slab Width:    |           | Ft        |          | Joint Length: | Ft            |       |
| Shoulder:            | Street Type:                   |         | Grade:                                      |                | 0              |           | Lanes:    |          | 0             |               |       |
| Section Comments:    |                                |         |                                             |                |                |           |           |          |               |               |       |
| Work Date:           | 9/1/1919                       |         | Work Type: Base Course - Cinders (Major MR) |                |                |           | Code:     | BA-CI    |               | Is Major M&R: | True  |
| Work Date:           | 9/2/1919                       |         | Work Type: New Construction - AC            |                |                |           | Code:     | NC-AC    |               | Is Major M&R: | True  |
| Work Date:           | 9/3/1995                       |         | Work Type: Overlay - AC Thin                |                |                |           | Code:     | OL-AT    |               | Is Major M&R: | True  |
| Work Date:           | 9/4/1995                       |         | Work Type: Crack Sealing - AC               |                |                |           | Code:     | CS-AC    |               | Is Major M&R: | False |
| Work Date:           | 9/1/2000                       |         | Work Type: Crack Sealing - AC               |                |                |           | Code:     | CS-AC    |               | Is Major M&R: | False |
| Work Date:           | 9/1/2004                       |         | Work Type: Crack Sealing - AC               |                |                |           | Code:     | CS-AC    |               | Is Major M&R: | False |
| Work Date:           | 9/2/2004                       |         | Work Type: Surface Treatment - Slurry Seal  |                |                |           | Code:     | ST-SS    |               | Is Major M&R: | False |
| Work Date:           | 9/1/2008                       |         | Work Type: Crack Seal - Wide Cracks         |                |                |           | Code:     | CS-WD    |               | Is Major M&R: | False |
| Work Date:           | 9/1/2012                       |         | Work Type: Subbase - Aggregate              |                |                |           | Code:     | SB-AG    |               | Is Major M&R: | False |
| Work Date:           | 9/2/2012                       |         | Work Type: Base Course - Aggregate          |                |                |           | Code:     | BA-AG    |               | Is Major M&R: | False |
| Work Date:           | 9/3/2012                       |         | Work Type: Complete Reconstruction - AC     |                |                |           | Code:     | CR-AC    |               | Is Major M&R: | True  |
| Work Date:           | 9/1/2015                       |         | Work Type: Crack Sealing - AC               |                |                |           | Code:     | CS-AC    |               | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                               | 35             |                | Surveyed: |           |          |               |               | 6     |
| Conditions:          | PCI:                           |         | 87                                          |                |                |           |           |          |               |               |       |
| Inspection Comments: |                                |         |                                             |                |                |           |           |          |               |               |       |
| Sample Number:       | 01                             | Type:   | R                                           | Area:          | 5250.00 SqFt   |           | PCI:      | 88       |               |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | L       | 75.00                                       | Ft             |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | L       | 5250.00                                     | SqFt           |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | L       | 20.00                                       | Ft             |                |           |           |          |               |               |       |
| Sample Number:       | 08                             | Type:   | R                                           | Area:          | 5250.00 SqFt   |           | PCI:      | 87       |               |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | L       | 53.00                                       | Ft             |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | L       | 5110.00                                     | SqFt           |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | M       | 140.00                                      | SqFt           |                |           |           |          |               |               |       |
| Sample Number:       | 13                             | Type:   | R                                           | Area:          | 5250.00 SqFt   |           | PCI:      | 87       |               |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | L       | 70.00                                       | Ft             |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | M       | 100.00                                      | SqFt           |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | L       | 5150.00                                     | SqFt           |                |           |           |          |               |               |       |
| Sample Number:       | 21                             | Type:   | R                                           | Area:          | 5250.00 SqFt   |           | PCI:      | 94       |               |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | L       | 5250.00                                     | SqFt           |                |           |           |          |               |               |       |
| Sample Number:       | 27                             | Type:   | R                                           | Area:          | 5250.00 SqFt   |           | PCI:      | 79       |               |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                             |                |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | L       | 22.00                                       | Ft             |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | M       | 35.00                                       | Ft             |                |           |           |          |               |               |       |
| 48                   | L & T CR                       | M       | 50.00                                       | Ft             |                |           |           |          |               |               |       |
| 57                   | WEATHERING                     | L       | 5250.00                                     | SqFt           |                |           |           |          |               |               |       |

|                                                        |            |                |                           |                |
|--------------------------------------------------------|------------|----------------|---------------------------|----------------|
| <b>Sample Number:</b> 33                               |            | <b>Type:</b> R | <b>Area:</b> 5250.00 SqFt | <b>PCI:</b> 89 |
| <b>Sample Comments:</b> Created by Inspection Schedule |            |                |                           |                |
| 57                                                     | WEATHERING | L              | 5250.00 SqFt              |                |
| 48                                                     | L & T CR   | L              | 50.00 Ft                  |                |

|                      |              |                                |                                 |                         |             |              |         |               |       |              |               |       |
|----------------------|--------------|--------------------------------|---------------------------------|-------------------------|-------------|--------------|---------|---------------|-------|--------------|---------------|-------|
| Network:             | Bend         |                                | Name:                           | Bend Municipal          |             |              |         |               |       |              |               |       |
| Branch:              | TAEROBE      |                                | Name:                           | Aero Taxiway Bend       |             | Use:         | TAXIWAY |               | Area: | 331,001 SqFt |               |       |
| Section:             | 01           | of 8                           | From:                           | TLE                     |             |              | To:     | TL06          |       | Last Const.: | 9/2/2008      |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxi way_AC |                         | Zone:       | KBDN         |         | Category:     | L     |              | Rank:         | S     |
| Area:                | 40,188 SqFt  |                                | Length:                         | 1,072 Ft                |             | Width:       | 36 Ft   |               |       |              |               |       |
| Slabs:               | Slab Length: |                                | Ft                              |                         | Slab Width: | Ft           |         | Joint Length: | Ft    |              |               |       |
| Shoulder:            | Street Type: |                                | Grade:                          |                         | 0           |              | Lanes:  | 0             |       |              |               |       |
| Section Comments:    |              |                                |                                 |                         |             |              |         |               |       |              |               |       |
| Work Date:           | 9/1/2008     |                                | Work Type:                      | Base Course - Aggregate |             |              |         | Code:         | BA-AG |              | Is Major M&R: | False |
| Work Date:           | 9/2/2008     |                                | Work Type:                      | New Construction - AC   |             |              |         | Code:         | NC-AC |              | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                   | 8                       |             | Surveyed:    | 4       |               |       |              |               |       |
| Conditions:          | PCI:         | 69                             |                                 |                         |             |              |         |               |       |              |               |       |
| Inspection Comments: |              |                                |                                 |                         |             |              |         |               |       |              |               |       |
| Sample Number:       | 01           | Type:                          | R                               |                         | Area:       | 5095.00 SqFt |         | PCI:          | 71    |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 65.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 75.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | L                              | 52.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| 57                   | WEATHERING   | L                              | 5095.00 SqFt                    |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 38.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| Sample Number:       | 03           | Type:                          | R                               |                         | Area:       | 5337.00 SqFt |         | PCI:          | 67    |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                         |             |              |         |               |       |              |               |       |
| 57                   | WEATHERING   | L                              | 5337.00 SqFt                    |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 186.00 Ft                       |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | L                              | 15.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | L                              | 35.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 70.00 Ft                        |                         |             |              |         |               |       |              |               |       |
| Sample Number:       | 04           | Type:                          | R                               |                         | Area:       | 5458.00 SqFt |         | PCI:          | 68    |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 200.00 Ft                       |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | L                              | 100.00 Ft                       |                         |             |              |         |               |       |              |               |       |
| 57                   | WEATHERING   | L                              | 5458.00 SqFt                    |                         |             |              |         |               |       |              |               |       |
| Sample Number:       | 06           | Type:                          | R                               |                         | Area:       | 5733.00 SqFt |         | PCI:          | 69    |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | L                              | 100.00 Ft                       |                         |             |              |         |               |       |              |               |       |
| 57                   | WEATHERING   | L                              | 5733.00 SqFt                    |                         |             |              |         |               |       |              |               |       |
| 48                   | L & T CR     | M                              | 198.00 Ft                       |                         |             |              |         |               |       |              |               |       |

|                      |              |                                |                                 |                   |              |           |                         |               |              |              |          |               |       |
|----------------------|--------------|--------------------------------|---------------------------------|-------------------|--------------|-----------|-------------------------|---------------|--------------|--------------|----------|---------------|-------|
| Network:             | Bend         |                                | Name:                           | Bend Municipal    |              |           |                         |               |              |              |          |               |       |
| Branch:              | TAEROBE      |                                | Name:                           | Aero Taxiway Bend |              | Use:      | TAXIWAY                 | Area:         | 331,001 SqFt |              |          |               |       |
| Section:             | 05           | of 8                           | From:                           | TL01              |              |           | To:                     | TL08          |              | Last Const.: | 9/2/2008 |               |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxi way_AC |                   | Zone:        | KBDN      |                         | Category:     | L            |              | Rank:    | S             |       |
| Area:                | 38,964 SqFt  |                                | Length:                         | 608 Ft            |              | Width:    | 58 Ft                   |               |              |              |          |               |       |
| Slabs:               | Slab Length: |                                | Ft                              |                   | Slab Width:  | Ft        |                         | Joint Length: | Ft           |              |          |               |       |
| Shoulder:            | Street Type: |                                | Grade:                          |                   | 0            |           | Lanes:                  | 0             |              |              |          |               |       |
| Section Comments:    |              |                                |                                 |                   |              |           |                         |               |              |              |          |               |       |
| Work Date:           | 9/1/2008     |                                | Work Type:                      |                   |              |           | Base Course - Aggregate |               | Code:        | BA-AG        |          | Is Major M&R: | False |
| Work Date:           | 9/2/2008     |                                | Work Type:                      |                   |              |           | New Construction - AC   |               | Code:        | NC-AC        |          | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                   | 7                 |              | Surveyed: | 4                       |               |              |              |          |               |       |
| Conditions:          | PCI: 74      |                                |                                 |                   |              |           |                         |               |              |              |          |               |       |
| Inspection Comments: |              |                                |                                 |                   |              |           |                         |               |              |              |          |               |       |
| Sample Number:       | 02           | Type:                          | R                               | Area:             | 5782.00 SqFt |           |                         | PCI:          | 74           |              |          |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                   |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | M                              | 100.00                          | Ft                |              |           |                         |               |              |              |          |               |       |
| 57                   | WEATHERING   | L                              | 5782.00                         | SqFt              |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | L                              | 255.00                          | Ft                |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | L                              | 58.00                           | Ft                |              |           |                         |               |              |              |          |               |       |
| Sample Number:       | 03           | Type:                          | R                               | Area:             | 6150.00 SqFt |           |                         | PCI:          | 76           |              |          |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                   |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | L                              | 280.00                          | Ft                |              |           |                         |               |              |              |          |               |       |
| 57                   | WEATHERING   | L                              | 6150.00                         | SqFt              |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | M                              | 100.00                          | Ft                |              |           |                         |               |              |              |          |               |       |
| Sample Number:       | 05           | Type:                          | R                               | Area:             | 5782.00 SqFt |           |                         | PCI:          | 75           |              |          |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                   |              |           |                         |               |              |              |          |               |       |
| 57                   | WEATHERING   | L                              | 5782.00                         | SqFt              |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | L                              | 70.00                           | Ft                |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | M                              | 120.00                          | Ft                |              |           |                         |               |              |              |          |               |       |
| Sample Number:       | 06           | Type:                          | R                               | Area:             | 4324.00 SqFt |           |                         | PCI:          | 72           |              |          |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                 |                   |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | L                              | 6.00                            | Ft                |              |           |                         |               |              |              |          |               |       |
| 57                   | WEATHERING   | L                              | 4324.00                         | SqFt              |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | M                              | 117.00                          | Ft                |              |           |                         |               |              |              |          |               |       |
| 48                   | L & T CR     | L                              | 122.00                          | Ft                |              |           |                         |               |              |              |          |               |       |

|                                                 |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
|-------------------------------------------------|-------------|---------|------------------------------------|-------------------|----------------|-------------|--------------|-----------|---------------|---------------------|--------------|----------|
| Network:                                        | Bend        |         |                                    | Name:             | Bend Municipal |             |              |           |               |                     |              |          |
| Branch:                                         | TAEROBE     |         | Name:                              | Aero Taxiway Bend |                | Use:        | TAXIWAY      | Area:     | 331,001 SqFt  |                     |              |          |
| Section:                                        | 07          | of      | 8                                  | From:             | TL01           |             |              | To:       | TL08          |                     | Last Const.: | 9/2/2008 |
| Surface:                                        | AC          | Family: | 2022_Central_Cat1/2_Taxi way_AC    |                   | Zone:          | KBDN        |              | Category: | L             |                     | Rank:        | S        |
| Area:                                           | 40,813 SqFt |         | Length:                            | 579 Ft            |                | Width:      | 68 Ft        |           |               |                     |              |          |
| Slabs:                                          |             |         | Slab Length:                       | Ft                |                | Slab Width: | Ft           |           | Joint Length: | Ft                  |              |          |
| Shoulder:                                       |             |         | Street Type:                       |                   |                | Grade:      | 0            |           | Lanes:        | 0                   |              |          |
| Section Comments:                               |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
| Work Date:                                      | 9/1/2008    |         | Work Type: Base Course - Aggregate |                   |                |             | Code:        | BA-AG     |               | Is Major M&R: False |              |          |
| Work Date:                                      | 9/2/2008    |         | Work Type: New Construction - AC   |                   |                |             | Code:        | NC-AC     |               | Is Major M&R: True  |              |          |
| Last Insp. Date:                                | 3/1/2022    |         | TotalSamples:                      | 7                 |                | Surveyed:   |              | 4         |               |                     |              |          |
| Conditions:                                     | PCI: 73     |         |                                    |                   |                |             |              |           |               |                     |              |          |
| Inspection Comments:                            |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
| Sample Number:                                  | 02          |         | Type:                              | R                 |                | Area:       | 6803.00 SqFt |           | PCI:          | 70                  |              |          |
| Sample Comments: Created by Inspection Schedule |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | M                                  | 161.00 Ft         |                |             |              |           |               |                     |              |          |
| 57                                              | WEATHERING  |         | L                                  | 6803.00 SqFt      |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | M                                  | 92.00 Ft          |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | L                                  | 60.00 Ft          |                |             |              |           |               |                     |              |          |
| Sample Number:                                  | 03          |         | Type:                              | R                 |                | Area:       | 5685.00 SqFt |           | PCI:          | 75                  |              |          |
| Sample Comments: Created by Inspection Schedule |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
| 57                                              | WEATHERING  |         | L                                  | 5685.00 SqFt      |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | L                                  | 192.00 Ft         |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | M                                  | 108.00 Ft         |                |             |              |           |               |                     |              |          |
| Sample Number:                                  | 05          |         | Type:                              | R                 |                | Area:       | 6794.00 SqFt |           | PCI:          | 72                  |              |          |
| Sample Comments: Created by Inspection Schedule |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | M                                  | 170.00 Ft         |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | L                                  | 84.00 Ft          |                |             |              |           |               |                     |              |          |
| 57                                              | WEATHERING  |         | L                                  | 6794.00 SqFt      |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | L                                  | 50.00 Ft          |                |             |              |           |               |                     |              |          |
| Sample Number:                                  | 07          |         | Type:                              | R                 |                | Area:       | 4014.00 SqFt |           | PCI:          | 75                  |              |          |
| Sample Comments: Created by Inspection Schedule |             |         |                                    |                   |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | M                                  | 38.00 Ft          |                |             |              |           |               |                     |              |          |
| 57                                              | WEATHERING  |         | L                                  | 4014.00 SqFt      |                |             |              |           |               |                     |              |          |
| 48                                              | L & T CR    |         | L                                  | 200.00 Ft         |                |             |              |           |               |                     |              |          |

|                                                 |              |         |                                    |                   |              |           |         |               |              |                     |          |   |
|-------------------------------------------------|--------------|---------|------------------------------------|-------------------|--------------|-----------|---------|---------------|--------------|---------------------|----------|---|
| Network:                                        | Bend         |         | Name:                              | Bend Municipal    |              |           |         |               |              |                     |          |   |
| Branch:                                         | TAEROBE      |         | Name:                              | Aero Taxiway Bend |              | Use:      | TAXIWAY | Area:         | 331,001 SqFt |                     |          |   |
| Section:                                        | 06           | of 8    | From:                              | TL01              |              |           | To:     | TL08          |              | Last Const.:        | 9/2/2008 |   |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC    |                   | Zone:        | KBDN      |         | Category:     | L            |                     | Rank:    | S |
| Area:                                           | 37,723 SqFt  |         | Length:                            | 608 Ft            |              | Width:    | 55 Ft   |               |              |                     |          |   |
| Slabs:                                          | Slab Length: |         | Ft                                 |                   | Slab Width:  | Ft        |         | Joint Length: | Ft           |                     |          |   |
| Shoulder:                                       | Street Type: |         |                                    |                   | Grade:       | 0         |         | Lanes:        | 0            |                     |          |   |
| Section Comments:                               |              |         |                                    |                   |              |           |         |               |              |                     |          |   |
| Work Date:                                      | 9/1/2008     |         | Work Type: Base Course - Aggregate |                   |              |           | Code:   | BA-AG         |              | Is Major M&R: False |          |   |
| Work Date:                                      | 9/2/2008     |         | Work Type: New Construction - AC   |                   |              |           | Code:   | NC-AC         |              | Is Major M&R: True  |          |   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                      | 6                 |              | Surveyed: | 3       |               |              |                     |          |   |
| Conditions:                                     | PCI: 77      |         |                                    |                   |              |           |         |               |              |                     |          |   |
| Inspection Comments:                            |              |         |                                    |                   |              |           |         |               |              |                     |          |   |
| Sample Number:                                  | 02           | Type:   | R                                  | Area:             | 5541.00 SqFt |           | PCI:    | 76            |              |                     |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                    |                   |              |           |         |               |              |                     |          |   |
| 48                                              | L & T CR     |         | M                                  | 91.00 Ft          |              |           |         |               |              |                     |          |   |
| 48                                              | L & T CR     |         | L                                  | 240.00 Ft         |              |           |         |               |              |                     |          |   |
| 57                                              | WEATHERING   |         | L                                  | 5541.00 SqFt      |              |           |         |               |              |                     |          |   |
| Sample Number:                                  | 04           | Type:   | R                                  | Area:             | 6775.00 SqFt |           | PCI:    | 74            |              |                     |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                    |                   |              |           |         |               |              |                     |          |   |
| 48                                              | L & T CR     |         | L                                  | 300.00 Ft         |              |           |         |               |              |                     |          |   |
| 57                                              | WEATHERING   |         | L                                  | 6775.00 SqFt      |              |           |         |               |              |                     |          |   |
| 48                                              | L & T CR     |         | M                                  | 145.00 Ft         |              |           |         |               |              |                     |          |   |
| Sample Number:                                  | 05           | Type:   | R                                  | Area:             | 5541.00 SqFt |           | PCI:    | 81            |              |                     |          |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                    |                   |              |           |         |               |              |                     |          |   |
| 48                                              | L & T CR     |         | M                                  | 85.00 Ft          |              |           |         |               |              |                     |          |   |
| 57                                              | WEATHERING   |         | L                                  | 100.00 SqFt       |              |           |         |               |              |                     |          |   |
| 48                                              | L & T CR     |         | L                                  | 250.00 Ft         |              |           |         |               |              |                     |          |   |

|                      |              |                                |                                    |              |             |           |              |               |              |               |       |
|----------------------|--------------|--------------------------------|------------------------------------|--------------|-------------|-----------|--------------|---------------|--------------|---------------|-------|
| Network:             | Bend         | Name:                          | Bend Municipal                     |              |             |           |              |               |              |               |       |
| Branch:              | TAEROBE      | Name:                          | Aero Taxiway Bend                  |              | Use:        | TAXIWAY   | Area:        | 331,001 SqFt  |              |               |       |
| Section:             | 02           | of 8                           | From:                              | TL01         |             | To:       | TL08         |               | Last Const.: | 9/2/2008      |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxi way_AC    |              | Zone:       | KBDN      |              | Category:     | L            | Rank:         | S     |
| Area:                | 38,299 SqFt  |                                | Length:                            | 608 Ft       |             | Width:    | 62 Ft        |               |              |               |       |
| Slabs:               | Slab Length: |                                | Ft                                 |              | Slab Width: | Ft        |              | Joint Length: | Ft           |               |       |
| Shoulder:            | Street Type: |                                |                                    |              | Grade:      | 0         |              | Lanes:        | 0            |               |       |
| Section Comments:    |              |                                |                                    |              |             |           |              |               |              |               |       |
| Work Date:           | 9/1/2008     |                                | Work Type: Base Course - Aggregate |              |             |           | Code:        | BA-AG         |              | Is Major M&R: | False |
| Work Date:           | 9/2/2008     |                                | Work Type: New Construction - AC   |              |             |           | Code:        | NC-AC         |              | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                      | 6            |             | Surveyed: | 3            |               |              |               |       |
| Conditions:          | PCI:         | 70                             |                                    |              |             |           |              |               |              |               |       |
| Inspection Comments: |              |                                |                                    |              |             |           |              |               |              |               |       |
| Sample Number:       | 01           |                                | Type:                              | R            |             | Area:     | 6559.00 SqFt |               | PCI:         | 70            |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |              |             |           |              |               |              |               |       |
| 48                   | L & T CR     |                                | L                                  | 260.00 Ft    |             |           |              |               |              |               |       |
| 57                   | WEATHERING   |                                | L                                  | 6559.00 SqFt |             |           |              |               |              |               |       |
| 48                   | L & T CR     |                                | M                                  | 200.00 Ft    |             |           |              |               |              |               |       |
| Sample Number:       | 03           |                                | Type:                              | R            |             | Area:     | 6215.00 SqFt |               | PCI:         | 74            |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |              |             |           |              |               |              |               |       |
| 48                   | L & T CR     |                                | M                                  | 135.00 Ft    |             |           |              |               |              |               |       |
| 57                   | WEATHERING   |                                | L                                  | 6215.00 SqFt |             |           |              |               |              |               |       |
| 48                   | L & T CR     |                                | L                                  | 320.00 Ft    |             |           |              |               |              |               |       |
| Sample Number:       | 05           |                                | Type:                              | R            |             | Area:     | 6212.00 SqFt |               | PCI:         | 65            |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |              |             |           |              |               |              |               |       |
| 48                   | L & T CR     |                                | M                                  | 300.00 Ft    |             |           |              |               |              |               |       |
| 48                   | L & T CR     |                                | L                                  | 200.00 Ft    |             |           |              |               |              |               |       |
| 57                   | WEATHERING   |                                | L                                  | 6212.00 SqFt |             |           |              |               |              |               |       |

|                      |                                |         |                                    |                   |                |           |         |               |              |                     |          |   |
|----------------------|--------------------------------|---------|------------------------------------|-------------------|----------------|-----------|---------|---------------|--------------|---------------------|----------|---|
| Network:             | Bend                           |         |                                    | Name:             | Bend Municipal |           |         |               |              |                     |          |   |
| Branch:              | TAEROBE                        |         | Name:                              | Aero Taxiway Bend |                | Use:      | TAXIWAY | Area:         | 331,001 SqFt |                     |          |   |
| Section:             | 03                             | of      | 8                                  | From:             | TL01           |           | To:     | TL08          |              | Last Const.:        | 9/2/2008 |   |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxi way_AC    |                   | Zone:          | KBDN      |         | Category:     | L            |                     | Rank:    | S |
| Area:                | 54,823 SqFt                    |         | Length:                            | 608 Ft            |                | Width:    | 86 Ft   |               |              |                     |          |   |
| Slabs:               | Slab Length:                   |         | Ft                                 |                   | Slab Width:    | Ft        |         | Joint Length: | Ft           |                     |          |   |
| Shoulder:            | Street Type:                   |         |                                    |                   | Grade:         | 0         |         | Lanes:        | 0            |                     |          |   |
| Section Comments:    |                                |         |                                    |                   |                |           |         |               |              |                     |          |   |
| Work Date:           | 9/1/2008                       |         | Work Type: Base Course - Aggregate |                   |                |           | Code:   | BA-AG         |              | Is Major M&R: False |          |   |
| Work Date:           | 9/2/2008                       |         | Work Type: New Construction - AC   |                   |                |           | Code:   | NC-AC         |              | Is Major M&R: True  |          |   |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                      | 12                |                | Surveyed: | 4       |               |              |                     |          |   |
| Conditions:          | PCI: 61                        |         |                                    |                   |                |           |         |               |              |                     |          |   |
| Inspection Comments: |                                |         |                                    |                   |                |           |         |               |              |                     |          |   |
| Sample Number:       | 03                             | Type:   | R                                  | Area:             | 4318.00 SqFt   |           | PCI:    | 59            |              |                     |          |   |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |                   |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | L                                  | 100.00 Ft         |                |           |         |               |              |                     |          |   |
| 57                   | WEATHERING                     |         | L                                  | 4318.00 SqFt      |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 110.00 Ft         |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 200.00 Ft         |                |           |         |               |              |                     |          |   |
| Sample Number:       | 06                             | Type:   | R                                  | Area:             | 4318.00 SqFt   |           | PCI:    | 59            |              |                     |          |   |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |                   |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 120.00 Ft         |                |           |         |               |              |                     |          |   |
| 57                   | WEATHERING                     |         | L                                  | 4318.00 SqFt      |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 200.00 Ft         |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | L                                  | 100.00 Ft         |                |           |         |               |              |                     |          |   |
| Sample Number:       | 09                             | Type:   | R                                  | Area:             | 4318.00 SqFt   |           | PCI:    | 59            |              |                     |          |   |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |                   |                |           |         |               |              |                     |          |   |
| 57                   | WEATHERING                     |         | L                                  | 4318.00 SqFt      |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 150.00 Ft         |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 82.00 Ft          |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 77.00 Ft          |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | L                                  | 100.00 Ft         |                |           |         |               |              |                     |          |   |
| Sample Number:       | 12                             | Type:   | R                                  | Area:             | 5658.00 SqFt   |           | PCI:    | 65            |              |                     |          |   |
| Sample Comments:     | Created by Inspection Schedule |         |                                    |                   |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 242.00 Ft         |                |           |         |               |              |                     |          |   |
| 48                   | L & T CR                       |         | M                                  | 36.00 Ft          |                |           |         |               |              |                     |          |   |
| 50                   | PATCHING                       |         | L                                  | 185.00 SqFt       |                |           |         |               |              |                     |          |   |
| 57                   | WEATHERING                     |         | L                                  | 5658.00 SqFt      |                |           |         |               |              |                     |          |   |

|                      |                                |         |                                 |               |                         |        |           |               |       |       |              |               |       |
|----------------------|--------------------------------|---------|---------------------------------|---------------|-------------------------|--------|-----------|---------------|-------|-------|--------------|---------------|-------|
| Network:             | Bend                           |         |                                 | Name:         | Bend Municipal          |        |           |               |       |       |              |               |       |
| Branch:              | TAEROBE                        |         |                                 | Name:         | Aero Taxiway Bend       |        | Use:      | TAXIWAY       |       | Area: | 331,001 SqFt |               |       |
| Section:             | 04                             | of 8    |                                 | From:         | TL01                    |        |           | To:           | TL08  |       | Last Const.: | 9/2/2008      |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxi way_AC |               | Zone:                   | KBDN   |           | Category:     | L     |       | Rank:        | S             |       |
| Area:                | 39,175 SqFt                    |         | Length:                         | 608 Ft        |                         | Width: | 59 Ft     |               |       |       |              |               |       |
| Slabs:               | Slab Length:                   |         | Ft                              |               | Slab Width:             | Ft     |           | Joint Length: | Ft    |       |              |               |       |
| Shoulder:            | Street Type:                   |         |                                 |               | Grade:                  | 0      |           | Lanes:        | 0     |       |              |               |       |
| Section Comments:    |                                |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| Work Date:           | 9/1/2008                       |         |                                 | Work Type:    | Base Course - Aggregate |        |           |               | Code: | BA-AG |              | Is Major M&R: | False |
| Work Date:           | 9/2/2008                       |         |                                 | Work Type:    | New Construction - AC   |        |           |               | Code: | NC-AC |              | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022                       |         |                                 | TotalSamples: | 7                       |        | Surveyed: | 4             |       |       |              |               |       |
| Conditions:          | PCI: 70                        |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| Inspection Comments: |                                |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| Sample Number:       | 02                             | Type:   | R                               | Area:         | 5927.00 SqFt            |        | PCI:      | 75            |       |       |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | M                               | 50.00         | Ft                      |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 115.00        | Ft                      |        |           |               |       |       |              |               |       |
| 57                   | WEATHERING                     |         | L                               | 5927.00       | SqFt                    |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 200.00        | Ft                      |        |           |               |       |       |              |               |       |
| Sample Number:       | 04                             | Type:   | R                               | Area:         | 5927.00 SqFt            |        | PCI:      | 67            |       |       |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 200.00        | Ft                      |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | M                               | 250.00        | Ft                      |        |           |               |       |       |              |               |       |
| 57                   | WEATHERING                     |         | L                               | 5927.00       | SqFt                    |        |           |               |       |       |              |               |       |
| Sample Number:       | 05                             | Type:   | R                               | Area:         | 5927.00 SqFt            |        | PCI:      | 71            |       |       |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | M                               | 53.00         | Ft                      |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 100.00        | Ft                      |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 82.00         | Ft                      |        |           |               |       |       |              |               |       |
| 57                   | WEATHERING                     |         | L                               | 5927.00       | SqFt                    |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | M                               | 125.00        | Ft                      |        |           |               |       |       |              |               |       |
| Sample Number:       | 07                             | Type:   | R                               | Area:         | 4094.00 SqFt            |        | PCI:      | 66            |       |       |              |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                 |               |                         |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 100.00        | Ft                      |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | M                               | 100.00        | Ft                      |        |           |               |       |       |              |               |       |
| 57                   | WEATHERING                     |         | L                               | 4094.00       | SqFt                    |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | M                               | 78.00         | Ft                      |        |           |               |       |       |              |               |       |
| 48                   | L & T CR                       |         | L                               | 70.00         | Ft                      |        |           |               |       |       |              |               |       |

|                      |              |                                |                                    |                   |                |           |         |               |              |                     |              |          |
|----------------------|--------------|--------------------------------|------------------------------------|-------------------|----------------|-----------|---------|---------------|--------------|---------------------|--------------|----------|
| Network:             | Bend         |                                |                                    | Name:             | Bend Municipal |           |         |               |              |                     |              |          |
| Branch:              | TAEROBE      |                                | Name:                              | Aero Taxiway Bend |                | Use:      | TAXIWAY | Area:         | 331,001 SqFt |                     |              |          |
| Section:             | 08           | of                             | 8                                  | From:             | TBB            |           |         | To:           | TL07         |                     | Last Const.: | 9/2/2008 |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxi way_AC    |                   | Zone:          | KBDN      |         | Category:     | L            |                     | Rank:        | S        |
| Area:                | 41,016 SqFt  |                                | Length:                            | 1,200 Ft          |                | Width:    | 34 Ft   |               |              |                     |              |          |
| Slabs:               | Slab Length: |                                | Ft                                 |                   | Slab Width:    | Ft        |         | Joint Length: | Ft           |                     |              |          |
| Shoulder:            | Street Type: |                                |                                    |                   | Grade:         | 0         |         | Lanes:        | 0            |                     |              |          |
| Section Comments:    |              |                                |                                    |                   |                |           |         |               |              |                     |              |          |
| Work Date:           | 9/1/2008     |                                | Work Type: Base Course - Aggregate |                   |                |           | Code:   | BA-AG         |              | Is Major M&R: False |              |          |
| Work Date:           | 9/2/2008     |                                | Work Type: New Construction - AC   |                   |                |           | Code:   | NC-AC         |              | Is Major M&R: True  |              |          |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                      | 8                 |                | Surveyed: |         | 4             |              |                     |              |          |
| Conditions:          | PCI: 70      |                                |                                    |                   |                |           |         |               |              |                     |              |          |
| Inspection Comments: |              |                                |                                    |                   |                |           |         |               |              |                     |              |          |
| Sample Number:       | 01           | Type:                          | R                                  | Area:             | 5529.00 SqFt   |           |         | PCI:          | 71           |                     |              |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |                   |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 250.00                             | Ft                |                |           |         |               |              |                     |              |          |
| 57                   | WEATHERING   | L                              | 5529.00                            | SqFt              |                |           |         |               |              |                     |              |          |
| Sample Number:       | 03           | Type:                          | R                                  | Area:             | 5073.00 SqFt   |           |         | PCI:          | 65           |                     |              |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |                   |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 69.00                              | Ft                |                |           |         |               |              |                     |              |          |
| 57                   | WEATHERING   | L                              | 5073.00                            | SqFt              |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 163.00                             | Ft                |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 103.00                             | Ft                |                |           |         |               |              |                     |              |          |
| Sample Number:       | 04           | Type:                          | R                                  | Area:             | 5073.00 SqFt   |           |         | PCI:          | 75           |                     |              |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |                   |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | L                              | 230.00                             | Ft                |                |           |         |               |              |                     |              |          |
| 57                   | WEATHERING   | L                              | 5073.00                            | SqFt              |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 98.00                              | Ft                |                |           |         |               |              |                     |              |          |
| Sample Number:       | 06           | Type:                          | R                                  | Area:             | 5073.00 SqFt   |           |         | PCI:          | 70           |                     |              |          |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |                   |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 37.00                              | Ft                |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | M                              | 128.00                             | Ft                |                |           |         |               |              |                     |              |          |
| 48                   | L & T CR     | L                              | 242.00                             | Ft                |                |           |         |               |              |                     |              |          |
| 57                   | WEATHERING   | L                              | 5073.00                            | SqFt              |                |           |         |               |              |                     |              |          |

|                      |              |                                |                                    |                |              |                                 |               |               |              |           |               |       |
|----------------------|--------------|--------------------------------|------------------------------------|----------------|--------------|---------------------------------|---------------|---------------|--------------|-----------|---------------|-------|
| Network:             | Bend         |                                | Name:                              | Bend Municipal |              |                                 |               |               |              |           |               |       |
| Branch:              | TB1BE        | Name:                          | Taxiway B1 Bend                    |                | Use:         | TAXIWAY                         | Area:         | 12,660 SqFt   |              |           |               |       |
| Section:             | 01           | of                             | 1                                  | From:          | Taxiway B    |                                 | To:           | Runway 34 End | Last Const.: | 10/3/2010 |               |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxi<br>way_AC | Zone:          | KBDN         |                                 | Category:     | L             | Rank:        | P         |               |       |
| Area:                | 12,660 SqFt  |                                | Length:                            | 210 Ft         |              | Width:                          | 35 Ft         |               |              |           |               |       |
| Slabs:               | Slab Length: |                                | Ft                                 | Slab Width:    |              | Ft                              | Joint Length: |               | Ft           |           |               |       |
| Shoulder:            | Street Type: |                                |                                    | Grade:         |              | 0                               | Lanes:        |               | 0            |           |               |       |
| Section Comments:    |              |                                |                                    |                |              |                                 |               |               |              |           |               |       |
| Work Date:           | 10/1/2010    |                                | Work Type:                         |                |              | Subbase - Aggregate             |               | Code:         | SB-AG        |           | Is Major M&R: | False |
| Work Date:           | 10/2/2010    |                                | Work Type:                         |                |              | Base Course - Crushed Aggregate |               | Code:         | BA-CA        |           | Is Major M&R: | False |
| Work Date:           | 10/3/2010    |                                | Work Type:                         |                |              | New Construction - AC           |               | Code:         | NC-AC        |           | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                      | 3              |              | Surveyed:                       |               | 3             |              |           |               |       |
| Conditions:          | PCI:         | 75                             |                                    |                |              |                                 |               |               |              |           |               |       |
| Inspection Comments: |              |                                |                                    |                |              |                                 |               |               |              |           |               |       |
| Sample Number:       | 01           | Type:                          | R                                  | Area:          | 2572.00 SqFt |                                 | PCI:          | 78            |              |           |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |                |              |                                 |               |               |              |           |               |       |
| 48                   | L & T CR     |                                | L                                  | 40.00 Ft       |              |                                 |               |               |              |           |               |       |
| 48                   | L & T CR     |                                | M                                  | 30.00 Ft       |              |                                 |               |               |              |           |               |       |
| 57                   | WEATHERING   |                                | L                                  | 2572.00 SqFt   |              |                                 |               |               |              |           |               |       |
| Sample Number:       | 02           | Type:                          | R                                  | Area:          | 5373.00 SqFt |                                 | PCI:          | 75            |              |           |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                    |                |              |                                 |               |               |              |           |               |       |
| 57                   | WEATHERING   |                                | M                                  | 5373.00 SqFt   |              |                                 |               |               |              |           |               |       |
| 48                   | L & T CR     |                                | L                                  | 104.00 Ft      |              |                                 |               |               |              |           |               |       |
| Sample Number:       | 03           | Type:                          | R                                  | Area:          | 4715.00 SqFt |                                 | PCI:          | 75            |              |           |               |       |
| Sample Comments:     |              |                                |                                    |                |              |                                 |               |               |              |           |               |       |
| 48                   | L & T CR     |                                | L                                  | 111.00 Ft      |              |                                 |               |               |              |           |               |       |
| 57                   | WEATHERING   |                                | M                                  | 4715.00 SqFt   |              |                                 |               |               |              |           |               |       |

|                      |              |                                |                                            |                 |              |           |         |               |       |               |           |   |
|----------------------|--------------|--------------------------------|--------------------------------------------|-----------------|--------------|-----------|---------|---------------|-------|---------------|-----------|---|
| Network:             | Bend         |                                | Name:                                      | Bend Municipal  |              |           |         |               |       |               |           |   |
| Branch:              | TB2BE        |                                | Name:                                      | Taxiway B2 Bend |              | Use:      | TAXIWAY |               | Area: | 11,307 SqFt   |           |   |
| Section:             | 01           | of 2                           | From:                                      | Runway 16/34    |              |           | To:     | TB2BE-02      |       | Last Const.:  | 10/3/2010 |   |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxi way_AC            |                 | Zone:        | KBDN      |         | Category:     | L     |               | Rank:     | P |
| Area:                | 8,364 SqFt   |                                | Length:                                    | 210 Ft          |              | Width:    | 35 Ft   |               |       |               |           |   |
| Slabs:               | Slab Length: |                                | Ft                                         |                 | Slab Width:  | Ft        |         | Joint Length: | Ft    |               |           |   |
| Shoulder:            | Street Type: |                                | Grade:                                     |                 | 0            |           | Lanes:  | 0             |       |               |           |   |
| Section Comments:    |              |                                |                                            |                 |              |           |         |               |       |               |           |   |
| Work Date:           | 10/1/2010    |                                | Work Type: Subbase - Aggregate             |                 |              |           | Code:   | SB-AG         |       | Is Major M&R: | False     |   |
| Work Date:           | 10/2/2010    |                                | Work Type: Base Course - Crushed Aggregate |                 |              |           | Code:   | BA-CA         |       | Is Major M&R: | False     |   |
| Work Date:           | 10/3/2010    |                                | Work Type: New Construction - AC           |                 |              |           | Code:   | NC-AC         |       | Is Major M&R: | True      |   |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                              | 2               |              | Surveyed: | 2       |               |       |               |           |   |
| Conditions:          | PCI:         | 75                             |                                            |                 |              |           |         |               |       |               |           |   |
| Inspection Comments: |              |                                |                                            |                 |              |           |         |               |       |               |           |   |
| Sample Number:       | 01           | Type:                          | R                                          | Area:           | 2665.00 SqFt |           | PCI:    | 75            |       |               |           |   |
| Sample Comments:     |              | Created by Inspection Schedule |                                            |                 |              |           |         |               |       |               |           |   |
| 57                   | WEATHERING   |                                | M                                          | 2665.00 SqFt    |              |           |         |               |       |               |           |   |
| 48                   | L & T CR     |                                | L                                          | 40.00 Ft        |              |           |         |               |       |               |           |   |
| Sample Number:       | 02           | Type:                          | R                                          | Area:           | 5699.00 SqFt |           | PCI:    | 75            |       |               |           |   |
| Sample Comments:     |              | Created by Inspection Schedule |                                            |                 |              |           |         |               |       |               |           |   |
| 48                   | L & T CR     |                                | L                                          | 42.00 Ft        |              |           |         |               |       |               |           |   |
| 57                   | WEATHERING   |                                | M                                          | 5000.00 SqFt    |              |           |         |               |       |               |           |   |
| 48                   | L & T CR     |                                | L                                          | 118.00 Ft       |              |           |         |               |       |               |           |   |
| 57                   | WEATHERING   |                                | L                                          | 699.00 SqFt     |              |           |         |               |       |               |           |   |

|                                                 |              |         |                                 |                                 |              |           |         |               |             |              |               |       |
|-------------------------------------------------|--------------|---------|---------------------------------|---------------------------------|--------------|-----------|---------|---------------|-------------|--------------|---------------|-------|
| Network:                                        | Bend         |         | Name:                           | Bend Municipal                  |              |           |         |               |             |              |               |       |
| Branch:                                         | TB2BE        |         | Name:                           | Taxiway B2 Bend                 |              | Use:      | TAXIWAY | Area:         | 11,307 SqFt |              |               |       |
| Section:                                        | 02           | of      | 2                               | From:                           | TB2BE-01     |           | To:     | Taxiway B     |             | Last Const.: | 10/3/2010     |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC |                                 | Zone:        | KBDN      |         | Category:     | L           |              | Rank:         | P     |
| Area:                                           | 2,943 SqFt   |         | Length:                         | 35 Ft                           |              | Width:    | 35 Ft   |               |             |              |               |       |
| Slabs:                                          | Slab Length: |         | Ft                              |                                 | Slab Width:  | Ft        |         | Joint Length: | Ft          |              |               |       |
| Shoulder:                                       | Street Type: |         | Grade:                          |                                 | 0            |           | Lanes:  | 0             |             |              |               |       |
| Section Comments:                               |              |         |                                 |                                 |              |           |         |               |             |              |               |       |
| Work Date:                                      | 10/1/2010    |         | Work Type:                      | Subbase - Aggregate             |              |           |         | Code:         | SB-AG       |              | Is Major M&R: | False |
| Work Date:                                      | 10/2/2010    |         | Work Type:                      | Base Course - Crushed Aggregate |              |           |         | Code:         | BA-CA       |              | Is Major M&R: | False |
| Work Date:                                      | 10/3/2010    |         | Work Type:                      | New Construction - AC           |              |           |         | Code:         | NC-AC       |              | Is Major M&R: | True  |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                   | 2                               |              | Surveyed: | 1       |               |             |              |               |       |
| Conditions:                                     | PCI:         | 80      |                                 |                                 |              |           |         |               |             |              |               |       |
| Inspection Comments:                            |              |         |                                 |                                 |              |           |         |               |             |              |               |       |
| Sample Number:                                  | 01           | Type:   | R                               | Area:                           | 2942.00 SqFt |           | PCI:    | 80            |             |              |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                 |                                 |              |           |         |               |             |              |               |       |
| 48                                              | L & T CR     |         | M                               | 5.00 Ft                         |              |           |         |               |             |              |               |       |
| 57                                              | WEATHERING   |         | L                               | 2942.00 SqFt                    |              |           |         |               |             |              |               |       |
| 48                                              | L & T CR     |         | L                               | 90.00 Ft                        |              |           |         |               |             |              |               |       |

|                             |                                |                |                                                   |                 |                    |                    |               |                  |                      |                                |
|-----------------------------|--------------------------------|----------------|---------------------------------------------------|-----------------|--------------------|--------------------|---------------|------------------|----------------------|--------------------------------|
| <b>Network:</b>             | Bend                           |                |                                                   | <b>Name:</b>    | Bend Municipal     |                    |               |                  |                      |                                |
| <b>Branch:</b>              | TB3BE                          |                | <b>Name:</b>                                      | Taxiway B3 Bend |                    | <b>Use:</b>        | TAXIWAY       | <b>Area:</b>     | 11,307 SqFt          |                                |
| <b>Section:</b>             | 02                             | of 2           | <b>From:</b>                                      | TB3BE-01        |                    |                    | <b>To:</b>    | Taxiway B        |                      |                                |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxiway_AC                    |                 | <b>Zone:</b>       | KBDN               |               | <b>Category:</b> | L                    |                                |
| <b>Area:</b>                | 2,949 SqFt                     |                | <b>Length:</b>                                    | 35 Ft           |                    | <b>Width:</b>      | 35 Ft         |                  |                      |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                |                 | <b>Slab Width:</b> |                    | Ft            |                  | <b>Joint Length:</b> | Ft                             |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                | <b>Grade:</b>                                     |                 | 0                  |                    | <b>Lanes:</b> |                  | 0                    |                                |
| <b>Section Comments:</b>    |                                |                |                                                   |                 |                    |                    |               |                  |                      |                                |
| <b>Work Date:</b>           | 10/1/2010                      |                | <b>Work Type:</b> Subbase - Aggregate             |                 |                    |                    | <b>Code:</b>  | SB-AG            |                      | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 10/2/2010                      |                | <b>Work Type:</b> Base Course - Crushed Aggregate |                 |                    |                    | <b>Code:</b>  | BA-CA            |                      | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 10/3/2010                      |                | <b>Work Type:</b> New Construction - AC           |                 |                    |                    | <b>Code:</b>  | NC-AC            |                      | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 7/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC              |                 |                    |                    | <b>Code:</b>  | CS-AC            |                      | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                              | 2               |                    | <b>Surveyed:</b> 1 |               |                  |                      |                                |
| <b>Conditions:</b>          | PCI: 84                        |                |                                                   |                 |                    |                    |               |                  |                      |                                |
| <b>Inspection Comments:</b> |                                |                |                                                   |                 |                    |                    |               |                  |                      |                                |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                 | <b>Area:</b>    | 2947.00 SqFt       |                    | <b>PCI:</b>   | 84               |                      |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                   |                 |                    |                    |               |                  |                      |                                |
| 48                          | L & T CR                       |                | L                                                 | 60.00 Ft        |                    |                    |               |                  |                      |                                |
| 48                          | L & T CR                       |                | M                                                 | 3.00 Ft         |                    |                    |               |                  |                      |                                |
| 57                          | WEATHERING                     |                | L                                                 | 2947.00 SqFt    |                    |                    |               |                  |                      |                                |

|                                                 |              |         |                                            |                 |              |           |         |                  |       |               |           |   |
|-------------------------------------------------|--------------|---------|--------------------------------------------|-----------------|--------------|-----------|---------|------------------|-------|---------------|-----------|---|
| Network:                                        | Bend         |         | Name:                                      | Bend Municipal  |              |           |         |                  |       |               |           |   |
| Branch:                                         | TB3BE        |         | Name:                                      | Taxiway B3 Bend |              | Use:      | TAXIWAY |                  | Area: | 11,307 SqFt   |           |   |
| Section:                                        | 01           | of      | 2                                          | From:           | Runway 16/34 |           | To:     | ccc:Runway 16/34 |       | Last Const.:  | 10/3/2010 |   |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC            |                 | Zone:        | KBDN      |         | Category:        | L     |               | Rank:     | P |
| Area:                                           | 8,358 SqFt   |         | Length:                                    | 210 Ft          |              | Width:    | 35 Ft   |                  |       |               |           |   |
| Slabs:                                          | Slab Length: |         | Ft                                         |                 | Slab Width:  | Ft        |         | Joint Length:    | Ft    |               |           |   |
| Shoulder:                                       | Street Type: |         |                                            |                 | Grade:       | 0         |         | Lanes:           | 0     |               |           |   |
| Section Comments:                               |              |         |                                            |                 |              |           |         |                  |       |               |           |   |
| Work Date:                                      | 10/1/2010    |         | Work Type: Subbase - Aggregate             |                 |              |           | Code:   | SB-AG            |       | Is Major M&R: | False     |   |
| Work Date:                                      | 10/2/2010    |         | Work Type: Base Course - Crushed Aggregate |                 |              |           | Code:   | BA-CA            |       | Is Major M&R: | False     |   |
| Work Date:                                      | 10/3/2010    |         | Work Type: New Construction - AC           |                 |              |           | Code:   | NC-AC            |       | Is Major M&R: | True      |   |
| Work Date:                                      | 7/1/2015     |         | Work Type: Crack Sealing - AC              |                 |              |           | Code:   | CS-AC            |       | Is Major M&R: | False     |   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                              | 2               |              | Surveyed: | 2       |                  |       |               |           |   |
| Conditions:                                     | PCI: 71      |         |                                            |                 |              |           |         |                  |       |               |           |   |
| Inspection Comments:                            |              |         |                                            |                 |              |           |         |                  |       |               |           |   |
| Sample Number:                                  | 01           | Type:   | R                                          | Area:           | 2659.00 SqFt |           | PCI:    | 75               |       |               |           |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                            |                 |              |           |         |                  |       |               |           |   |
| 48                                              | L & T CR     |         | L                                          | 73.00           | Ft           |           |         |                  |       |               |           |   |
| 57                                              | WEATHERING   |         | M                                          | 2659.00         | SqFt         |           |         |                  |       |               |           |   |
| Sample Number:                                  | 02           | Type:   | R                                          | Area:           | 5699.00 SqFt |           | PCI:    | 70               |       |               |           |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                            |                 |              |           |         |                  |       |               |           |   |
| 48                                              | L & T CR     |         | L                                          | 74.00           | Ft           |           |         |                  |       |               |           |   |
| 57                                              | WEATHERING   |         | M                                          | 5699.00         | SqFt         |           |         |                  |       |               |           |   |
| 48                                              | L & T CR     |         | M                                          | 56.00           | Ft           |           |         |                  |       |               |           |   |

|                      |              |                                |                                |                                 |              |                |         |               |             |              |               |       |
|----------------------|--------------|--------------------------------|--------------------------------|---------------------------------|--------------|----------------|---------|---------------|-------------|--------------|---------------|-------|
| Network:             |              | Bend                           |                                | Name:                           |              | Bend Municipal |         |               |             |              |               |       |
| Branch:              | TB4BE        |                                | Name:                          | Taxiway B4 Bend                 |              | Use:           | TAXIWAY | Area:         | 11,307 SqFt |              |               |       |
| Section:             | 01           | of 2                           |                                | From:                           | Runway 16/34 |                | To:     | TB4BE-02      |             | Last Const.: | 10/3/2010     |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxiway_AC |                                 | Zone:        | KBDN           |         | Category:     | L           |              | Rank:         | P     |
| Area:                | 8,361 SqFt   |                                | Length:                        | 210 Ft                          |              | Width:         | 35 Ft   |               |             |              |               |       |
| Slabs:               | Slab Length: |                                | Ft                             |                                 | Slab Width:  | Ft             |         | Joint Length: | Ft          |              |               |       |
| Shoulder:            | Street Type: |                                |                                |                                 | Grade:       | 0              |         | Lanes:        | 0           |              |               |       |
| Section Comments:    |              |                                |                                |                                 |              |                |         |               |             |              |               |       |
| Work Date:           | 10/1/2010    |                                | Work Type:                     | Subbase - Aggregate             |              |                |         | Code:         | SB-AG       |              | Is Major M&R: | False |
| Work Date:           | 10/2/2010    |                                | Work Type:                     | Base Course - Crushed Aggregate |              |                |         | Code:         | BA-CA       |              | Is Major M&R: | False |
| Work Date:           | 10/3/2010    |                                | Work Type:                     | New Construction - AC           |              |                |         | Code:         | NC-AC       |              | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                  | 2                               |              | Surveyed:      | 2       |               |             |              |               |       |
| Conditions:          | PCI: 75      |                                |                                |                                 |              |                |         |               |             |              |               |       |
| Inspection Comments: |              |                                |                                |                                 |              |                |         |               |             |              |               |       |
| Sample Number:       | 01           | Type:                          | R                              | Area:                           | 2662.00 SqFt |                | PCI:    | 76            |             |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                |                                 |              |                |         |               |             |              |               |       |
| 57                   | WEATHERING   |                                | M                              | 2662.00                         | SqFt         |                |         |               |             |              |               |       |
| 48                   | L & T CR     |                                | L                              | 12.00                           | Ft           |                |         |               |             |              |               |       |
| Sample Number:       | 02           | Type:                          | R                              | Area:                           | 5699.00 SqFt |                | PCI:    | 75            |             |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                |                                 |              |                |         |               |             |              |               |       |
| 48                   | L & T CR     |                                | M                              | 17.00                           | Ft           |                |         |               |             |              |               |       |
| 48                   | L & T CR     |                                | M                              | 56.00                           | Ft           |                |         |               |             |              |               |       |
| 57                   | WEATHERING   |                                | M                              | 5699.00                         | SqFt         |                |         |               |             |              |               |       |

|                                                 |              |         |                                            |                 |                |             |           |           |                        |                     |
|-------------------------------------------------|--------------|---------|--------------------------------------------|-----------------|----------------|-------------|-----------|-----------|------------------------|---------------------|
| Network:                                        | Bend         |         |                                            | Name:           | Bend Municipal |             |           |           |                        |                     |
| Branch:                                         | TB4BE        |         | Name:                                      | Taxiway B4 Bend |                | Use:        | TAXIWAY   | Area:     | 11,307 SqFt            |                     |
| Section:                                        | 02           | of      | 2                                          | From:           | TB4BE-01       |             | To:       | Taxiway B | Last Const.: 10/3/2010 |                     |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi<br>way_AC         | Zone:           | KBDN           |             | Category: | L         | Rank: P                |                     |
| Area:                                           | 2,946 SqFt   |         | Length:                                    | 35 Ft           |                | Width:      | 35 Ft     |           |                        |                     |
| Slabs:                                          | Slab Length: |         | Ft                                         |                 | Slab Width:    |             | Ft        |           | Joint Length:          | Ft                  |
| Shoulder:                                       | Street Type: |         |                                            |                 | Grade:         | 0           |           | Lanes:    | 0                      |                     |
| Section Comments:                               |              |         |                                            |                 |                |             |           |           |                        |                     |
| Work Date:                                      | 10/1/2010    |         | Work Type: Subbase - Aggregate             |                 |                |             | Code:     | SB-AG     |                        | Is Major M&R: False |
| Work Date:                                      | 10/2/2010    |         | Work Type: Base Course - Crushed Aggregate |                 |                |             | Code:     | BA-CA     |                        | Is Major M&R: False |
| Work Date:                                      | 10/3/2010    |         | Work Type: New Construction - AC           |                 |                |             | Code:     | NC-AC     |                        | Is Major M&R: True  |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                              | 2               |                | Surveyed: 1 |           |           |                        |                     |
| Conditions:                                     | PCI: 75      |         |                                            |                 |                |             |           |           |                        |                     |
| Inspection Comments:                            |              |         |                                            |                 |                |             |           |           |                        |                     |
| Sample Number:                                  | 01           | Type:   | R                                          | Area:           | 2945.00 SqFt   |             | PCI:      | 75        |                        |                     |
| Sample Comments: Created by Inspection Schedule |              |         |                                            |                 |                |             |           |           |                        |                     |
| 57                                              | WEATHERING   |         | L                                          | 1500.00 SqFt    |                |             |           |           |                        |                     |
| 57                                              | WEATHERING   |         | M                                          | 1445.00 SqFt    |                |             |           |           |                        |                     |
| 48                                              | L & T CR     |         | L                                          | 110.00 Ft       |                |             |           |           |                        |                     |

|                             |                                |                |                                                   |              |                    |                  |                  |                      |              |                          |       |
|-----------------------------|--------------------------------|----------------|---------------------------------------------------|--------------|--------------------|------------------|------------------|----------------------|--------------|--------------------------|-------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                                      |              | Bend Municipal     |                  |                  |                      |              |                          |       |
| <b>Branch:</b>              | TB5BE                          | <b>Name:</b>   | Taxiway B5 Bend                                   |              | <b>Use:</b>        | TAXIWAY          | <b>Area:</b>     | 11,307 SqFt          |              |                          |       |
| <b>Section:</b>             | 01                             | of 2           | <b>From:</b>                                      | Runway 16/34 |                    | <b>To:</b>       | TB5BE-02         | <b>Last Const.:</b>  | 10/3/2010    |                          |       |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxiway_AC                    |              | <b>Zone:</b>       | KBDN             | <b>Category:</b> | L                    | <b>Rank:</b> | P                        |       |
| <b>Area:</b>                | 8,431 SqFt                     |                | <b>Length:</b>                                    | 210 Ft       |                    | <b>Width:</b>    | 35 Ft            |                      |              |                          |       |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                |              | <b>Slab Width:</b> | Ft               |                  | <b>Joint Length:</b> | Ft           |                          |       |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                   |              | <b>Grade:</b>      | 0                |                  | <b>Lanes:</b>        | 0            |                          |       |
| <b>Section Comments:</b>    |                                |                |                                                   |              |                    |                  |                  |                      |              |                          |       |
| <b>Work Date:</b>           | 10/1/2010                      |                | <b>Work Type:</b> Subbase - Aggregate             |              |                    |                  | <b>Code:</b>     | SB-AG                |              | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>           | 10/2/2010                      |                | <b>Work Type:</b> Base Course - Crushed Aggregate |              |                    |                  | <b>Code:</b>     | BA-CA                |              | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>           | 10/3/2010                      |                | <b>Work Type:</b> New Construction - AC           |              |                    |                  | <b>Code:</b>     | NC-AC                |              | <b>Is Major M&amp;R:</b> | True  |
| <b>Work Date:</b>           | 7/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC              |              |                    |                  | <b>Code:</b>     | CS-AC                |              | <b>Is Major M&amp;R:</b> | False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                              | 2            |                    | <b>Surveyed:</b> | 2                |                      |              |                          |       |
| <b>Conditions:</b>          | PCI: 68                        |                |                                                   |              |                    |                  |                  |                      |              |                          |       |
| <b>Inspection Comments:</b> |                                |                |                                                   |              |                    |                  |                  |                      |              |                          |       |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                 | <b>Area:</b> | 2732.00 SqFt       |                  | <b>PCI:</b>      | 75                   |              |                          |       |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                   |              |                    |                  |                  |                      |              |                          |       |
| 48                          | L & T CR                       | L              | 48.00                                             | Ft           |                    |                  |                  |                      |              |                          |       |
| 57                          | WEATHERING                     | M              | 2732.00                                           | SqFt         |                    |                  |                  |                      |              |                          |       |
| <b>Sample Number:</b>       | 02                             | <b>Type:</b>   | R                                                 | <b>Area:</b> | 5699.00 SqFt       |                  | <b>PCI:</b>      | 65                   |              |                          |       |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                   |              |                    |                  |                  |                      |              |                          |       |
| 48                          | L & T CR                       | L              | 106.00                                            | Ft           |                    |                  |                  |                      |              |                          |       |
| 48                          | L & T CR                       | M              | 20.00                                             | Ft           |                    |                  |                  |                      |              |                          |       |
| 57                          | WEATHERING                     | M              | 5699.00                                           | SqFt         |                    |                  |                  |                      |              |                          |       |
| 41                          | ALLIGATOR CR                   | L              | 10.00                                             | SqFt         |                    |                  |                  |                      |              |                          |       |

|                             |                                |                |                                                   |                 |                    |                  |              |                  |                      |                                |
|-----------------------------|--------------------------------|----------------|---------------------------------------------------|-----------------|--------------------|------------------|--------------|------------------|----------------------|--------------------------------|
| <b>Network:</b>             |                                | Bend           |                                                   | <b>Name:</b>    |                    | Bend Municipal   |              |                  |                      |                                |
| <b>Branch:</b>              | TB5BE                          |                | <b>Name:</b>                                      | Taxiway B5 Bend |                    | <b>Use:</b>      | TAXIWAY      | <b>Area:</b>     | 11,307 SqFt          |                                |
| <b>Section:</b>             | 02                             | of             | 2                                                 | <b>From:</b>    | TB5BE-01           |                  | <b>To:</b>   | Taxiway B        |                      |                                |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxiway_AC                    |                 | <b>Zone:</b>       | KBDN             |              | <b>Category:</b> | L                    |                                |
| <b>Area:</b>                | 2,876 SqFt                     |                | <b>Length:</b>                                    | 35 Ft           |                    | <b>Width:</b>    | 35 Ft        |                  |                      |                                |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                                                |                 | <b>Slab Width:</b> |                  | Ft           |                  | <b>Joint Length:</b> | Ft                             |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                |                                                   |                 | <b>Grade:</b>      | 0                |              | <b>Lanes:</b>    | 0                    |                                |
| <b>Section Comments:</b>    |                                |                |                                                   |                 |                    |                  |              |                  |                      |                                |
| <b>Work Date:</b>           | 10/1/2010                      |                | <b>Work Type:</b> Subbase - Aggregate             |                 |                    |                  | <b>Code:</b> | SB-AG            |                      | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 10/2/2010                      |                | <b>Work Type:</b> Base Course - Crushed Aggregate |                 |                    |                  | <b>Code:</b> | BA-CA            |                      | <b>Is Major M&amp;R:</b> False |
| <b>Work Date:</b>           | 10/3/2010                      |                | <b>Work Type:</b> New Construction - AC           |                 |                    |                  | <b>Code:</b> | NC-AC            |                      | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b>           | 7/1/2015                       |                | <b>Work Type:</b> Crack Sealing - AC              |                 |                    |                  | <b>Code:</b> | CS-AC            |                      | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>                              | 2               |                    | <b>Surveyed:</b> | 1            |                  |                      |                                |
| <b>Conditions:</b>          | PCI: 70                        |                |                                                   |                 |                    |                  |              |                  |                      |                                |
| <b>Inspection Comments:</b> |                                |                |                                                   |                 |                    |                  |              |                  |                      |                                |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                                                 | <b>Area:</b>    | 2876.00 SqFt       |                  | <b>PCI:</b>  | 70               |                      |                                |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                                   |                 |                    |                  |              |                  |                      |                                |
| 48                          | L & T CR                       |                | M                                                 | 10.00 Ft        |                    |                  |              |                  |                      |                                |
| 57                          | WEATHERING                     |                | M                                                 | 1426.00 SqFt    |                    |                  |              |                  |                      |                                |
| 48                          | L & T CR                       |                | L                                                 | 115.00 Ft       |                    |                  |              |                  |                      |                                |
| 57                          | WEATHERING                     |                | L                                                 | 1450.00 SqFt    |                    |                  |              |                  |                      |                                |

|                                                 |              |         |                                            |                 |               |           |         |               |       |               |           |   |
|-------------------------------------------------|--------------|---------|--------------------------------------------|-----------------|---------------|-----------|---------|---------------|-------|---------------|-----------|---|
| Network:                                        | Bend         |         | Name:                                      | Bend Municipal  |               |           |         |               |       |               |           |   |
| Branch:                                         | TB6BE        |         | Name:                                      | Taxiway B6 Bend |               | Use:      | TAXIWAY |               | Area: | 14,755 SqFt   |           |   |
| Section:                                        | 01           | of      | 2                                          | From:           | Runway 16 End |           | To:     | TB6BE-02      |       | Last Const.:  | 10/3/2010 |   |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxiway_AC             |                 | Zone:         | KBDN      |         | Category:     | L     |               | Rank:     | P |
| Area:                                           | 12,729 SqFt  |         | Length:                                    | 210 Ft          |               | Width:    | 37 Ft   |               |       |               |           |   |
| Slabs:                                          | Slab Length: |         | Ft                                         |                 | Slab Width:   | Ft        |         | Joint Length: | Ft    |               |           |   |
| Shoulder:                                       | Street Type: |         | Grade:                                     |                 | 0             |           | Lanes:  | 0             |       |               |           |   |
| Section Comments:                               |              |         |                                            |                 |               |           |         |               |       |               |           |   |
| Work Date:                                      | 10/1/2010    |         | Work Type: Subbase - Aggregate             |                 |               |           | Code:   | SB-AG         |       | Is Major M&R: | False     |   |
| Work Date:                                      | 10/2/2010    |         | Work Type: Base Course - Crushed Aggregate |                 |               |           | Code:   | BA-CA         |       | Is Major M&R: | False     |   |
| Work Date:                                      | 10/3/2010    |         | Work Type: New Construction - AC           |                 |               |           | Code:   | NC-AC         |       | Is Major M&R: | True      |   |
| Work Date:                                      | 7/1/2015     |         | Work Type: Crack Sealing - AC              |                 |               |           | Code:   | CS-AC         |       | Is Major M&R: | False     |   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                              | 3               |               | Surveyed: | 3       |               |       |               |           |   |
| Conditions:                                     | PCI:         | 77      |                                            |                 |               |           |         |               |       |               |           |   |
| Inspection Comments:                            |              |         |                                            |                 |               |           |         |               |       |               |           |   |
| Sample Number:                                  | 01           | Type:   | R                                          | Area:           | 2572.00 SqFt  |           | PCI:    | 78            |       |               |           |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                            |                 |               |           |         |               |       |               |           |   |
| 57                                              | WEATHERING   |         | L                                          | 2572.00 SqFt    |               |           |         |               |       |               |           |   |
| 48                                              | L & T CR     |         | M                                          | 28.00 Ft        |               |           |         |               |       |               |           |   |
| 48                                              | L & T CR     |         | L                                          | 70.00 Ft        |               |           |         |               |       |               |           |   |
| Sample Number:                                  | 02           | Type:   | R                                          | Area:           | 5373.00 SqFt  |           | PCI:    | 78            |       |               |           |   |
| Sample Comments: Created by Inspection Schedule |              |         |                                            |                 |               |           |         |               |       |               |           |   |
| 48                                              | L & T CR     |         | M                                          | 70.00 Ft        |               |           |         |               |       |               |           |   |
| 48                                              | L & T CR     |         | L                                          | 56.00 Ft        |               |           |         |               |       |               |           |   |
| 57                                              | WEATHERING   |         | L                                          | 5373.00 SqFt    |               |           |         |               |       |               |           |   |
| Sample Number:                                  | 03           | Type:   | R                                          | Area:           | 4784.00 SqFt  |           | PCI:    | 75            |       |               |           |   |
| Sample Comments:                                |              |         |                                            |                 |               |           |         |               |       |               |           |   |
| 48                                              | L & T CR     |         | M                                          | 145.00 Ft       |               |           |         |               |       |               |           |   |
| 57                                              | WEATHERING   |         | L                                          | 4784.00 SqFt    |               |           |         |               |       |               |           |   |

|                      |                                |               |                                 |           |                |           |           |               |           |
|----------------------|--------------------------------|---------------|---------------------------------|-----------|----------------|-----------|-----------|---------------|-----------|
| Network:             | Bend                           |               |                                 | Name:     | Bend Municipal |           |           |               |           |
| Branch:              | TB6BE                          | Name:         | Taxiway B6 Bend                 |           | Use:           | TAXIWAY   | Area:     | 14,755 SqFt   |           |
| Section:             | 02                             | of            | 2                               | From:     | TB6BE-02       | To:       | Taxiway B | Last Const.:  | 10/3/2010 |
| Surface:             | AC                             | Family:       | 2022_Central_Cat1/2_Taxiway_AC  | Zone:     | KBDN           | Category: | L         | Rank:         | P         |
| Area:                | 2,026 SqFt                     | Length:       | 35 Ft                           | Width:    | 37 Ft          |           |           |               |           |
| Slabs:               | Slab Length:                   | Ft            | Slab Width:                     | Ft        | Joint Length:  | Ft        |           |               |           |
| Shoulder:            | Street Type:                   | Grade:        | 0                               | Lanes:    | 0              |           |           |               |           |
| Section Comments:    |                                |               |                                 |           |                |           |           |               |           |
| Work Date:           | 10/1/2010                      | Work Type:    | Subbase - Aggregate             |           |                | Code:     | SB-AG     | Is Major M&R: | False     |
| Work Date:           | 10/2/2010                      | Work Type:    | Base Course - Crushed Aggregate |           |                | Code:     | BA-CA     | Is Major M&R: | False     |
| Work Date:           | 10/3/2010                      | Work Type:    | New Construction - AC           |           |                | Code:     | NC-AC     | Is Major M&R: | True      |
| Work Date:           | 7/1/2015                       | Work Type:    | Crack Sealing - AC              |           |                | Code:     | CS-AC     | Is Major M&R: | False     |
| Last Insp. Date:     | 3/1/2022                       | TotalSamples: | 3                               | Surveyed: | 1              |           |           |               |           |
| Conditions:          | PCI:                           | 70            |                                 |           |                |           |           |               |           |
| Inspection Comments: |                                |               |                                 |           |                |           |           |               |           |
| Sample Number:       | 01                             | Type:         | R                               | Area:     | 2026.00 SqFt   | PCI:      | 70        |               |           |
| Sample Comments:     | Created by Inspection Schedule |               |                                 |           |                |           |           |               |           |
| 57                   | WEATHERING                     | L             | 1000.00                         | SqFt      |                |           |           |               |           |
| 48                   | L & T CR                       | M             | 25.00                           | Ft        |                |           |           |               |           |
| 48                   | L & T CR                       | L             | 50.00                           | Ft        |                |           |           |               |           |
| 57                   | WEATHERING                     | M             | 1026.00                         | SqFt      |                |           |           |               |           |

|                      |                                |         |                                            |                 |                |           |         |               |               |       |
|----------------------|--------------------------------|---------|--------------------------------------------|-----------------|----------------|-----------|---------|---------------|---------------|-------|
| Network:             | Bend                           |         |                                            | Name:           | Bend Municipal |           |         |               |               |       |
| Branch:              | TBBBE                          |         | Name:                                      | Taxiway BB Bend |                | Use:      | TAXIWAY | Area:         | 36,692 SqFt   |       |
| Section:             | 01                             | of      | 1                                          | From:           | TB             | To:       | T08     | Last Const.:  | 10/3/2010     |       |
| Surface:             | AC                             | Family: | 2022_Central_Cat1/2_Taxiway_AC             | Zone:           | KBDN           | Category: | L       | Rank:         | S             |       |
| Area:                | 36,692 SqFt                    |         | Length:                                    | 835 Ft          |                | Width:    | 35 Ft   |               |               |       |
| Slabs:               | Slab Length:                   |         | Ft                                         |                 | Slab Width:    | Ft        |         | Joint Length: | Ft            |       |
| Shoulder:            | Street Type:                   |         | Grade:                                     |                 | 0              |           | Lanes:  | 0             |               |       |
| Section Comments:    |                                |         |                                            |                 |                |           |         |               |               |       |
| Work Date:           | 10/1/2010                      |         | Work Type: Subbase - Aggregate             |                 |                |           | Code:   | SB-AG         | Is Major M&R: | False |
| Work Date:           | 10/2/2010                      |         | Work Type: Base Course - Crushed Aggregate |                 |                |           | Code:   | BA-CA         | Is Major M&R: | False |
| Work Date:           | 10/3/2010                      |         | Work Type: New Construction - AC           |                 |                |           | Code:   | NC-AC         | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022                       |         | TotalSamples:                              | 7               |                | Surveyed: | 4       |               |               |       |
| Conditions:          | PCI: 81                        |         |                                            |                 |                |           |         |               |               |       |
| Inspection Comments: |                                |         |                                            |                 |                |           |         |               |               |       |
| Sample Number:       | 02                             | Type:   | R                                          | Area:           | 5258.00 SqFt   |           | PCI:    | 75            |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                 |                |           |         |               |               |       |
| 48                   | L & T CR                       | L       | 150.00                                     | Ft              |                |           |         |               |               |       |
| 48                   | L & T CR                       | L       | 75.00                                      | Ft              |                |           |         |               |               |       |
| 57                   | WEATHERING                     | M       | 5258.00                                    | SqFt            |                |           |         |               |               |       |
| Sample Number:       | 04                             | Type:   | R                                          | Area:           | 5248.00 SqFt   |           | PCI:    | 83            |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                 |                |           |         |               |               |       |
| 48                   | L & T CR                       | L       | 150.00                                     | Ft              |                |           |         |               |               |       |
| 48                   | L & T CR                       | L       | 39.00                                      | Ft              |                |           |         |               |               |       |
| 57                   | WEATHERING                     | L       | 5248.00                                    | SqFt            |                |           |         |               |               |       |
| Sample Number:       | 06                             | Type:   | R                                          | Area:           | 5248.00 SqFt   |           | PCI:    | 76            |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                 |                |           |         |               |               |       |
| 48                   | L & T CR                       | L       | 56.00                                      | Ft              |                |           |         |               |               |       |
| 57                   | WEATHERING                     | L       | 5248.00                                    | SqFt            |                |           |         |               |               |       |
| 48                   | L & T CR                       | M       | 99.00                                      | Ft              |                |           |         |               |               |       |
| Sample Number:       | 07                             | Type:   | R                                          | Area:           | 5526.00 SqFt   |           | PCI:    | 88            |               |       |
| Sample Comments:     | Created by Inspection Schedule |         |                                            |                 |                |           |         |               |               |       |
| 48                   | L & T CR                       | L       | 100.00                                     | Ft              |                |           |         |               |               |       |
| 57                   | WEATHERING                     | L       | 5526.00                                    | SqFt            |                |           |         |               |               |       |

|                                                 |              |              |                                 |                |              |               |            |               |       |
|-------------------------------------------------|--------------|--------------|---------------------------------|----------------|--------------|---------------|------------|---------------|-------|
| Network:                                        | Bend         |              | Name:                           | Bend Municipal |              |               |            |               |       |
| Branch:                                         | TBBE         | Name:        | Taxiway B Bend                  |                | Use:         | TAXIWAY       | Area:      | 181,500 SqFt  |       |
| Section:                                        | 01           | of 1         | From:                           | Taxiway B1     |              | To:           | Taxiway B6 |               |       |
| Surface:                                        | AC           | Family:      | 2022_Central_Cat1/2_Taxiway_AC  | Zone:          | KBDN         | Category:     | L          | Rank:         | P     |
| Area:                                           | 181,500 SqFt | Length:      | 5,200 Ft                        | Width:         | 35 Ft        |               |            |               |       |
| Slabs:                                          |              | Slab Length: | Ft                              | Slab Width:    | Ft           | Joint Length: | Ft         |               |       |
| Shoulder:                                       |              | Street Type: |                                 | Grade:         | 0            | Lanes:        | 0          |               |       |
| Section Comments:                               |              |              |                                 |                |              |               |            |               |       |
| Work Date:                                      | 10/1/2010    | Work Type:   | Subbase - Aggregate             |                |              | Code:         | SB-AG      | Is Major M&R: | False |
| Work Date:                                      | 10/2/2010    | Work Type:   | Base Course - Crushed Aggregate |                |              | Code:         | BA-CA      | Is Major M&R: | False |
| Work Date:                                      | 10/3/2010    | Work Type:   | New Construction - AC           |                |              | Code:         | NC-AC      | Is Major M&R: | True  |
| Last Insp. Date: 3/1/2022                       |              |              |                                 |                |              |               |            |               |       |
| TotalSamples:                                   |              | 35           | Surveyed:                       |                | 6            |               |            |               |       |
| Conditions:                                     | PCI:         | 72           |                                 |                |              |               |            |               |       |
| Inspection Comments:                            |              |              |                                 |                |              |               |            |               |       |
| Sample Number:                                  | 01           | Type:        | R                               | Area:          | 5154.00 SqFt | PCI:          | 79         |               |       |
| Sample Comments: Created by Inspection Schedule |              |              |                                 |                |              |               |            |               |       |
| 57                                              | WEATHERING   | L            | 5154.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 182.00 Ft                       |                |              |               |            |               |       |
| 48                                              | L & T CR     | M            | 15.00 Ft                        |                |              |               |            |               |       |
| Sample Number:                                  | 09           | Type:        | R                               | Area:          | 5250.00 SqFt | PCI:          | 70         |               |       |
| Sample Comments: Created by Inspection Schedule |              |              |                                 |                |              |               |            |               |       |
| 48                                              | L & T CR     | M            | 14.00 Ft                        |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 75.00 Ft                        |                |              |               |            |               |       |
| 57                                              | WEATHERING   | M            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | M            | 25.00 Ft                        |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 150.00 Ft                       |                |              |               |            |               |       |
| 57                                              | WEATHERING   | L            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 25.00 Ft                        |                |              |               |            |               |       |
| Sample Number:                                  | 13           | Type:        | R                               | Area:          | 5250.00 SqFt | PCI:          | 67         |               |       |
| Sample Comments: Created by Inspection Schedule |              |              |                                 |                |              |               |            |               |       |
| 48                                              | L & T CR     | M            | 13.00 Ft                        |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 128.00 Ft                       |                |              |               |            |               |       |
| 57                                              | WEATHERING   | L            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 40.00 Ft                        |                |              |               |            |               |       |
| 57                                              | WEATHERING   | M            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 50                                              | PATCHING     | L            | 45.00 SqFt                      |                |              |               |            |               |       |
| Sample Number:                                  | 20           | Type:        | R                               | Area:          | 5250.00 SqFt | PCI:          | 70         |               |       |
| Sample Comments: Created by Inspection Schedule |              |              |                                 |                |              |               |            |               |       |
| 50                                              | PATCHING     | L            | 120.00 SqFt                     |                |              |               |            |               |       |
| 57                                              | WEATHERING   | M            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 50.00 Ft                        |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 142.00 Ft                       |                |              |               |            |               |       |
| 57                                              | WEATHERING   | L            | 2625.00 SqFt                    |                |              |               |            |               |       |
| Sample Number:                                  | 28           | Type:        | R                               | Area:          | 5250.00 SqFt | PCI:          | 71         |               |       |
| Sample Comments: Created by Inspection Schedule |              |              |                                 |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 140.00 Ft                       |                |              |               |            |               |       |
| 57                                              | WEATHERING   | L            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | M            | 4.00 Ft                         |                |              |               |            |               |       |
| 57                                              | WEATHERING   | M            | 2625.00 SqFt                    |                |              |               |            |               |       |
| Sample Number:                                  | 34           | Type:        | R                               | Area:          | 5250.00 SqFt | PCI:          | 75         |               |       |
| Sample Comments: Created by Inspection Schedule |              |              |                                 |                |              |               |            |               |       |
| 57                                              | WEATHERING   | L            | 2625.00 SqFt                    |                |              |               |            |               |       |
| 48                                              | L & T CR     | L            | 170.00 Ft                       |                |              |               |            |               |       |
| 57                                              | WEATHERING   | M            | 2625.00 SqFt                    |                |              |               |            |               |       |

|                      |              |         |                                    |                         |                |           |           |               |               |          |
|----------------------|--------------|---------|------------------------------------|-------------------------|----------------|-----------|-----------|---------------|---------------|----------|
| Network:             | Bend         |         | Name:                              |                         | Bend Municipal |           |           |               |               |          |
| Branch:              | THELIBE      |         | Name:                              | Helicopter Area Taxiway |                | Use:      | TAXIWAY   | Area:         | 26,243 SqFt   |          |
| Section:             | 02           | of      | 2                                  | From:                   | See Map        |           | To:       | --            | Last Const.:  | 7/3/2017 |
| Surface:             | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC    |                         | Zone:          | KBDN      | Category: | L             | Rank:         | P        |
| Area:                | 10,117 SqFt  |         | Length:                            | 188 Ft                  |                | Width:    | 50 Ft     |               |               |          |
| Slabs:               | Slab Length: |         | Ft                                 |                         | Slab Width:    | Ft        |           | Joint Length: | Ft            |          |
| Shoulder:            | Street Type: |         |                                    |                         | Grade:         | 0         |           | Lanes:        | 0             |          |
| Section Comments:    |              |         |                                    |                         |                |           |           |               |               |          |
| Work Date:           | 7/1/2017     |         | Work Type: Subbase - Aggregate     |                         |                |           | Code:     | SB-AG         | Is Major M&R: | False    |
| Work Date:           | 7/2/2017     |         | Work Type: Base Course - Aggregate |                         |                |           | Code:     | BA-AG         | Is Major M&R: | False    |
| Work Date:           | 7/3/2017     |         | Work Type: New Construction - AC   |                         |                |           | Code:     | NC-AC         | Is Major M&R: | True     |
| Last Insp. Date:     | 3/1/2022     |         | TotalSamples:                      | 2                       |                | Surveyed: | 2         |               |               |          |
| Conditions:          | PCI: 94      |         |                                    |                         |                |           |           |               |               |          |
| Inspection Comments: |              |         |                                    |                         |                |           |           |               |               |          |
| Sample Number:       | 01           | Type:   | R                                  | Area:                   | 4985.00 SqFt   |           | PCI:      | 94            |               |          |
| Sample Comments:     |              |         |                                    |                         |                |           |           |               |               |          |
| 57                   | WEATHERING   |         | L                                  | 4985.00 SqFt            |                |           |           |               |               |          |
| Sample Number:       | 02           | Type:   | R                                  | Area:                   | 5100.00 SqFt   |           | PCI:      | 94            |               |          |
| Sample Comments:     |              |         |                                    |                         |                |           |           |               |               |          |
| 57                   | WEATHERING   |         | L                                  | 5100.00 SqFt            |                |           |           |               |               |          |

|                      |              |               |                                    |           |               |           |             |               |          |
|----------------------|--------------|---------------|------------------------------------|-----------|---------------|-----------|-------------|---------------|----------|
| Network:             | Bend         | Name:         | Bend Municipal                     |           |               |           |             |               |          |
| Branch:              | THELIBE      | Name:         | Helicopter Area Taxiway            | Use:      | TAXIWAY       | Area:     | 26,243 SqFt |               |          |
| Section:             | 01           | of            | 2                                  | From:     | See Map       | To:       | -           | Last Const.:  | 7/3/2017 |
| Surface:             | AC           | Family:       | 2022_Central_Cat1/2_Taxi<br>way_AC | Zone:     | KBDN          | Category: | L           | Rank:         | P        |
| Area:                | 16,126 SqFt  | Length:       | 611 Ft                             | Width:    | 25 Ft         |           |             |               |          |
| Slabs:               | Slab Length: | Ft            | Slab Width:                        | Ft        | Joint Length: | Ft        |             |               |          |
| Shoulder:            | Street Type: | Grade:        | 0                                  | Lanes:    | 0             |           |             |               |          |
| Section Comments:    |              |               |                                    |           |               |           |             |               |          |
| Work Date:           | 7/1/2017     | Work Type:    | Subbase - Aggregate                |           |               | Code:     | SB-AG       | Is Major M&R: | False    |
| Work Date:           | 7/2/2017     | Work Type:    | Base Course - Aggregate            |           |               | Code:     | BA-AG       | Is Major M&R: | False    |
| Work Date:           | 7/3/2017     | Work Type:    | New Construction - AC              |           |               | Code:     | NC-AC       | Is Major M&R: | True     |
| Last Insp. Date:     | 3/1/2022     | TotalSamples: | 3                                  | Surveyed: | 3             |           |             |               |          |
| Conditions:          | PCI:         | 94            |                                    |           |               |           |             |               |          |
| Inspection Comments: |              |               |                                    |           |               |           |             |               |          |
| Sample Number:       | 01           | Type:         | R                                  | Area:     | 5692.00 SqFt  | PCI:      | 94          |               |          |
| Sample Comments:     |              |               |                                    |           |               |           |             |               |          |
| 57                   | WEATHERING   | L             | 5692.00                            | SqFt      |               |           |             |               |          |
| Sample Number:       | 02           | Type:         | R                                  | Area:     | 4985.00 SqFt  | PCI:      | 94          |               |          |
| Sample Comments:     |              |               |                                    |           |               |           |             |               |          |
| 57                   | WEATHERING   | L             | 4985.00                            | SqFt      |               |           |             |               |          |
| Sample Number:       | 03           | Type:         | R                                  | Area:     | 5400.00 SqFt  | PCI:      | 94          |               |          |
| Sample Comments:     |              |               |                                    |           |               |           |             |               |          |
| 57                   | WEATHERING   | L             | 5400.00                            | SqFt      |               |           |             |               |          |

|                                                 |              |         |                                             |                   |                |             |           |           |                       |
|-------------------------------------------------|--------------|---------|---------------------------------------------|-------------------|----------------|-------------|-----------|-----------|-----------------------|
| Network:                                        | Bend         |         |                                             | Name:             | Bend Municipal |             |           |           |                       |
| Branch:                                         | TLA10BE      |         | Name:                                       | Taxilane A10 Bend |                | Use:        | TAXIWAY   | Area:     | 33,353 SqFt           |
| Section:                                        | 02           | of      | 2                                           | From:             | TLA10BE-01     |             | To:       | TLA9BE-02 | Last Const.: 9/2/1999 |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC             | Zone:             | KBDN           |             | Category: | L         | Rank: S               |
| Area:                                           | 27,138 SqFt  |         | Length:                                     | 775 Ft            |                | Width:      | 35 Ft     |           |                       |
| Slabs:                                          | Slab Length: |         | Ft                                          |                   | Slab Width:    |             | Ft        |           | Joint Length: Ft      |
| Shoulder:                                       | Street Type: |         | Grade:                                      |                   | 0              |             | Lanes:    |           | 0                     |
| Section Comments:                               |              |         |                                             |                   |                |             |           |           |                       |
| Work Date:                                      | 9/1/1999     |         | Work Type: Base Course - Unknown (Major MR) |                   |                |             | Code:     | BA-UN     | Is Major M&R: True    |
| Work Date:                                      | 9/2/1999     |         | Work Type: New Construction - AC            |                   |                |             | Code:     | NC-AC     | Is Major M&R: True    |
| Work Date:                                      | 9/1/2004     |         | Work Type: Crack Sealing - AC               |                   |                |             | Code:     | CS-AC     | Is Major M&R: False   |
| Work Date:                                      | 9/1/2008     |         | Work Type: Crack Sealing - AC               |                   |                |             | Code:     | CS-AC     | Is Major M&R: False   |
| Work Date:                                      | 9/1/2012     |         | Work Type: Crack Sealing - AC               |                   |                |             | Code:     | CS-AC     | Is Major M&R: False   |
| Work Date:                                      | 9/2/2012     |         | Work Type: Patching - AC Deep               |                   |                |             | Code:     | PA-AD     | Is Major M&R: False   |
| Work Date:                                      | 9/1/2015     |         | Work Type: Crack Sealing - AC               |                   |                |             | Code:     | CS-AC     | Is Major M&R: False   |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                               | 5                 |                | Surveyed: 3 |           |           |                       |
| Conditions:                                     | PCI: 60      |         |                                             |                   |                |             |           |           |                       |
| Inspection Comments:                            |              |         |                                             |                   |                |             |           |           |                       |
| Sample Number:                                  | 01           | Type:   | R                                           | Area:             | 5384.00 SqFt   |             | PCI:      | 63        |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                   |                |             |           |           |                       |
| 48                                              | L & T CR     |         | L                                           | 151.00            | Ft             |             |           |           |                       |
| 48                                              | L & T CR     |         | M                                           | 100.00            | Ft             |             |           |           |                       |
| 57                                              | WEATHERING   |         | M                                           | 5384.00           | SqFt           |             |           |           |                       |
| 48                                              | L & T CR     |         | M                                           | 100.00            | Ft             |             |           |           |                       |
| 48                                              | L & T CR     |         | L                                           | 100.00            | Ft             |             |           |           |                       |
| 48                                              | L & T CR     |         | L                                           | 127.00            | Ft             |             |           |           |                       |
| Sample Number:                                  | 02           | Type:   | R                                           | Area:             | 5250.00 SqFt   |             | PCI:      | 59        |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                   |                |             |           |           |                       |
| 48                                              | L & T CR     |         | L                                           | 100.00            | Ft             |             |           |           |                       |
| 57                                              | WEATHERING   |         | M                                           | 5250.00           | SqFt           |             |           |           |                       |
| 48                                              | L & T CR     |         | M                                           | 418.00            | Ft             |             |           |           |                       |
| Sample Number:                                  | 04           | Type:   | R                                           | Area:             | 5250.00 SqFt   |             | PCI:      | 59        |                       |
| Sample Comments: Created by Inspection Schedule |              |         |                                             |                   |                |             |           |           |                       |
| 57                                              | WEATHERING   |         | M                                           | 5250.00           | SqFt           |             |           |           |                       |
| 48                                              | L & T CR     |         | M                                           | 497.00            | Ft             |             |           |           |                       |
| 48                                              | L & T CR     |         | L                                           | 25.00             | Ft             |             |           |           |                       |

|                                                 |              |         |                                 |                   |              |           |                              |           |               |              |          |               |       |
|-------------------------------------------------|--------------|---------|---------------------------------|-------------------|--------------|-----------|------------------------------|-----------|---------------|--------------|----------|---------------|-------|
| Network:                                        | Bend         |         | Name:                           | Bend Municipal    |              |           |                              |           |               |              |          |               |       |
| Branch:                                         | TLA10BE      |         | Name:                           | Taxilane A10 Bend |              | Use:      | TAXIWAY                      | Area:     | 33,353 SqFt   |              |          |               |       |
| Section:                                        | 01           | of      | 2                               | From:             | TABE-01      |           |                              | To:       | TLA10BE-02    | Last Const.: | 9/3/2012 |               |       |
| Surface:                                        | AC           | Family: | 2022_Central_Cat1/2_Taxi way_AC | Zone:             | KBDN         |           |                              | Category: | L             | Rank:        | S        |               |       |
| Area:                                           | 6,215 SqFt   |         | Length:                         | 116 Ft            |              | Width:    | 35 Ft                        |           |               |              |          |               |       |
| Slabs:                                          | Slab Length: |         | Ft                              |                   | Slab Width:  |           | Ft                           |           | Joint Length: |              | Ft       |               |       |
| Shoulder:                                       | Street Type: |         | Grade:                          |                   | 0            |           | Lanes:                       |           | 0             |              |          |               |       |
| Section Comments:                               |              |         |                                 |                   |              |           |                              |           |               |              |          |               |       |
| Work Date:                                      | 9/1/2012     |         | Work Type:                      |                   |              |           | Subbase - Aggregate          |           | Code:         | SB-AG        |          | Is Major M&R: | False |
| Work Date:                                      | 9/2/2012     |         | Work Type:                      |                   |              |           | Base Course - Aggregate      |           | Code:         | BA-AG        |          | Is Major M&R: | False |
| Work Date:                                      | 9/3/2012     |         | Work Type:                      |                   |              |           | Complete Reconstruction - AC |           | Code:         | CR-AC        |          | Is Major M&R: | True  |
| Last Insp. Date:                                | 3/1/2022     |         | TotalSamples:                   | 1                 |              | Surveyed: | 1                            |           |               |              |          |               |       |
| Conditions:                                     | PCI:         | 89      |                                 |                   |              |           |                              |           |               |              |          |               |       |
| Inspection Comments:                            |              |         |                                 |                   |              |           |                              |           |               |              |          |               |       |
| Sample Number:                                  | 01           | Type:   | R                               | Area:             | 6215.00 SqFt |           |                              | PCI:      | 89            |              |          |               |       |
| Sample Comments: Created by Inspection Schedule |              |         |                                 |                   |              |           |                              |           |               |              |          |               |       |
| 48                                              | L & T CR     |         | L                               | 50.00 Ft          |              |           |                              |           |               |              |          |               |       |
| 57                                              | WEATHERING   |         | L                               | 6215.00 SqFt      |              |           |                              |           |               |              |          |               |       |

|                                                 |            |               |                                  |                  |              |      |               |        |               |          |
|-------------------------------------------------|------------|---------------|----------------------------------|------------------|--------------|------|---------------|--------|---------------|----------|
| Network:                                        | Bend       |               | Name:                            | Bend Municipal   |              |      |               |        |               |          |
| Branch:                                         | TLA7BE     |               | Name:                            | Taxilane A7 Bend |              | Use: | TAXIWAY       | Area:  | 8,976 SqFt    |          |
| Section:                                        | 01         | of            | 1                                | From:            | TABE-02      |      | To:           | A03-01 | Last Const.:  | 9/3/2012 |
| Surface:                                        | AC         | Family:       | 2022_Central_Cat1/2_Taxi way_AC  | Zone:            | KBDN         |      | Category:     | L      | Rank:         | S        |
| Area:                                           | 8,976 SqFt | Length:       | 182 Ft                           | Width:           | 40 Ft        |      |               |        |               |          |
| Slabs:                                          |            | Slab Length:  | Ft                               | Slab Width:      | Ft           |      | Joint Length: | Ft     |               |          |
| Shoulder:                                       |            | Street Type:  |                                  | Grade:           | 0            |      | Lanes:        | 0      |               |          |
| Section Comments:                               |            |               |                                  |                  |              |      |               |        |               |          |
| Work Date:                                      | 9/1/1991   | Work Type:    | Base Course - Unknown (Major MR) |                  |              |      | Code:         | BA-UN  | Is Major M&R: | True     |
| Work Date:                                      | 9/2/1991   | Work Type:    | New Construction - AC            |                  |              |      | Code:         | NC-AC  | Is Major M&R: | True     |
| Work Date:                                      | 9/1/2000   | Work Type:    | Crack Sealing - AC               |                  |              |      | Code:         | CS-AC  | Is Major M&R: | False    |
| Work Date:                                      | 9/2/2000   | Work Type:    | Surface Seal - Fog Seal          |                  |              |      | Code:         | SS-FS  | Is Major M&R: | False    |
| Work Date:                                      | 9/1/2004   | Work Type:    | Crack Sealing - AC               |                  |              |      | Code:         | CS-AC  | Is Major M&R: | False    |
| Work Date:                                      | 9/1/2008   | Work Type:    | Crack Seal - Wide Cracks         |                  |              |      | Code:         | CS-WD  | Is Major M&R: | False    |
| Work Date:                                      | 9/2/2008   | Work Type:    | Patching - AC Deep               |                  |              |      | Code:         | PA-AD  | Is Major M&R: | False    |
| Work Date:                                      | 9/1/2012   | Work Type:    | Subbase - Aggregate              |                  |              |      | Code:         | SB-AG  | Is Major M&R: | False    |
| Work Date:                                      | 9/2/2012   | Work Type:    | Base Course - Aggregate          |                  |              |      | Code:         | BA-AG  | Is Major M&R: | False    |
| Work Date:                                      | 9/3/2012   | Work Type:    | Complete Reconstruction - AC     |                  |              |      | Code:         | CR-AC  | Is Major M&R: | True     |
| Last Insp. Date:                                | 3/1/2022   | TotalSamples: | 2                                | Surveyed:        | 2            |      |               |        |               |          |
| Conditions:                                     | PCI:       | 88            |                                  |                  |              |      |               |        |               |          |
| Inspection Comments:                            |            |               |                                  |                  |              |      |               |        |               |          |
| Sample Number:                                  | 01         | Type:         | R                                | Area:            | 4956.00 SqFt | PCI: | 90            |        |               |          |
| Sample Comments: Created by Inspection Schedule |            |               |                                  |                  |              |      |               |        |               |          |
| 57                                              | WEATHERING | L             | 4956.00 SqFt                     |                  |              |      |               |        |               |          |
| 48                                              | L & T CR   | M             | 6.00 Ft                          |                  |              |      |               |        |               |          |
| Sample Number:                                  | 02         | Type:         | R                                | Area:            | 4020.00 SqFt | PCI: | 86            |        |               |          |
| Sample Comments: Created by Inspection Schedule |            |               |                                  |                  |              |      |               |        |               |          |
| 57                                              | WEATHERING | L             | 4020.00 SqFt                     |                  |              |      |               |        |               |          |
| 48                                              | L & T CR   | L             | 5.00 Ft                          |                  |              |      |               |        |               |          |
| 48                                              | L & T CR   | L             | 20.00 Ft                         |                  |              |      |               |        |               |          |
| 48                                              | L & T CR   | M             | 5.00 Ft                          |                  |              |      |               |        |               |          |

|                                                        |                                               |                             |                         |                                |
|--------------------------------------------------------|-----------------------------------------------|-----------------------------|-------------------------|--------------------------------|
| <b>Network:</b> Bend                                   |                                               | <b>Name:</b> Bend Municipal |                         |                                |
| <b>Branch:</b> TLA8BE                                  | <b>Name:</b> Taxilane A8 Bend                 | <b>Use:</b> TAXIWAY         | <b>Area:</b> 8,487 SqFt |                                |
| <b>Section:</b> 02                                     | of 2                                          | <b>From:</b> TABE-02        | <b>To:</b> A09BE-01     | <b>Last Const.:</b> 9/1/2008   |
| <b>Surface:</b> AC                                     | <b>Family:</b> 2022_Central_Cat1/2_Taxiway_AC | <b>Zone:</b> KBDN           | <b>Category:</b> L      | <b>Rank:</b> S                 |
| <b>Area:</b> 2,625 SqFt                                | <b>Length:</b> 75 Ft                          | <b>Width:</b> 35 Ft         |                         |                                |
| <b>Slabs:</b>                                          | <b>Slab Length:</b> Ft                        | <b>Slab Width:</b> Ft       | <b>Joint Length:</b> Ft |                                |
| <b>Shoulder:</b>                                       | <b>Street Type:</b>                           | <b>Grade:</b> 0             | <b>Lanes:</b> 0         |                                |
| <b>Section Comments:</b>                               |                                               |                             |                         |                                |
| <b>Work Date:</b> 9/1/2008                             | <b>Work Type:</b> New Construction - AC       |                             | <b>Code:</b> NC-AC      | <b>Is Major M&amp;R:</b> True  |
| <b>Work Date:</b> 9/1/2015                             | <b>Work Type:</b> Crack Sealing - AC          |                             | <b>Code:</b> CS-AC      | <b>Is Major M&amp;R:</b> False |
| <b>Last Insp. Date:</b> 3/1/2022                       | <b>TotalSamples:</b> 1                        | <b>Surveyed:</b> 1          |                         |                                |
| <b>Conditions:</b> PCI: 69                             |                                               |                             |                         |                                |
| <b>Inspection Comments:</b>                            |                                               |                             |                         |                                |
| <b>Sample Number:</b> 01                               | <b>Type:</b> R                                | <b>Area:</b> 2625.00 SqFt   | <b>PCI:</b> 69          |                                |
| <b>Sample Comments:</b> Created by Inspection Schedule |                                               |                             |                         |                                |
| 48                                                     | L & T CR                                      | M                           | 68.00 Ft                |                                |
| 48                                                     | L & T CR                                      | L                           | 23.00 Ft                |                                |
| 50                                                     | PATCHING                                      | L                           | 70.00 SqFt              |                                |
| 57                                                     | WEATHERING                                    | L                           | 2625.00 SqFt            |                                |

|                             |                                |                |                                 |                              |                    |                  |               |                      |                     |                          |       |
|-----------------------------|--------------------------------|----------------|---------------------------------|------------------------------|--------------------|------------------|---------------|----------------------|---------------------|--------------------------|-------|
| <b>Network:</b>             | Bend                           |                | <b>Name:</b>                    | Bend Municipal               |                    |                  |               |                      |                     |                          |       |
| <b>Branch:</b>              | TLA8BE                         |                | <b>Name:</b>                    | Taxilane A8 Bend             |                    | <b>Use:</b>      | TAXIWAY       | <b>Area:</b>         | 8,487 SqFt          |                          |       |
| <b>Section:</b>             | 01                             | of 2           | <b>From:</b>                    | TABE-01                      |                    | <b>To:</b>       | TLA8BE-02     |                      | <b>Last Const.:</b> | 9/3/2012                 |       |
| <b>Surface:</b>             | AC                             | <b>Family:</b> | 2022_Central_Cat1/2_Taxi way_AC |                              | <b>Zone:</b>       | KBDN             |               | <b>Category:</b>     | L                   | <b>Rank:</b>             | S     |
| <b>Area:</b>                | 5,862 SqFt                     |                | <b>Length:</b>                  | 108 Ft                       |                    | <b>Width:</b>    | 35 Ft         |                      |                     |                          |       |
| <b>Slabs:</b>               | <b>Slab Length:</b>            |                | Ft                              |                              | <b>Slab Width:</b> | Ft               |               | <b>Joint Length:</b> | Ft                  |                          |       |
| <b>Shoulder:</b>            | <b>Street Type:</b>            |                | <b>Grade:</b>                   |                              | 0                  |                  | <b>Lanes:</b> | 0                    |                     |                          |       |
| <b>Section Comments:</b>    |                                |                |                                 |                              |                    |                  |               |                      |                     |                          |       |
| <b>Work Date:</b>           | 9/1/2012                       |                | <b>Work Type:</b>               | Subbase - Aggregate          |                    |                  | <b>Code:</b>  | SB-AG                |                     | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>           | 9/2/2012                       |                | <b>Work Type:</b>               | Base Course - Aggregate      |                    |                  | <b>Code:</b>  | BA-AG                |                     | <b>Is Major M&amp;R:</b> | False |
| <b>Work Date:</b>           | 9/3/2012                       |                | <b>Work Type:</b>               | Complete Reconstruction - AC |                    |                  | <b>Code:</b>  | CR-AC                |                     | <b>Is Major M&amp;R:</b> | True  |
| <b>Work Date:</b>           | 7/1/2015                       |                | <b>Work Type:</b>               | Crack Sealing - AC           |                    |                  | <b>Code:</b>  | CS-AC                |                     | <b>Is Major M&amp;R:</b> | False |
| <b>Last Insp. Date:</b>     | 3/1/2022                       |                | <b>TotalSamples:</b>            | 1                            |                    | <b>Surveyed:</b> | 1             |                      |                     |                          |       |
| <b>Conditions:</b>          | PCI:                           | 90             |                                 |                              |                    |                  |               |                      |                     |                          |       |
| <b>Inspection Comments:</b> |                                |                |                                 |                              |                    |                  |               |                      |                     |                          |       |
| <b>Sample Number:</b>       | 01                             | <b>Type:</b>   | R                               |                              | <b>Area:</b>       | 5862.00 SqFt     |               | <b>PCI:</b>          | 90                  |                          |       |
| <b>Sample Comments:</b>     | Created by Inspection Schedule |                |                                 |                              |                    |                  |               |                      |                     |                          |       |
| 57                          | WEATHERING                     |                | L                               |                              | 5862.00 SqFt       |                  |               |                      |                     |                          |       |
| 48                          | L & T CR                       |                | L                               |                              | 44.00 Ft           |                  |               |                      |                     |                          |       |

|                                                 |              |               |                                  |                  |                |           |         |               |              |          |
|-------------------------------------------------|--------------|---------------|----------------------------------|------------------|----------------|-----------|---------|---------------|--------------|----------|
| Network:                                        | Bend         |               |                                  | Name:            | Bend Municipal |           |         |               |              |          |
| Branch:                                         | TLA9BE       |               | Name:                            | Taxilane A9 Bend |                | Use:      | TAXIWAY | Area:         | 10,038 SqFt  |          |
| Section:                                        | 02           | of 2          | From:                            | TLA9BE-01        |                |           | To:     | A05BE-03      | Last Const.: | 9/2/1999 |
| Surface:                                        | AC           | Family:       | 2022_Central_Cat1/2_Taxi way_AC  | Zone:            | KBDN           | Category: | L       | Rank:         | S            |          |
| Area:                                           | 5,923 SqFt   | Length:       | 201 Ft                           | Width:           | 30 Ft          |           |         |               |              |          |
| Slabs:                                          | Slab Length: | Ft            | Slab Width:                      | Ft               | Joint Length:  | Ft        |         |               |              |          |
| Shoulder:                                       | Street Type: | Grade:        | 0                                | Lanes:           | 0              |           |         |               |              |          |
| Section Comments:                               |              |               |                                  |                  |                |           |         |               |              |          |
| Work Date:                                      | 9/1/1999     | Work Type:    | Base Course - Unknown (Major MR) |                  |                | Code:     | BA-UN   | Is Major M&R: | True         |          |
| Work Date:                                      | 9/2/1999     | Work Type:    | New Construction - AC            |                  |                | Code:     | NC-AC   | Is Major M&R: | True         |          |
| Work Date:                                      | 9/1/2004     | Work Type:    | Crack Sealing - AC               |                  |                | Code:     | CS-AC   | Is Major M&R: | False        |          |
| Work Date:                                      | 9/1/2012     | Work Type:    | Crack Sealing - AC               |                  |                | Code:     | CS-AC   | Is Major M&R: | False        |          |
| Work Date:                                      | 9/1/2015     | Work Type:    | Crack Sealing - AC               |                  |                | Code:     | CS-AC   | Is Major M&R: | False        |          |
| Last Insp. Date:                                | 3/1/2022     | TotalSamples: | 1                                | Surveyed:        | 1              |           |         |               |              |          |
| Conditions:                                     | PCI:         | 62            |                                  |                  |                |           |         |               |              |          |
| Inspection Comments:                            |              |               |                                  |                  |                |           |         |               |              |          |
| Sample Number:                                  | 01           | Type:         | R                                | Area:            | 5923.00 SqFt   | PCI:      | 62      |               |              |          |
| Sample Comments: Created by Inspection Schedule |              |               |                                  |                  |                |           |         |               |              |          |
| 48                                              | L & T CR     | M             | 50.00                            | Ft               |                |           |         |               |              |          |
| 48                                              | L & T CR     | L             | 150.00                           | Ft               |                |           |         |               |              |          |
| 48                                              | L & T CR     | M             | 125.00                           | Ft               |                |           |         |               |              |          |
| 57                                              | WEATHERING   | M             | 5923.00                          | SqFt             |                |           |         |               |              |          |
| 48                                              | L & T CR     | M             | 161.00                           | Ft               |                |           |         |               |              |          |
| 48                                              | L & T CR     | L             | 154.00                           | Ft               |                |           |         |               |              |          |

|                      |              |                                |                                |                  |              |                |                              |               |             |              |          |               |       |
|----------------------|--------------|--------------------------------|--------------------------------|------------------|--------------|----------------|------------------------------|---------------|-------------|--------------|----------|---------------|-------|
| Network:             |              | Bend                           |                                | Name:            |              | Bend Municipal |                              |               |             |              |          |               |       |
| Branch:              | TLA9BE       |                                | Name:                          | Taxilane A9 Bend |              | Use:           | TAXIWAY                      | Area:         | 10,038 SqFt |              |          |               |       |
| Section:             | 01           | of 2                           |                                | From:            | TABE-01      |                | To:                          | TLA9BE-02     |             | Last Const.: | 9/3/2012 |               |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxiway_AC |                  | Zone:        | KBDN           |                              | Category:     | L           |              | Rank:    | S             |       |
| Area:                | 4,115 SqFt   |                                | Length:                        | 97 Ft            |              | Width:         | 30 Ft                        |               |             |              |          |               |       |
| Slabs:               | Slab Length: |                                | Ft                             |                  | Slab Width:  | Ft             |                              | Joint Length: | Ft          |              |          |               |       |
| Shoulder:            | Street Type: |                                |                                |                  | Grade:       | 0              |                              | Lanes:        | 0           |              |          |               |       |
| Section Comments:    |              |                                |                                |                  |              |                |                              |               |             |              |          |               |       |
| Work Date:           | 9/1/2012     |                                | Work Type:                     |                  |              |                | Subbase - Aggregate          |               | Code:       | SB-AG        |          | Is Major M&R: | False |
| Work Date:           | 9/2/2012     |                                | Work Type:                     |                  |              |                | Base Course - Aggregate      |               | Code:       | BA-AG        |          | Is Major M&R: | False |
| Work Date:           | 9/3/2012     |                                | Work Type:                     |                  |              |                | Complete Reconstruction - AC |               | Code:       | CR-AC        |          | Is Major M&R: | True  |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                  | 1                |              | Surveyed:      | 1                            |               |             |              |          |               |       |
| Conditions:          | PCI: 89      |                                |                                |                  |              |                |                              |               |             |              |          |               |       |
| Inspection Comments: |              |                                |                                |                  |              |                |                              |               |             |              |          |               |       |
| Sample Number:       | 01           | Type:                          | R                              | Area:            | 4115.00 SqFt |                | PCI:                         | 89            |             |              |          |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                |                  |              |                |                              |               |             |              |          |               |       |
| 48                   | L & T CR     |                                | L                              | 68.00 Ft         |              |                |                              |               |             |              |          |               |       |
| 57                   | WEATHERING   |                                | L                              | 4115.00 SqFt     |              |                |                              |               |             |              |          |               |       |

|                      |              |                                |                                |                                 |              |                |         |               |            |              |               |       |
|----------------------|--------------|--------------------------------|--------------------------------|---------------------------------|--------------|----------------|---------|---------------|------------|--------------|---------------|-------|
| Network:             |              | Bend                           |                                | Name:                           |              | Bend Municipal |         |               |            |              |               |       |
| Branch:              | TLCBE        |                                | Name:                          | Taxilane C Bend                 |              | Use:           | TAXIWAY | Area:         | 5,156 SqFt |              |               |       |
| Section:             | 01           | of 1                           |                                | From:                           | Taxiway B    |                | To:     | -             |            | Last Const.: | 10/3/2010     |       |
| Surface:             | AC           | Family:                        | 2022_Central_Cat1/2_Taxiway_AC |                                 | Zone:        | KBDN           |         | Category:     | L          |              | Rank:         | S     |
| Area:                | 5,156 SqFt   |                                | Length:                        | 145 Ft                          |              | Width:         | 30 Ft   |               |            |              |               |       |
| Slabs:               | Slab Length: |                                | Ft                             |                                 | Slab Width:  | Ft             |         | Joint Length: | Ft         |              |               |       |
| Shoulder:            | Street Type: |                                |                                |                                 | Grade:       | 0              |         | Lanes:        | 0          |              |               |       |
| Section Comments:    |              |                                |                                |                                 |              |                |         |               |            |              |               |       |
| Work Date:           | 10/1/2010    |                                | Work Type:                     | Subbase - Aggregate             |              |                |         | Code:         | SB-AG      |              | Is Major M&R: | False |
| Work Date:           | 10/2/2010    |                                | Work Type:                     | Base Course - Crushed Aggregate |              |                |         | Code:         | BA-CA      |              | Is Major M&R: | False |
| Work Date:           | 10/3/2010    |                                | Work Type:                     | New Construction - AC           |              |                |         | Code:         | NC-AC      |              | Is Major M&R: | True  |
| Work Date:           | 9/1/2015     |                                | Work Type:                     | Crack Sealing - AC              |              |                |         | Code:         | CS-AC      |              | Is Major M&R: | False |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                  | 1                               |              | Surveyed:      | 1       |               |            |              |               |       |
| Conditions:          | PCI: 75      |                                |                                |                                 |              |                |         |               |            |              |               |       |
| Inspection Comments: |              |                                |                                |                                 |              |                |         |               |            |              |               |       |
| Sample Number:       | 01           | Type:                          | R                              | Area:                           | 5156.00 SqFt |                | PCI:    | 75            |            |              |               |       |
| Sample Comments:     |              | Created by Inspection Schedule |                                |                                 |              |                |         |               |            |              |               |       |
| 48                   | L & T CR     |                                | L                              | 60.00 Ft                        |              |                |         |               |            |              |               |       |
| 57                   | WEATHERING   |                                | L                              | 2550.00 SqFt                    |              |                |         |               |            |              |               |       |
| 57                   | WEATHERING   |                                | M                              | 2606.00 SqFt                    |              |                |         |               |            |              |               |       |

|                      |              |                                |                                            |                                 |                |           |              |                    |           |               |           |
|----------------------|--------------|--------------------------------|--------------------------------------------|---------------------------------|----------------|-----------|--------------|--------------------|-----------|---------------|-----------|
| Network:             | Bend         |                                |                                            | Name:                           | Bend Municipal |           |              |                    |           |               |           |
| Branch:              | TLEBE        |                                | Name:                                      | Taxilane E Bend                 |                | Use:      | TAXIWAY      |                    | Area:     | 5,330 SqFt    |           |
| Section:             | 01 of 1      |                                | From:                                      | Taxiway B                       |                |           | To:          | South Run-Up Apron |           | Last Const.:  | 10/3/2010 |
| Surface:             | AC           |                                | Family:                                    | 2022_Central_Cat1/2_Taxi way_AC |                | Zone:     | KBDN         |                    | Category: | L Rank: S     |           |
| Area:                | 5,330 SqFt   |                                | Length:                                    | 98 Ft                           |                | Width:    | 40 Ft        |                    |           |               |           |
| Slabs:               | Slab Length: |                                | Ft                                         |                                 | Slab Width:    | Ft        |              | Joint Length:      | Ft        |               |           |
| Shoulder:            | Street Type: |                                | Grade:                                     |                                 | 0              |           | Lanes:       | 0                  |           |               |           |
| Section Comments:    |              |                                |                                            |                                 |                |           |              |                    |           |               |           |
| Work Date:           | 10/1/2010    |                                | Work Type: Subbase - Aggregate             |                                 |                |           | Code:        | SB-AG              |           | Is Major M&R: | False     |
| Work Date:           | 10/2/2010    |                                | Work Type: Base Course - Crushed Aggregate |                                 |                |           | Code:        | BA-CA              |           | Is Major M&R: | False     |
| Work Date:           | 10/3/2010    |                                | Work Type: New Construction - AC           |                                 |                |           | Code:        | NC-AC              |           | Is Major M&R: | True      |
| Last Insp. Date:     | 3/1/2022     |                                | TotalSamples:                              | 1                               |                | Surveyed: | 1            |                    |           |               |           |
| Conditions:          | PCI: 94      |                                |                                            |                                 |                |           |              |                    |           |               |           |
| Inspection Comments: |              |                                |                                            |                                 |                |           |              |                    |           |               |           |
| Sample Number:       | 01           |                                | Type:                                      | R                               |                | Area:     | 5330.00 SqFt |                    | PCI:      | 94            |           |
| Sample Comments:     |              | Created by Inspection Schedule |                                            |                                 |                |           |              |                    |           |               |           |
| 57                   | WEATHERING   |                                | L                                          | 5330.00 SqFt                    |                |           |              |                    |           |               |           |

---

## **APPENDIX F**

### *Work History Report*

8/31/2022

## Work History Report

Page 1 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A01BE    |                            | Apron 01 Bend            |                                      | <b>Section:</b> 01 | <b>Surface:</b> AC |
|--------------------------------|-------------------|-------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/3/2012         | <b>Use:</b> APRON | <b>Rank:</b> S          | <b>Length:</b> 340.00 (Ft) | <b>Width:</b> 47.00 (Ft) | <b>True Area:</b> 14132.00000 (SqFt) |                    |                    |
| Work Date                      | Work Code         | Work Description        | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                    |
| 9/3/2012                       | NC-AC             | New Construction - AC   | 0.00                       | 3.00                     | <input checked="" type="checkbox"/>  | P401               |                    |
| 9/2/2012                       | BA-AG             | Base Course - Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             | P209               |                    |
| 9/1/2012                       | SB-AG             | Subbase - Aggregate     | 0.00                       | 9.00                     | <input type="checkbox"/>             | P154               |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE    |                              | Apron 02 Bend            |                                     | <b>Section:</b> 01 | <b>Surface:</b> AC |
|--------------------------------|-------------------|-------------------------|------------------------------|--------------------------|-------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/3/2012         | <b>Use:</b> APRON | <b>Rank:</b> P          | <b>Length:</b> 1,388.00 (Ft) | <b>Width:</b> 47.00 (Ft) | <b>True Area:</b> 65227 (SqFt)      |                    |                    |
| Work Date                      | Work Code         | Work Description        | Cost                         | Thickness (in)           | Major M&R                           | Comments           |                    |
| 9/3/2012                       | NC-AC             | New Construction - AC   | 0.00                         | 3.00                     | <input checked="" type="checkbox"/> | P401               |                    |
| 9/2/2012                       | BA-AG             | Base Course - Aggregate | 0.00                         | 8.00                     | <input type="checkbox"/>            | P209               |                    |
| 9/1/2012                       | SB-AG             | Subbase - Aggregate     | 0.00                         | 9.00                     | <input type="checkbox"/>            | P154               |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE    |                            | Apron 02 Bend             |                                     | <b>Section:</b> 02             | <b>Surface:</b> AC |
|--------------------------------|-------------------|-------------------------|----------------------------|---------------------------|-------------------------------------|--------------------------------|--------------------|
| <b>L.C.D.</b> 9/1/2005         | <b>Use:</b> APRON | <b>Rank:</b> P          | <b>Length:</b> 450.00 (Ft) | <b>Width:</b> 220.00 (Ft) | <b>True Area:</b> 98940 (SqFt)      |                                |                    |
| Work Date                      | Work Code         | Work Description        | Cost                       | Thickness (in)            | Major M&R                           | Comments                       |                    |
| 7/2/2018                       | SS-FS             | Surface Seal - Fog Seal | 9,894.00                   | 0.00                      | <input type="checkbox"/>            |                                |                    |
| 7/1/2018                       | CS-AC             | Crack Sealing - AC      | 0.00                       | 0.00                      | <input type="checkbox"/>            |                                |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC      | 0.00                       | 0.00                      | <input type="checkbox"/>            | P0007207W, PMP 2015            |                    |
| 9/2/2012                       | PA-AD             | Patching - AC Deep      | 0.00                       | 0.00                      | <input type="checkbox"/>            | PMP 2012                       |                    |
| 9/1/2012                       | CS-AC             | Crack Sealing - AC      | 0.00                       | 0.00                      | <input type="checkbox"/>            | PMP 2012                       |                    |
| 9/1/2005                       | NC-AC             | New Construction - AC   | 0.00                       | 0.00                      | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE             |                            | Apron 02 Bend            |                                      | <b>Section:</b> 03     | <b>Surface:</b> AC |
|--------------------------------|-------------------|----------------------------------|----------------------------|--------------------------|--------------------------------------|------------------------|--------------------|
| <b>L.C.D.</b> 9/2/1999         | <b>Use:</b> APRON | <b>Rank:</b> P                   | <b>Length:</b> 497.00 (Ft) | <b>Width:</b> 70.00 (Ft) | <b>True Area:</b> 36867.00087 (SqFt) |                        |                    |
| Work Date                      | Work Code         | Work Description                 | Cost                       | Thickness (in)           | Major M&R                            | Comments               |                    |
| 7/2/2018                       | SS-FS             | Surface Seal - Fog Seal          | 3,686.70                   | 0.00                     | <input type="checkbox"/>             |                        |                    |
| 7/1/2018                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                     | <input type="checkbox"/>             |                        |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                     | <input type="checkbox"/>             | P0007207W, PMP 2015    |                    |
| 9/1/2012                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                     | <input type="checkbox"/>             | PMP 2012               |                    |
| 9/1/2008                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.10                     | <input type="checkbox"/>             | PMP 2008               |                    |
| 9/1/2004                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.10                     | <input type="checkbox"/>             | Oregon DOA 2004 Maint. |                    |
| 9/2/1999                       | CR-AC             | Complete Reconstruction - AC     | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  | unk. thickness         |                    |
| 9/1/1999                       | BA-UN             | Base Course - Unknown (Major MR) | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  |                        |                    |

8/31/2022

## Work History Report

Page 2 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE             |                            | Apron 02 Bend             |                                      | <b>Section:</b> 04                                                                                                                          | <b>Surface:</b> AC |
|--------------------------------|-------------------|----------------------------------|----------------------------|---------------------------|--------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------|--------------------|
| <b>L.C.D.</b> 9/2/1999         | <b>Use:</b> APRON | <b>Rank:</b> P                   | <b>Length:</b> 225.00 (Ft) | <b>Width:</b> 290.00 (Ft) | <b>True Area:</b> 62888.00001 (SqFt) |                                                                                                                                             |                    |
| Work Date                      | Work Code         | Work Description                 | Cost                       | Thickness (in)            | Major M&R                            | Comments                                                                                                                                    |                    |
| 7/2/2018                       | SS-FS             | Surface Seal - Fog Seal          | 6,288.80                   | 0.00                      | <input type="checkbox"/>             | P0007207W, PMP 2015<br>PMP 2012<br>PMP 2012<br>PMP 2008<br>Oregon DOA 2004 Maint.<br>date estimated from curve<br>date estimated from curve |                    |
| 7/1/2018                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                      | <input type="checkbox"/>             |                                                                                                                                             |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                      | <input type="checkbox"/>             |                                                                                                                                             |                    |
| 9/2/2012                       | PA-AD             | Patching - AC Deep               | 0.00                       | 0.00                      | <input type="checkbox"/>             |                                                                                                                                             |                    |
| 9/1/2012                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                      | <input type="checkbox"/>             |                                                                                                                                             |                    |
| 9/1/2008                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.10                      | <input type="checkbox"/>             |                                                                                                                                             |                    |
| 9/1/2004                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.10                      | <input type="checkbox"/>             |                                                                                                                                             |                    |
| 9/2/1999                       | CR-AC             | Complete Reconstruction - AC     | 0.00                       | 2.00                      | <input checked="" type="checkbox"/>  |                                                                                                                                             |                    |
| 9/1/1999                       | BA-CI             | Base Course - Cinders (Major MR) | 0.00                       | 4.00                      | <input checked="" type="checkbox"/>  |                                                                                                                                             |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE             |                            | Apron 02 Bend             |                                      | <b>Section:</b> 05                                                                 | <b>Surface:</b> AC |
|--------------------------------|-------------------|----------------------------------|----------------------------|---------------------------|--------------------------------------|------------------------------------------------------------------------------------|--------------------|
| <b>L.C.D.</b> 7/3/2018         | <b>Use:</b> APRON | <b>Rank:</b> P                   | <b>Length:</b> 410.00 (Ft) | <b>Width:</b> 217.00 (Ft) | <b>True Area:</b> 97120.00002 (SqFt) |                                                                                    |                    |
| Work Date                      | Work Code         | Work Description                 | Cost                       | Thickness (in)            | Major M&R                            | Comments                                                                           |                    |
| 7/3/2018                       | CR-AC             | Complete Reconstruction - AC     | 485,600.00                 | 4.00                      | <input checked="" type="checkbox"/>  | after 1995<br>after 1995<br>date estimated from curve<br>date estimated from curve |                    |
| 7/2/2018                       | BA-AG             | Base Course - Aggregate          | 0.00                       | 6.00                      | <input type="checkbox"/>             |                                                                                    |                    |
| 7/1/2018                       | SB-AG             | Subbase - Aggregate              | 0.00                       | 8.00                      | <input type="checkbox"/>             |                                                                                    |                    |
| 9/2/1995                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.10                      | <input type="checkbox"/>             |                                                                                    |                    |
| 9/1/1995                       | ST-SS             | Surface Treatment - Slurry Seal  | 0.00                       | 0.50                      | <input type="checkbox"/>             |                                                                                    |                    |
| 9/2/1977                       | NC-AC             | New Construction - AC            | 0.00                       | 2.00                      | <input checked="" type="checkbox"/>  |                                                                                    |                    |
| 9/1/1977                       | BA-CI             | Base Course - Cinders (Major MR) | 0.00                       | 4.00                      | <input checked="" type="checkbox"/>  |                                                                                    |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE         |                            | Apron 02 Bend             |                                      | <b>Section:</b> 06                                                                           | <b>Surface:</b> AC |
|--------------------------------|-------------------|------------------------------|----------------------------|---------------------------|--------------------------------------|----------------------------------------------------------------------------------------------|--------------------|
| <b>L.C.D.</b> 7/3/2018         | <b>Use:</b> APRON | <b>Rank:</b> P               | <b>Length:</b> 300.00 (Ft) | <b>Width:</b> 245.00 (Ft) | <b>True Area:</b> 72650.00002 (SqFt) |                                                                                              |                    |
| Work Date                      | Work Code         | Work Description             | Cost                       | Thickness (in)            | Major M&R                            | Comments                                                                                     |                    |
| 7/3/2018                       | CR-AC             | Complete Reconstruction - AC | 363,250.00                 | 4.00                      | <input checked="" type="checkbox"/>  | PMP 2008<br>Oregon DOA 2004 Maint.<br>date estimated from curve<br>date estimated from curve |                    |
| 7/2/2018                       | BA-AG             | Base Course - Aggregate      | 0.00                       | 6.00                      | <input type="checkbox"/>             |                                                                                              |                    |
| 7/1/2018                       | SB-AG             | Subbase - Aggregate          | 0.00                       | 8.00                      | <input type="checkbox"/>             |                                                                                              |                    |
| 9/1/2008                       | CS-AC             | Crack Sealing - AC           | 0.00                       | 0.10                      | <input type="checkbox"/>             |                                                                                              |                    |
| 9/1/2004                       | CS-AC             | Crack Sealing - AC           | 0.00                       | 0.10                      | <input type="checkbox"/>             |                                                                                              |                    |
| 9/2/1995                       | NC-AC             | New Construction - AC        | 0.00                       | 2.00                      | <input checked="" type="checkbox"/>  |                                                                                              |                    |
| 9/1/1995                       | BA-AG             | Base Course - Aggregate      | 0.00                       | 6.00                      | <input checked="" type="checkbox"/>  |                                                                                              |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A02BE         |                           | Apron 02 Bend            |                                      | <b>Section:</b> 07 | <b>Surface:</b> AC |
|--------------------------------|-------------------|------------------------------|---------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 7/3/2018         | <b>Use:</b> APRON | <b>Rank:</b> P               | <b>Length:</b> 50.00 (Ft) | <b>Width:</b> 85.00 (Ft) | <b>True Area:</b> 4560.000001 (SqFt) |                    |                    |
| Work Date                      | Work Code         | Work Description             | Cost                      | Thickness (in)           | Major M&R                            | Comments           |                    |
| 7/3/2018                       | CR-AC             | Complete Reconstruction - AC | 22,800.00                 | 4.00                     | <input checked="" type="checkbox"/>  |                    |                    |
| 7/2/2018                       | BA-AG             | Base Course - Aggregate      | 0.00                      | 6.00                     | <input type="checkbox"/>             |                    |                    |
| 7/1/2018                       | SB-AG             | Subbase - Aggregate          | 0.00                      | 8.00                     | <input type="checkbox"/>             |                    |                    |
| 1/1/1900                       | NU-IN             | New Construction - Initial   | 0.00                      | 0.00                     | <input checked="" type="checkbox"/>  |                    |                    |

8/31/2022

## Work History Report

Page 3 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** A03BE **Apron** 03 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/1995 **Use:** APRON **Rank:** S **Length:** 350.00 (Ft) **Width:** 213.00 (Ft) **True Area:** 52460.00177 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                           |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015                |
| 9/2/2012  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012, included Wide Crack Repa |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                           |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008                           |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                           |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.             |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                                    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                                    |
| 9/2/1995  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve          |
| 9/1/1995  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve          |

**Network:** Bend Municipal **Branch:** A03BE **Apron** 03 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/1/2005 **Use:** APRON **Rank:** S **Length:** 213.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 8520.000002 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|--------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015            |
| 9/1/2012  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                       |
| 9/1/2008  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                       |
| 9/1/2005  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

**Network:** Bend Municipal **Branch:** A04BE **Apron** 04 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** APRON **Rank:** S **Length:** 478.00 (Ft) **Width:** 75.00 (Ft) **True Area:** 36640 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | NC-AC     | New Construction - AC   | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate     | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** A04BE **Apron** 04 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 7/1/2013 **Use:** APRON **Rank:** S **Length:** 120.00 (Ft) **Width:** 50.00 (Ft) **True Area:** 7510.000002 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2013  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |          |

8/31/2022

## Work History Report

Page 4 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** A05BE **Apron** 05 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/1/2005 **Use:** APRON **Rank:** S **Length:** 232.00 (Ft) **Width:** 30.00 (Ft) **True Area:** 7160 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                     |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015          |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                     |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                     |
| 9/1/2005  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Assumed date, Unk. thickness |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.       |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                              |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                              |
| 9/2/1994  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve    |
| 9/1/1994  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve    |

**Network:** Bend Municipal **Branch:** A05BE **Apron** 05 Bend **Section:** 02 **Surface:** AAC  
**L.C.D.** 9/1/2011 **Use:** APRON **Rank:** S **Length:** 227.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 9080.000002 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                        |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------------|
| 9/1/2011  | OL-AS     | Overlay - AC Structural          | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed date |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                        |
| 9/1/2005  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Assumed date, Unk. thickness    |
| 9/1/2005  | NU-IN     | New Construction - Initial       | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                                 |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.          |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                                 |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                                 |
| 9/2/1994  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve       |
| 9/1/1994  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve       |

**Network:** Bend Municipal **Branch:** A06BE **Apron** 06 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/1/2008 **Use:** APRON **Rank:** S **Length:** 300.00 (Ft) **Width:** 100.00 (Ft) **True Area:** 30000.00000 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                            |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|-------------------------------------|
| 9/2/2015  | PA-AD     | Patching - AC Deep    | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2015                            |
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015                 |
| 9/1/2008  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown construction date & thickne |

**Network:** Bend Municipal **Branch:** A07BE **Apron** 07 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** APRON **Rank:** S **Length:** 223.00 (Ft) **Width:** 56.00 (Ft) **True Area:** 15810 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | NC-AC     | New Construction - AC   | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate     | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

8/31/2022

## Work History Report

Page 5 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** A07BE **Apron** 07 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** APRON **Rank:** S **Length:** 263.00 (Ft) **Width:** 50.00 (Ft) **True Area:** 9223.000000 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments               |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015    |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012               |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint. |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness         |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                        |

**Network:** Bend Municipal **Branch:** A07BE **Apron** 07 Bend **Section:** 03 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** APRON **Rank:** S **Length:** 270.00 (Ft) **Width:** 50.00 (Ft) **True Area:** 12472.00033 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments               |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015    |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012               |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint. |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness         |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                        |

**Network:** Bend Municipal **Branch:** A07BE **Apron** 07 Bend **Section:** 04 **Surface:** AC  
**L.C.D.** 9/1/2005 **Use:** APRON **Rank:** S **Length:** 270.00 (Ft) **Width:** 20.00 (Ft) **True Area:** 5610.000001 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|--------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015            |
| 9/1/2012  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                       |
| 9/1/2005  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

**Network:** Bend Municipal **Branch:** A08BE **Apron** 08 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** APRON **Rank:** S **Length:** 235.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 5923.000147 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

8/31/2022

## Work History Report

Page 6 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** A08BE **Apron** 08 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** APRON **Rank:** S **Length:** 235.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 5912.000147 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012            |
| 9/1/2012  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012            |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008            |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008            |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness      |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                     |

**Network:** Bend Municipal **Branch:** A08BE **Apron** 08 Bend **Section:** 03 **Surface:** AC  
**L.C.D.** 9/1/2005 **Use:** APRON **Rank:** S **Length:** 195.00 (Ft) **Width:** 30.00 (Ft) **True Area:** 5840.000001 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|--------------------------------|
| 6/1/2017  | ST-SS     | Surface Treatment - Slurry Seal | 0.00 | 0.00           | <input type="checkbox"/>            |                                |
| 9/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015            |
| 9/2/2012  | PA-AD     | Patching - AC Deep              | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                       |
| 9/1/2012  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                       |
| 9/1/2005  | NC-AC     | New Construction - AC           | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

**Network:** Bend Municipal **Branch:** A08BE **Apron** 08 Bend **Section:** 04 **Surface:** AC  
**L.C.D.** 9/1/2005 **Use:** APRON **Rank:** S **Length:** 130.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 4365.000001 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|--------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015            |
| 9/1/2012  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                       |
| 9/1/2005  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

**Network:** Bend Municipal **Branch:** A08BE **Apron** 08 Bend **Section:** 05 **Surface:** AC  
**L.C.D.** 1/1/2002 **Use:** APRON **Rank:** S **Length:** 330.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 8050.000205 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC         | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/1/2012  | CS-AC     | Crack Sealing - AC         | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012            |
| 1/1/2002  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                     |

**Network:** Bend Municipal **Branch:** A08BE **Apron** 08 Bend **Section:** 06 **Surface:** AC  
**L.C.D.** 1/1/2002 **Use:** APRON **Rank:** S **Length:** 358.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 9411.000225 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC         | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/1/2012  | CS-AC     | Crack Sealing - AC         | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012            |
| 1/1/2002  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                     |

8/31/2022

**Work History Report**

Page 7 of 26

*Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions*

**Network:** Bend Municipal      **Branch:** A08BE      Apron 08 Bend      **Section:** 07      **Surface:** AC  
**L.C.D.** 9/3/2012      **Use:** APRON      **Rank:** S      **Length:** 552.00 (Ft)      **Width:** 56.00 (Ft)      **True Area:** 31202 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | NC-AC     | New Construction - AC   | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate     | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal      **Branch:** A08BE      Apron 08 Bend      **Section:** 08      **Surface:** AC  
**L.C.D.** 1/1/1900      **Use:** APRON      **Rank:** S      **Length:** 65.00 (Ft)      **Width:** 60.00 (Ft)      **True Area:** 1557.000000 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|----------|
| 1/1/1900  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |          |

**Network:** Bend Municipal      **Branch:** A08BE      Apron 08 Bend      **Section:** 09      **Surface:** PCC  
**L.C.D.** 1/1/1900      **Use:** APRON      **Rank:** S      **Length:** 70.00 (Ft)      **Width:** 25.00 (Ft)      **True Area:** 1804.000000 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|----------|
| 1/1/1900  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |          |

**Network:** Bend Municipal      **Branch:** A08BE      Apron 08 Bend      **Section:** 10      **Surface:** AC  
**L.C.D.** 1/1/1900      **Use:** APRON      **Rank:** S      **Length:** 105.00 (Ft)      **Width:** 8.00 (Ft)      **True Area:** 840.0000002 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|----------|
| 1/1/1900  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |          |

**Network:** Bend Municipal      **Branch:** A08BE      Apron 08 Bend      **Section:** 11      **Surface:** PCC  
**L.C.D.** 1/1/1900      **Use:** APRON      **Rank:** S      **Length:** 100.00 (Ft)      **Width:** 25.00 (Ft)      **True Area:** 2500.000000 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|----------|
| 1/1/1900  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |          |

**Network:** Bend Municipal      **Branch:** A08BE      Apron 08 Bend      **Section:** 12      **Surface:** AC  
**L.C.D.** 1/1/1900      **Use:** APRON      **Rank:** S      **Length:** 100.00 (Ft)      **Width:** 30.00 (Ft)      **True Area:** 3030.000000 (SqFt)

| Work Date | Work Code | Work Description           | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|----------------------------|------|----------------|-------------------------------------|----------|
| 1/1/1900  | NU-IN     | New Construction - Initial | 0.00 | 0.00           | <input checked="" type="checkbox"/> |          |

**Network:** Bend Municipal      **Branch:** A09BE      Apron 09 Bend      **Section:** 01      **Surface:** AC  
**L.C.D.** 9/1/2005      **Use:** APRON      **Rank:** S      **Length:** 120.00 (Ft)      **Width:** 125.00 (Ft)      **True Area:** 15000.00000 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|--------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015            |
| 9/1/2005  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

8/31/2022

**Work History Report**

Page 8 of 26

*Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions*

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A09BE       |                            | Apron 09 Bend            |                                      | <b>Section:</b> 02 | <b>Surface:</b> PCC |
|--------------------------------|-------------------|----------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|---------------------|
| <b>L.C.D.</b> 1/1/1900         | <b>Use:</b> APRON | <b>Rank:</b> S             | <b>Length:</b> 100.00 (Ft) | <b>Width:</b> 25.00 (Ft) | <b>True Area:</b> 2585.000000 (SqFt) |                    |                     |
| Work Date                      | Work Code         | Work Description           | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                     |
| 1/1/1900                       | NU-IN             | New Construction - Initial | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  |                    |                     |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A10BE             |                            | Apron 10 Bend            |                                      | <b>Section:</b> 01  | <b>Surface:</b> AC |
|--------------------------------|-------------------|----------------------------------|----------------------------|--------------------------|--------------------------------------|---------------------|--------------------|
| <b>L.C.D.</b> 9/2/1999         | <b>Use:</b> APRON | <b>Rank:</b> S                   | <b>Length:</b> 120.00 (Ft) | <b>Width:</b> 30.00 (Ft) | <b>True Area:</b> 3655.000001 (SqFt) |                     |                    |
| Work Date                      | Work Code         | Work Description                 | Cost                       | Thickness (in)           | Major M&R                            | Comments            |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.00                     | <input type="checkbox"/>             | P0007207W, PMP 2015 |                    |
| 9/1/2008                       | CS-AC             | Crack Sealing - AC               | 0.00                       | 0.10                     | <input type="checkbox"/>             | PMP 2008            |                    |
| 9/2/1999                       | NC-AC             | New Construction - AC            | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  | unk. thickness      |                    |
| 9/1/1999                       | BA-UN             | Base Course - Unknown (Major MR) | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  |                     |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A10BE  |                           | Apron 10 Bend            |                                      | <b>Section:</b> 02             | <b>Surface:</b> AC |
|--------------------------------|-------------------|-----------------------|---------------------------|--------------------------|--------------------------------------|--------------------------------|--------------------|
| <b>L.C.D.</b> 9/1/2005         | <b>Use:</b> APRON | <b>Rank:</b> S        | <b>Length:</b> 50.00 (Ft) | <b>Width:</b> 20.00 (Ft) | <b>True Area:</b> 920.0000002 (SqFt) |                                |                    |
| Work Date                      | Work Code         | Work Description      | Cost                      | Thickness (in)           | Major M&R                            | Comments                       |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC    | 0.00                      | 0.00                     | <input type="checkbox"/>             | P0007207W, PMP 2015            |                    |
| 9/1/2005                       | NC-AC             | New Construction - AC | 0.00                      | 0.00                     | <input checked="" type="checkbox"/>  | Unknown thickness, assumed LCD |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A10BE  |                           | Apron 10 Bend            |                                      | <b>Section:</b> 03             | <b>Surface:</b> AC |
|--------------------------------|-------------------|-----------------------|---------------------------|--------------------------|--------------------------------------|--------------------------------|--------------------|
| <b>L.C.D.</b> 9/1/2005         | <b>Use:</b> APRON | <b>Rank:</b> S        | <b>Length:</b> 30.00 (Ft) | <b>Width:</b> 80.00 (Ft) | <b>True Area:</b> 2385.000000 (SqFt) |                                |                    |
| Work Date                      | Work Code         | Work Description      | Cost                      | Thickness (in)           | Major M&R                            | Comments                       |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC    | 0.00                      | 0.00                     | <input type="checkbox"/>             | P0007207W, PMP 2015            |                    |
| 9/1/2005                       | NC-AC             | New Construction - AC | 0.00                      | 0.00                     | <input checked="" type="checkbox"/>  | Unknown thickness, assumed LCD |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A10BE       |                            | Apron 10 Bend            |                                      | <b>Section:</b> 04 | <b>Surface:</b> PCC |
|--------------------------------|-------------------|----------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|---------------------|
| <b>L.C.D.</b> 1/1/1900         | <b>Use:</b> APRON | <b>Rank:</b> S             | <b>Length:</b> 100.00 (Ft) | <b>Width:</b> 22.00 (Ft) | <b>True Area:</b> 2127.000000 (SqFt) |                    |                     |
| Work Date                      | Work Code         | Work Description           | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                     |
| 1/1/1900                       | NU-IN             | New Construction - Initial | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  |                    |                     |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> A11BE  |                            | Apron 11 Bend            |                                      | <b>Section:</b> 01             | <b>Surface:</b> AC |
|--------------------------------|-------------------|-----------------------|----------------------------|--------------------------|--------------------------------------|--------------------------------|--------------------|
| <b>L.C.D.</b> 9/1/2005         | <b>Use:</b> APRON | <b>Rank:</b> S        | <b>Length:</b> 124.00 (Ft) | <b>Width:</b> 80.00 (Ft) | <b>True Area:</b> 9920.000003 (SqFt) |                                |                    |
| Work Date                      | Work Code         | Work Description      | Cost                       | Thickness (in)           | Major M&R                            | Comments                       |                    |
| 9/2/2015                       | PA-AD             | Patching - AC Deep    | 0.00                       | 0.00                     | <input type="checkbox"/>             | PMP 2015                       |                    |
| 9/1/2015                       | CS-AC             | Crack Sealing - AC    | 0.00                       | 0.00                     | <input type="checkbox"/>             | P0007207W, PMP 2015            |                    |
| 9/1/2005                       | NC-AC             | New Construction - AC | 0.00                       | 0.00                     | <input checked="" type="checkbox"/>  | Unknown thickness, assumed LCD |                    |

8/31/2022

## Work History Report

Page 9 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> AHELIBE  |                            | Helicopter Apron          |                                      | <b>Section:</b> 01 | <b>Surface:</b> AC |
|--------------------------------|-------------------|-------------------------|----------------------------|---------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 7/3/2017         | <b>Use:</b> APRON | <b>Rank:</b> P          | <b>Length:</b> 540.00 (Ft) | <b>Width:</b> 723.00 (Ft) | <b>True Area:</b> 393378.0001 (SqFt) |                    |                    |
| Work Date                      | Work Code         | Work Description        | Cost                       | Thickness (in)            | Major M&R                            | Comments           |                    |
| 7/3/2017                       | NC-AC             | New Construction - AC   | 0.00                       | 4.00                      | <input checked="" type="checkbox"/>  | P401               |                    |
| 7/2/2017                       | BA-AG             | Base Course - Aggregate | 0.00                       | 4.00                      | <input type="checkbox"/>             | P209               |                    |
| 7/1/2017                       | SB-AG             | Subbase - Aggregate     | 0.00                       | 10.00                     | <input type="checkbox"/>             | P154               |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> AHELIBE  |                            | Helicopter Apron          |                                      | <b>Section:</b> 02 | <b>Surface:</b> AC |
|--------------------------------|-------------------|-------------------------|----------------------------|---------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 7/3/2017         | <b>Use:</b> APRON | <b>Rank:</b> P          | <b>Length:</b> 225.00 (Ft) | <b>Width:</b> 225.00 (Ft) | <b>True Area:</b> 44220.00001 (SqFt) |                    |                    |
| Work Date                      | Work Code         | Work Description        | Cost                       | Thickness (in)            | Major M&R                            | Comments           |                    |
| 7/3/2017                       | NC-AC             | New Construction - AC   | 0.00                       | 4.00                      | <input checked="" type="checkbox"/>  | P401               |                    |
| 7/2/2017                       | BA-AG             | Base Course - Aggregate | 0.00                       | 4.00                      | <input type="checkbox"/>             | P209               |                    |
| 7/1/2017                       | SB-AG             | Subbase - Aggregate     | 0.00                       | 10.00                     | <input type="checkbox"/>             | P154               |                    |

| <b>Network:</b> Bend Municipal |                   | <b>Branch:</b> AHELIBE |                            | Helicopter Apron          |                                      | <b>Section:</b> 03 | <b>Surface:</b> PCC |
|--------------------------------|-------------------|------------------------|----------------------------|---------------------------|--------------------------------------|--------------------|---------------------|
| <b>L.C.D.</b> 7/2/2017         | <b>Use:</b> APRON | <b>Rank:</b> P         | <b>Length:</b> 212.00 (Ft) | <b>Width:</b> 212.00 (Ft) | <b>True Area:</b> 45280.00001 (SqFt) |                    |                     |
| Work Date                      | Work Code         | Work Description       | Cost                       | Thickness (in)            | Major M&R                            | Comments           |                     |
| 7/2/2017                       | NC-PC             | New Construction - PCC | 0.00                       | 0.00                      | <input checked="" type="checkbox"/>  |                    |                     |
| 7/1/2017                       | SB-AG             | Subbase - Aggregate    | 0.00                       | 12.00                     | <input type="checkbox"/>             | P154               |                     |

| <b>Network:</b> Bend Municipal |           | <b>Branch:</b> ATANHOLDBTW A North Run- |      | <b>Section:</b> 01 |                                     | <b>Surface:</b> AC         |  |                           |  |                                |  |
|--------------------------------|-----------|-----------------------------------------|------|--------------------|-------------------------------------|----------------------------|--|---------------------------|--|--------------------------------|--|
| <b>L.C.D.</b> 9/3/2012         |           | <b>Use:</b> APRON                       |      | <b>Rank:</b> S     |                                     | <b>Length:</b> 350.00 (Ft) |  | <b>Width:</b> 105.00 (Ft) |  | <b>True Area:</b> 31349 (SqFt) |  |
| Work Date                      | Work Code | Work Description                        | Cost | Thickness (in)     | Major M&R                           | Comments                   |  |                           |  |                                |  |
| 9/1/2015                       | CS-AC     | Crack Sealing - AC                      | 0.00 | 0.00               | <input type="checkbox"/>            | P0007207W, PMP 2015        |  |                           |  |                                |  |
| 9/3/2012                       | NC-AC     | New Construction - AC                   | 0.00 | 3.00               | <input checked="" type="checkbox"/> | P401                       |  |                           |  |                                |  |
| 9/2/2012                       | BA-AG     | Base Course - Aggregate                 | 0.00 | 8.00               | <input type="checkbox"/>            | P209                       |  |                           |  |                                |  |
| 9/1/2012                       | SB-AG     | Subbase - Aggregate                     | 0.00 | 9.00               | <input type="checkbox"/>            | P154                       |  |                           |  |                                |  |

| <b>Network:</b> Bend Municipal |           | <b>Branch:</b> ATASHOLDB TW A South Run- |                | <b>Section:</b> 01         |                                     | <b>Surface:</b> AC                   |  |
|--------------------------------|-----------|------------------------------------------|----------------|----------------------------|-------------------------------------|--------------------------------------|--|
| <b>L.C.D.</b> 9/3/2012         |           | <b>Use:</b> APRON                        | <b>Rank:</b> S | <b>Length:</b> 330.00 (Ft) | <b>Width:</b> 105.00 (Ft)           | <b>True Area:</b> 33318.00000 (SqFt) |  |
| Work Date                      | Work Code | Work Description                         | Cost           | Thickness (in)             | Major M&R                           | Comments                             |  |
| 9/3/2012                       | NC-AC     | New Construction - AC                    | 0.00           | 3.00                       | <input checked="" type="checkbox"/> | P401                                 |  |
| 9/2/2012                       | BA-AG     | Base Course - Aggregate                  | 0.00           | 8.00                       | <input type="checkbox"/>            | P209                                 |  |
| 9/1/2012                       | SB-AG     | Subbase - Aggregate                      | 0.00           | 9.00                       | <input type="checkbox"/>            | P154                                 |  |

| <b>Network:</b> Bend Municipal |           | <b>Branch:</b> ATBNHOLDBTW B North Run- |                | <b>Section:</b> 01         |                                     | <b>Surface:</b> AC                   |  |
|--------------------------------|-----------|-----------------------------------------|----------------|----------------------------|-------------------------------------|--------------------------------------|--|
| <b>L.C.D.</b> 10/3/2010        |           | <b>Use:</b> APRON                       | <b>Rank:</b> S | <b>Length:</b> 375.00 (Ft) | <b>Width:</b> 105.00 (Ft)           | <b>True Area:</b> 31198.00001 (SqFt) |  |
| Work Date                      | Work Code | Work Description                        | Cost           | Thickness (in)             | Major M&R                           | Comments                             |  |
| 10/3/2010                      | NC-AC     | New Construction - AC                   | 0.00           | 3.00                       | <input checked="" type="checkbox"/> | P-401                                |  |
| 10/2/2010                      | BA-CA     | Base Course - Crushed Aggregate         | 0.00           | 8.00                       | <input type="checkbox"/>            | P-209                                |  |
| 10/1/2010                      | SB-AG     | Subbase - Aggregate                     | 0.00           | 9.00                       | <input type="checkbox"/>            | P-154                                |  |

8/31/2022

## Work History Report

Page 10 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** ATBSHOLDB TW B South Run- **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** APRON **Rank:** S **Length:** 375.00 (Ft) **Width:** 105.00 (Ft) **True Area:** 33049.00001 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** R16BE Runway 16/34 Ben **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2006 **Use:** RUNWAY **Rank:** P **Length:** 5,200.00 (Ft) **Width:** 75.00 (Ft) **True Area:** 390000.0001 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 9/1/2012  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012 |
| 10/3/2006 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 6.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2006 | SB-AG     | Subbase - Aggregate             | 0.00 | 13.00          | <input type="checkbox"/>            | P-154    |
| 9/1/1995  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.10           | <input type="checkbox"/>            |          |
| 9/2/1977  | NC-AC     | New Construction - AC           | 0.00 | 2.00           | <input checked="" type="checkbox"/> |          |
| 9/1/1977  | BA-AG     | Base Course - Aggregate         | 0.00 | 9.00           | <input checked="" type="checkbox"/> |          |

**Network:** Bend Municipal **Branch:** T01BE Taxiway 01 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/1998 **Use:** TAXIWAY **Rank:** S **Length:** 200.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 5840.000001 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/2/1998  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1998  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

**Network:** Bend Municipal **Branch:** T02BE Taxiway 02 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/1995 **Use:** TAXIWAY **Rank:** S **Length:** 330.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 11370.00000 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                           |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015                |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012, includes Wide Crack Repa |
| 9/2/1995  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve          |
| 9/1/1995  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve          |

**Network:** Bend Municipal **Branch:** T03BE Taxiway 03 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** S **Length:** 150.00 (Ft) **Width:** 30.00 (Ft) **True Area:** 7392 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

8/31/2022

## Work History Report

Page 11 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

Network: Bend Municipal Branch: T03BE Taxiway 03 Bend Section: 02 Surface: AC  
 L.C.D. 9/2/1994 Use: TAXIWAY Rank: S Length: 144.00 (Ft) Width: 30.00 (Ft) True Area: 5062 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                  |
| 9/1/2012  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                  |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1994  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | date unknown              |
| 9/2/1994  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1994  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

Network: Bend Municipal Branch: T03BE Taxiway 03 Bend Section: 03 Surface: AC  
 L.C.D. 9/2/1996 Use: TAXIWAY Rank: S Length: 190.00 (Ft) Width: 60.00 (Ft) True Area: 10800.00000 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                  |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1996  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1996  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

Network: Bend Municipal Branch: T03BE Taxiway 03 Bend Section: 04 Surface: AC  
 L.C.D. 9/2/1966 Use: TAXIWAY Rank: S Length: 78.00 (Ft) Width: 60.00 (Ft) True Area: 4683.000001 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/1988  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1966  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1966  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

Network: Bend Municipal Branch: T03BE Taxiway 03 Bend Section: 05 Surface: AC  
 L.C.D. 9/2/1955 Use: TAXIWAY Rank: S Length: 365.00 (Ft) Width: 60.00 (Ft) True Area: 21900.00054 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/1988  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1955  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1955  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

8/31/2022

## Work History Report

Page 12 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** T03BE **Taxiway:** 03 Bend **Section:** 06 **Surface:** AC  
**L.C.D.** 9/2/1988 **Use:** TAXIWAY **Rank:** S **Length:** 110.00 (Ft) **Width:** 60.00 (Ft) **True Area:** 6600.000165 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/4/1988  | SS-CT     | Surface Seal - Coal Tar          | 0.00 | 0.50           | <input type="checkbox"/>            | date unknown              |
| 9/3/1988  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1988  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1988  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

**Network:** Bend Municipal **Branch:** T03BE **Taxiway:** 03 Bend **Section:** 07 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** TAXIWAY **Rank:** S **Length:** 45.00 (Ft) **Width:** 60.00 (Ft) **True Area:** 2834.000068 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments               |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------|
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008               |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint. |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness         |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                        |

**Network:** Bend Municipal **Branch:** T04BE **Taxiway:** 04 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/1996 **Use:** TAXIWAY **Rank:** S **Length:** 524.00 (Ft) **Width:** 30.00 (Ft) **True Area:** 15759 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/2/2015  | PA-AF     | Patching - AC Full Depth         | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2015                  |
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1996  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1996  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1996  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

**Network:** Bend Municipal **Branch:** T04BE **Taxiway:** 04 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/1963 **Use:** TAXIWAY **Rank:** S **Length:** 214.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 8666 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/1995  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1963  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1963  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

8/31/2022

## Work History Report

Page 13 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

Network: Bend Municipal Branch: T05BE Taxiway 05 Bend Section: 01 Surface: AC  
 L.C.D. 9/2/1993 Use: TAXIWAY Rank: S Length: 778.00 (Ft) Width: 30.00 (Ft) True Area: 24436.00058 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                  |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1993  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1993  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1993  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

Network: Bend Municipal Branch: T05BE Taxiway 05 Bend Section: 02 Surface: AC  
 L.C.D. 9/2/1999 Use: TAXIWAY Rank: S Length: 20.00 (Ft) Width: 55.00 (Ft) True Area: 1271.000028 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012            |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008            |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness      |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                     |

Network: Bend Municipal Branch: T06BE Taxiway 06 Bend Section: 01 Surface: AC  
 L.C.D. 9/3/2012 Use: TAXIWAY Rank: P Length: 45.00 (Ft) Width: 50.00 (Ft) True Area: 2250.000000 (SqFt)

| Work Date | Work Code | Work Description                 | Cost   | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|--------|----------------|-------------------------------------|---------------------------|
| 7/2/2018  | SS-FS     | Surface Seal - Fog Seal          | 537.00 | 0.00           | <input type="checkbox"/>            |                           |
| 7/1/2018  | CS-AC     | Crack Sealing - AC               | 0.00   | 0.00           | <input type="checkbox"/>            |                           |
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC     | 0.00   | 3.00           | <input checked="" type="checkbox"/> | P401                      |
| 9/2/2012  | BA-AG     | Base Course - Aggregate          | 0.00   | 8.00           | <input type="checkbox"/>            | P209                      |
| 9/1/2012  | SB-AG     | Subbase - Aggregate              | 0.00   | 9.00           | <input type="checkbox"/>            | P154                      |
| 9/1/1995  | CS-AC     | Crack Sealing - AC               | 0.00   | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1955  | NC-AC     | New Construction - AC            | 0.00   | 2.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1955  | BA-CI     | Base Course - Cinders (Major MR) | 0.00   | 4.00           | <input checked="" type="checkbox"/> | date estimated from curve |

8/31/2022

## Work History Report

Page 14 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** T06BE **Taxiway:** 06 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** TAXIWAY **Rank:** P **Length:** 220.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8040.000002 (SqFt)

| Work Date | Work Code | Work Description                 | Cost   | Thickness (in) | Major M&R                           | Comments                                                      |
|-----------|-----------|----------------------------------|--------|----------------|-------------------------------------|---------------------------------------------------------------|
| 7/2/2018  | SS-FS     | Surface Seal - Fog Seal          | 489.70 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015<br>PMP 2012<br>PMP 2008<br>unk. thickness |
| 7/1/2018  | CS-AC     | Crack Sealing - AC               | 0.00   | 0.00           | <input type="checkbox"/>            |                                                               |
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00   | 0.00           | <input type="checkbox"/>            |                                                               |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00   | 0.00           | <input type="checkbox"/>            |                                                               |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00   | 0.10           | <input type="checkbox"/>            |                                                               |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00   | 0.00           | <input checked="" type="checkbox"/> |                                                               |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00   | 0.00           | <input checked="" type="checkbox"/> |                                                               |

**Network:** Bend Municipal **Branch:** T07BE **Taxiway:** 07 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** P **Length:** 87.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 4332 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** T07BE **Taxiway:** 07 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 7/3/2018 **Use:** TAXIWAY **Rank:** P **Length:** 170.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 6156 (SqFt)

| Work Date | Work Code | Work Description                 | Cost      | Thickness (in) | Major M&R                           | Comments                                                                                     |
|-----------|-----------|----------------------------------|-----------|----------------|-------------------------------------|----------------------------------------------------------------------------------------------|
| 7/3/2018  | CR-AC     | Complete Reconstruction - AC     | 30,780.00 | 4.00           | <input checked="" type="checkbox"/> | PMP 2008<br>Oregon DOA 2004 Maint.<br>date estimated from curve<br>date estimated from curve |
| 7/2/2018  | BA-AG     | Base Course - Aggregate          | 0.00      | 6.00           | <input type="checkbox"/>            |                                                                                              |
| 7/1/2018  | SB-AG     | Subbase - Aggregate              | 0.00      | 8.00           | <input type="checkbox"/>            |                                                                                              |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00      | 0.10           | <input type="checkbox"/>            |                                                                                              |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00      | 0.10           | <input type="checkbox"/>            |                                                                                              |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00      | 0.00           | <input checked="" type="checkbox"/> |                                                                                              |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00      | 0.00           | <input checked="" type="checkbox"/> |                                                                                              |

**Network:** Bend Municipal **Branch:** T07BE **Taxiway:** 07 Bend **Section:** 03 **Surface:** AC  
**L.C.D.** 9/2/1961 **Use:** TAXIWAY **Rank:** S **Length:** 190.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 7570.000190 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                                               |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|--------------------------------------------------------|
| 9/2/2012  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                                               |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                                               |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                                               |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.                                 |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            | date estimated from curve<br>date estimated from curve |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                                                        |
| 9/2/1961  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                                                        |
| 9/1/1961  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                                                        |

8/31/2022

## Work History Report

Page 15 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** T08BE **Taxiway:** 08 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** TAXIWAY **Rank:** S **Length:** 635.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 17039.00040 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012                  |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

**Network:** Bend Municipal **Branch:** T09BE **Taxiway:** 09 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/1/2005 **Use:** TAXIWAY **Rank:** S **Length:** 40.00 (Ft) **Width:** 30.00 (Ft) **True Area:** 1216.000000 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|--------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015            |
| 9/1/2005  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

**Network:** Bend Municipal **Branch:** T10BE **Taxiway:** 10 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** S **Length:** 72.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 2849 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** T10BE **Taxiway:** 10 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** TAXIWAY **Rank:** S **Length:** 40.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 1060.000000 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments               |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015    |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint. |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness         |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                        |

**Network:** Bend Municipal **Branch:** T11BE **Taxiway:** 11 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** S **Length:** 60.00 (Ft) **Width:** 30.00 (Ft) **True Area:** 2611 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments                       |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|--------------------------------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                           |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209                           |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154                           |
| 9/1/2005  | NC-AC     | New Construction - AC        | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown thickness, assumed LCD |

8/31/2022

## Work History Report

Page 16 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TA1BE **Taxiway:** A1 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2006 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 12685.00000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2006 | NC-AC     | New Construction - AC           | 0.00 | 4.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 6.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2006 | SB-AG     | Subbase - Aggregate             | 0.00 | 12.00          | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TA1BE **Taxiway:** A1 Bend **Section:** 02 **Surface:** AAC  
**L.C.D.** 9/2/2012 **Use:** TAXIWAY **Rank:** P **Length:** 33.00 (Ft) **Width:** 60.00 (Ft) **True Area:** 2030.000000 (SqFt)

| Work Date | Work Code | Work Description            | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-----------------------------|------|----------------|-------------------------------------|----------|
| 9/2/2012  | SR-AC     | Surface Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/1/2012  | MI-CO     | Cold Milling                | 0.00 | -3.00          | <input type="checkbox"/>            | P401     |
| 10/3/2006 | NC-AC     | New Construction - AC       | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 10/2/2006 | BA-AG     | Base Course - Aggregate     | 0.00 | 6.00           | <input type="checkbox"/>            | P209     |
| 10/1/2006 | SB-AG     | Subbase - Aggregate         | 0.00 | 13.00          | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** TA2BE **Taxiway:** A2 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2006 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8275.000002 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 10/3/2006 | NC-AC     | New Construction - AC            | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401                     |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate  | 0.00 | 6.00           | <input type="checkbox"/>            | P-209                     |
| 10/1/2006 | SB-AG     | Subbase - Aggregate              | 0.00 | 13.00          | <input type="checkbox"/>            | P-154                     |
| 9/2/2004  | ST-SS     | Surface Treatment - Slurry Seal  | 0.00 | 0.50           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/1995  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1994  | OL-AT     | Overlay - AC Thin                | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/2/1919  | NC-AC     | New Construction - AC            | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date unknown              |
| 9/1/1919  | BA-CI     | Base Course - Cinders (Major MR) | 0.00 | 4.00           | <input checked="" type="checkbox"/> | date unknown              |

**Network:** Bend Municipal **Branch:** TA2BE **Taxiway:** A2 Bend **Section:** 02 **Surface:** AAC  
**L.C.D.** 9/2/2012 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 75.00 (Ft) **True Area:** 2945.000000 (SqFt)

| Work Date | Work Code | Work Description            | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|-----------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC          | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/2/2012  | SR-AC     | Surface Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                |
| 9/1/2012  | MI-CO     | Cold Milling                | 0.00 | -3.00          | <input type="checkbox"/>            | P401                |
| 10/3/2006 | NC-AC     | New Construction - AC       | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                |
| 10/2/2006 | BA-AG     | Base Course - Aggregate     | 0.00 | 6.00           | <input type="checkbox"/>            | P209                |
| 10/1/2006 | SB-AG     | Subbase - Aggregate         | 0.00 | 13.00          | <input type="checkbox"/>            | P154                |

8/31/2022

## Work History Report

Page 17 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

Network: Bend Municipal Branch: TA3BE Taxiway A3 Bend Section: 01 Surface: AC  
 L.C.D. 10/3/2006 Use: TAXIWAY Rank: P Length: 210.00 (Ft) Width: 35.00 (Ft) True Area: 8315.000002 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 10/3/2006 | NC-AC     | New Construction - AC            | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401                     |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate  | 0.00 | 6.00           | <input type="checkbox"/>            | P-209                     |
| 10/1/2006 | SB-AG     | Subbase - Aggregate              | 0.00 | 13.00          | <input type="checkbox"/>            | P-154                     |
| 9/2/2004  | ST-SS     | Surface Treatment - Slurry Seal  | 0.00 | 0.50           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1995  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/1995  | OL-AT     | Overlay - AC Thin                | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/2/1919  | NC-AC     | New Construction - AC            | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date unknown              |
| 9/1/1919  | BA-CI     | Base Course - Cinders (Major MR) | 0.00 | 4.00           | <input checked="" type="checkbox"/> | date unknown              |

Network: Bend Municipal Branch: TA3BE Taxiway A3 Bend Section: 02 Surface: AC  
 L.C.D. 9/3/2012 Use: TAXIWAY Rank: P Length: 35.00 (Ft) Width: 75.00 (Ft) True Area: 2885.000000 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC           | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209                |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154                |

Network: Bend Municipal Branch: TA4BE Taxiway A4 Bend Section: 01 Surface: AC  
 L.C.D. 10/3/2006 Use: TAXIWAY Rank: P Length: 210.00 (Ft) Width: 35.00 (Ft) True Area: 8400.000002 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 10/3/2006 | NC-AC     | New Construction - AC            | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401                     |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate  | 0.00 | 6.00           | <input type="checkbox"/>            | P-209                     |
| 10/1/2006 | SB-AG     | Subbase - Aggregate              | 0.00 | 13.00          | <input type="checkbox"/>            | P-154                     |
| 9/2/2004  | ST-SS     | Surface Treatment - Slurry Seal  | 0.00 | 0.50           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1995  | OL-AT     | Overlay - AC Thin                | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1995  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1919  | NC-AC     | New Construction - AC            | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date unknown              |
| 9/1/1919  | BA-CI     | Base Course - Cinders (Major MR) | 0.00 | 4.00           | <input checked="" type="checkbox"/> | date unknown              |

8/31/2022

## Work History Report

Page 18 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TA4BE **Taxiway:** A4 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 75.00 (Ft) **True Area:** 2860.000000 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments            |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|---------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC           | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015 |
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209                |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154                |

**Network:** Bend Municipal **Branch:** TA5BE **Taxiway:** A5 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2006 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8480.000002 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 10/3/2006 | NC-AC     | New Construction - AC            | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401                     |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate  | 0.00 | 6.00           | <input type="checkbox"/>            | P-209                     |
| 10/1/2006 | SB-AG     | Subbase - Aggregate              | 0.00 | 13.00          | <input type="checkbox"/>            | P-154                     |
| 9/2/2004  | ST-SS     | Surface Treatment - Slurry Seal  | 0.00 | 0.50           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/1995  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1992  | OL-AT     | Overlay - AC Thin                | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/2/1919  | NC-AC     | New Construction - AC            | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date unknown              |
| 9/1/1919  | BA-CI     | Base Course - Cinders (Major MR) | 0.00 | 4.00           | <input checked="" type="checkbox"/> | date unknown              |

**Network:** Bend Municipal **Branch:** TA5BE **Taxiway:** A5 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 75.00 (Ft) **True Area:** 2890.000000 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** TA6BE **Taxiway:** A6 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2006 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 50.00 (Ft) **True Area:** 12716.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2006 | NC-AC     | New Construction - AC           | 0.00 | 4.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2006 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 6.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2006 | SB-AG     | Subbase - Aggregate             | 0.00 | 12.00          | <input type="checkbox"/>            | P-154    |

8/31/2022

## Work History Report

Page 19 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TA6BE **Taxiway:** A6 Bend **Section:** 02 **Surface:** AAC  
**L.C.D.** 9/2/2012 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 75.00 (Ft) **True Area:** 2000.000000 (SqFt)

| Work Date | Work Code | Work Description            | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-----------------------------|------|----------------|-------------------------------------|----------|
| 9/2/2012  | SR-AC     | Surface Reconstruction - AC | 0.00 | 4.00           | <input checked="" type="checkbox"/> | P401     |
| 9/1/2012  | MI-CO     | Cold Milling                | 0.00 | -4.00          | <input type="checkbox"/>            | P401     |
| 10/3/2006 | NC-AC     | New Construction - AC       | 0.00 | 4.00           | <input checked="" type="checkbox"/> | P401     |
| 10/2/2006 | BA-AG     | Base Course - Aggregate     | 0.00 | 6.00           | <input type="checkbox"/>            | P209     |
| 10/1/2006 | SB-AG     | Subbase - Aggregate         | 0.00 | 13.00          | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** TABE **Taxiway:** A Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** P **Length:** 5,200.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 182005 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015       |
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC     | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                      |
| 9/2/2012  | BA-AG     | Base Course - Aggregate          | 0.00 | 8.00           | <input type="checkbox"/>            | P209                      |
| 9/1/2012  | SB-AG     | Subbase - Aggregate              | 0.00 | 9.00           | <input type="checkbox"/>            | P154                      |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/2/2004  | ST-SS     | Surface Treatment - Slurry Seal  | 0.00 | 0.50           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/4/1995  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/3/1995  | OL-AT     | Overlay - AC Thin                | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/2/1919  | NC-AC     | New Construction - AC            | 0.00 | 2.00           | <input checked="" type="checkbox"/> | date unknown              |
| 9/1/1919  | BA-CI     | Base Course - Cinders (Major MR) | 0.00 | 4.00           | <input checked="" type="checkbox"/> | date unknown              |

**Network:** Bend Municipal **Branch:** TAEROBE **Aero Taxiway:** Ben **Section:** 01 **Surface:** AC  
**L.C.D.** 9/2/2008 **Use:** TAXIWAY **Rank:** S **Length:** 1,072.00 (Ft) **Width:** 36.00 (Ft) **True Area:** 40188.00001 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 9/2/2008  | NC-AC     | New Construction - AC   | 0.00 | 3.50           | <input checked="" type="checkbox"/> | ,        |
| 9/1/2008  | BA-AG     | Base Course - Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | ,        |

**Network:** Bend Municipal **Branch:** TAEROBE **Aero Taxiway:** Ben **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/2008 **Use:** TAXIWAY **Rank:** S **Length:** 608.00 (Ft) **Width:** 62.00 (Ft) **True Area:** 38299.00001 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 9/2/2008  | NC-AC     | New Construction - AC   | 0.00 | 3.50           | <input checked="" type="checkbox"/> | ,        |
| 9/1/2008  | BA-AG     | Base Course - Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | ,        |

**Network:** Bend Municipal **Branch:** TAEROBE **Aero Taxiway:** Ben **Section:** 03 **Surface:** AC  
**L.C.D.** 9/2/2008 **Use:** TAXIWAY **Rank:** S **Length:** 608.00 (Ft) **Width:** 86.00 (Ft) **True Area:** 54823.00001 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 9/2/2008  | NC-AC     | New Construction - AC   | 0.00 | 3.50           | <input checked="" type="checkbox"/> | ,        |
| 9/1/2008  | BA-AG     | Base Course - Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | ,        |

8/31/2022

**Work History Report**

Page 20 of 26

*Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions*

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TAEROBE  |                            | Aero Taxiway Ben         |                                      | <b>Section:</b> 04 | <b>Surface:</b> AC |
|--------------------------------|---------------------|-------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/2/2008         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S          | <b>Length:</b> 608.00 (Ft) | <b>Width:</b> 59.00 (Ft) | <b>True Area:</b> 39175.00001 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description        | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                    |
| 9/2/2008                       | NC-AC               | New Construction - AC   | 0.00                       | 3.50                     | <input checked="" type="checkbox"/>  |                    |                    |
| 9/1/2008                       | BA-AG               | Base Course - Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             |                    |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TAEROBE  |                            | Aero Taxiway Ben         |                                      | <b>Section:</b> 05 | <b>Surface:</b> AC |
|--------------------------------|---------------------|-------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/2/2008         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S          | <b>Length:</b> 608.00 (Ft) | <b>Width:</b> 58.00 (Ft) | <b>True Area:</b> 38964.00001 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description        | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                    |
| 9/2/2008                       | NC-AC               | New Construction - AC   | 0.00                       | 3.50                     | <input checked="" type="checkbox"/>  |                    |                    |
| 9/1/2008                       | BA-AG               | Base Course - Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             |                    |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TAEROBE  |                            | Aero Taxiway Ben         |                                      | <b>Section:</b> 06 | <b>Surface:</b> AC |
|--------------------------------|---------------------|-------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/2/2008         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S          | <b>Length:</b> 608.00 (Ft) | <b>Width:</b> 55.00 (Ft) | <b>True Area:</b> 37723.00001 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description        | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                    |
| 9/2/2008                       | NC-AC               | New Construction - AC   | 0.00                       | 3.50                     | <input checked="" type="checkbox"/>  |                    |                    |
| 9/1/2008                       | BA-AG               | Base Course - Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             |                    |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TAEROBE  |                            | Aero Taxiway Ben         |                                      | <b>Section:</b> 07 | <b>Surface:</b> AC |
|--------------------------------|---------------------|-------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/2/2008         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S          | <b>Length:</b> 579.00 (Ft) | <b>Width:</b> 68.00 (Ft) | <b>True Area:</b> 40813.00001 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description        | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                    |
| 9/2/2008                       | NC-AC               | New Construction - AC   | 0.00                       | 3.50                     | <input checked="" type="checkbox"/>  |                    |                    |
| 9/1/2008                       | BA-AG               | Base Course - Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             |                    |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TAEROBE  |                              | Aero Taxiway Ben         |                                      | <b>Section:</b> 08 | <b>Surface:</b> AC |
|--------------------------------|---------------------|-------------------------|------------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/2/2008         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S          | <b>Length:</b> 1,200.00 (Ft) | <b>Width:</b> 34.00 (Ft) | <b>True Area:</b> 41016.00001 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description        | Cost                         | Thickness (in)           | Major M&R                            | Comments           |                    |
| 9/2/2008                       | NC-AC               | New Construction - AC   | 0.00                         | 3.50                     | <input checked="" type="checkbox"/>  |                    |                    |
| 9/1/2008                       | BA-AG               | Base Course - Aggregate | 0.00                         | 8.00                     | <input type="checkbox"/>             |                    |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TB1BE            |                            | Taxiway B1 Bend          |                                      | <b>Section:</b> 01 | <b>Surface:</b> AC |
|--------------------------------|---------------------|---------------------------------|----------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 10/3/2010        | <b>Use:</b> TAXIWAY | <b>Rank:</b> P                  | <b>Length:</b> 210.00 (Ft) | <b>Width:</b> 35.00 (Ft) | <b>True Area:</b> 12660.00000 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description                | Cost                       | Thickness (in)           | Major M&R                            | Comments           |                    |
| 10/3/2010                      | NC-AC               | New Construction - AC           | 0.00                       | 3.00                     | <input checked="" type="checkbox"/>  | P-401              |                    |
| 10/2/2010                      | BA-CA               | Base Course - Crushed Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             | P-209              |                    |
| 10/1/2010                      | SB-AG               | Subbase - Aggregate             | 0.00                       | 9.00                     | <input type="checkbox"/>             | P-154              |                    |

8/31/2022

## Work History Report

Page 21 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TB2BE **Taxiway:** B2 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8364.000002 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB2BE **Taxiway:** B2 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 2943.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB3BE **Taxiway:** B3 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8358.000002 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 0.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB3BE **Taxiway:** B3 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 2949.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB4BE **Taxiway:** B4 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8361.000002 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

8/31/2022

## Work History Report

Page 22 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TB4BE **Taxiway:** B4 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 2946.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB5BE **Taxiway:** B5 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 8431.000002 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB5BE **Taxiway:** B5 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 2876.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB6BE **Taxiway:** B6 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 210.00 (Ft) **Width:** 37.50 (Ft) **True Area:** 12729.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TB6BE **Taxiway:** B6 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 35.00 (Ft) **Width:** 37.50 (Ft) **True Area:** 2026.000000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC              | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 0.00           | <input type="checkbox"/>            | P-154    |

8/31/2022

## Work History Report

Page 23 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TBBBE Taxiway BB Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** S **Length:** 835.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 36692.00001 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** TBBE Taxiway B Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 10/3/2010 **Use:** TAXIWAY **Rank:** P **Length:** 5,200.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 181500.0000 (SqFt)

| Work Date | Work Code | Work Description                | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|---------------------------------|------|----------------|-------------------------------------|----------|
| 10/3/2010 | NC-AC     | New Construction - AC           | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P-401    |
| 10/2/2010 | BA-CA     | Base Course - Crushed Aggregate | 0.00 | 8.00           | <input type="checkbox"/>            | P-209    |
| 10/1/2010 | SB-AG     | Subbase - Aggregate             | 0.00 | 9.00           | <input type="checkbox"/>            | P-154    |

**Network:** Bend Municipal **Branch:** THELIBE Helicopter Area Ta **Section:** 01 **Surface:** AC  
**L.C.D.** 7/3/2017 **Use:** TAXIWAY **Rank:** P **Length:** 611.00 (Ft) **Width:** 25.00 (Ft) **True Area:** 16126.00000 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 7/3/2017  | NC-AC     | New Construction - AC   | 0.00 | 4.00           | <input checked="" type="checkbox"/> | P401     |
| 7/2/2017  | BA-AG     | Base Course - Aggregate | 0.00 | 4.00           | <input type="checkbox"/>            | P209     |
| 7/1/2017  | SB-AG     | Subbase - Aggregate     | 0.00 | 10.00          | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** THELIBE Helicopter Area Ta **Section:** 02 **Surface:** AC  
**L.C.D.** 7/3/2017 **Use:** TAXIWAY **Rank:** P **Length:** 188.00 (Ft) **Width:** 50.00 (Ft) **True Area:** 10117.00000 (SqFt)

| Work Date | Work Code | Work Description        | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|-------------------------|------|----------------|-------------------------------------|----------|
| 7/3/2017  | NC-AC     | New Construction - AC   | 0.00 | 4.00           | <input checked="" type="checkbox"/> | P401     |
| 7/2/2017  | BA-AG     | Base Course - Aggregate | 0.00 | 4.00           | <input type="checkbox"/>            | P209     |
| 7/1/2017  | SB-AG     | Subbase - Aggregate     | 0.00 | 10.00          | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** TLA10BE Taxilane A10 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** S **Length:** 116.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 6215.000000 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|----------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

8/31/2022

## Work History Report

Page 24 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

**Network:** Bend Municipal **Branch:** TLA10BE **Taxilane** A10 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/2/1999 **Use:** TAXIWAY **Rank:** S **Length:** 775.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 27138 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments               |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015    |
| 9/2/2012  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012               |
| 9/1/2012  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2012               |
| 9/1/2008  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008               |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint. |
| 9/2/1999  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | unk. thickness         |
| 9/1/1999  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> |                        |

**Network:** Bend Municipal **Branch:** TLA7BE **Taxilane** A7 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** S **Length:** 182.00 (Ft) **Width:** 40.00 (Ft) **True Area:** 8976 (SqFt)

| Work Date | Work Code | Work Description                 | Cost | Thickness (in) | Major M&R                           | Comments                  |
|-----------|-----------|----------------------------------|------|----------------|-------------------------------------|---------------------------|
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC     | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401                      |
| 9/2/2012  | BA-AG     | Base Course - Aggregate          | 0.00 | 8.00           | <input type="checkbox"/>            | P209                      |
| 9/1/2012  | SB-AG     | Subbase - Aggregate              | 0.00 | 9.00           | <input type="checkbox"/>            | P154                      |
| 9/2/2008  | PA-AD     | Patching - AC Deep               | 0.00 | 0.00           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2008  | CS-WD     | Crack Seal - Wide Cracks         | 0.00 | 0.10           | <input type="checkbox"/>            | PMP 2008                  |
| 9/1/2004  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |
| 9/2/2000  | SS-FS     | Surface Seal - Fog Seal          | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/1/2000  | CS-AC     | Crack Sealing - AC               | 0.00 | 0.10           | <input type="checkbox"/>            |                           |
| 9/2/1991  | NC-AC     | New Construction - AC            | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |
| 9/1/1991  | BA-UN     | Base Course - Unknown (Major MR) | 0.00 | 0.00           | <input checked="" type="checkbox"/> | date estimated from curve |

**Network:** Bend Municipal **Branch:** TLA8BE **Taxilane** A8 Bend **Section:** 01 **Surface:** AC  
**L.C.D.** 9/3/2012 **Use:** TAXIWAY **Rank:** S **Length:** 107.50 (Ft) **Width:** 35.00 (Ft) **True Area:** 5862 (SqFt)

| Work Date | Work Code | Work Description             | Cost | Thickness (in) | Major M&R                           | Comments |
|-----------|-----------|------------------------------|------|----------------|-------------------------------------|----------|
| 7/1/2015  | CS-AC     | Crack Sealing - AC           | 0.00 | 0.00           | <input type="checkbox"/>            |          |
| 9/3/2012  | CR-AC     | Complete Reconstruction - AC | 0.00 | 3.00           | <input checked="" type="checkbox"/> | P401     |
| 9/2/2012  | BA-AG     | Base Course - Aggregate      | 0.00 | 8.00           | <input type="checkbox"/>            | P209     |
| 9/1/2012  | SB-AG     | Subbase - Aggregate          | 0.00 | 9.00           | <input type="checkbox"/>            | P154     |

**Network:** Bend Municipal **Branch:** TLA8BE **Taxilane** A8 Bend **Section:** 02 **Surface:** AC  
**L.C.D.** 9/1/2008 **Use:** TAXIWAY **Rank:** S **Length:** 75.00 (Ft) **Width:** 35.00 (Ft) **True Area:** 2624.999999 (SqFt)

| Work Date | Work Code | Work Description      | Cost | Thickness (in) | Major M&R                           | Comments                            |
|-----------|-----------|-----------------------|------|----------------|-------------------------------------|-------------------------------------|
| 9/1/2015  | CS-AC     | Crack Sealing - AC    | 0.00 | 0.00           | <input type="checkbox"/>            | P0007207W, PMP 2015                 |
| 9/1/2008  | NC-AC     | New Construction - AC | 0.00 | 0.00           | <input checked="" type="checkbox"/> | Unknown construction date & thickne |

8/31/2022

## Work History Report

Page 25 of 26

Pavement Database: ODA\_WOC3\_8-30-2022\_NewDetCurveRegions

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TLA9BE        |                           | Taxilane A9 Bend         |                                     | <b>Section:</b> 01 | <b>Surface:</b> AC |
|--------------------------------|---------------------|------------------------------|---------------------------|--------------------------|-------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 9/3/2012         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S               | <b>Length:</b> 96.50 (Ft) | <b>Width:</b> 30.00 (Ft) | <b>True Area:</b> 4115 (SqFt)       |                    |                    |
| Work Date                      | Work Code           | Work Description             | Cost                      | Thickness (in)           | Major M&R                           | Comments           |                    |
| 9/3/2012                       | CR-AC               | Complete Reconstruction - AC | 0.00                      | 3.00                     | <input checked="" type="checkbox"/> | P401               |                    |
| 9/2/2012                       | BA-AG               | Base Course - Aggregate      | 0.00                      | 8.00                     | <input type="checkbox"/>            | P209               |                    |
| 9/1/2012                       | SB-AG               | Subbase - Aggregate          | 0.00                      | 9.00                     | <input type="checkbox"/>            | P154               |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TLA9BE            |                            | Taxilane A9 Bend         |                                     | <b>Section:</b> 02        | <b>Surface:</b> AC |
|--------------------------------|---------------------|----------------------------------|----------------------------|--------------------------|-------------------------------------|---------------------------|--------------------|
| <b>L.C.D.</b> 9/2/1999         | <b>Use:</b> TAXIWAY | <b>Rank:</b> S                   | <b>Length:</b> 201.00 (Ft) | <b>Width:</b> 30.00 (Ft) | <b>True Area:</b> 5923 (SqFt)       |                           |                    |
| Work Date                      | Work Code           | Work Description                 | Cost                       | Thickness (in)           | Major M&R                           | Comments                  |                    |
| 9/1/2015                       | CS-AC               | Crack Sealing - AC               | 0.00                       | 0.00                     | <input type="checkbox"/>            | P0007207W, PMP 2015       |                    |
| 9/1/2012                       | CS-AC               | Crack Sealing - AC               | 0.00                       | 0.00                     | <input type="checkbox"/>            | PMP 2012                  |                    |
| 9/1/2004                       | CS-AC               | Crack Sealing - AC               | 0.00                       | 0.10                     | <input type="checkbox"/>            | Oregon DOA 2004 Maint.    |                    |
| 9/2/1999                       | NC-AC               | New Construction - AC            | 0.00                       | 0.00                     | <input checked="" type="checkbox"/> | date estimated from curve |                    |
| 9/1/1999                       | BA-UN               | Base Course - Unknown (Major MR) | 0.00                       | 0.00                     | <input checked="" type="checkbox"/> | date estimated from curve |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TLCBE            |                            | Taxilane C Bend          |                                      | <b>Section:</b> 01  | <b>Surface:</b> AC |
|--------------------------------|---------------------|---------------------------------|----------------------------|--------------------------|--------------------------------------|---------------------|--------------------|
| <b>L.C.D.</b> 10/3/2010        | <b>Use:</b> TAXIWAY | <b>Rank:</b> S                  | <b>Length:</b> 145.00 (Ft) | <b>Width:</b> 30.00 (Ft) | <b>True Area:</b> 5156.000001 (SqFt) |                     |                    |
| Work Date                      | Work Code           | Work Description                | Cost                       | Thickness (in)           | Major M&R                            | Comments            |                    |
| 9/1/2015                       | CS-AC               | Crack Sealing - AC              | 0.00                       | 0.00                     | <input type="checkbox"/>             | P0007207W, PMP 2015 |                    |
| 10/3/2010                      | NC-AC               | New Construction - AC           | 0.00                       | 3.00                     | <input checked="" type="checkbox"/>  | P-401               |                    |
| 10/2/2010                      | BA-CA               | Base Course - Crushed Aggregate | 0.00                       | 8.00                     | <input type="checkbox"/>             | P-209               |                    |
| 10/1/2010                      | SB-AG               | Subbase - Aggregate             | 0.00                       | 9.00                     | <input type="checkbox"/>             | P-154               |                    |

| <b>Network:</b> Bend Municipal |                     | <b>Branch:</b> TLEBE            |                           | Taxilane E Bend          |                                      | <b>Section:</b> 01 | <b>Surface:</b> AC |
|--------------------------------|---------------------|---------------------------------|---------------------------|--------------------------|--------------------------------------|--------------------|--------------------|
| <b>L.C.D.</b> 10/3/2010        | <b>Use:</b> TAXIWAY | <b>Rank:</b> S                  | <b>Length:</b> 98.00 (Ft) | <b>Width:</b> 40.00 (Ft) | <b>True Area:</b> 5330.000001 (SqFt) |                    |                    |
| Work Date                      | Work Code           | Work Description                | Cost                      | Thickness (in)           | Major M&R                            | Comments           |                    |
| 10/3/2010                      | NC-AC               | New Construction - AC           | 0.00                      | 3.00                     | <input checked="" type="checkbox"/>  | P-401              |                    |
| 10/2/2010                      | BA-CA               | Base Course - Crushed Aggregate | 0.00                      | 8.00                     | <input type="checkbox"/>             | P-209              |                    |
| 10/1/2010                      | SB-AG               | Subbase - Aggregate             | 0.00                      | 9.00                     | <input type="checkbox"/>             | P-154              |                    |

**Summary:**

| Work Description                 | Section Count | Area Total (SqFt) | Thickness Avg (in) | Thickness STD (in) |
|----------------------------------|---------------|-------------------|--------------------|--------------------|
| Base Course - Unknown (Major MR) | 29            | 343,875.01        | 0.00               | 0.00               |
| Base Course - Aggregate          | 41            | 1,907,873.00      | 7.24               | 1.34               |
| Base Course - Cinders (Major MR) | 8             | 377,733.00        | 4.00               | 0.00               |
| Base Course - Crushed Aggregate  | 24            | 814,439.00        | 7.42               | 0.91               |
| Cold Milling                     | 3             | 6,975.00          | -3.33              | 0.47               |
| Complete Reconstruction - AC     | 19            | 515,483.00        | 3.00               | 0.86               |
| Crack Seal - Wide Cracks         | 8             | 305,654.00        | 0.10               | 0.00               |
| Crack Sealing - AC               | 149           | 3,884,324.02      | 0.05               | 0.05               |
| New Construction - AC            | 98            | 3,132,629.01      | 1.70               | 1.57               |
| New Construction - Initial       | 12            | 53,054.00         | 0.00               | 0.00               |
| New Construction - PCC           | 1             | 45,280.00         | 0.00               | 0.00               |
| Overlay - AC Structural          | 1             | 9,080.00          | 0.00               | 0.00               |
| Overlay - AC Thin                | 5             | 215,475.00        | 2.00               | 0.00               |
| Patching - AC Deep               | 17            | 419,299.00        | 0.00               | 0.00               |
| Patching - AC Full Depth         | 1             | 15,759.00         | 0.00               | 0.00               |
| Subbase - Aggregate              | 56            | 1,973,941.00      | 9.41               | 2.37               |
| Surface Reconstruction - AC      | 3             | 6,975.00          | 3.33               | 0.47               |
| Surface Seal - Coal Tar          | 1             | 6,600.00          | 0.50               | 0.00               |
| Surface Seal - Fog Seal          | 16            | 376,871.00        | 0.07               | 0.05               |
| Surface Treatment - Slurry Seal  | 7             | 318,435.00        | 0.43               | 0.17               |