

Benton County Sheriff's Office

Bent_pol01A

Benton County

Building Type	County
EOC-Public Safety Answering P	Benton
Street	
180 NW 5th St	
City	State Zip
Corvallis	OR 97330
Latitude	Longitude
44.56574	123.26312
Tracking Code	Inspection Date
RVS in 2006	6/26/2006



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	2.8	-1	-0.5	0	0	0	-0.6	0	0.7
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0


Benton County Sheriff's Office

Final RVS Score

Final Type	Final Score
C2	0.7

FEMA-154 Collapse Potential

High (>10%)

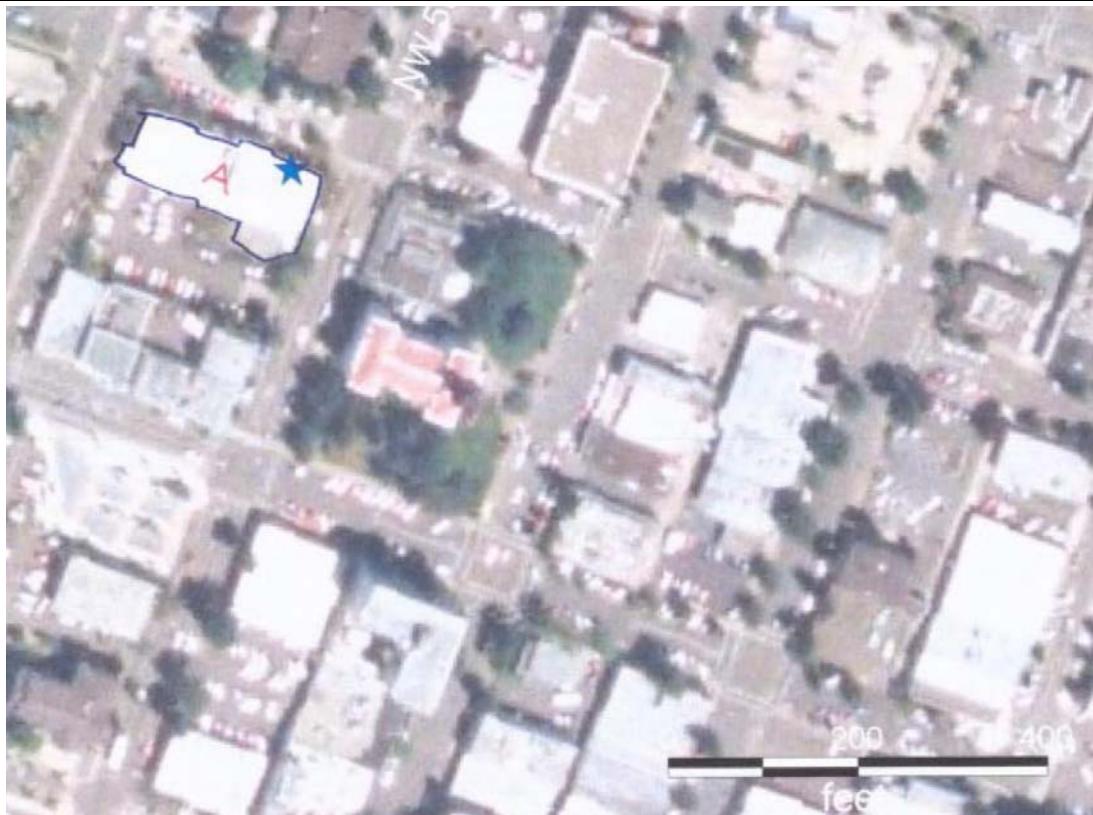

OregonGeology

Benton County Sheriff's Office

Bent_pol01A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	2	Yes	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Single Change	
None		Short Columns	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
S	Vertical Irregularity Secondary	W	Other
			
S	General Site	S	General Site
			
S	Primary Structural Type shear wall	S	General Site