

Wichita Elementary School

North Clackamas SD 12

Clac_sch24A

Building Type School	County Clackamas	
Street 6031 SE King Rd		
City Milwaukie	State OR	Zip 97222
Latitude 45.44835	Longitude 122.60132	
Tracking Code RVS in 2006	Inspection Date 12/19/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	-2	-0.5	-1	0	-0.4	0	0	-0.1
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Wichita Elementary School

Final RVS Score

Final Type	Final Score
W2	-0.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Wichita Elementary School

Clac_sch24A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built		
291	1941	1941	1940		
Total Area (square ft)	Number of Stories	Basement	Pounding Potential		
33994	1	No	No		
Plan Irregularities		Vertical Irregularities			
Reentrant Corners: U shaped		Steps in Elevation View: 2 to 3 Changes			
Torsion: Eccentric Stiffness		None			
None		None			
Falling Hazards		Poor Conditions			
Other: Brick Veneer		None			
Unreinforced Chimneys		None			
Other: Ornamental Hazard Over Exit		None			
	S Falling Hazard		S Basement		SW Falling Hazard
	W Basement		W Plan Irregularity Secondary		W Primary Structural Type
	N Vertical Irregularity Primary		NE Primary Structural Type		NW Primary Structural Type



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Wichita Elementary School


Clac_sch24A



NW Plan Irregularity Secondary



NW Vertical Irregularity Primary

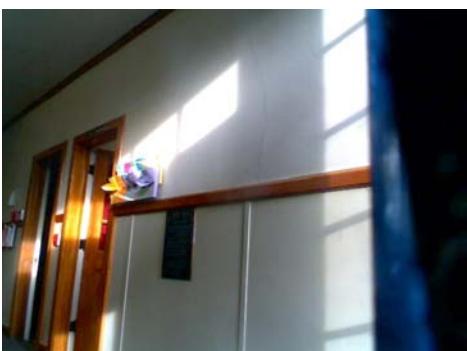

S Field Verified Year Built
1941