

Scappoose High School

Scappoose SD 1J

Colu_sch01A

Building Type	County	
School	Columbia	
Street		
33700 Se High School Way		
City	State	Zip
Scappoose	OR	97056
Latitude	Longitude	
45.74843	122.87455	
Tracking Code	Inspection Date	
RVS in 2006	8/22/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	0	0	0	1.3
Secondary	C2	2.8	-1	-0.5	0	0	0	0	0	1.3
Tertiary		0	0	0	0	0	0	0	0	0

Scappoose High School

Final RVS Score

Final Type	Final Score
RM1	1.3

FEMA-154 Collapse Potential

Moderate (>1%)

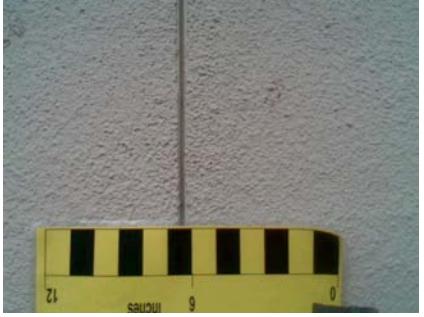


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Scappoose High School

Colu_sch01A

Enrollment 741	Year Built (Field Verified) 1972	Year Built (Alt. Source) 1972	Est. Decade Built 1970
Total Area (square ft) 102000	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners: Other None None		Vertical Irregularities Steps in Elevation View: Very Irregular Changes None None	
Falling Hazards Other: Ornamental Hazard Over Exit None None		Poor Conditions None None None	
			
N Primary Structural Type cmu in hall	N Elevation View	NE Plan Irregularity Primary	
			
E Other jt in surface coating over hard structure	E Plan Irregularity Primary	E Vertical Irregularity Primary	
			
N Falling Hazard	N Vertical Irregularity Primary	W Falling Hazard	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Scappoose High School

Colu_sch01A



W Elevation View



W Vertical Irregularity Primary



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Scappoose High School

Scappoose SD 1J

Colu_sch01B

Building Type School	County Columbia	
Street 33700 Se High School Way		
City Scappoose	State OR	Zip 97056
Latitude 45.74775	Longitude 122.87297	
Tracking Code RVS in 2006	Inspection Date 8/22/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	0	0	0	0	0	0	0	2.8
Secondary	C1	2.5	0	0	0	0	0	0	0	2.5
Tertiary	C3	1.6	0	0	0	0	0	0	0	1.6

Scappoose High School

Final RVS Score

Final Type	Final Score
C3	1.6

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Scappoose High School

Colu_sch01B

Enrollment 741	Year Built (Field Verified) 1972	Year Built (Alt. Source) 1970	Est. Decade Built 1970
Total Area (square ft) 102000	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards Other: Ornamental Hazard Over Exit		Poor Conditions None None None	
			
SW Elevation View		W Primary Structural Type	
			
S Elevation View		S Primary Structural Type cmu in hall	
			
E Elevation View		E Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries