

Clatskanie Middle/High School

Clatskanie SD 6J

Colu_sch03A

Building Type School	County Columbia	
Street 471 Sw Bel Air Dr		
City Clatskanie	State OR	Zip 97016
Latitude 46.101	Longitude 123.21123	
Tracking Code RVS in 2006	Inspection Date 9/1/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary	PC1	2.6	0	-0.5	0	0	-0.4	0	0	1.7
Tertiary	W2	3.8	-2	-0.5	0	0	-0.4	0	0	0.9

Clatskanie Middle/High School

Final RVS Score

Final Type	Final Score
RM1	0.9

FEMA-154 Collapse Potential

High (>10%)




Oregon Geology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Clatskanie Middle/High School

Colu_sch03A

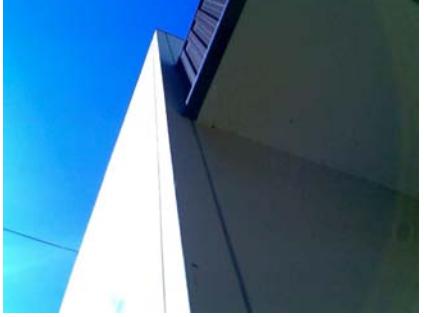Enrollment 477	Year Built (Field Verified) 1978	Year Built (Alt. Source) 1978	Est. Decade Built 1970
Total Area (square ft) 117768	Number of Stories 2	Basement	Pounding Potential No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: 2 to 3 Changes	
Out of Plane Lateral-Force-Resistance Elements		Building On Hill or Sloped Site	
None		None	
Falling Hazards		Poor Conditions	
Other: Ornamental Hazard Over Exit		None	
None		None	
None		None	
			
N Plan Irregularity Secondary		E Other metal siding	
		E Secondary Structural Type	
			
E Primary Structural Type		E Secondary Structural Type caulked vert jts	
		E Secondary Structural Type	
			
SE Elevation View		S Vertical Irregularity Secondary	
		S Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Clatskanie Middle/High School


Colu_sch03A



S Elevation View



S Other
white wall above is added mech screen, most likely stud framed. Not a part of pc gym framing.

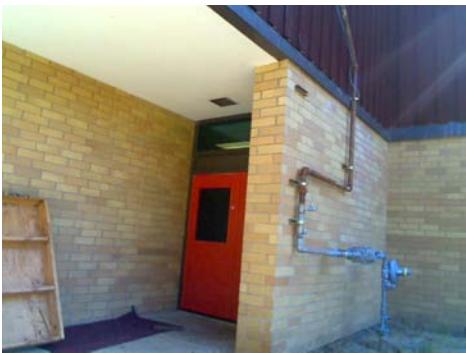

S Primary Structural Type
rm detailing



S Falling Hazard



W Elevation View



SW Elevation View



NW Falling Hazard



NW Elevation View



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries