


Grant Watts Elementary School

Colu_sch09A

Scappoose SD 1J

Building Type	County
School	Columbia
Street	
52000 SE 3rd PL	
City	State Zip
Scappoose	OR 97056
Latitude	Longitude
45.75005	122.87268
Tracking Code	Inspection Date
RVS in 2006	8/22/2006

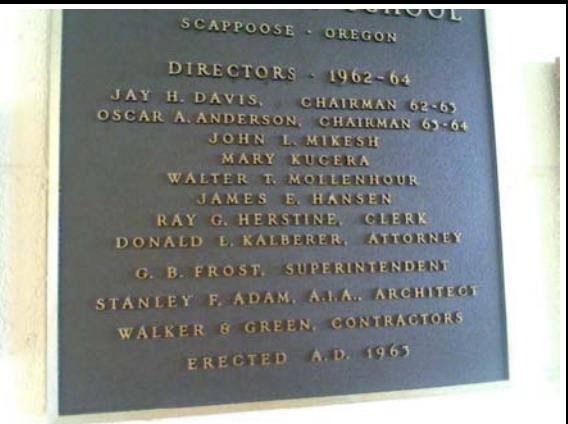

Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	0	0	0	1.3
Secondary	W2	3.8	-2	-0.5	0	0	0	0	0	1.3
Tertiary		0	0	0	0	0	0	0	0	0

Grant Watts Elementary School

Final RVS Score

Final Type	Final Score
RM1	1.3

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Grant Watts Elementary School

Colu_sch09A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
385	1963	1963	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
39300	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: 2 to 3 Changes	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Ornamental Hazard Over Exit		None	
Unreinforced Chimneys		None	
None		None	
			
N Primary Structural Type	N Primary Structural Type	N Falling Hazard	
			
NE Vertical Irregularity Primary	N Elevation View	NE Elevation View no pounding	
			
NE Plan Irregularity Primary	SW Falling Hazard	E Primary Structural Type wood/cmu transition	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Grant Watts Elementary School

Colu_sch09A



SE Elevation View



SE Falling Hazard



S Plan Irregularity Primary



S Primary Structural Type
wood/cmu



W Primary Structural Type
wood/cmu

Grant Watts Elementary School

Colu_sch09B

Scappoose SD 1J

Building Type School	County Columbia	
Street 52000 SE 3rd PL		
City Scappoose	State OR	Zip 97056
Latitude 45.75009	Longitude 122.87339	
Tracking Code RVS in 2006	Inspection Date 8/22/2006	

Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card										
	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	0	0	0	0	0	0	0	3.8
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0



Grant Watts Elementary School

Final RVS Score

Final Type W2	Final Score 3.8
------------------	--------------------

FEMA-154 Collapse Potential

Low (<1%)



Colu_sch09



OregonGeology

Grant Watts Elementary School

Colu_sch09B

Enrollment 385	Year Built (Field Verified) 1963	Year Built (Alt. Source) 1963	Est. Decade Built 1970
Total Area (square ft) 39300	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards Other: Ornamental Hazard Over Exit		Poor Conditions None None None	
 E Building Name		 SW Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries