


# Ochoco Elementary School

Crook County SD

Croo\_sch04A

Building Type	County	
School	Crook	
Street		
440 NW Madras Hwy		
City	State	Zip
Prineville	OR	97754
Latitude	Longitude	
44.30424	120.85903	
Tracking Code	Inspection Date	
RVS in 2006	7/6/2006	

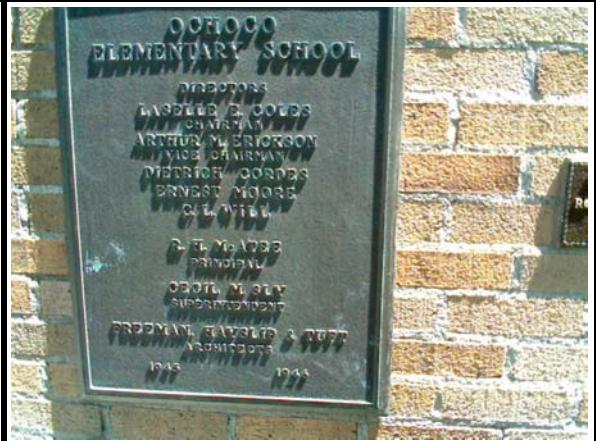

Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	0	0	0	0	-1.2	0	0.4
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Ochoco Elementary School

## Final RVS Score

Final Type	Final Score
C2	0.4

## FEMA-154 Collapse Potential

High (>10%)



OregonGeology

# Ochoco Elementary School

Croo\_sch04A

Enrollment 413	Year Built (Field Verified) 1945	Year Built (Alt. Source) 1945	Est. Decade Built 1940
Total Area (square ft) 39694	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities Steps in Elevation View: Single Change Steps in Elevation View: Single Change (Adjacent Building/Entity) None	
Falling Hazards None None None		Poor Conditions None None None	
			
S Elevation View		SE Vertical Irregularity Primary	
		SE Vertical Irregularity Secondary	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Ochoco Elementary School

Crook County SD

Croo\_sch04B

Building Type School	County Crook	
Street 440 NW Madras Hwy		
City Prineville	State OR	Zip 97754
Latitude 44.30449	Longitude 120.85873	
Tracking Code RVS in 2006	Inspection Date 7/6/2006	



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Secondary	C2	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Tertiary		0	0	0	0	0	0	0	0	0

Ochoco Elementary School

### Final RVS Score

Final Type	Final Score
RM1	-0.1

### FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

# Ochoco Elementary School

Croo\_sch04B

Enrollment 413	Year Built (Field Verified) 1945	Year Built (Alt. Source) 1945	Est. Decade Built 1950
Total Area (square ft) 39694	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners:T shaped (Adjacent Build/Entity) None None		Vertical Irregularities Steps in Elevation View: Single Change (Adjacent Building/Entity) None None	
Falling Hazards None None None		Poor Conditions None None None	
 NW Plan Irregularity Primary			

# Ochoco Elementary School

Crook County SD

Croo\_sch04C

Building Type School	County Crook	
Street 440 NW Madras Hwy		
City Prineville	State OR	Zip 97754
Latitude 44.30448	Longitude 120.85945	
Tracking Code RVS in 2006	Inspection Date 7/6/2006	



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Secondary	C2	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Tertiary		0	0	0	0	0	0	0	0	0

Ochoco Elementary School

## Final RVS Score

Final Type	Final Score
RM1	-0.1

## FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

# Ochoco Elementary School

Croo\_sch04C

Enrollment 413	Year Built (Field Verified) 1945	Year Built (Alt. Source) 1945	Est. Decade Built 1960
Total Area (square ft) 39694	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners:Other (Adjacent Build/Entity) None None		Vertical Irregularities Steps in Elevation View: Single Change (Adjacent Building/Entity) None None	
Falling Hazards None None None		Poor Conditions None None None	
 SW Elevation View			

# Ochoco Elementary School

Crook County SD

Croo\_sch04D

Building Type School	County Crook	
Street 440 NW Madras Hwy		
City Prineville	State OR	Zip 97754
Latitude 44.30478	Longitude 120.85918	
Tracking Code RVS in 2006	Inspection Date 7/6/2006	



Seismicity Zone: Moderate

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	4.8	0	-0.5	0	0	0	-1.2	0	3.1
Secondary	RM1	3.6	0	-0.5	0	0	0	-1.2	0	1.9
Tertiary		0	0	0	0	0	0	0	0	0

Ochoco Elementary School

## Final RVS Score

Final Type	Final Score
RM1	1.9

## FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

# Ochoco Elementary School

Croo\_sch04D

Enrollment 413	Year Built (Field Verified) 1945	Year Built (Alt. Source) 1945	Est. Decade Built 1970
Total Area (square ft) 39694	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners:L shaped (Adjacent Build/Entity) None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	
 N Plan Irregularity Secondary		 NW Elevation View	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries