

# Brookings Police and Fire/Rescue

City of Brookings

Curr\_pol02A

Building Type	County
EOC-Public Safety Answering P	Curry
Street	
898 Elk Drive	
City	State Zip
Brookings	OR 97415
Latitude	Longitude
42.05537	124.28743
Tracking Code	Inspection Date
RVS in 2006	8/4/2006



Seismicity Zone: Very High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	0	0	0	1.3
Secondary	W2	3.8	-2	-0.5	0	0	0	0	0	1.3
Tertiary		0	0	0	0	0	0	0	0	0


Brookings Police and Fire/Rescue

## Final RVS Score

Final Type	Final Score
RM1	1.3

## FEMA-154 Collapse Potential

Moderate (>1%)

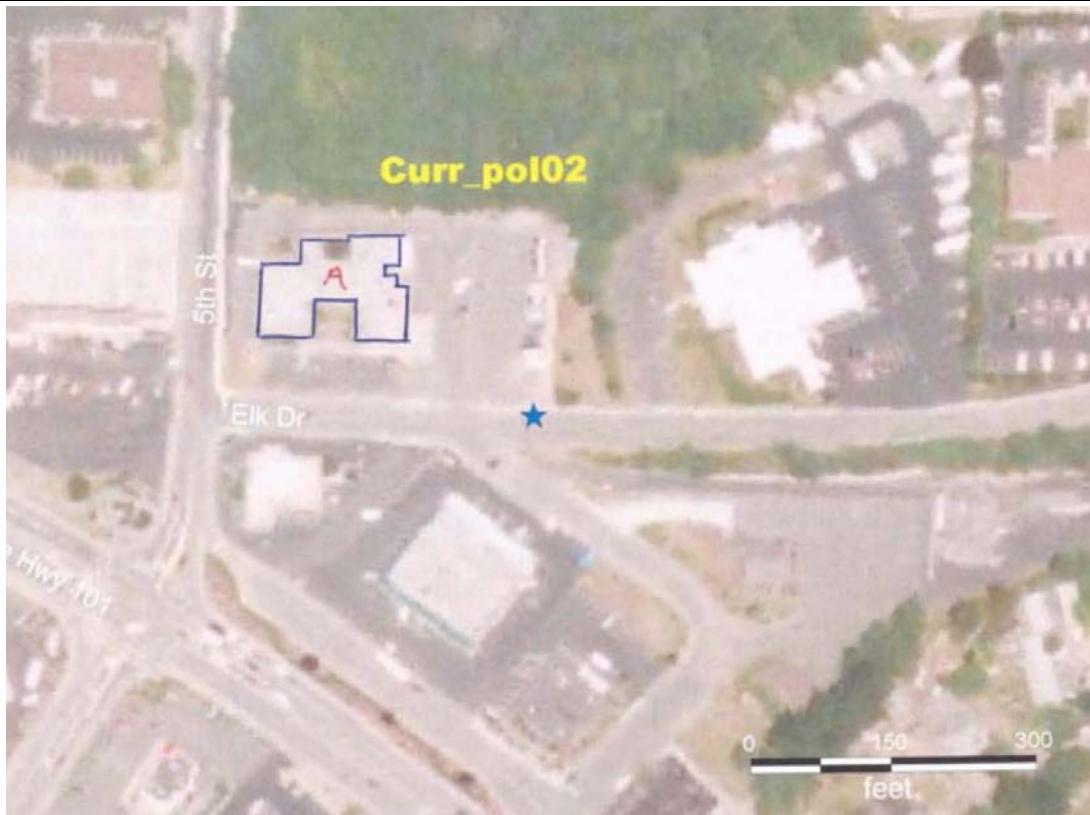

OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Brookings Police and Fire/Rescue

Curr\_pol02A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1970
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
Out of Plane Lateral-Force-Resistance Elements		None	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
W	General Site	S	Plan Irregularity Primary
			
W	Primary Structural Type secondary structural type also	E	General Site
			
E	General Site	E	Plan Irregularity Secondary



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries