


High Desert Middle School

Bend-LaPine SD 1

Desc_sch19A

Building Type	County	
School	Deschutes	
Street		
61111 27th St		
City	State	Zip
Bend	OR	97702
Latitude	Longitude	
44.01559	121.26202	
Tracking Code	Inspection Date	
RVS in 2006	7/4/2006	

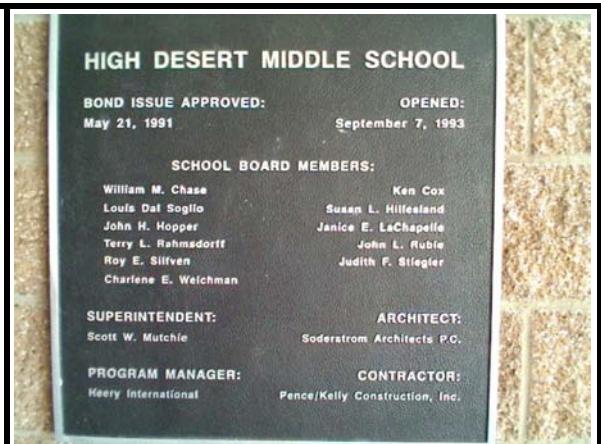

Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

High Desert Middle School

Final RVS Score

Final Type	Final Score
RM1	0.3

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

High Desert Middle School

Desc_sch19A

Enrollment 651	Year Built (Field Verified) 1993	Year Built (Alt. Source) 1993	Est. Decade Built 1990
Total Area (square ft) 106000	Number of Stories 2	Basement	Pounding Potential No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: Very Irregular Changes	
Large Diaphragm or Central Opening		None	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
NW Plan Irregularity Primary		S Vertical Irregularity Primary	
		S Tertiary Structural Type	
		E Plan Irregularity Secondary	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries