

Humboldt Elementary School

John Day SD 3

Gran_sch06A

Building Type School	County Grant	
Street 329 N Humboldt St		
City Canyon City	State OR	Zip 97820
Latitude 44.39911	Longitude 118.94914	
Tracking Code RVS in 2006	Inspection Date 7/27/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	4.8	-3	-0.5	0	0	0	-1.2	0	0.1
Secondary	RM1	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Tertiary		0	0	0	0	0	0	0	0	0


Humboldt Elementary School

Final RVS Score


Final Type	Final Score
RM1	-0.1

FEMA-154 Collapse Potential

Very High (100%)

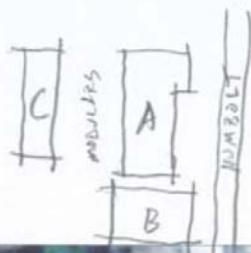

Humboldt Elementary
329 N Humboldt St
Canyon City, OR 97820

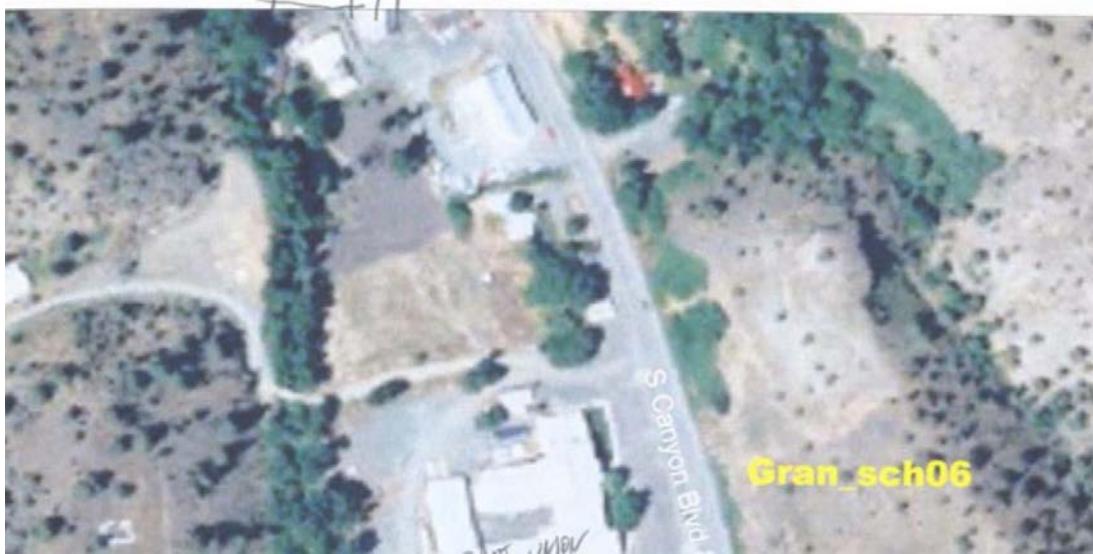

OregonGeology

Humboldt Elementary School

Gran_sch06A

Enrollment 286	Year Built (Field Verified) 1956	Year Built (Alt. Source) 1956	Est. Decade Built 1950
Total Area (square ft) 28990	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners: L Shaped None None		Vertical Irregularities Steps in Elevation View: Single Change None None	
Falling Hazards None None None		Poor Conditions None None None	
 E Vertical Irregularity Primary		 W Elevation View	

Humboldt Elementary School

John Day SD 3

Gran_sch06B

Building Type School	County Grant	
Street 329 N Humboldt St		
City Canyon City	State OR	Zip 97820
Latitude 44.39857	Longitude 118.94915	
Tracking Code RVS in 2006	Inspection Date 7/27/2006	

Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card


	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	4.8	0	0	0	0	0	-1.2	0	3.6
Secondary	RM1	3.6	0	0	0	0	0	-1.2	0	2.4
Tertiary		0	0	0	0	0	0	0	0	0



Humboldt Elementary School

Final RVS Score
Final Type RM1 Final Score 2.4

FEMA-154 Collapse Potential
Low (<1%)

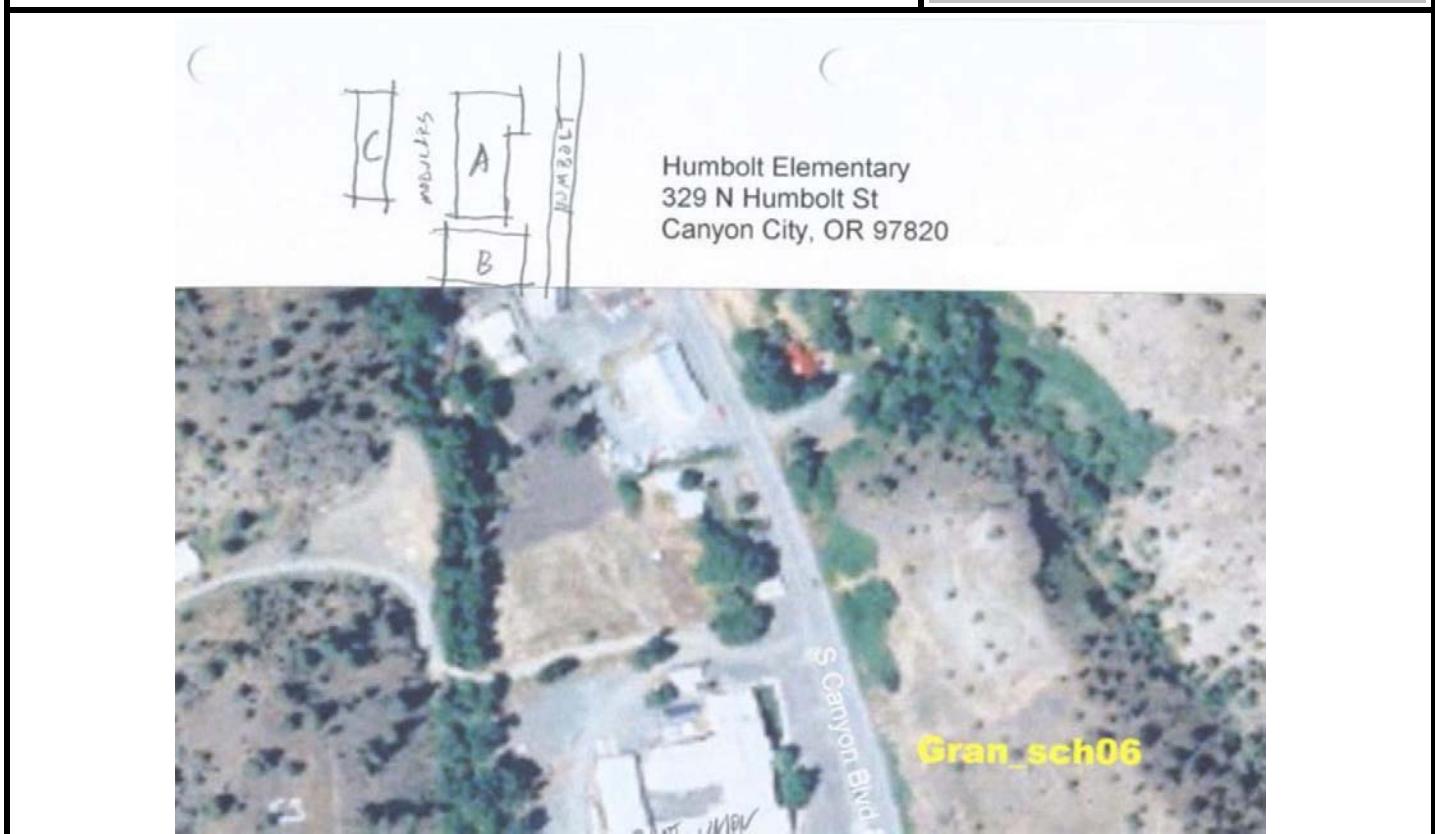

OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Humbolt Elementary School

Gran_sch06B

Enrollment 286	Year Built (Field Verified) 1956	Year Built (Alt. Source) 1956	Est. Decade Built 1960
Total Area (square ft) 28990	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	

Humboldt Elementary School

John Day SD 3

Gran_sch06C

Building Type School	County Grant	
Street 329 N Humboldt St		
City Canyon City	State OR	Zip 97820
Latitude 44.39926	Longitude 118.94966	
Tracking Code RVS in 2006	Inspection Date 7/27/2006	



Humboldt Elementary School


Final RVS Score

Final Type	Final Score
RM1	2.4

FEMA-154 Collapse Potential

Low (<1%)

	Seismicity Zone: Moderate									
	FEMA 154 Rapid Visual Screening Score Card									
	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W1	5.2	0	0	0	0	0	-0.6	0	4.6
Secondary	RM1	3.6	0	0	0	0	0	-1.2	0	2.4
Tertiary		0	0	0	0	0	0	0	0	0

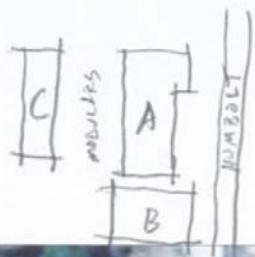

Humboldt Elementary
329 N Humboldt St
Canyon City, OR 97820



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Humbolt Elementary School

Gran_sch06C

Enrollment 286	Year Built (Field Verified) 1956	Year Built (Alt. Source) 1956	Est. Decade Built 1970
Total Area (square ft) 28990	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	