

Hines Middle School

Harney County SD 3

Harn_sch05A

Building Type	County	
School	Harney	
Street		
500 W Barnes Ave		
City	State	Zip
Hines	OR	97738
Latitude	Longitude	
43.56334	119.08753	
Tracking Code	Inspection Date	
RVS in 2006	6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	URM	3.4	-1.5	-0.5	-0.4	0	0	-0.8	0	0.2
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0


Hines Middle School

Final RVS Score

Final Type	Final Score
URM	0.2

FEMA-154 Collapse Potential

High (>10%)

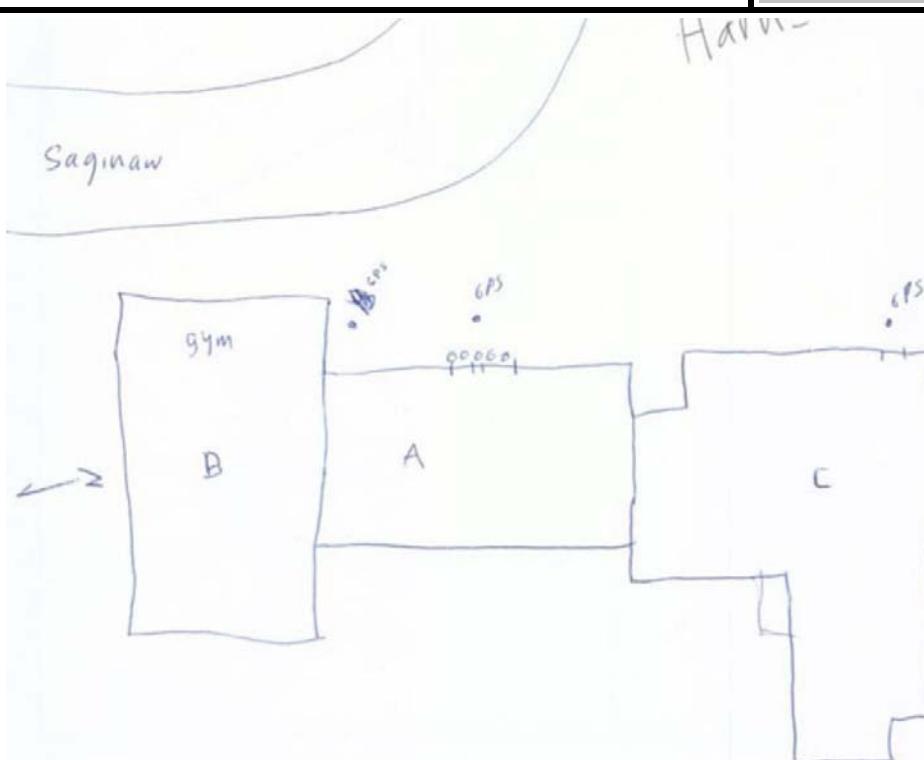

OregonGeology

Hines Middle School

Harn_sch05A

Enrollment 252	Year Built (Field Verified) 1931	Year Built (Alt. Source) 1930	Est. Decade Built 1930
Total Area (square ft)	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities Reentrant Corners:L shaped (Adjacent Build/Entity) None None		Vertical Irregularities Steps in Elevation View: Single Change (Adjacent Building/Entity) None None	
Falling Hazards Other: Ornamental Hazard Over Exit None None		Poor Conditions Poor Masonry None None	
			
			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Hines Middle School

Harney County SD 3

Harn_sch05B

Building Type	County	
School	Harney	
Street		
500 W Barnes Ave		
City	State	Zip
Hines	OR	97738
Latitude	Longitude	
43.56356	119.08734	
Tracking Code	Inspection Date	
RVS in 2006	6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Secondary	RM1	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Tertiary		0	0	0	0	0	0	0	0	0


Hines Middle School

Final RVS Score

Final Type	Final Score
C2	-0.1

FEMA-154 Collapse Potential

Very High (100%)

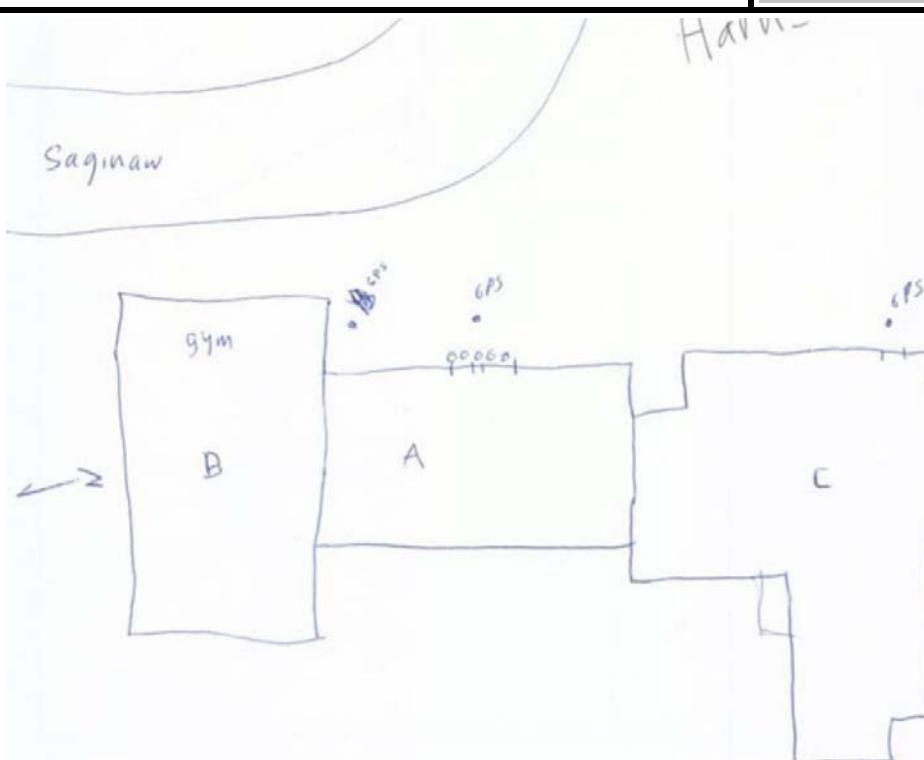

OregonGeology

Hines Middle School

Harn_sch05B

Enrollment 252	Year Built (Field Verified) 1930	Year Built (Alt. Source) 1930	Est. Decade Built 1950
Total Area (square ft)	Number of Stories 1	Basement	Pounding Potential Yes
Plan Irregularities Reentrant Corners:L shaped (Adjacent Build/Entity) None None		Vertical Irregularities Steps in Elevation View: Single Change (Adjacent Building/Entity) None None	
Falling Hazards Other: Brick Veneer None None		Poor Conditions None None None	
			
E Elevation View		N Elevation View	
			
		W General Site	

Hines Middle School

Harney County SD 3

Harn_sch05C

Building Type	County	
School	Harney	
Street		
500 W Barnes Ave		
City	State	Zip
Hines	OR	97738
Latitude	Longitude	
43.56304	119.08779	
Tracking Code	Inspection Date	
RVS in 2006	6/28/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	0	-0.5	0	0	0	-1.2	0	1.9
Secondary	RM1	3.6	0	-0.5	0	0	0	-1.2	0	1.9
Tertiary		0	0	0	0	0	0	0	0	0


Hines Middle School

Final RVS Score

Final Type	Final Score
C2	1.9

FEMA-154 Collapse Potential

Moderate (>1%)

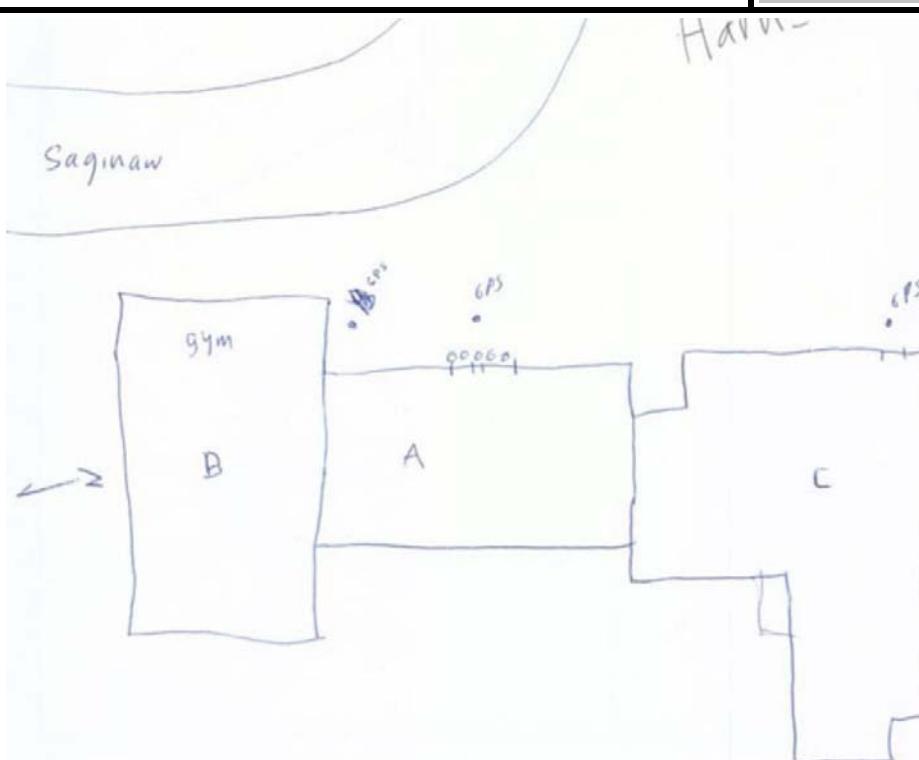

OregonGeology

Hines Middle School

Harn_sch05C

Enrollment 252	Year Built (Field Verified) 1930	Year Built (Alt. Source) 1930	Est. Decade Built 1950		
Total Area (square ft)	Number of Stories 2	Basement	Pounding Potential No		
Plan Irregularities Reentrant Corners:L shaped (Adjacent Build/Entity)		Vertical Irregularities None			
Out of Plane Lateral-Force-Resistance Elements		None			
Reentrant Corners: L Shaped		None			
Falling Hazards Other: Brick Veneer		Poor Conditions None			
None		None			
None		None			
	E Elevation View		E Elevation View		W General Site
	S General Site				



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries