

Jacksonville Fire Department

City of Jacksonville

Jack_fir16A

Building Type	County	
Fire - City	Jackson	
Street		
180 N 3rd St		
City	State	Zip
Jacksonville	OR	97530
Latitude	Longitude	
42.31467	122.96717	
Tracking Code	Inspection Date	
RVS in 2006	7/21/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W1	5.2	0	0	0	0	-0.2	0	0	5
Secondary	RM1	3.6	0	0	-0.4	0	-0.8	0	0	2.4
Tertiary		0	0	0	0	0	0	0	0	0

Jacksonville Fire Department

Final RVS Score

Final Type	Final Score
RM1	2.4

FEMA-154 Collapse Potential

Low (<1%)

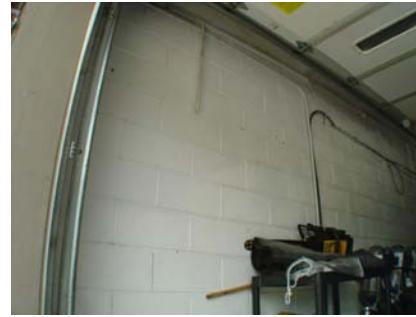


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Jacksonville Fire Department

Jack_fir16A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1920
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
None		None	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Brick Veneer		Cracks	
None		Poor Masonry	
None		None	
			
SE	Elevation View	N	Secondary Structural Type
			
		S	Poor Condition



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries