

# Medford Police Department - City Hall

City of Medford

Jack\_pol07A

Building Type Police - City	County Jackson	
Street 411 W 8th St		
City Medford	State OR	Zip 97501
Latitude 42.32253	Longitude 122.87597	
Tracking Code RVS in 2006	Inspection Date 7/6/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card										
	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	3.6	-2	0	0	0	0	-1.2	0	0.4
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Medford Police Department - City Hall

**Final RVS Score**

Final Type C2	Final Score 0.4
------------------	--------------------

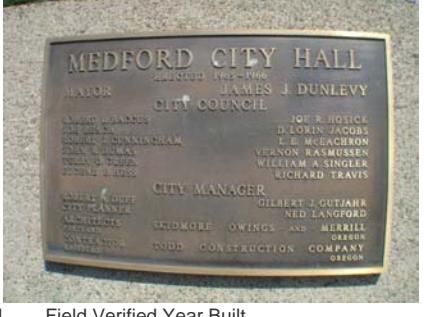
FEMA-154 Collapse Potential

High (>10%)
-------------



# Medford Police Department - City Hall

Jack\_pol07A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1966	1966	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	3	Yes	No
Plan Irregularities		Vertical Irregularities	
None		Short Columns	
None		None	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
			
W	Primary Structural Type	NE	Vertical Irregularity Primary
			
N	NW Vertical Irregularity Primary		
			
N	Field Verified Year Built		