

Phoenix Elementary School

Phoenix-Talent SD 4

Jack_sch46A

Building Type	County	
School	Jackson	
Street		
215 N Rose St		
City	State	Zip
Phoenix	OR	97535
Latitude	Longitude	
42.27233	122.82039	
Tracking Code	Inspection Date	
RVS in 2006	6/30/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	4.8	-3	-0.5	0	0	0	-1.2	0	0.1
Secondary	RM1	3.6	-2	-0.5	0	0	0	-1.2	0	-0.1
Tertiary		0	0	0	0	0	0	0	0	0

Phoenix Elementary School

Final RVS Score

Final Type	Final Score
RM1	-0.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Phoenix Elementary School

Jack_sch46A


Enrollment 461	Year Built (Field Verified) 1974	Year Built (Alt. Source) 1974	Est. Decade Built 1960
Total Area (square ft) 50262	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners: Other None None		Vertical Irregularities Steps in Elevation View: Single Change None None	
Falling Hazards None None Other: General		Poor Conditions None None None	
			
SE Falling Hazard		SW Plan Irregularity Primary	

Phoenix Elementary School

Phoenix-Talent SD 4

Jack_sch46B

Building Type	County	
School	Jackson	
Street		
215 N Rose St		
City	State	Zip
Phoenix	OR	97535
Latitude	Longitude	
42.2728	122.82	
Tracking Code	Inspection Date	
RVS in 2006	6/30/2006	

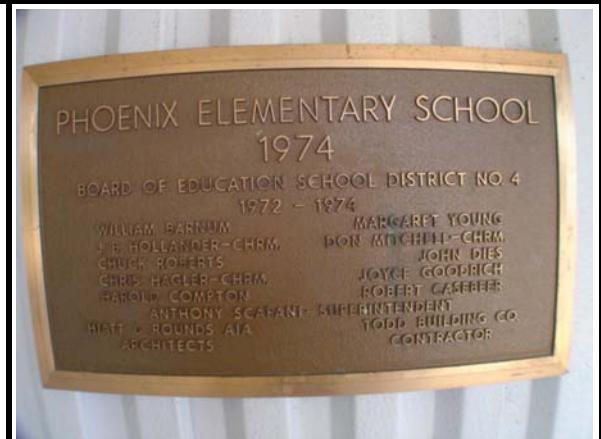

Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	S3	3.8	0	-0.5	0	0	-0.6	0	0	2.7
Secondary	RM1	3.6	0	-0.5	0	0	-0.8	0	0	2.3
Tertiary		0	0	0	0	0	0	0	0	0

Phoenix Elementary School

Final RVS Score

Final Type	Final Score
RM1	2.3

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Phoenix Elementary School

Jack_sch46B

Enrollment 461	Year Built (Field Verified) 1974	Year Built (Alt. Source) 1974	Est. Decade Built 1970
Total Area (square ft) 50262	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other None None		None None None	
Falling Hazards		Poor Conditions	
None None None		None None None	
			
N Elevation View		N Primary Structural Type	
			
		N Plan Irregularity Primary	

Phoenix Elementary School

Phoenix-Talent SD 4

Jack_sch46C

Building Type	County
School	Jackson
Street	
215 N Rose St	
City	State Zip
Phoenix	OR 97535
Latitude	Longitude
42.27244	122.82092
Tracking Code	Inspection Date
RVS in 2006	6/30/2006



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	4.8	0	0	0	0	0	-1.2	0	3.6
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Phoenix Elementary School

Final RVS Score

Final Type	Final Score
W2	3.6

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Phoenix Elementary School

Jack_sch46C

Enrollment 461	Year Built (Field Verified) 1974	Year Built (Alt. Source) 1974	Est. Decade Built 1960
Total Area (square ft) 50262	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards Other: General None None		Poor Conditions None None None	
 S Falling Hazard			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Phoenix Elementary School

Phoenix-Talent SD 4

Jack_sch46D

Building Type School	County Jackson	
Street 215 N Rose St		
City Phoenix	State OR	Zip 97535
Latitude 42.27272	Longitude 122.82083	
Tracking Code RVS in 2006	Inspection Date 6/30/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W1	5.2	0	0	0	1.6	-0.2	0	0	6.6
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Phoenix Elementary School

Final RVS Score

Final Type	Final Score
W1	6.6

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Phoenix Elementary School

Jack_sch46D

Enrollment 461	Year Built (Field Verified) 1974	Year Built (Alt. Source) 1974	Est. Decade Built 1990
Total Area (square ft) 50262	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	

Phoenix Elementary School

Phoenix-Talent SD 4

Jack_sch46E

Building Type	County
School	Jackson
Street	
215 N Rose St	
City	State Zip
Phoenix	OR 97535
Latitude	Longitude
42.27278	122.82069
Tracking Code	Inspection Date
RVS in 2006	6/30/2006



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W1	5.2	0	0	0	1.6	-0.2	0	0	6.6
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Phoenix Elementary School

Final RVS Score

Final Type	Final Score
W1	6.6

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Phoenix Elementary School

Jack_sch46E

Enrollment 461	Year Built (Field Verified) 1974	Year Built (Alt. Source) 1974	Est. Decade Built 1990
Total Area (square ft) 50262	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities None None None		Vertical Irregularities None None None	
Falling Hazards None None None		Poor Conditions None None None	

Phoenix Elementary School

Phoenix-Talent SD 4

Jack_sch46F

Building Type	County	
School	Jackson	
Street		
215 N Rose St		
City	State	Zip
Phoenix	OR	97535
Latitude	Longitude	
42.27301	122.82053	
Tracking Code	Inspection Date	
RVS in 2006	6/30/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	0	0	-0.8	0	0	0.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Phoenix Elementary School

Final RVS Score

Final Type	Final Score
RM1	0.3

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Phoenix Elementary School

Jack_sch46F

Enrollment 461	Year Built (Field Verified) 1974	Year Built (Alt. Source) 1974	Est. Decade Built 1960
Total Area (square ft) 50262	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Reentrant Corners: L Shaped None None		Vertical Irregularities Steps in Elevation View: 2 to 3 Changes None None	
Falling Hazards None None None		Poor Conditions None None None	
			
S	Plan Irregularity Primary	W	Vertical Irregularity Primary