

North Middle School

Jose_sch02A

Grants Pass SD 7

Building Type		County	
School		Josephine	
Street			
1725 NW Highland Ave.			
City	State	Zip	
Grants Pass	OR	97526	
Latitude		Longitude	
42.45773		123.33083	
Tracking Code		Inspection Date	
RVS in 2006		7/24/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	0	0	0	1.3
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

North Middle School

Final RVS Score

Final Type

Final Score

RM1

1.3

FEMA-154 Collapse Potential

Moderate (>1%)




OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
670		1967	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
86303	1	No	No

Plan Irregularities	Vertical Irregularities
Out of Plane Lateral-Force-Resistance Elements	Steps in Elevation View: Single Change
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None

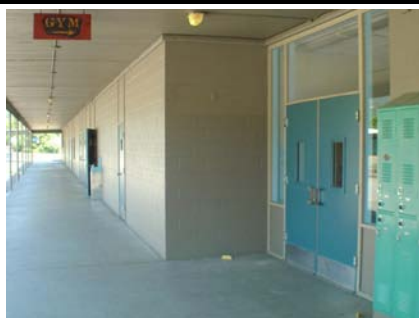

W Plan Irregularity Primary



N Vertical Irregularity Primary



SW General Site

North Middle School

Jose_sch02B

Grants Pass SD 7

Building Type		County	
School		Josephine	
Street			
1725 NW Highland Ave.			
City		State	Zip
Grants Pass		OR	97526
Latitude		Longitude	
42.4576		123.33196	
Tracking Code		Inspection Date	
RVS in 2006		7/24/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	0	0	0	0	0	0	0	2.8
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

North Middle School

Final RVS Score

Final Type

Final Score

RM1

2.8

FEMA-154 Collapse Potential

Low (<1%)




OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
670		1967	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
86303	1	No	No

Plan Irregularities	Vertical Irregularities
None	None
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



North Middle School

Jose_sch02C

Grants Pass SD 7

Building Type		County	
School		Josephine	
Street			
1725 NW Highland Ave.			
City	State	Zip	
Grants Pass	OR	97526	
Latitude		Longitude	
42.45857		123.3309	
Tracking Code		Inspection Date	
RVS in 2006		7/24/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	0	0	0	0	0	0	1.8
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

North Middle School

Final RVS Score

Final Type

Final Score

RM1

1.8

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
670		1967	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
86303	1	No	No

Plan Irregularities	Vertical Irregularities
None	Steps in Elevation View: Single Change
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



E Vertical Irregularity Primary