

# North Valley High School

Three Rivers/Josephine County SD

Jose\_sch17A

Building Type	County	
School	Josephine	
Street		
6741 Monument Dr.		
City	State	Zip
Grants Pass	OR	97526
Latitude	Longitude	
42.51839	123.3705	
Tracking Code	Inspection Date	
RVS in 2006	7/26/2006	



Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

North Valley High School

## Final RVS Score

Final Type	Final Score
RM1	0.9

## FEMA-154 Collapse Potential

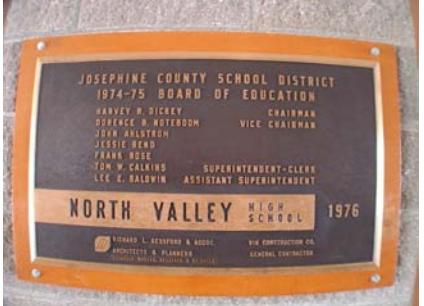
High (>10%)



OregonGeology

# North Valley High School

Jose\_sch17A

Enrollment 732	Year Built (Field Verified) 1976	Year Built (Alt. Source) 1976	Est. Decade Built 1970
Total Area (square ft) 136157	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Steps in Elevation View: 2 to 3 Changes	
Out of Plane Lateral-Force-Resistance Elements		None	
None		None	
Falling Hazards		Poor Conditions	
None		None	
None		None	
None		None	
	W Vertical Irregularity Primary		W Plan Irregularity Secondary
	W Plan Irregularity Primary		
	N General Site		SE General Site
	W Field Verified Year Built		



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries