


Pelican Elementary School

Klamath Falls City Schools

Klam_sch01A

Building Type		County	
School		Klamath	
Street			
501 McLean St			
City	State	Zip	
Klamath Falls	OR	97601	
Latitude		Longitude	
42.24949		121.804	
Tracking Code		Inspection Date	
RVS in 2006		7/20/2006	

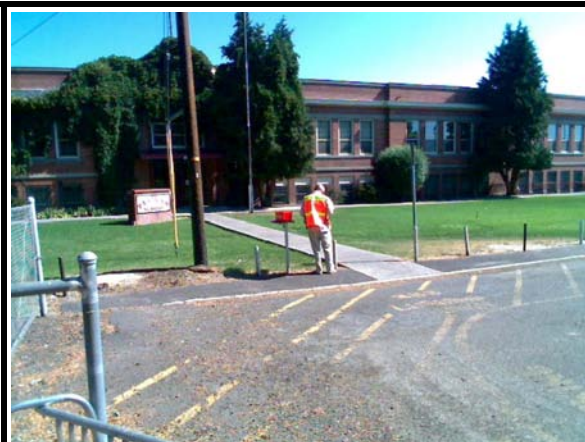

Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	URM	1.8	-1	0	-0.2	0	0	0	0	0.6
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Pelican Elementary School

Final RVS Score

Final Type

Final Score

URM

0.6

FEMA-154 Collapse Potential

High (>10%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Pelican Elementary School

Klam_sch01A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
185	1921	1921	1920
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
31287	2	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: L Shaped	Steps in Elevation View: Single Change
Reentrant Corners: U shaped	Steps in Elevation View: Single Change (Adjacent Building/Entity)
Out of Plane Lateral-Force-Resistance Elements	None

Falling Hazards	Poor Conditions
Parapets: Unreinforced Over Exit	None
Parapets: Unreinforced Around Entire Building	None
Unreinforced Chimneys	None



SW Plan Irregularity Tertiary



S Falling Hazard



S Falling Hazard



SE Elevation View



S Field Verified Year Built



NW Other



NW Plan Irregularity Primary



W Plan Irregularity Secondary



W Falling Hazard

Pelican Elementary School

Klamath Falls City Schools

Klam_sch01B

Building Type		County	
School		Klamath	
Street			
501 McLean St.			
City	State	Zip	
Klamath Falls	OR	97601	
Latitude		Longitude	
42.24973		121.80391	
Tracking Code		Inspection Date	
RVS in 2006		7/20/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	2.8	-1	-0.5	0	0	0	0	0	1.3
Secondary	RM1	2.8	-1	-0.5	0	0	0	0	0	1.3
Tertiary		0	0	0	0	0	0	0	0	0

Pelican Elementary School

Final RVS Score

Final Type

Final Score

C2

1.3

FEMA-154 Collapse Potential

Moderate (>1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Pelican Elementary School

Klam_sch01B

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
185		1921	1950
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
31287	2	No	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: L Shaped	Steps in Elevation View: Single Change
Reentrant Corners: U shaped	Steps in Elevation View: Single Change (Adjacent Building/Entity)
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None



NE Plan Irregularity Primary