


Junction City RFPD

Junction City RFPD

Lane_fir23A

Building Type Fire - RFPD	County Lane	
Street 175 W 7th St		
City Junction City	State OR	Zip 97448
Latitude 44.2204	Longitude 123.20212	
Tracking Code RVS in 2006	Inspection Date 7/31/2006	

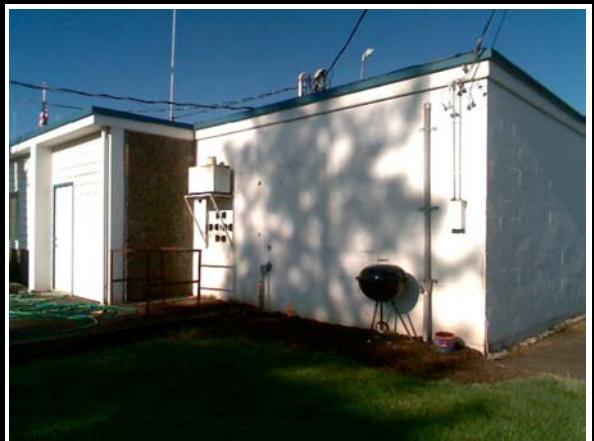

Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	PC1	2.6	0	-0.5	0	0	0	-0.6	0	1.5
Secondary	C1	2.5	-1.5	-0.5	0	0	0	-0.6	0	-0.1
Tertiary	W2	3.8	-2	-0.5	0	0	0	-0.8	0	0.5

Junction City RFPD

Final RVS Score

Final Type	Final Score
C1	-0.1

FEMA-154 Collapse Potential

Very High (100%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Junction City RFPD

Lane_fir23A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1950
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
Out of Plane Lateral-Force-Resistance Elements		Steps in Elevation View: Very Irregular Changes	
Reentrant Corners: L Shaped		None	
None		None	
Falling Hazards		Poor Conditions	
None		Other	
None		None	
None		None	
			
NW Vertical Irregularity Primary also shows plan irregularity - reentrant corner		NE Tertiary Structural Type and secondary structural type.	
		N Tertiary Structural Type	
		SW General Site	
		W Primary Structural Type	
		W Poor Condition	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries