

Cottage Grove Police Dept

City of Cottage Grove

Lane_pol06A

Building Type		County	
EOC-Public Safety Answering P		Lane	
Street			
400 E Main St			
City	State	Zip	
Cottage Grove	OR	97424	
Latitude		Longitude	
43.79758		123.06373	
Tracking Code		Inspection Date	
RVS in 2006		7/20/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	-2	-0.5	0	0	-0.4	0	0	0.9
Secondary	RM1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Tertiary		0	0	0	0	0	0	0	0	0

Cottage Grove Police Dept

Final RVS Score

Final Type

Final Score

W2

0.9

FEMA-154 Collapse Potential

High (>10%)




OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	Yes	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: Other	Steps in Elevation View: Single Change
None	None
None	None


Falling Hazards	Poor Conditions
None	None
None	None
None	None

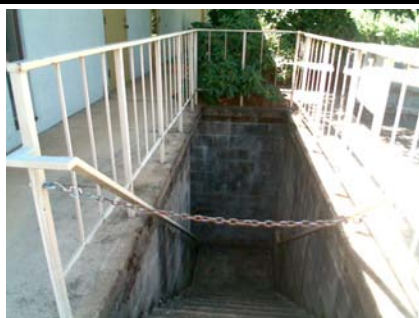

E Basement



N Plan Irregularity Primary

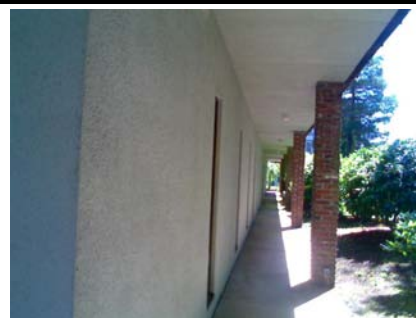

W General Site



W Vertical Irregularity Primary