

Linn County Sheriff's Office

Linn County

Linn_pol06A

Building Type Police - County	County Linn	
Street 255 N Main St.		
City Brownsville	State OR	Zip 97327
Latitude 44.39329	Longitude 122.98472	
Tracking Code RVS in 2006	Inspection Date 7/7/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	0	-0.5	0	0	-0.4	0	0	2.9
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0


Linn County Sheriff's Office

Final RVS Score

Final Type	Final Score
W2	2.9

FEMA-154 Collapse Potential

Low (<1%)

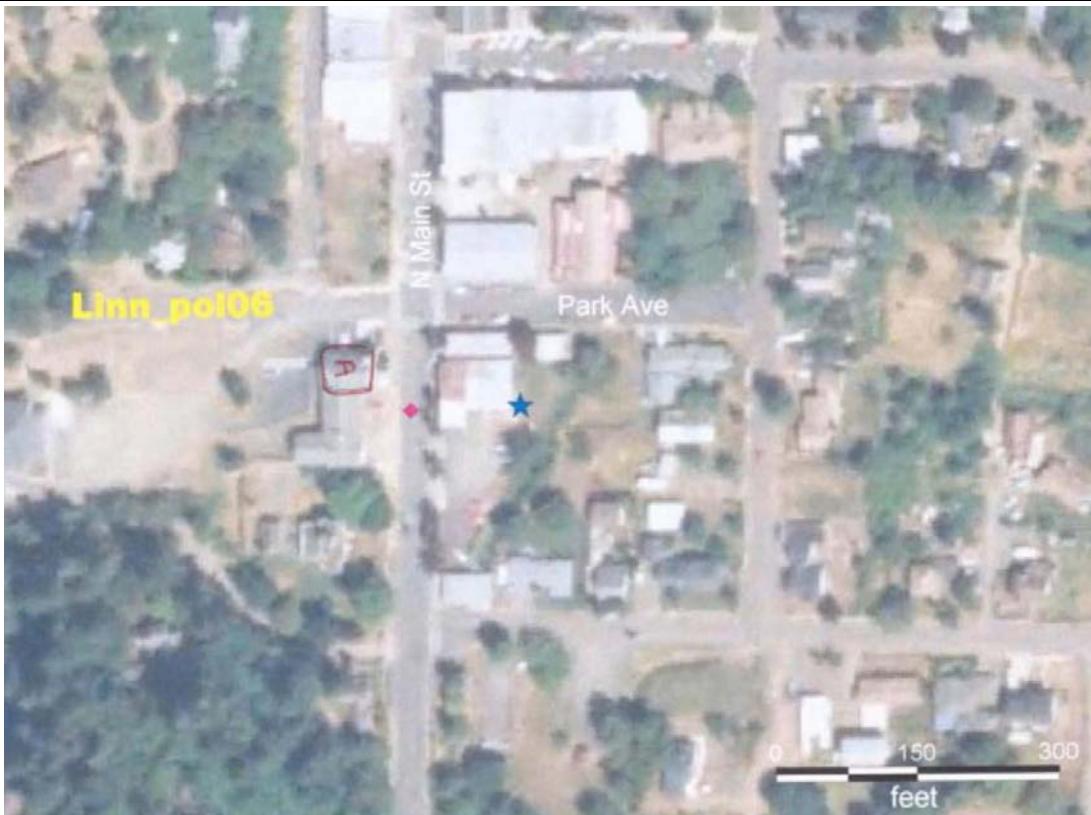

OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Linn County Sheriff's Office

Linn_pol06A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1950
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	2	No	Yes
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		Building On Hill or Sloped Site	
Reentrant Corners: Other (Adjacent Build/Entity)		None	
Out of Plane Lateral-Force-Resistance Elements		None	
Falling Hazards		Poor Conditions	
Other: General		None	
None		None	
None		None	
			
W Falling Hazard Right above door -- didn't look safe.	NW Plan Irregularity Tertiary	NW Vertical Irregularity Primary building on slope.	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries