

Pioneer Memorial Hospital - Heppner

Morr_hos01A

NFP (MC Health District)

Building Type		County	
Hospital		Morrow	
Street			
564 Pioneer Dr			
City	State	Zip	
Heppner	OR	97836	
Latitude		Longitude	
45.35588		119.54866	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	-2	-0.5	-0.4	0	0	0	0	0.7
Secondary	C2	3.6	-2	-0.5	-0.4	0	0	0	0	0.7
Tertiary		0	0	0	0	0	0	0	0	0

Pioneer Memorial Hospital - Heppner

Final RVS Score

Final Type

Final Score

RM1

0.7

FEMA-154 Collapse Potential

High (>10%)




OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries


Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1950	1940
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	Yes	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: H Shaped	Building On Hill or Sloped Site
None	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None

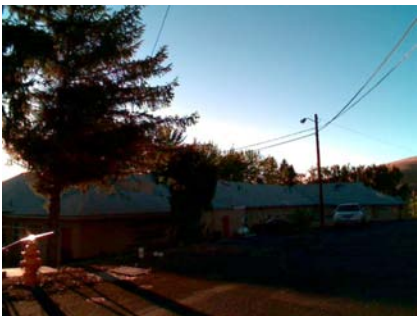

N Plan Irregularity Primary

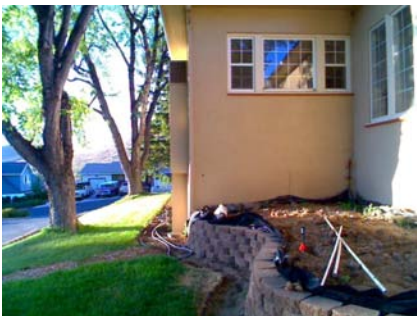

SE Primary Structural Type



Pioneer Memorial Hospital - Heppner

Morr_hos01B

NFP (MC Health District)

Building Type		County	
Hospital		Morrow	
Street			
564 Pioneer Dr			
City	State	Zip	
Heppner	OR	97836	
Latitude		Longitude	
45.35609		119.54847	
Tracking Code		Inspection Date	
RVS in 2006		7/25/2006	



Seismicity Zone: Moderate

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	3.6	0	-0.5	0	0	0	0	0	3.1
Secondary		0	0	0	0	0	0	0	0	0
Tertiary		0	0	0	0	0	0	0	0	0

Pioneer Memorial Hospital - Heppner

Final RVS Score

Final Type

Final Score

RM1

3.1

FEMA-154 Collapse Potential

Low (<1%)



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
		1950	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	Yes	No

Plan Irregularities	Vertical Irregularities
Reentrant Corners: L Shaped	None
Reentrant Corners: Other	None
None	None

Falling Hazards	Poor Conditions
None	None
None	None
None	None

