

Cascade - Student Center

Mult_coc17A

Portland CC

Building Type	County
Community_College	Multnomah
Street	
705 N Killingsworth St	
City	State Zip
Portland	OR 97217
Latitude	Longitude
45.56351	122.67354
Tracking Code	Inspection Date
RVS2006 & FEMA154	6/29/2006



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	PC2	2.6	-1	-0.5	0	0	-0.4	0	0	0.7
Secondary	S2	3.4	-1.5	-0.5	0	0	-0.4	0	0	1
Tertiary	C2	3.2	-1	-0.5	0	0	-0.4	0	0	1.3


Cascade - Student Center

Final RVS Score

Final Type	Final Score
PC2	0.7

FEMA-154 Collapse Potential

High (>10%)

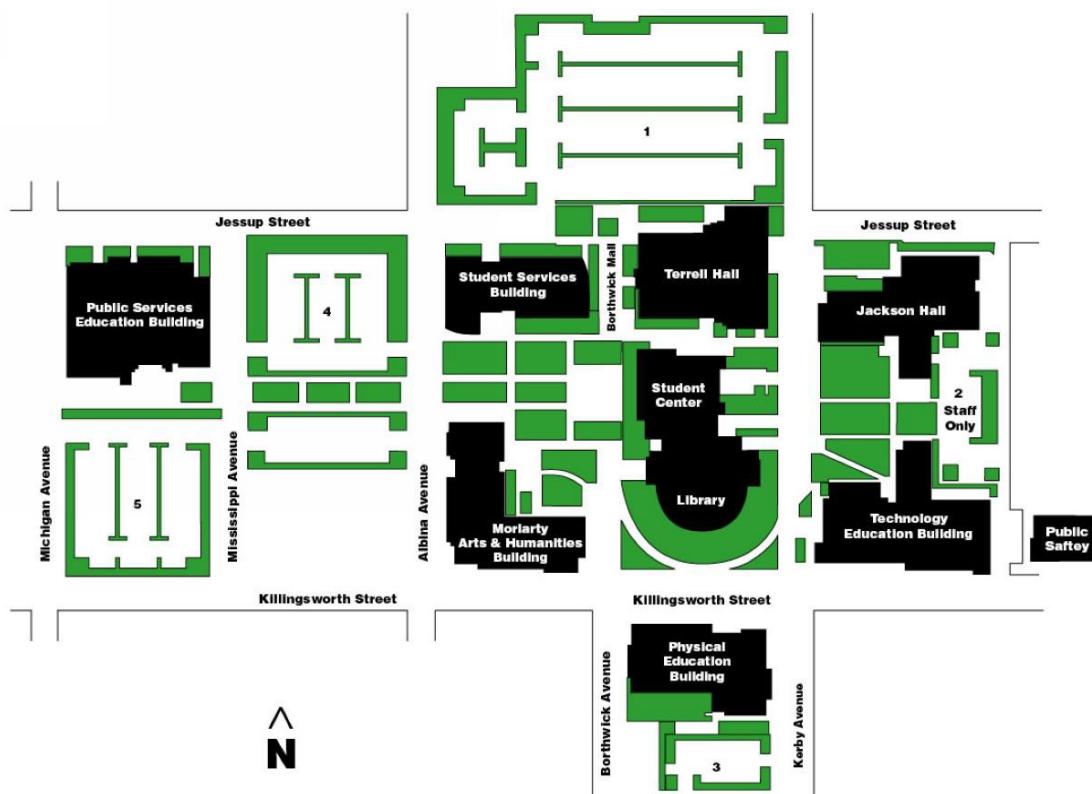

OregonGeology

Cascade - Student Center

Mult_coc17A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1965	1965	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
22563	4	No	Yes
Plan Irregularities		Vertical Irregularities	
Yes: Unknown		Yes: Unknown	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Light Cladding		None	
None		None	
None		None	
			
E	Basement	N	Secondary Structural Type
			
NE	Elevation View	NE	Elevation View
			
NW	Elevation View	NW	Elevation View
			
N		Seismic Upgrade SEISMIC JOINT BETWEEN D AND F	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries