

Cascade - Public Service

Mult_coc20A

Portland CC

Building Type Community_College	County Multnomah	
Street 705 N Killingsworth St		
City Portland	State OR	Zip 97217
Latitude 45.56375	Longitude 122.67646	
Tracking Code RVS in 2006	Inspection Date 6/29/2006	



Seismicity Zone: High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	URM	1.8	0	0	0	0	-0.4	0	0	1.4
Secondary	W1	4.4	0	0	0	2.4	0	0	0	6.8
Tertiary		0	0	0	0	0	0	0	0	0


Cascade - Public Service

Final RVS Score

Final Type	Final Score
URM	1.4

FEMA-154 Collapse Potential

Moderate (>1%)

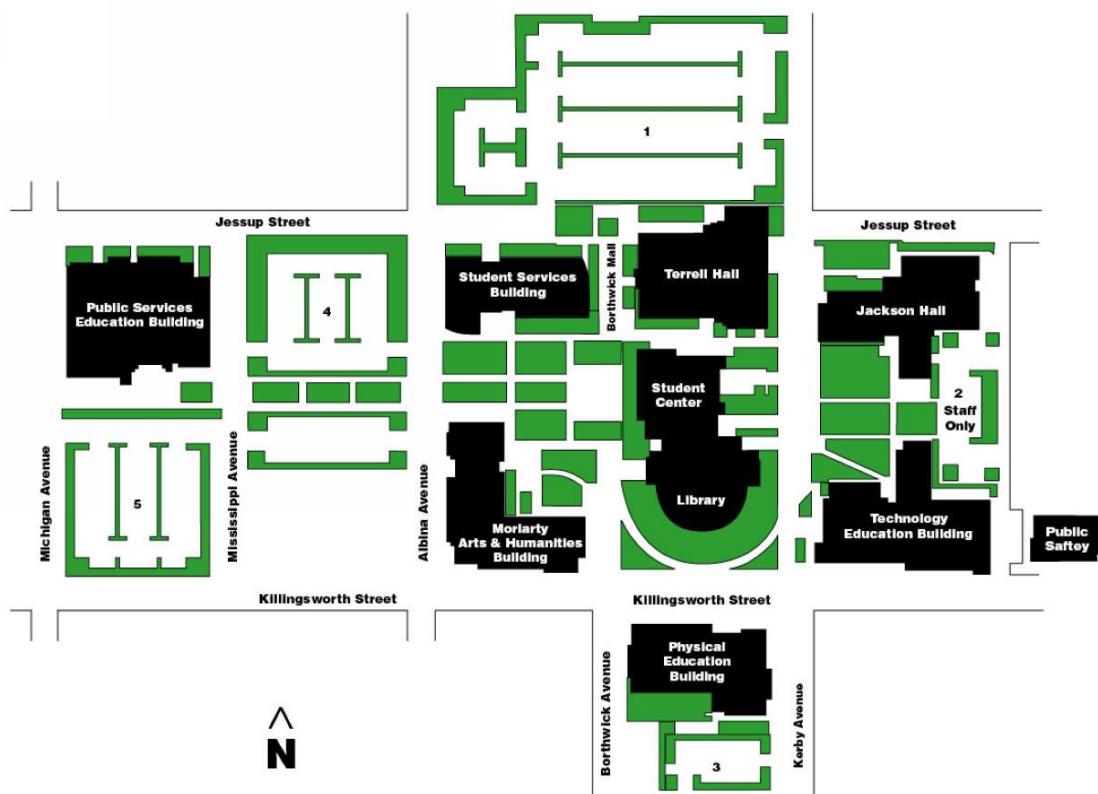

OregonGeology

Cascade - Public Service

Mult_coc20A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	2003	2003	1960
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
28400	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: Other		None	
None		None	
None		None	
Falling Hazards		Poor Conditions	
Parapets: Unreinforced Over Exit		None	
None		None	
None		None	
			
SE Elevation View		SW Primary Structural Type	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries