

# Portland City Police - Central

City of Portland

Mult\_pol16A

Building Type Police - City	County Multnomah	
Street 1111 SW 2nd Ave		
City Portland	State OR	Zip 97204
Latitude 45.51494	Longitude 122.6768	
Tracking Code RVS in 2006	Inspection Date 7/3/2006	



Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C1	3.1	-1.5	-0.5	0	1.4	-0.4	0	0	2.1
Secondary	C2	3.6	-1	-0.5	0	2.4	-0.4	0	0	4.1
Tertiary		0	0	0	0	0	0	0	0	0

Portland City Police - Central

## Final RVS Score

Final Type	Final Score
C1	2.1

## FEMA-154 Collapse Potential

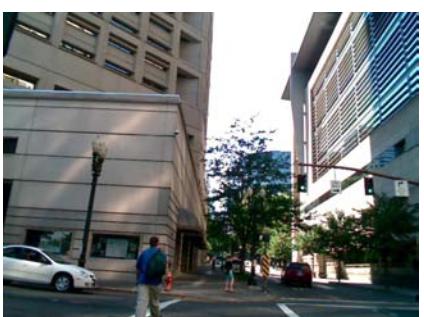
Low (<1%)



OregonGeology

# Portland City Police - Central

Mult\_pol16A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
	1983	1983	1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	20	No	No
Plan Irregularities		Vertical Irregularities	
None		Steps in Elevation View: Single Change	
None		Building On Hill or Sloped Site	
None		None	
Falling Hazards		Poor Conditions	
Heavy Cladding (thick stone or concrete)		None	
None		None	
None		None	
			
W	Building Name	W	Building Name
			
W	Falling Hazard	S	Falling Hazard
			
E	Elevation View	E	Vertical Irregularity Primary
		NE Vertical Irregularity Secondary	



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries