

# Pauling Academy of Integrated Sciences

Portland SD 1J

Mult\_sch45A

Building Type	County
School	Multnomah
Street	
3905 Se 91st Ave	
City	State Zip
Portland	OR 97266
Latitude	Longitude
45.49436	122.5721
Tracking Code	Inspection Date
Already Retrofitted	7/6/2006



Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	C2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary	C1	2.5	-1.5	-0.5	0	0	-0.4	0	0	0.1
Tertiary										0


Pauling Academy of Integrated Sciences

## Final RVS Score

Final Type	Final Score
C1	0.1

## FEMA-154 Collapse Potential


Moderate (>1%)

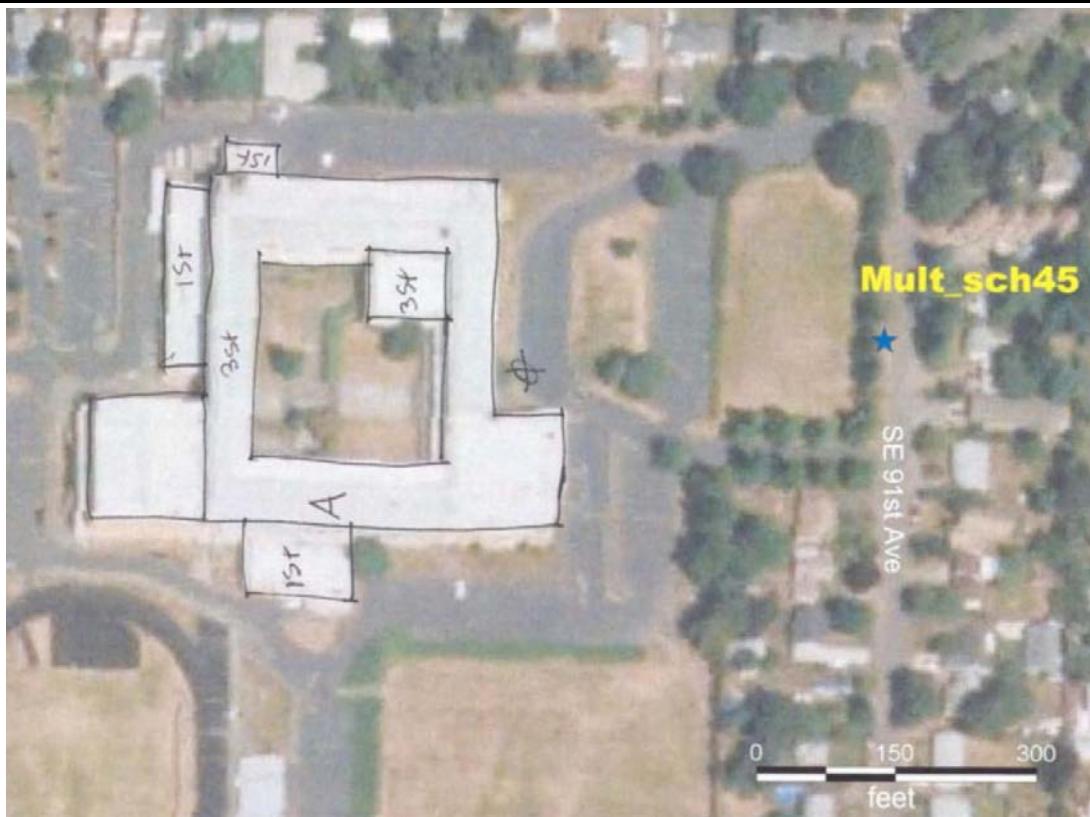

OregonGeology

# Pauling Academy of Integrated Sciences

Mult\_sch45A

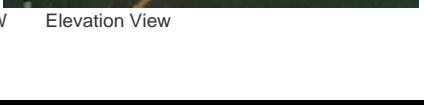Enrollment 277	Year Built (Field Verified) 1961	Year Built (Alt. Source) 1961	Est. Decade Built 1960
Total Area (square ft) 	Number of Stories 3	Basement	Pounding Potential No
Plan Irregularities Large Diaphragm or Central Opening		Vertical Irregularities Steps in Elevation View: Very Irregular Changes	
Reentrant Corners: Other None		Building On Hill or Sloped Site None	
Falling Hazards Other: Brick Veneer		Poor Conditions None	
Other: Ornamental Hazard Over Exit None		None	
			
E	Elevation View	E	Plan Irregularity Primary
			
E	Vertical Irregularity Secondary	S	Vertical Irregularity Primary
			
NW	Field Verified Year Built	S	Elevation View
			
E	Elevation View	W	Building Name
			
W	Elevation View	W	Elevation View



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries

# Pauling Academy of Integrated Sciences

Mult\_sch45A



W Elevation View



SW Vertical Irregularity Primary



NW Elevation View



N Building Name



N Falling Hazard



NE Elevation View