

# Willamina Middle School at Grand Ronde

Willamina SD 30J

Polk\_sch19A

Building Type	County	
School	Polk	
Street		
8720 Grand Ronde Rd		
City	State	Zip
Grand Ronde	OR	97347
Latitude	Longitude	
45.06157	123.60797	
Tracking Code	Inspection Date	
RVS in 2006	7/20/2006	



Seismicity Zone: High

## FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	RM1	2.8	-1	-0.5	0	0	-0.4	0	0	0.9
Secondary	W2	3.8	-2	-0.5	0	2.4	-0.4	0	0	3.3
Tertiary	C2	2.8	-1	-0.5	0	0	-0.4	0	0	0.9

Willamina Middle School at Grand Ronde

## Final RVS Score

Final Type	Final Score
RM1	0.9

## FEMA-154 Collapse Potential

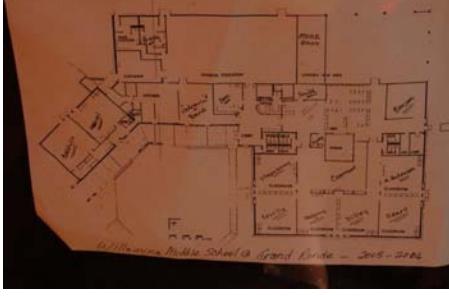
High (>10%)



OregonGeology

# Willamina Middle School at Grand Ronde

Polk\_sch19A

Enrollment 201	Year Built (Field Verified) 1981	Year Built (Alt. Source) 1980	Est. Decade Built 1980
Total Area (square ft) 94000	Number of Stories 1	Basement	Pounding Potential No
Plan Irregularities Non-Parallel System Reentrant Corners: Other None		Vertical Irregularities Steps in Elevation View: Very Irregular Changes None None	
Falling Hazards None None None		Poor Conditions None None None	
			
N Secondary Structural Type wood beams in roof		SE General Site	
Is there wood in the vertical elements as well? 		W Other 	
NW Vertical Irregularity Primary			



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment  
Oregon Department of Geology and Mineral Industries