

Manzanita Department Of Public Safety

City of Manzanita

Till_fir06A

Building Type	County	
Fire - City	Tillamook	
Street		
165 5th St S		
City	State	Zip
Manzanita	OR	97130
Latitude	Longitude	
45.71846	123.93343	
Tracking Code	Inspection Date	
RVS in 2006	9/6/2006	



Seismicity Zone: Very High

FEMA 154 Rapid Visual Screening Score Card

	Type	Basic Score	Vert Irreg	Plan Irreg	Pre-Code	Post-Bench	Soil C	Soil D	Soil E	RVS Score
Primary	W2	3.8	0	-0.5	0	2.4	0	-0.8	0	4.9
Secondary	C2	2.8	0	-0.5	0	0	0	-0.6	0	1.7
Tertiary		0	0	0	0	0	0	0	0	0

Manzanita Department Of Public Safety

Final RVS Score

Final Type	Final Score
C2	1.7

FEMA-154 Collapse Potential

Moderate (>1%)

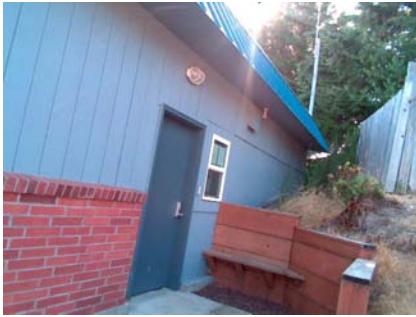


OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries

Manzanita Department Of Public Safety

Till_fir06A

Enrollment	Year Built (Field Verified)	Year Built (Alt. Source)	Est. Decade Built
			1980
Total Area (square ft)	Number of Stories	Basement	Pounding Potential
	1	No	No
Plan Irregularities		Vertical Irregularities	
Reentrant Corners: L Shaped		Building On Hill or Sloped Site	
Torsion: Eccentric Stiffness		None	
None		None	
Falling Hazards		Poor Conditions	
Other: Brick Veneer		None	
None		None	
None		None	
			
E	Plan Irregularity Primary	NE	Elevation View
			
SW	Primary Structural Type	SE	General Site paramedics bldg
			
		S	Elevation View



OregonGeology

Rapid Visual Screening - Senate Bill #2 - Seismic Needs Assessment
Oregon Department of Geology and Mineral Industries